



- Existing fabric removed to create an open plan office space. Downstands and columns retained to give indication of existing floor plan.
- Existing corridors retained. Refurbishment of finishes and targeted conservation repairs to be undertaken.
- Grand staircase retained. Refurbishment of finishes and targeted conservation repairs to be undertaken.
- Lightwell retained, redundant services removed, and glazed bricks repaired. New paving tiles proposed to lightwell at basement level, providing level access from SME.
- Original lightwell form to be reinstated at basement level following the removal of WCs. Repairs to glazed bricks and original windows where retained. New paving tiles proposed to lightwell, providing level access from SME.
- Where removed or blocked, original window and door openings to be reinstated to match Lightwell 02. Secondary glazing introduced to windows to provide 60 minute fire rating.
- Existing stair cores to be retained.
- Corridor form retained. Refurbishment of finishes and targeted conservation repairs to be undertaken. New fire doors inserted to create a refuge lobby to staircase. New doors to match existing.
- Open office space created to CAT A finish. New services sensitively integrated into historic fabric and acoustic suspended ceilings to contain services.
- Pitched roof removed and replaced with flat roof. Open office space retained below to CAT A finish. New services sensitively integrated into historic fabric and acoustic suspended ceilings to contain services.
- ASHPs to be supported on new flat roof.
- Glazed roof lights over lightwells with integrated AOVs for smoke ventilation.
- Proposed plant to be integrated into existing roof pitches. Roofs to be thermally upgraded at floor level - retained as cold roof spaces.
- New fire doors inserted to create a refuge lobby to staircase.
- Window to be reinstated to match existing window G.LW02-7.
- Roof Build-Up to be upgraded.
- Allowance for strip-out and relining works to existing lead gutters, repairs to lead flashings at roof level and replacement of bottom 3 slate courses with new lead edge dipped to suit exposure.

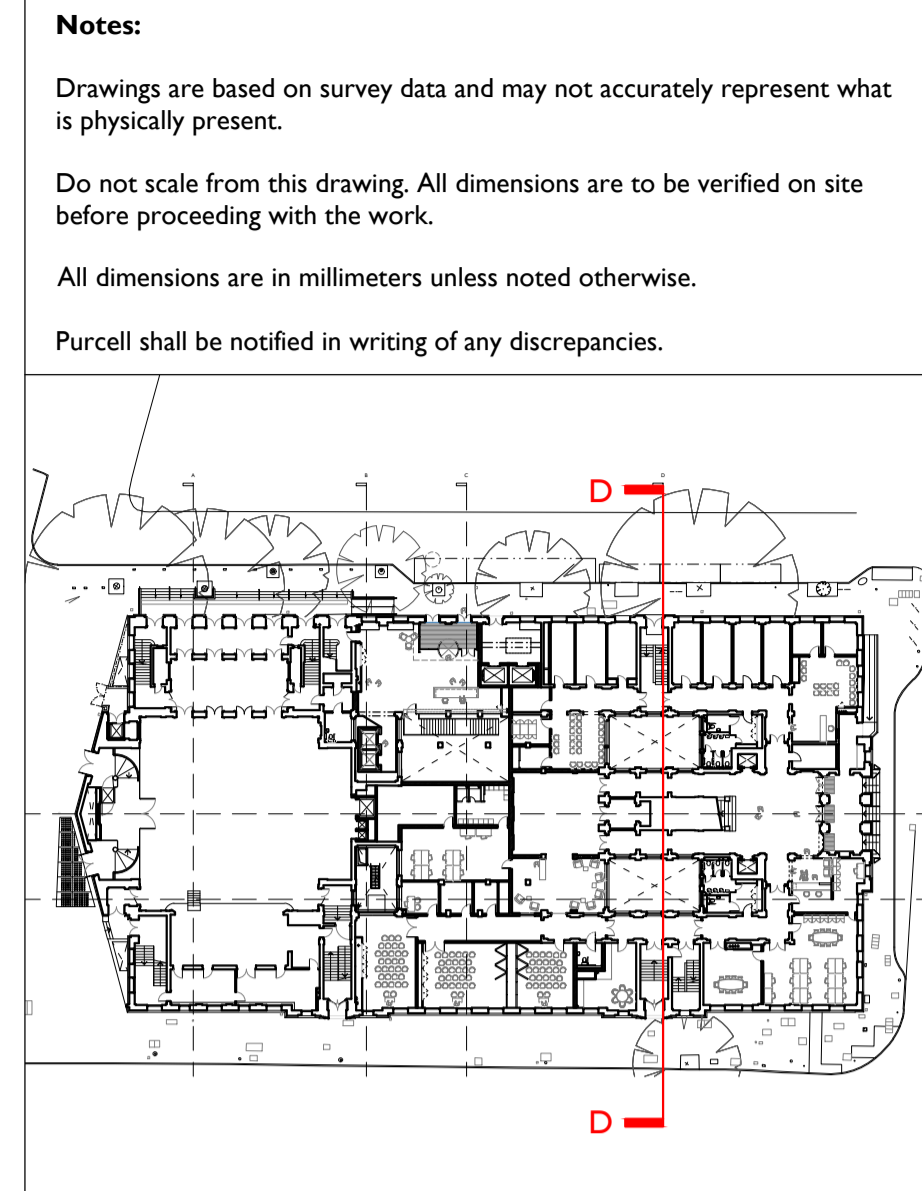


- Proposed Works Key**
- Proposed Wall
  - Window Number
  - Door Number
  - Refuge Point
  - Annotation Item
  - Manhole Location

Drawings to be read in conjunction with:

Use Designation Plans: Drawing Series (92)900  
 Conservation Strategy Report CTH-PUR-MP-00-SP-A-00005  
 Window Strategy Report CTH-PUR-XX-XX-RP-A-00012

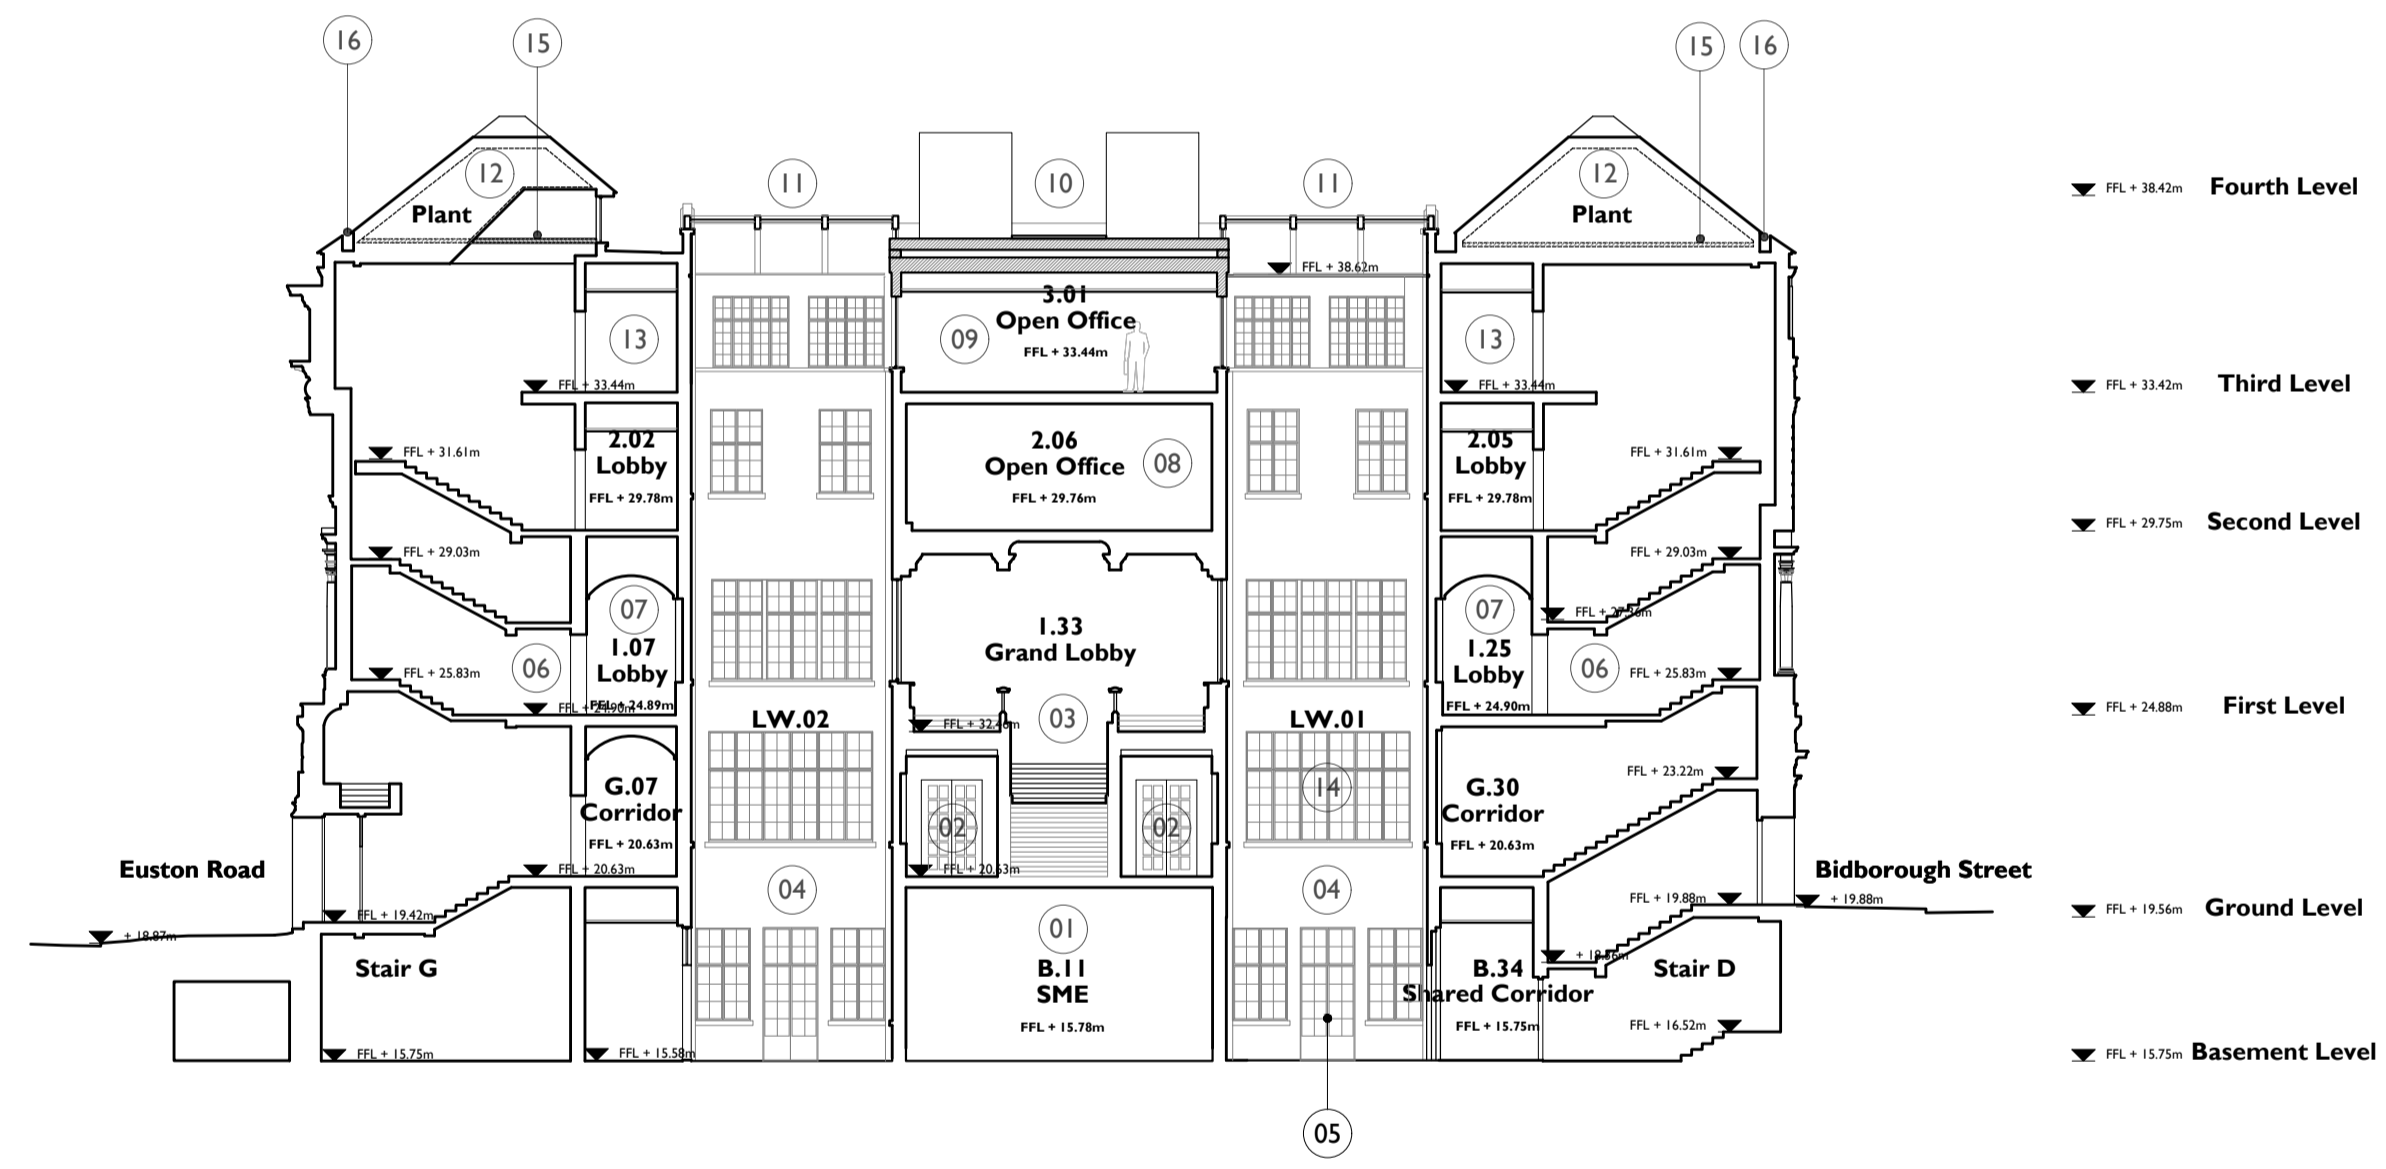

**I GA PROPOSED SECTION D-D**  
**92203 1:200 @ A1**

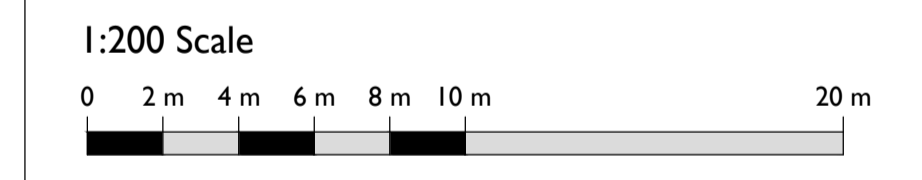

SS P00 18 Apr 2019 NS NS

ISSUE	DATE	DRAWN	CHECKED	DESCRIPTION
<b>DRAWING TITLE</b>		GA PROPOSED SECTION D-D		
<b>DRAWING NO.</b>		CTH-PUR-MP-ZZ-DR-A-92203		
<b>REVISION</b>		SS P00		
<b>SIZE &amp; SCALE</b>		A1L	1:200	
<b>DRAWING STATUS</b>		SS SUITABLE FOR PLANNING		

<b>CLIENT</b>	Lendlease	
<b>PROJECT</b>	Camden Town Hall	
<b>JOB NUMBER</b>	238664	