
## TYPE E - REMOVAL OF EXISTING RADIATORS FIXED TO HISTORIC FABRIC

See the method statements at the back of this document for details of making good the lath & plaster and decorative plaster in materials to match existing.

## 9MS/2/002 - AS BUILT CONDITION



9MS/2/002 Office - As Built Condition with radiators fixed to historical wall panelling / plaster finish

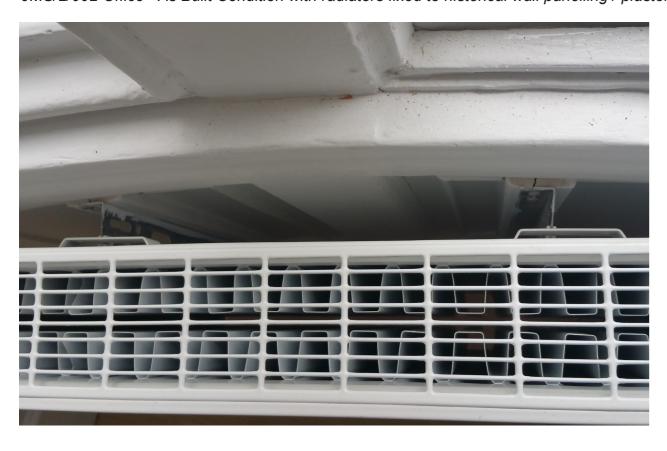


## 9MS/2/S02 - PROPOSED STELRAD MOUNTING BRACKETS

Low level boxing in with trunking to be carefully removed. Implemented radiator wall brackets to be removed from wall. Any resultant repair work to be carried out using lime plaster and decoration to match existing. Implemented radiator to be re used and floor mounted using stelrad floor standing brackets.

Where radiators have been fixed on boxing with electrical trunking and outlets installed under them at skirting level, the boxing and trunking is to be removed. In these circumstances remove the radiators and connecting pipework after removal of boxing and trunking reposition the radiators at normal height in line with other radiators. Where due to height of skirting board radiators cannot be fixed back to the wall fabric, mount the radiators on proprietary feet ordered from Stelrad subject to approval of architect. It is permissible to install pipework exposed under radiators from the riser fixed back to skirting and pained white. Allow for installing new pipework and fittings from the riser. Heating system drain down required. Flush and refill as required and dose the system. Leave in working order.



For fixation on finished floor Monclac floor standing bracket 120-215, article code R5209, the distance between the bottom of the radiator and the floor is adjustable per 5 mm.

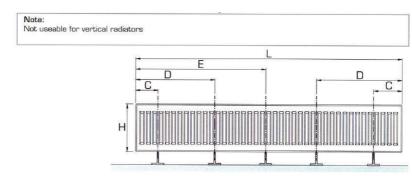

## recommended positions and numbers

	L	400	500 1100	1200	1400 1800	3000 5000
Н	Number		3 рс.			
300	С	117	150	250	250	250
400 500	Е	8	•	- 3	- 5	L/2+17

	L	400	500 1100	1200	1400 1800	2000	5500	2400	2600	2800	3000
Н	Number:	2 pc.		3 pc. 4 pc.			5 pc.				
600 700 900	С	117	150	250	250	250			250		
	D	100		7.20	ĕ	750	817	850	750	817	850
	E	25			817	120	- 12	1	L/2 +17		



BDP.

Varies@A3

14/06/2019

16 Brewhouse Yard Clerkenwell London EC1V 4LJ United Kingdom T +44 (0)20 7812 8000 F +44 (0)20 7812 8399 www.bdp.com

British Museum Perimeter Properties Refurbishment

P2002323

Additional works Type E - Removal of existing radiators fixed to historic fabric

(70)AD008