


1 Complete New Single Spiral Sash Window (Non DocL) Sheet Job No Item No Customer **Blades** D33358 1 of 1 Sectional Details Diagram Finished Frame Head 150 x 35 mm Finished Frame Jamb 150 x 35 mm Finished Cill 150 x 65 mm 630 55 mm Sash Head Sash Stile 58 mm Spifal/Hung A2 194 Chamfered Sash Btm Rail (int) 95 mm Sash Midrail 36 mm Sash Thickness 48 mm **Short Victorian** Top Sash Horn धि 969 Btm Sash Horn No horn 746 F 750 F 820 Location Glazing Bar 24 mm with 8 mm Nib First Floor Front Bathroom Profile Ovolo Material Quantity Moulding Cutter 6 x 13 with 6 mm shoulder Accoya sashes, 1 10 x 27 mm Glazing Rebate Accoya frame, Hardwood cill Ironmongery Glazing - HERITAGE UNITS Internal Pane External Pane 1 x Fitch Catch SC Spacer 4 x Rola Lock Back Plate Fastener Top 4mm Planitherm 4mm Low Iron 8mm 2 x Rola Lock Egress SC 2 x Sash Lift SC 4mm Planitherm 8mm 4mm Low Iron Dry Seal White Tape, White Spacer Krypton Filled Paint Finish Standard White Internal External Standard White Production Notes Installation Notes SALES: Template includes EGRESS ROLAS Installed: Internally Production: Lower sashes frame recessed 23.9 lb, 25.6 lb 2 | 13 | 6 | 27 Job Tracking Order received: 04-07-2019 Print date: 02-09-2019 Last modified by: Chris Jewiss Sold by: Daniel Soady Last modified date: 02-09-2019 Surveyed by: Chris Jewiss Plantation Shutters: Remove and Re-fit

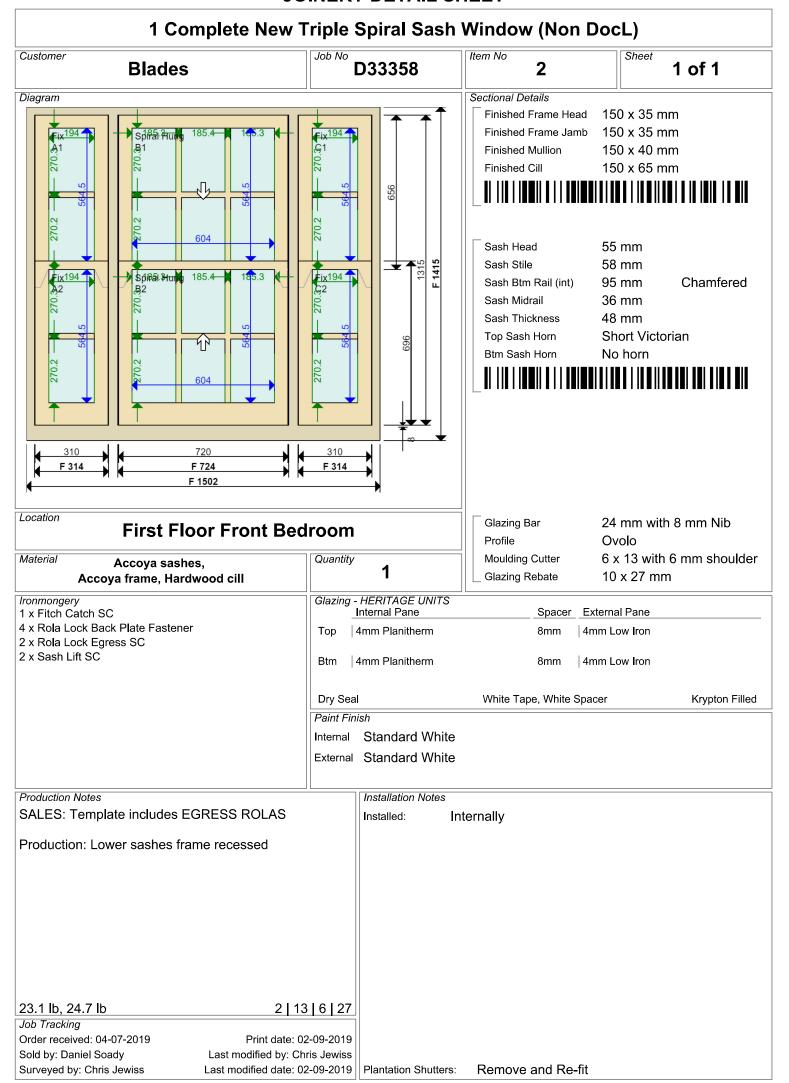

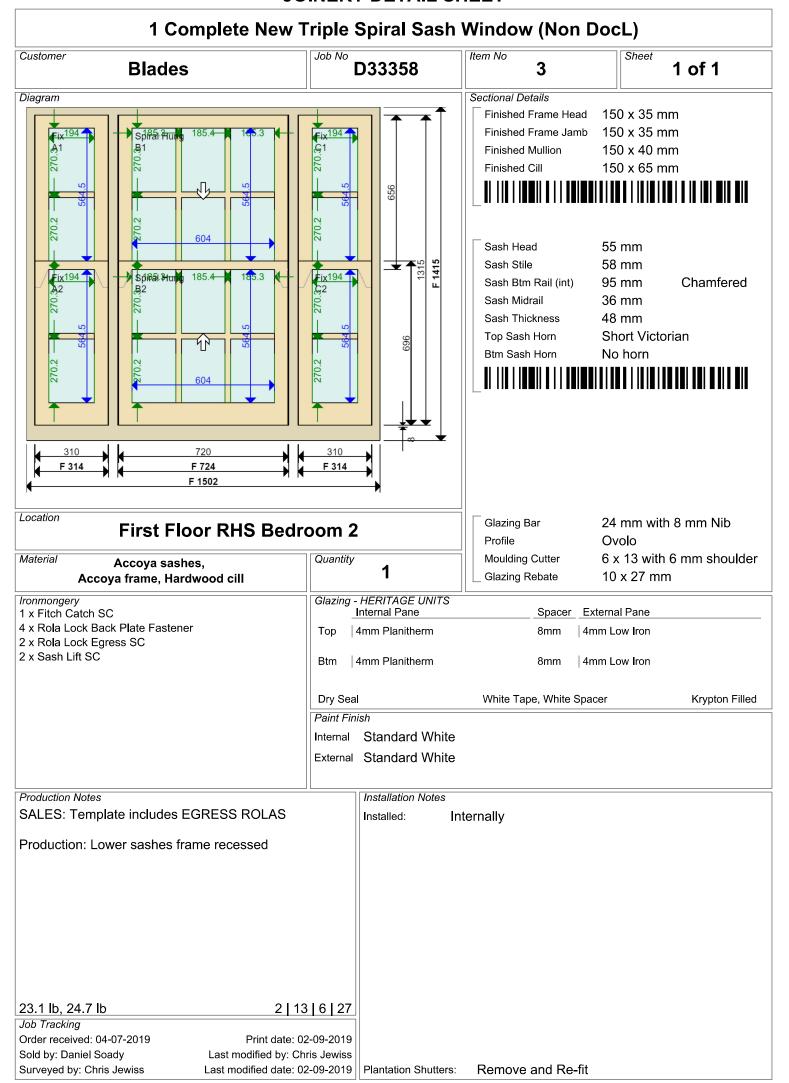

1 Complete New Single Spiral Sash Window (Non DocL) Job No Item No Sheet Customer **Blades** D33358 1 of 1 Sectional Details Diagram Finished Frame Head 150 x 35 mm Finished Frame Jamb 150 x 35 mm Finished Cill 150 x 65 mm 800 55 mm Sash Head 58 mm Sash Stile Spiral59ung 250.6 Chamfered Sash Btm Rail (int) 95 mm Sash Midrail 36 mm Sash Thickness 48 mm **Short Victorian** Top Sash Horn T) Btm Sash Horn No horn 800 916 F 920 F 990 Location Glazing Bar 24 mm with 8 mm Nib First Floor RHS Bathroom Profile Ovolo Material Quantity Moulding Cutter 6 x 13 with 6 mm shoulder Accoya sashes, 1 10 x 27 mm Glazing Rebate Accoya frame, Hardwood cill Ironmongery Glazing - HERITAGE UNITS Internal Pane External Pane 1 x Fitch Catch SC Spacer 4 x Rola Lock Back Plate Fastener Top 4mm Planitherm 4mm Low Iron 8mm 2 x Rola Lock Egress SC 2 x Sash Lift SC 4mm Planitherm 4mm Low Iron 8mm Dry Seal White Tape, White Spacer Krypton Filled Paint Finish Standard White Internal External Standard White Production Notes Installation Notes SALES: Template includes EGRESS ROLAS Installed: Internally Production: Lower sashes frame recessed * customer wishes to go spiral as per other windows. 25.7 lb, 27.7 lb 2 | 13 | 6 | 27 Job Tracking Order received: 04-07-2019 Print date: 02-09-2019 Last modified by: Chris Jewiss Sold by: Daniel Soady Last modified date: 02-09-2019 Surveyed by: Chris Jewiss Plantation Shutters: Remove and Re-fit

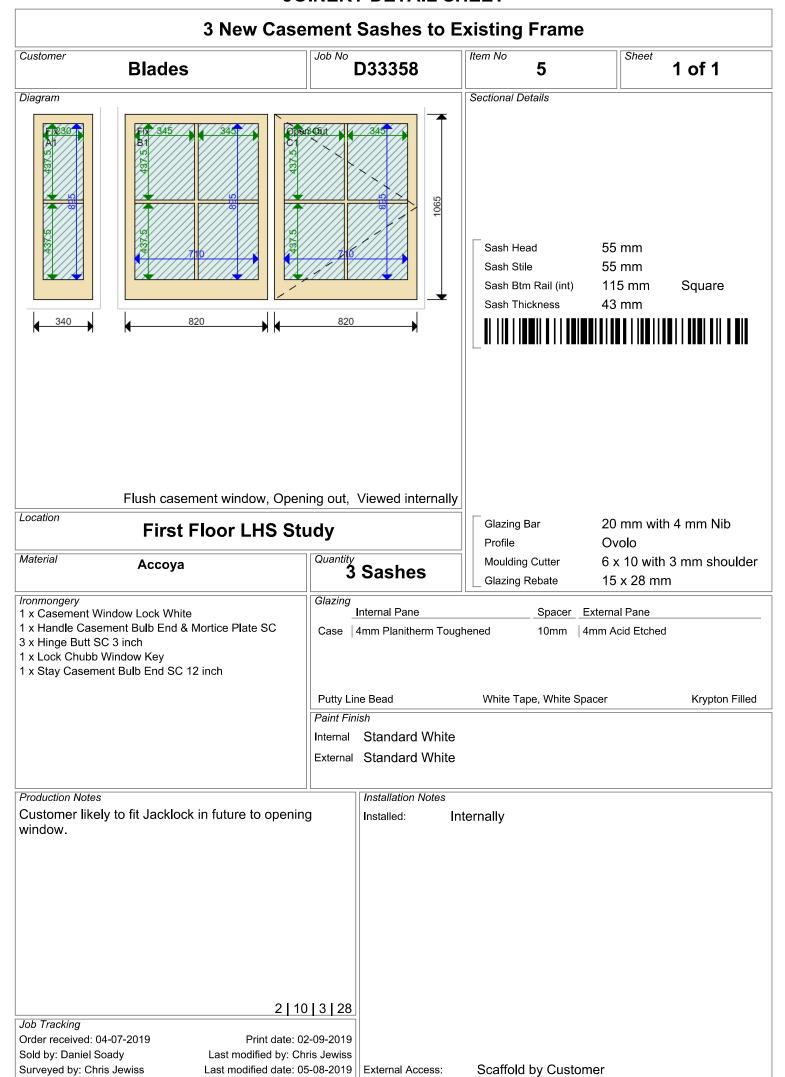

3 Complete New Spiral Sash Window Bays (Non DocL) Item No Job No Sheet Customer **Blades** D33358 1 of 1 6 Sectional Details Diagram 150 x 35 mm Finished Frame Head Finished Frame Jamb 150 x 35 mm Finished Mullion 150 x 40 mm Finished Cill 150 x 65 mm F 1375 spiral Hung 55 mm Sash Head 9/9 Sash Stile 58 mm Sash Btm Rail (int) 95 mm Chamfered Sash Midrail 36 mm Sash Thickness 48 mm 266 307 716 307 F 311 Top Sash Horn **Short Victorian** F 311 F 720 F 270 F 270 F 1492 Btm Sash Horn No horn Location Glazing Bar 24 mm with 8 mm Nib **Ground Floor Front Living Room** Profile Ovolo Material Quantity Moulding Cutter 6 x 13 with 6 mm shoulder Accoya sashes, 3 Glazing Rebate 10 x 27 mm Accoya frame, Hardwood cill Ironmongery Glazing - HERITAGE UNITS Internal Pane External Pane Spacer 1 x Fitch Catch SC 1 x Lock Chubb Window Key Top 4mm Planitherm 4mm Low Iron 8mm 4 x Rola Lock Back Plate Fastener 2 x Rola Lock SC 4mm Planitherm 8mm 4mm Low Iron 2 x Sash Lift SC Dry Seal White Tape, White Spacer Krypton Filled Paint Finish Standard White Internal External Standard White Production Notes Installation Notes *Try to increase glass sightlines compared to existing. Installed: Internally *Lead works to be determined at survey, customer aware *Customer aware shutters wont go back on. 22.3 lb, 23.9 lb 2 | 13 | 6 | 27 Job Tracking Order received: 04-07-2019 Print date: 02-09-2019

Sold by: Daniel Soady

Surveyed by: Chris Jewiss

Last modified by: Chris Jewiss Last modified date: 02-09-2019

Validation for D33358 printed by Chris on 02-09-2019

Item 1

#I8: Heritage units

Item 2

#I8: Heritage units

Item 3

#I8: Heritage units

Item 4

#18: Heritage units

Item 5

Nothing to highlight

Item 6

#W34: Frame interior widths are similar but not the same

#I8: Heritage units