


3 **G.04: Existing West Sectional Elevation**
1:50 @ A3

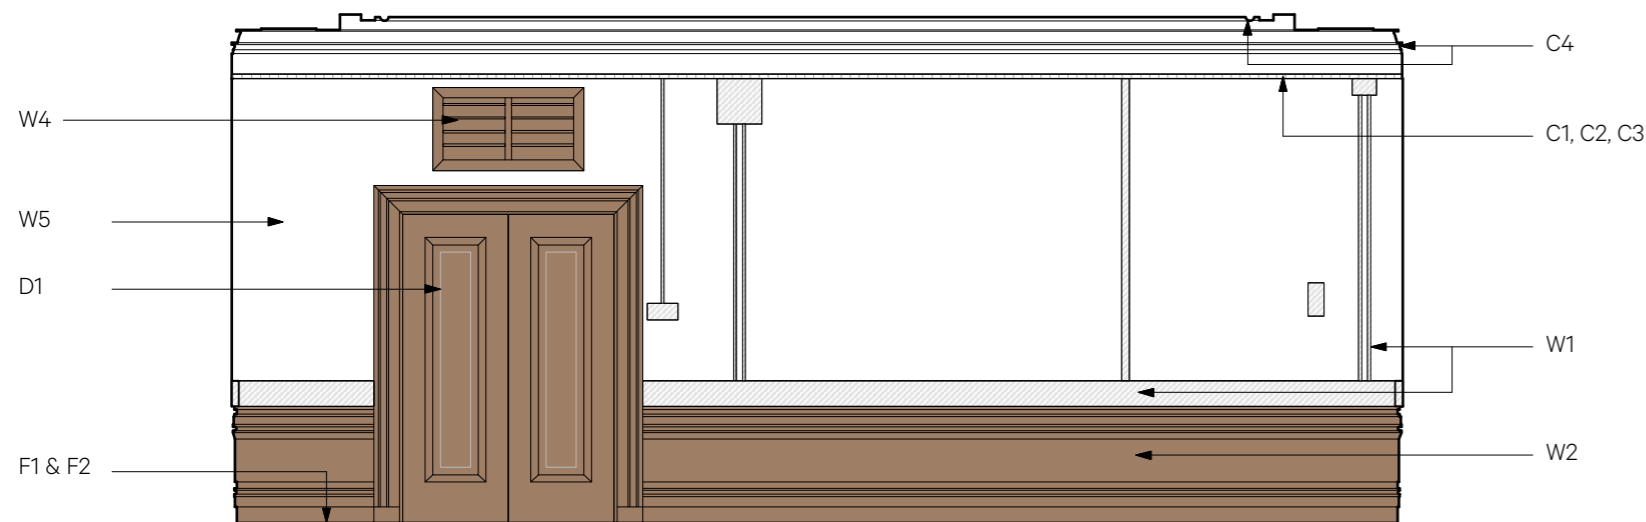

4 **G.04: Existing North Sectional Elevation**
1:50 @ A3

Walls

- W1 Existing services to be removed, including dado trunking. Refer to photographs P1-4.
- W2 Existing hardwood panelling retained and protected throughout works. Refer to photographs P1-4.
- W3 New penetrations to west wall (between G.04 and G.05) located below existing cornice level for ventilation ductwork. Refer to photograph P4.
- W4 Existing transfer grille above door to north elevation to be retained. Refer to photographs P1 & P5.
- W5 Existing walls made good and redecorated. Refer to photographs P1-4.
- W6 New power and data trunking with hardwood covering to match existing hardwood panelling.
- W7 New heavy curtains to south elevation.
- W8 New acoustic wall boards to provide mounting for AV screens.

Floor

- F1 Existing carpet to be carefully removed. Refer to photographs P7-10.
- F2 Existing cork flooring to be restored (and replaced where necessary). Refer to photographs P7-10. Please refer to method statement submitted as part of this application.

Ceiling

- C1 Existing suspended ceiling and fixings to be removed. Refer to photographs P1-4.
- C2 Existing ceiling-level services and lighting to be removed. Refer to photographs P1-4.
- C3 Existing above-ceiling services to be generally removed, with the exception of existing water pipes serving the library above.
- C4 Existing ceiling cornice retained and protected throughout the works. Existing condition to be surveyed following the removal of the existing suspended ceiling. Refer to photograph P11.
- C5 Existing boxing out of window heads at ceiling level removed. Refer to photograph P6.
- C6 New suspended ceiling.
- C7 Chandelier.
- C8 New recessed track lighting.
- C9 New recessed linear ventilation slot diffuser/extract.

Doors

- D1 Existing doors to be retained and protected throughout works. Refer to photographs P1 & P12.

Windows

- W1 Existing blinds to be removed. Refer to photograph P6.
- W2 New heavy curtains.

Furniture

- Fu1 New joinery units to house fan coil units, AV equipment and personal storage.
- Fu2 Existing clock removed. Refer to photographs P1 & P4.