
## 

DEMOLITION NOTES:	Existing casement windows carefully repaired				GENEI	RAL NOTES:
<ul> <li>for details of locations. New R&amp;D survey to be undertaken to confirm no remaining asbestos is present following enabling package.</li> <li>8.</li> <li>2. Refer to MEP consultant Information for extent of services and electrical strip out.</li> <li>3. Existing external doors and frames carefully repaired and openings made good ready to receive new decoration.</li> <li>4. Existing sanitary ware carefully removed and abutments / substrates made good ready to receive new finishes and equipment.</li> <li>5. Existing kitchens and associated services carefully removed with abutments and substrates capped off. Refer to MEP drawings for extents</li> </ul>	<ul> <li>Existing casement windows carefully repaired and made good ready to receive new decoration and ironmongery.</li> <li>New opening formed at half landing between first and second floor providing access to external staircase. New lintels provided, external brickwork to be supported on steel lintel, no visible lintel permitted in external fabric.</li> <li>Existing curtains / blinds removed.</li> <li>Existing rooflights retained.</li> <li>Existing floor finishes carefully removed.and new lintels installed in accordance with structural engineers information. Provide temporary support as required.</li> <li>Existing mansafe system relocated at first floor</li> </ul>		OFFICE	replaced custom	<ul> <li>2. I</li> <li>3. <i>1</i></li> <li>4. I</li> <li>5. I</li> <li>6. I</li> <li>7. I</li> <li>high level AC units to be removed and</li> <li>with low level fan cooler units within</li> <li>oinery encasement, position and</li> </ul>	Refurbished external door Existing lift refurbished All doors to be retained and redecorated. Where appropriate and in accordance with fire consultant specification treat with envirograf fire coating. New kitchenette New electric radiators as indicated New slate effect hearth Existing stairs refurbished with new carpet. Areas of damaged lath and plaster repaired, re-plastered and redecorated. Existing damaged and missing suspended ceiling to be carefully removed and replaced
<ol> <li>Existing tiled wall finishs carefully removed and substrate made good ready to receive new finish.</li> </ol>	<ul> <li>Existing mansale system relocated at installoor roof level to provide access to areas outside of new roof terrace.</li> <li>Existing WC cubicles carefully removed.</li> </ul>				and dado rails to be repainted. Colour as	All existing windows to be refurbished and to receive new ironmongery Existing WCs fully refurbished with new sanitary wear
	All existing trunking and conduits to be carefully removed. New wiring and sockets to be proposed underneath existing plywood flooring in floor boxes. See MEP consultant details. Door to be carefully removed to allow for AOV above stair for to be operational.	OFFICE	LANDING NOCITIVO OFFICE NO. 19	All existing refurbish approved Existing replaced	12.ng trunking and conduits to be carefullyI. New wiring and sockets to be proposedath existing plywood flooring in floorbee MEP consultant details.ng electric heaters to be replaced.o be provided by MEP consultant.16.ng damaged floors wall and ceilings froms and opening up works to be carefullysitively made good. Details ofment are subject to architect details19.d by the conservation off and LPA.high level AC units to be removed and11.12.13.14.15.16.17.18.19.11.11.11.12.12.13.14.15.15.16.17.17.18.19.11.11.11.11.12.12.13.14.15.15.16.17.18.19.19.11.11.11.12.13.14.15.15.16.17.18.19.19.10.10.10.11.11.12.13.14.14.15.15.16.	Any existing damaged or missing areas of plasterboard with skim finish repaired and redecorated Existing cast iron fireplace and wood surround retained and refurbished. Existing decorated wood surround stripped back and redecorated New downlights in basement Existing fireplace hearth and surround retained. Existing decorated surround stripped back and redecorated All existing window boards and reveals retained, stripped back and redecorated Existing stone surrounds retained and cleaned Existing painted balustrade redecorated New stair tread installed to match existing stairs Existing stairs walls repaired ready for redecoration All existing wall and ceiling lights to be replaced. Existing ocations to be utilised to avoid further intervention with historic building fabric.
	Existing high level AC units to be removed and replaced with low level fan cooler units within custom joinery encasement. position and specification to be confirmed by MEP		No. 19	All exist removed	ation to be confirmed in MEP design. 22.	All existing trunking and conduits to be retained All previously infilled openings between 17 and 18 are to be reviewed and upgraded to provide 60min fire separation between buildings, from the no.18 side, to be
	consultants All existing damaged floors, wall and ceilings from asbestos and opening up works to be carefully and sensitively made good. Details of refurbishment are subject to details approved by the conservation off and LPA.	MOTOR ROOM	LANDING OFFICE	boxes. S Existing replaced custom specifica consulta Where r stairs ar Painted All existi architect Capped kitchen f	high level AC units to be removed and24.high level AC units to be removed and25.I with low level fan cooler units within25.oinery encasement. position and1ation to be confirmed by MEP26.nts27.hissing, new dado rail to be installed to27.d landing areas to match existing profile.28.	All ceiling rose to be retained and redecorated All mouldings, skirtings, dado railing and paneling to be repainted and made good where damaged. All areas of water ingress/damp to be properly inspected and repaired. Replace All FCU's in existing locations. Existing window and door to be fitted with automatic opener as AOV
	Existing high level AC units to be removed and replaced with low level fan cooler units within custom joinery encasement. position and specification to be confirmed by MEP consultants	OFFICE		Existing replaced custom	ng trunking and conduits to be carefully I. New wiring and sockets to be proposed ath existing plywood flooring in floor see MEP consultant details. high level AC units to be removed and with low level fan cooler units within oinery encasement. position and titon to be confirmed by MEP nts	
Scale 1:50 0 1 2 3 4	5M					
<b>3RD FLOOR -</b>	<b>DEMOLITION PLAN</b>					FOR PLANNING
This drawing is protected under Copyright and at no time must any portion of this drawing be reproduced or copied in anyway without the permission of Morgan Lovell. All dimensions must be checked on site and NOT scaled				Morgan Lovell	Client Hogarth Properties (Rothschild)	Title 3RD FLOOR DEMOLITION PLAN
from this drawing. SUBJECT TO SITE SURVEY CHECK SURVEY UNDERTAKEN ONLY					Project PROJECT 04	Scale         Date         Designer/Drawn By         Checked By / Date           1:50 @ A1         NOV.21         TC / JPF         TC
BUILDING PARAMETERS TAKEN FROM DRAWINGS PROVIDED				16 Noel Street London W1F 8DA T: 0207 734 4466   F: 0207 734 2968   E: contact@morganlovell.com	18 & 19 SOUTHAMPTON PLACE	Drawing Number Project No. Floor Drawing No. Rev
BUILDING PARAMETERS TAKEN FROM AS BUILT DRAWINGS PROVIDED			P1FIRST ISSUE FOR REVIEWJPFTC09.06.22RevRevisionByCkdDate	W: http://www.morganlovell.com		ML3953 03 705 P1

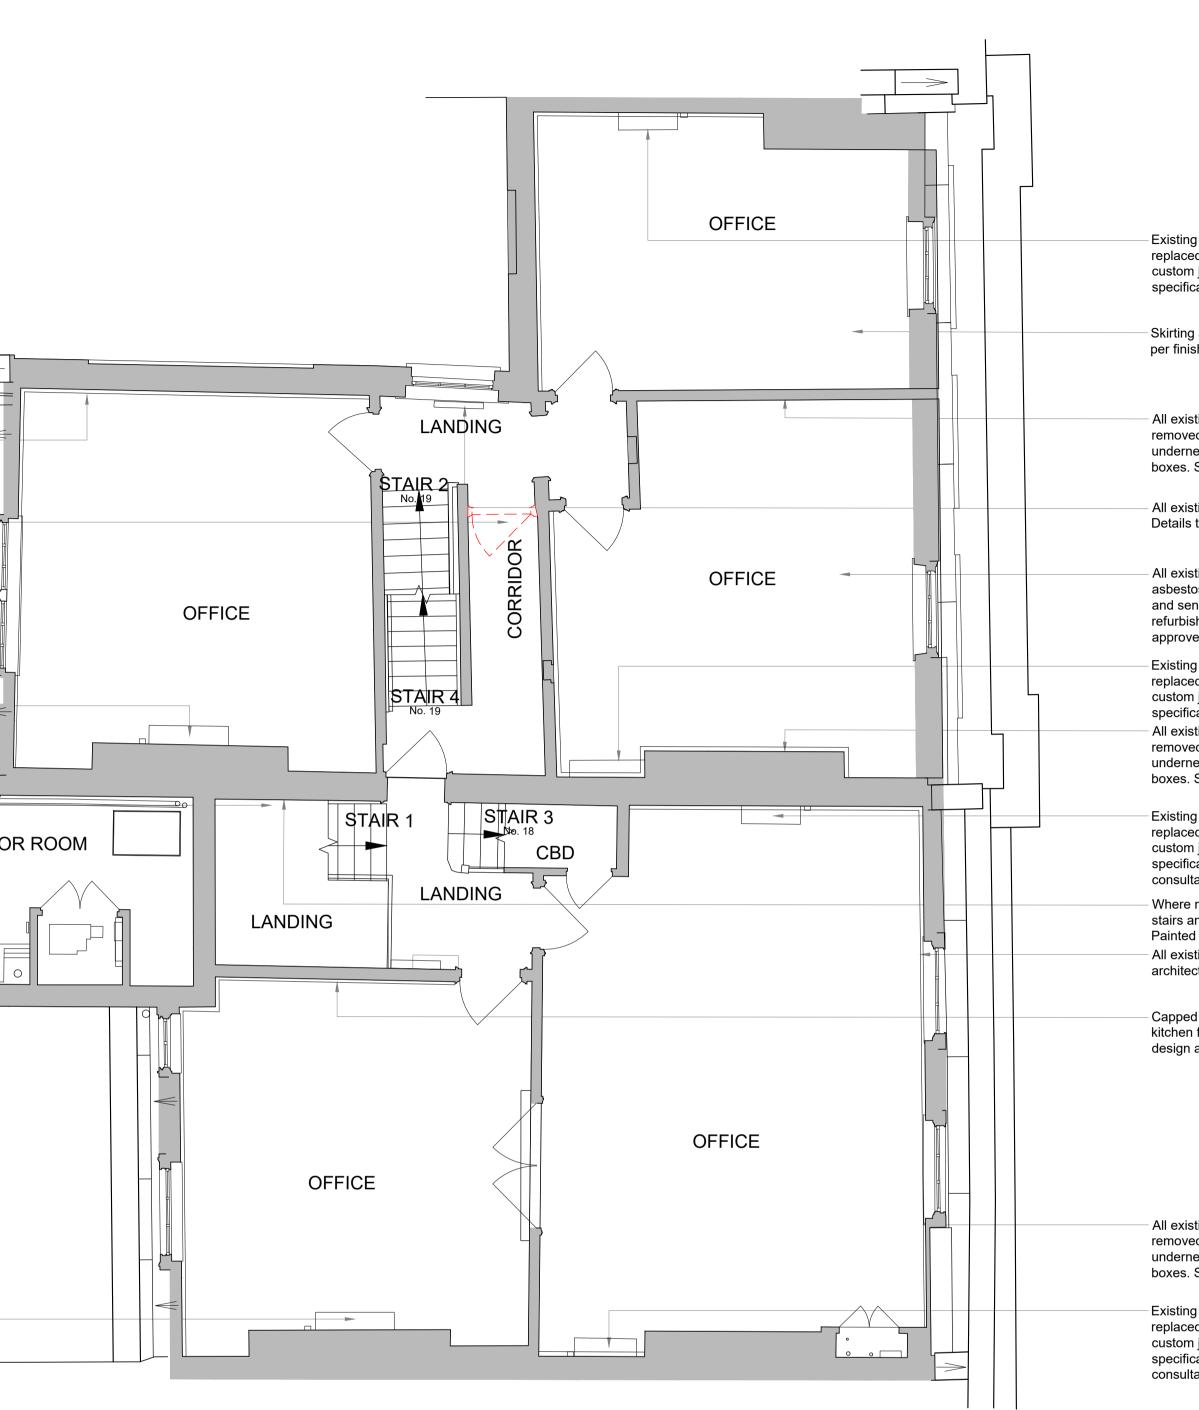

## GENERAL NOTES