

Examples of internal 'pod' treatment (design intent), painted panels (no skirtings), 15mm 'flash-gap' detail at junction with original wall volumes/ party walls and at floors.





No 63

Proposed Lower Ground Floor Plan (1:100)

LEGEND:

condition

structural integrity

membrane to flat roof

& Heritage best practice.

slates to match existing

address damp issues

6 Renew/ replace limestone flagstones

internal 'pods' to be treated separately

- 1 Period Skirting & Cornice to be introduced, in accordnace with Conservation & Heritage
- best practice

3 Walls to be plaster skimmed & painted in Heritage Approved paint range colour. New

4 Existing staircase to be retained to be protected during works and restored to original

5 New soot-washed brick closet wing to match existing, with lead-coloured single-ply

All original timber sash windows to be overhauled & made good to original condition. Modern windows to be replaced to match period existing in accordance with Conservation
8 Heritage best practice

8 Roof to be reformed, reuse existing slates where feasible, alternatively replace with Welsh

9 Renew timber entrance doors & repaint black. Fanlights over to be renewed/ restored.

(1) Remove existing mass concrete & PCC paving to garden and reduce level by 150mm to

(10) New dormer roof & cheeks to be formed with Code 4 leadwork

- 2 Floor joists & boarding to be overhauled or renewed locally where required to restore

Proposed Upper Ground Floor Plan (1:100)

NOTES;

FLOOR AREA (GIA total No 64 & 65) - 752 sq M/ 7,867 sq ft

increase of 84 sq M

No of separate Rooms - 26 (excluding separate siting-lounge rooms)

Proposed General Finishes (to match existing):


Walls; Yellow London Stock brickwork, red brickwork soldier arches (rear), buff coloured lime pointing. Stucco ashlar render painted white (front). Clay tile creasing to parapet. Brickwork to be soot washed.

0m

Roofs; Natural slate roofing, half-round ridges. Lead flat roofing & flashing. Timber glazed rooflights. Windows & Doors; Painted timber single-glazed sliding sashes and casements, painted timber solid doors with glazed fanlights

Metalwork; Painted steelwork 'Juilette' balcony

Hard-landscaping; Concrete paving slabs to rear & gravel. Rainwater Goods & Foul Pipework; Black UPVC & cast iron type downpipes and guttering

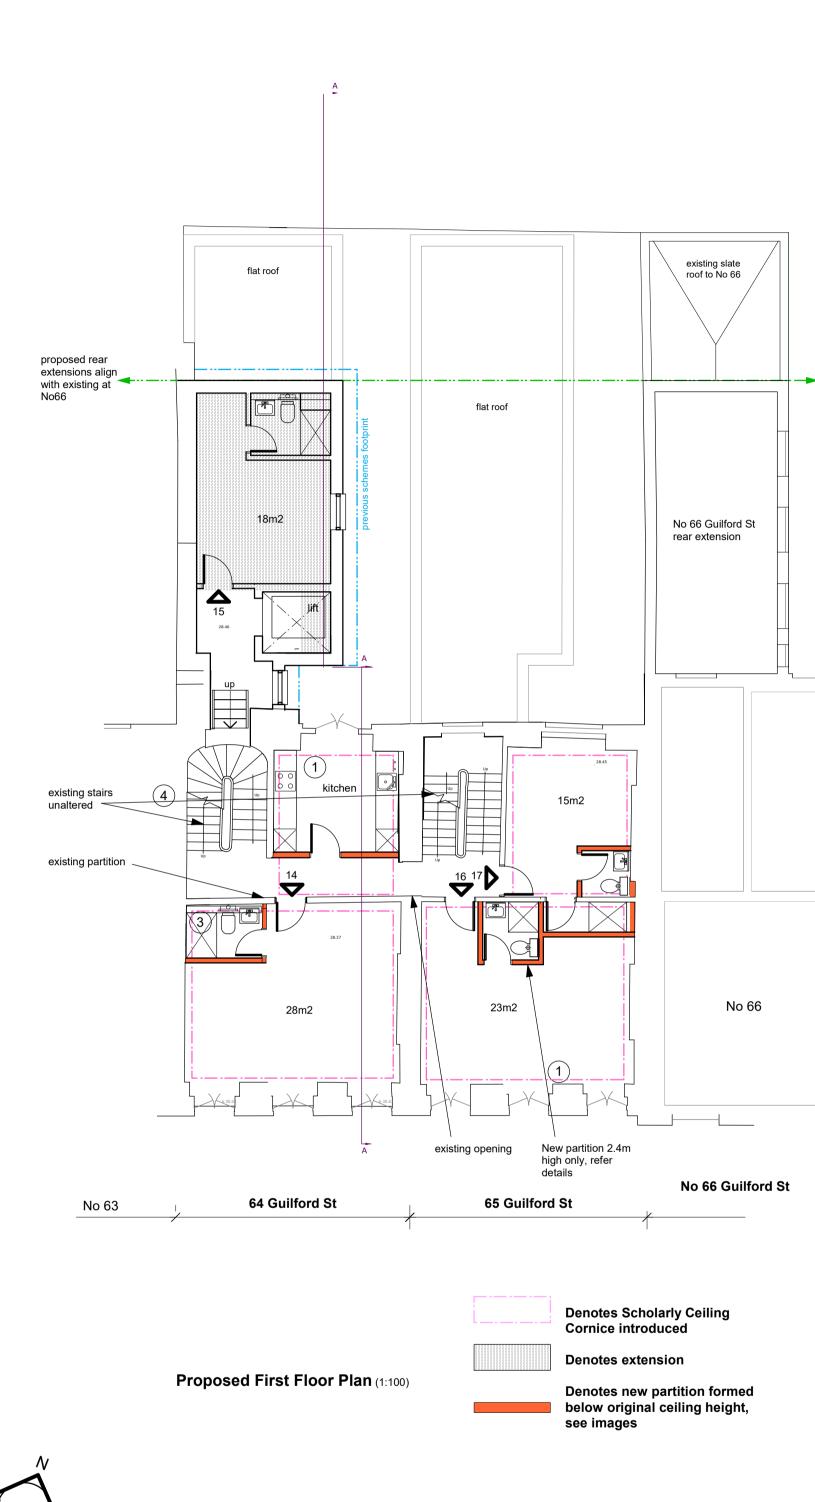

Ref.	Date	Description				Drawn	Checked
A B C D	May 2022 June 2022 Oct. '22 Feb 23	Scheme amended to suit Client & F Scheme amended to suit Client & F Scheme layout amended & rear ex Scheme amended to suit recomme	roject Team requirements ensions reduced to meet LB Camden recomr	mendations and No66 added to pla	n & section		
	NOTE:	Any errors or omissions to be	g (except for Planning purposes reported to the Architect. All din ction and fabrication commence	nensions relevant to the s			ed by
	• R	ICHARD I	MALTESE /	ARCHITE	ECTS	LTD•	
			MALTESE N20 0DZ T . 020 821			LTD • searchitects.com	n
proj	Studio 3	31 Manor Drive, Londor		13399 E. info@			n
proj	Studio 3 ect 64 -	31 Manor Drive, Londor	N20 0DZ T. 020 821	13399 E. info@ 1DD	richardmaltes	searchitects.co	n

drawing no. 11203/04

D

date

scale 1:100 @ A1

April 2021