



Monitoring Details:

Provider Name: CET

Monitoring Interval: Every 8 weeks

Instruction Date: 09/05/2021

Number of Visits: 19

Reading Date:

Visits Completed: 18

Date of Issue: 31/08/2023

Visits Outstanding: 1

Client Details:

Client: Sedgwick

Engineer / Handler: -




Monitored Address:

Occupier:



Telephone:

Email: -

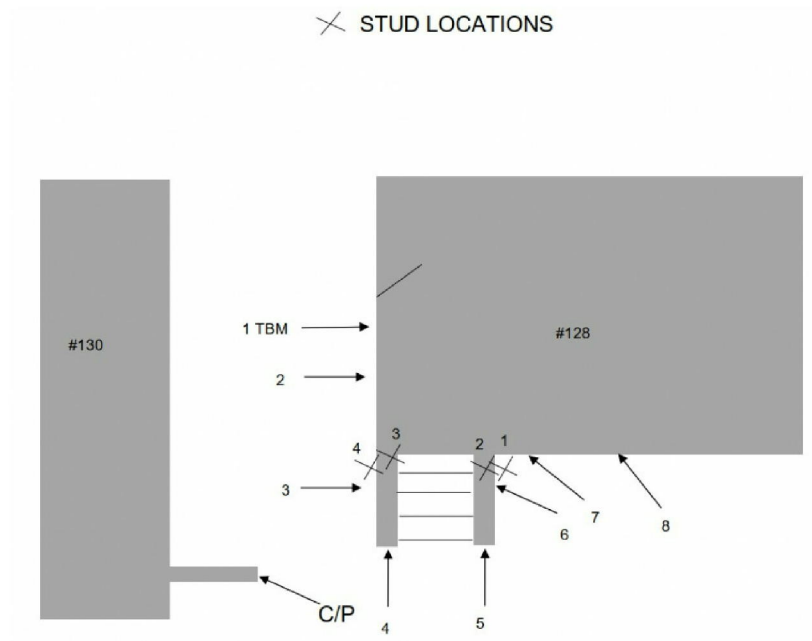

Visit Notes

Visit	Surveyors Note
Visit 1	
Visit 2	
Visit 3	
Visit 4	
Visit 5	
Visit 6	
Visit 7	
Visit 8	
Visit 9	
Visit 10	

Level Readings

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	01/09/20	02/11/20	06/01/21	08/03/21	26/04/21	07/06/21	12/08/21	17/11/21	11/01/22	11/03/22
TBM 1	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000
2	9.9779	9.9782	9.9783	9.9795	9.9796	9.9792	9.9796	9.9799	9.9803	9.9794
3	9.9853	9.9865	9.9889	9.9934	9.9950	9.9948	9.9964	9.9971	9.9992	9.9989
4	10.7922	10.7969	10.8015	10.8076	10.8068	10.8062	10.8088	10.8098	10.8124	10.8117
5	10.8433	10.8473	10.8531	10.8598	10.8585	10.8580	10.8590	10.8598	10.8625	10.8620
6	10.3797	10.3804	10.3833	10.3870	10.3862	10.3862	10.3883	10.3876	10.3884	10.3894
7	10.3249	10.3249	10.3250	10.3280	10.3262	10.3258	10.3294	10.3286	10.3292	10.3303
8	10.3234	10.3244	10.3256	10.3269	10.3261	10.3250	10.3271	10.3262	10.3266	10.3280

Visit Notes

Visit	Surveyors Note
Visit 11	
Visit 12	
Visit 13	
Visit 14	
Visit 15	
Visit 16	
Visit 17	
Visit 18	
Visit 19	
Visit 20	

Level Readings

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	04/05/22	30/06/22	17/08/22	03/10/22	05/12/22	06/02/23	11/04/23	12/06/23	31/08/23	
TBM 1	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	
2	9.9803	9.9804	9.9786	9.9784	9.9796	9.9796	9.9802	9.9808	9.9803	
3	9.9995	9.9985	9.9874	9.9870	9.9939	9.9948	9.9948	9.9983	9.9947	
4	10.8131	10.8097	10.7926	10.7952	10.8019	10.8067	10.8078	10.8099	10.8037	
5	10.8633	10.8614	10.8433	10.8426	10.8516	10.8559	10.8573	10.8609	10.8545	
6	10.3893	10.3889	10.3809	10.3789	10.3839	10.3853	10.3871	10.3867	10.3849	
7	10.3298	10.3306	10.3263	10.3279	10.3275	10.3279	10.3294	10.3289	10.3273	
8	10.3274	10.3266	10.3211	10.3209	10.3217	10.3224	10.3240	10.3234	10.3223	


Level Movement (Displayed in Millimeters)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	01/09/20	02/11/20	06/01/21	08/03/21	26/04/21	07/06/21	12/08/21	17/11/21	11/01/22	11/03/22
TBM1	0	0	0	0	0	0	0	0	0	0
2	0	+0.3	+0.4	+1.6	+1.7	+1.3	+1.7	+2	+2.4	+1.5
3	0	+1.2	+3.6	+8.1	+9.7	+9.5	+11.1	+11.8	+13.9	+13.6
4	0	+4.7	+9.3	+15.4	+14.6	+14	+16.6	+17.6	+20.2	+19.5
5	0	+4	+9.8	+16.5	+15.2	+14.7	+15.7	+16.5	+19.2	+18.7
6	0	+0.7	+3.6	+7.3	+6.5	+6.5	+8.6	+7.9	+8.7	+9.7
7	0	0	+0.1	+3.1	+1.3	+0.9	+4.5	+3.7	+4.3	+5.4
8	0	+1	+2.2	+3.5	+2.7	+1.6	+3.7	+2.8	+3.2	+4.6

Level Movement (Displayed in Millimeters) - Continuation of readings

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	04/05/22	30/06/22	17/08/22	03/10/22	05/12/22	06/02/23	11/04/23	12/06/23	31/08/23	
TBM1	0	0	0	0	0	0	0	0	0	
2	+2.4	+2.5	+0.7	+0.5	+1.7	+1.7	+2.3	+2.9	+2.4	
3	+14.2	+13.2	+2.1	+1.7	+8.6	+9.5	+9.5	+13	+9.4	
4	+20.9	+17.5	+0.4	+3	+9.7	+14.5	+15.6	+17.7	+11.5	
5	+20	+18.1	0	-0.7	+8.3	+12.6	+14	+17.6	+11.2	
6	+9.6	+9.2	+1.2	-0.8	+4.2	+5.6	+7.4	+7	+5.2	
7	+4.9	+5.7	+1.4	+3	+2.6	+3	+4.5	+4	+2.4	
8	+4	+3.2	-2.3	-2.5	-1.7	-1	+0.6	0	-1.1	

Level Readings Chart (Points TBM 1 - 8)

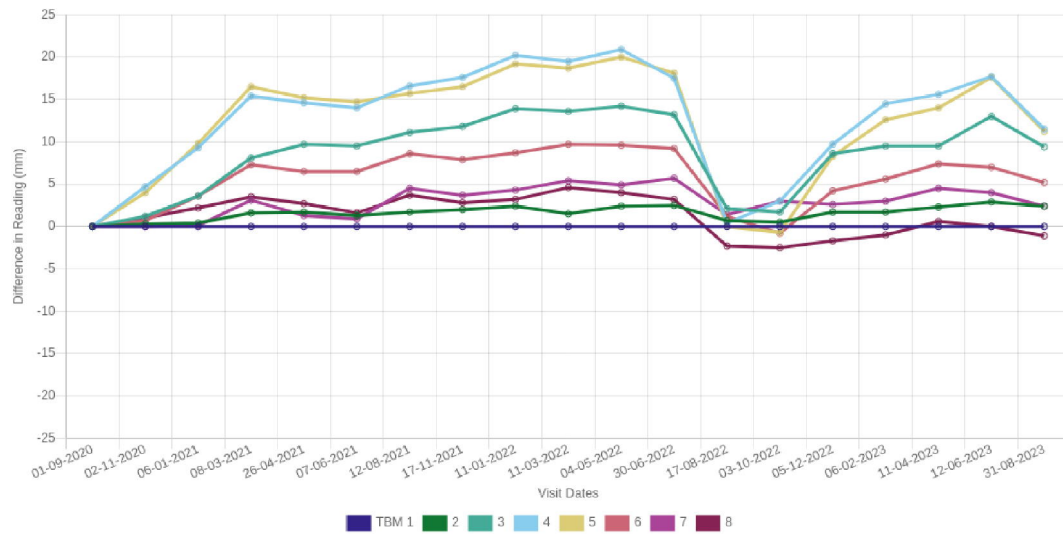


Crack Monitoring

EXT RH side of steps to main building

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	01/09/20	08/03/21	26/04/21	07/06/21	12/08/21	17/11/21	11/01/22	11/03/22	04/05/22	30/06/22
H	61.16	55.95	55.83	55.37			55.21	55.36	55.16	55.5
D										
C										

EXT RH side of steps to main building - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	01/09/20	08/03/21	26/04/21	07/06/21	12/08/21	17/11/21	11/01/22	11/03/22	04/05/22	30/06/22
H	0	-5.21	-5.33	-5.79			-5.95	-5.8	-6	-5.66
D										
C										

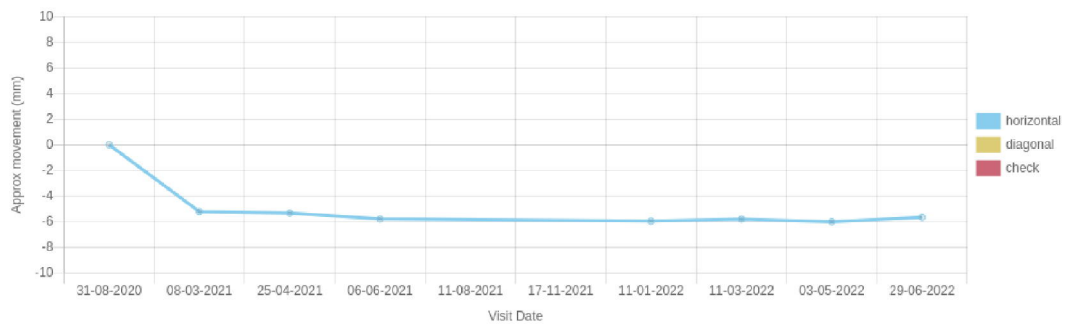


Crack Monitoring

EXT RH side of steps to main building

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	17/08/22	03/10/22	05/12/22	06/02/23	11/04/23	09/06/23	31/08/23			
H	60.31	60.66	57.79	57.51	57.68	55.42	55.01			
D										
C										

EXT RH side of steps to main building - Crack Readings Differences (Displayed in Millimetres)

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	17/08/22	03/10/22	05/12/22	06/02/23	11/04/23	09/06/23	31/08/23			
H	-0.85	-0.5	-3.37	-3.65	-3.48	-5.74	-6.15			
D										
C										

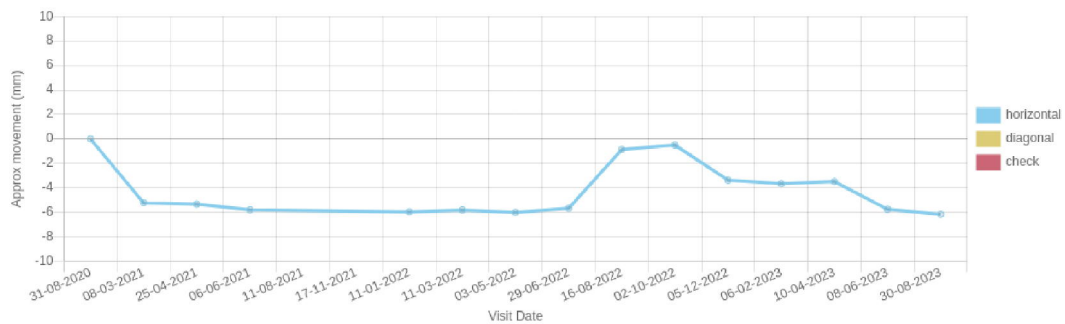


Crack Monitoring

EXT LH side of steps above sotrage shed

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	01/09/20	08/03/21	26/04/21	07/06/21	12/08/21	17/11/21	11/01/22	11/03/22	04/05/22	30/06/22
H	6754	6729	6748	6753		6759	6748	6754	674	6753
D	8211	8183	8196	8191	8185	8209	8201	8206	8215	8202
C	981	9812	9805	9805	9807	9805	9803	9796	9797	9787

EXT LH side of steps above sotrage shed - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	01/09/20	08/03/21	26/04/21	07/06/21	12/08/21	17/11/21	11/01/22	11/03/22	04/05/22	30/06/22
H	0	-0.25	-0.06	-0.01		0.05	-0.06	0	-0.14	-0.01
D	0	-0.28	-0.15	-0.2	-0.26	-0.02	-0.1	-0.05	0.04	-0.09
C	0	0.02	-0.05	-0.05	-0.03	-0.05	-0.07	-0.14	-0.13	-0.23

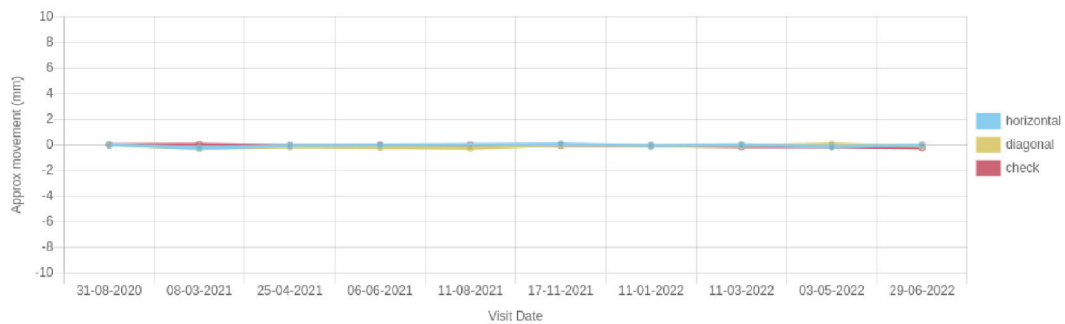


Crack Monitoring

EXT LH side of steps above sotrage shed

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	17/08/22	03/10/22	05/12/22	06/02/23	11/04/23	09/06/23	31/08/23			
H	6743		6719	6701	6694	6763	6749			
D	819		8189	8153	8154	8203	8182			
C	9798		9798	9791	9795	9789	9786			

EXT LH side of steps above sotrage shed - Crack Readings Differences (Displayed in Millimetres)

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	17/08/22	03/10/22	05/12/22	06/02/23	11/04/23	09/06/23	31/08/23			
H	-0.11		-0.35	-0.53	-0.6	0.09	-0.05			
D	-0.21		-0.22	-0.58	-0.57	-0.08	-0.29			
C	-0.12		-0.12	-0.19	-0.15	-0.21	-0.24			

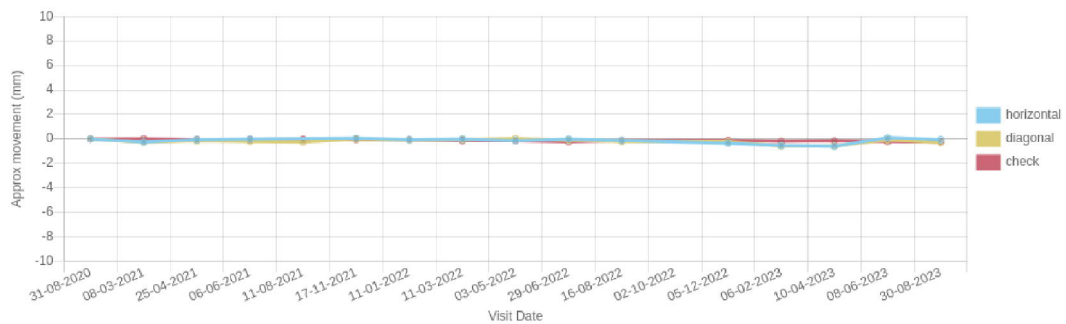


Crack Monitoring

EXT :LH side steps to porch REFIT

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	01/09/20	08/03/21	26/04/21	07/06/21	12/08/21	17/11/21	11/01/22	11/03/22	04/05/22	30/06/22
H					132.75	132.84	132.56	130.96	132.11	132.6
D										
C										

EXT :LH side steps to porch REFIT - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	01/09/20	08/03/21	26/04/21	07/06/21	12/08/21	17/11/21	11/01/22	11/03/22	04/05/22	30/06/22
H					0	0.09	-0.19	-1.79	-0.64	-0.15
D										
C										

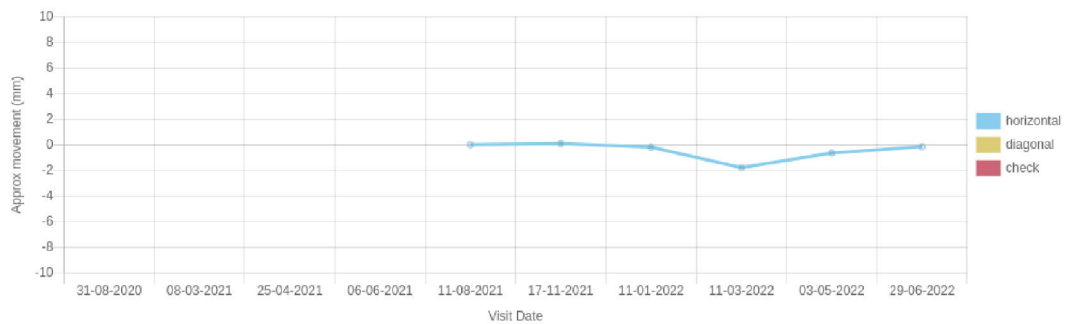


Crack Monitoring

EXT :LH side steps to porch REFIT

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	17/08/22	03/10/22	05/12/22	06/02/23	11/04/23	09/06/23	31/08/23			
H	13752	13764	1346	13437	13431	13241	13346			
D										
C										

EXT :LH side steps to porch REFIT - Crack Readings Differences (Displayed in Millimetres)

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	17/08/22	03/10/22	05/12/22	06/02/23	11/04/23	09/06/23	31/08/23			
H	4.77	4.89	1.85	1.62	1.56	-0.34	0.71			
D										
C										

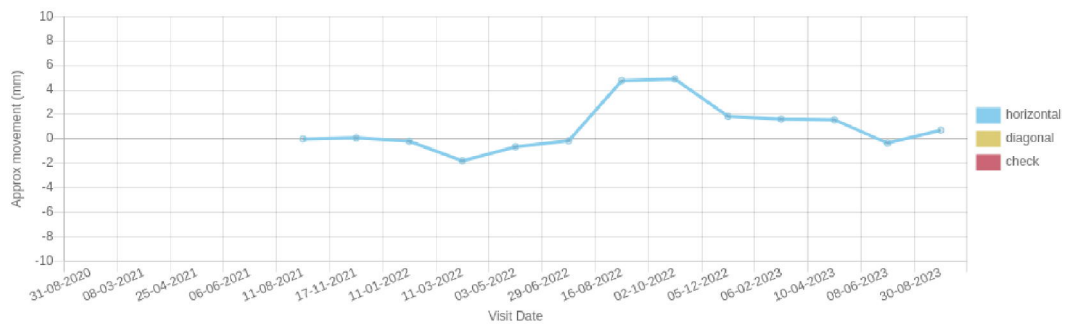


Crack Monitoring

EXT RH side stairs to porch REFIT

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	01/09/20	08/03/21	26/04/21	07/06/21	12/08/21	17/11/21	11/01/22	11/03/22	04/05/22	30/06/22
H										

EXT RH side stairs to porch REFIT - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	01/09/20	08/03/21	26/04/21	07/06/21	12/08/21	17/11/21	11/01/22	11/03/22	04/05/22	30/06/22
H										

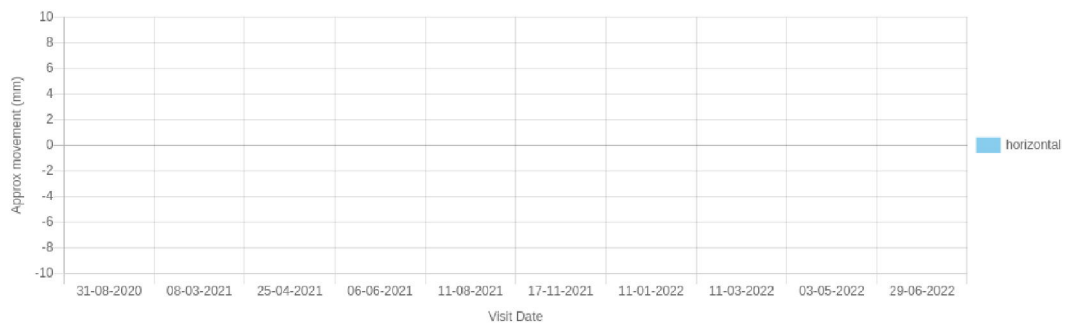

EXT RH side stairs to porch REFIT - Oldest photo




Crack Monitoring

EXT RH side stairs to porch REFIT

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	17/08/22	03/10/22	05/12/22	06/02/23	11/04/23	09/06/23	31/08/23			
H			95.33	95.27	95.15	91.95	93.71			

EXT RH side stairs to porch REFIT - Crack Readings Differences (Displayed in Millimetres)

	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16	Visit 17	Visit 18	Visit 19	Visit 20
	17/08/22	03/10/22	05/12/22	06/02/23	11/04/23	09/06/23	31/08/23			
H			0	-0.06	-0.18	-3.38	-1.62			

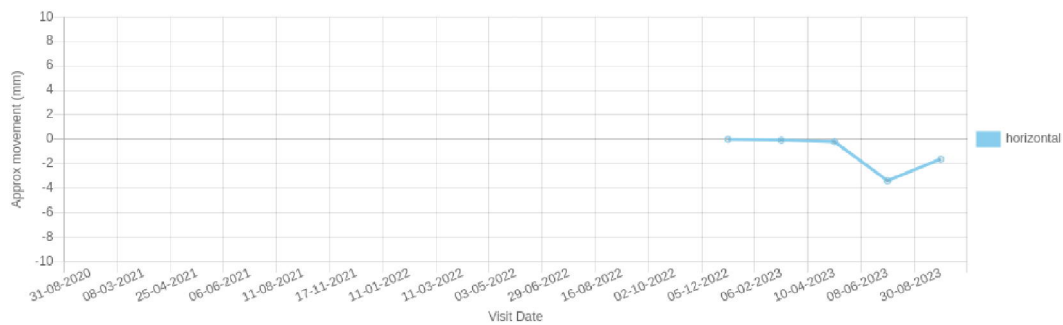

EXT RH side stairs to porch REFIT - Oldest photo

