




**LEVEL MONITORING - RELATIVE SURVEY READINGS**

<b>Provider Details</b>		<b>Client Details</b>		<b>Risk Address</b>	
Name:	MHN Ltd	Insurance Co.:	Jr Clare	Occupier:	Contover Trading Co Ltd
Date of Issue:	26/7/23	Client Name:	Davies Group Limited	Address:	73 Aberdare Gardens
		Technical Mgr:	Jessica Moran	Address:	London
		Email:	[REDACTED]	Town:	
		Client Ref:	[REDACTED]	County:	
		Address:	[REDACTED]	Post Code:	NW6 3AN
<b>Monitoring Details</b>		Address:	Subsidence and Surveying Services	Tel Home:	
Instruction Date:	9/4/20	Address:	PO Box 2598	Tel Work:	
First Reading Date:	17/04/2020	Town:	Stoke on Trent	Mobile:	
Maximum No Visits:	UFN	Post Code:	ST4 9EY	Other:	
Anticipated Expiry Date:	TBC	Other Email:		Other:	
Monitoring Int:	2 Monthly				

		Target Date:													
		Reading Date:													
		Issue Date:													
Row No.	Point Name	X Co-ordinate	Y Co-ordinate	10	11	12	13	14	15	16	17	18	19	20	21
1	1	0.00	0.00	10.5416	10.5402	10.5400	10.5401	10.5394	10.5393	10.5386	10.5397	10.5384	10.5393	10.5393	10.5387
2		0.50	0.00												
3		1.00	-1.00												
4		3.00	-1.00												
5	2	3.50	0.00	10.5495	10.5492	10.5490	10.5492	10.5480	10.5460	10.5464	10.5473	10.5473	10.5488	10.5478	10.5465
6	3	6.00	0.00	10.5442	10.5442	10.5432	10.5439	10.5432	10.5415	10.5427	10.5425	10.5429	10.5428	10.5428	10.5423
7	4	6.00	-0.50	10.4719	10.4716	10.4714	10.4716	10.4705	10.4692	10.4698	10.4696	10.4689	10.4707	10.4705	10.4689
8	5	9.50	-0.50	10.4020	10.4019	10.4009	10.4015	10.4008	10.4001	10.4009	10.4013	10.4011	10.4018	10.4012	10.4005
9		9.50	0.00												
10	6	10.00	0.00	10.4650	10.4646	10.4638	10.4649	10.4640	10.4636	10.4640	10.4647	10.4645	10.4649	10.4651	10.4637
11		10.00	10.00												
12		0.00	10.00												
13															
14															
15															
16															
17															
18															
19															
20															
21															
22															
23															
24															
25															
26															
27															
28															
29															
30															
31															
32															

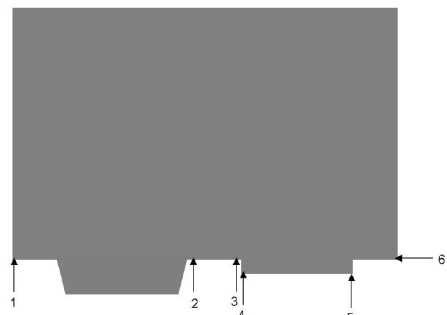

**FRONT**

- 28/07/2023
  - The Occupier expressed no new concerns
- It was not possible to install all stations within the same brick course. Therefore initial readings cannot be interpreted as Distortion Data.
- Readings have been made relative to a man hole in the road. It has an assumed value of 10.0000m. If this is not appropriate, please advise if a deep datum is required?
- Further readings to be taken Sept 23