

LEVEL MONITORING

for Subsidence Management Services

Gilling Court, Belsize Grove, London, NW3 4UY

Client:	Subsidence Management Services
Client Contact:	Stephan Barnes
Claim Number:	
Client Reference:	
Policy Holder:	Gilling Court (Hampstead) Ltd
Report Date:	23 November 2023
Our Ref:	



Level Monitoring Readings

The following table shows the reading levels of the various Level Monitoring Station points.

Date	1	2	3	4	5	6	7
13/12/2022	10.0000	9.9726	9.9053	9.9209	9.9733	9.9896	10.0716
20/01/2023	10.0000	9.9733	9.9069	9.9217	9.9737	9.9890	10.0719
17/02/2023	10.0000	9.9737	9.9065	9.9218	9.9729	9.9890	10.0712
17/03/2023	10.0000	9.9742	9.9077	9.9231	9.9743	9.9906	10.0723
16/05/2023	10.0000	9.9742	9.9076	9.9222	9.9729	9.9884	10.0707
27/06/2023	10.0000	9.9726	9.9043	9.9214	9.9747	9.9912	10.0733
17/08/2023	10.0000	9.9700	9.9016	9.9172	9.9729	9.9900	10.0736
20/11/2023	10.0000	9.9706	9.9023	9.9182	9.9749	9.9924	10.0752



Level Monitoring Difference Graphs

The following graphs display the progressive movement that each Level Monitoring Station recorded at each separate site visit date to give an overall look at how much the property is moving.

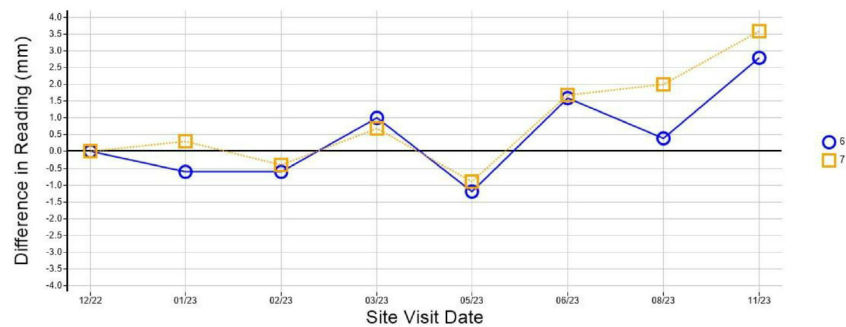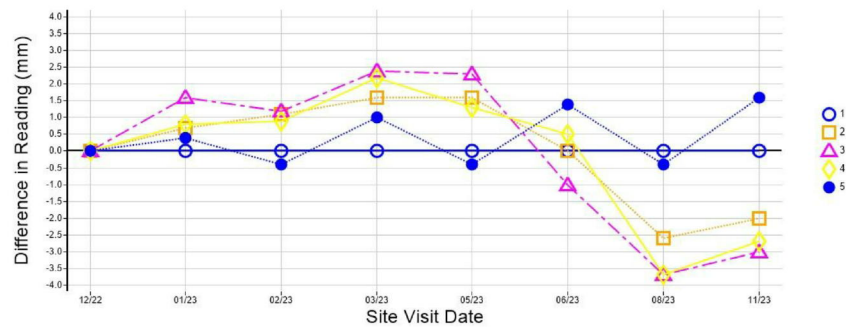

Level Monitoring Displacement Map

The following image shows an isometric representation of the movement of the property, based on the Level Monitoring Stations that were installed.

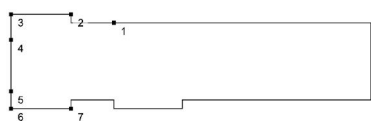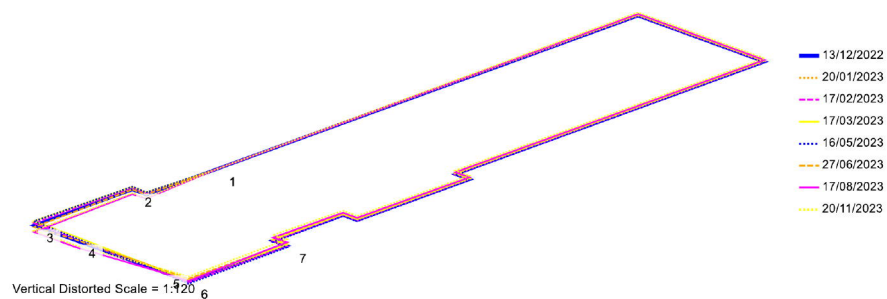

FRONT

Site Visit Notes

TBM on station 1 as requested. No suitable TBM2. If this is not suitable, please advise if a deep datum is required. Relative