

Monitoring Details:

Crack and Level Monitoring

Provider Name: CET

Monitoring Interval: Every 8 weeks

Instruction Date: 08/12/2022

Number of Visits: 9

Reading Date:

Visits Completed: 7

Date of Issue: 02/02/2024

Visits Outstanding: 2

Client Details:

Client: Sedgwick

Engineer / Handler: Luke Exall


Monitored Address:

Occupier:

Address: 69 Canfield Gardens, LONDON, NW6 3EA

Front Elevation



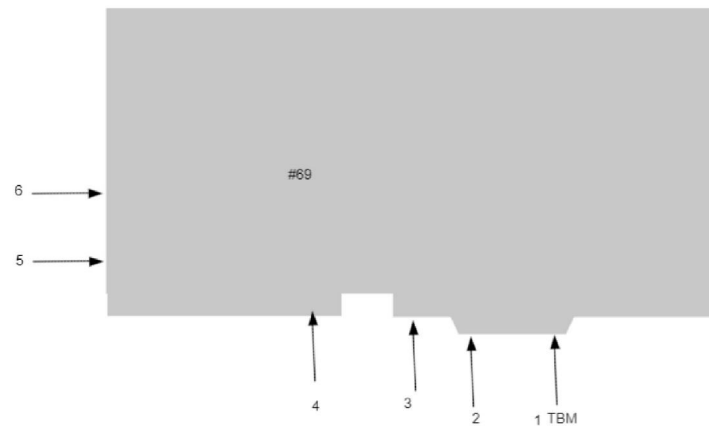

○ - Area of damage

FRONT


Level Readings

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	04/01/23	24/02/23	21/04/23	12/06/23	07/08/23	06/10/23	06/12/23	02/02/24
TBM1	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000
2	10.0094	10.0090	10.0090	10.0094	10.0089	10.0087	10.0091	10.0092
3	10.0924	10.0925	10.0927	10.0924	10.0918	10.0911	10.0918	10.0919
4	10.1127	10.1134	10.1141	10.1141	10.1109	10.1091	10.1102	10.1122
5	9.8922	9.8923	9.8929	9.8933	9.8914	9.8902	9.8901	9.8916
6	10.1724	10.1718	10.1722	10.1724	10.1718	10.1710	10.1714	10.1718
Taken by	JY	JY	JY	NM	BA	BA	BA	BA
Serial number	524015	524015	524015	524764	522887	522887	522887	522955

Level Movement (Displayed in Millimeters)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	04/01/23	24/02/23	21/04/23	12/06/23	07/08/23	06/10/23	06/12/23	02/02/24
TBM1	0	0	0	0	0	0	0	0
2	0	-0.4	-0.4	0	-0.5	-0.7	-0.3	-0.2
3	+0.2	+0.3	+0.5	+0.2	-0.4	-1.1	-0.4	-0.3
4	+0.8	+1.5	+2.2	+2.2	-1	-2.8	-1.7	+0.3
5	+0.1	+0.2	+0.8	+1.2	-0.7	-1.9	-2	-0.5
6	+0.2	-0.4	0	+0.2	-0.4	-1.2	-0.8	-0.4

Level Readings Chart (Points TBM 1 - 6)

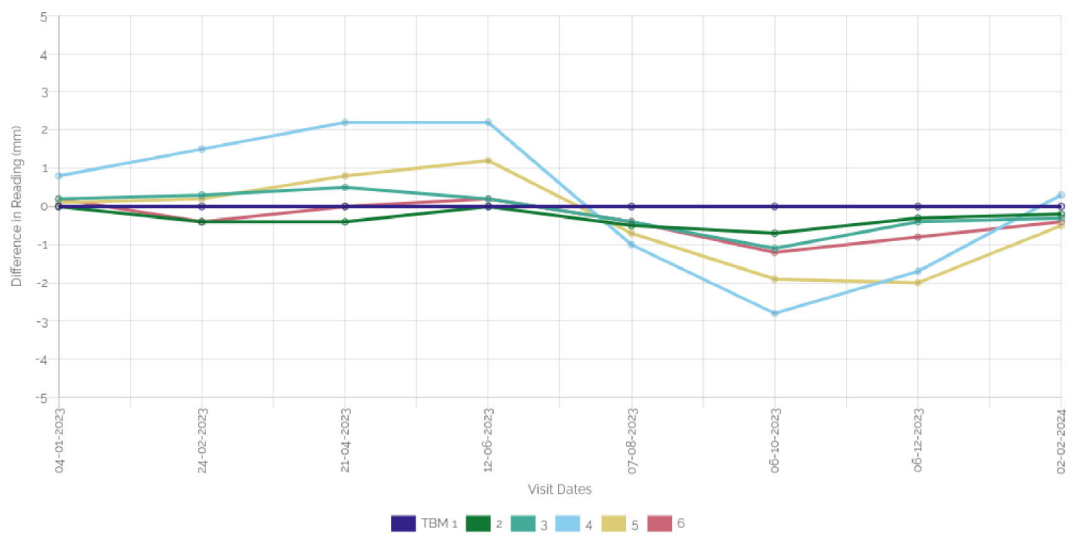


Crack Monitoring

Ext lhs below 1st window


	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	04/01/23	24/02/23	21/04/23	12/06/23	07/08/23	06/10/23	06/12/23	02/02/24
H	101.85	101.93	101.97	101.89	102.03	102.01	102.32	102.12
D	140.69	140.75	140.68	140.73	140.87	140.98	140.99	140.87
C	103.29	103.31	103.33	103.4	102.99	103.12	103.27	103.24
Taken by	JY	JY	JY	N.M	BA	BA	BA	BA
Callipers	2032	2032	6878	850	9083	9083	9083	9083

Ext lhs below 1st window - Crack Readings Differences (Displayed in Millimetres)


	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	04/01/23	24/02/23	21/04/23	12/06/23	07/08/23	06/10/23	06/12/23	02/02/24
H	0	0.08	0.12	0.04	0.18	0.16	0.47	0.27
D	-0.09	-0.03	-0.1	-0.05	0.09	0.2	0.21	0.09
C	0.08	0.1	0.12	0.19	-0.22	-0.09	0.06	0.03

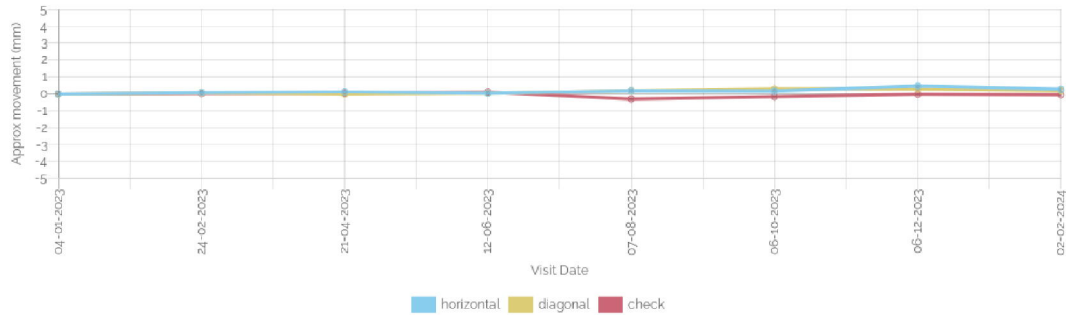

Ext lhs below 1st window - Visit #1

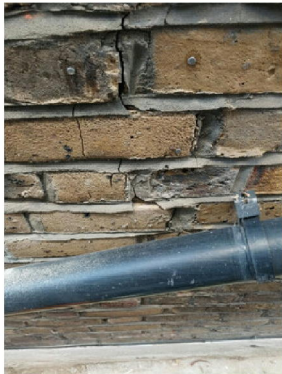

Ext lhs below 1st window - Visit #6

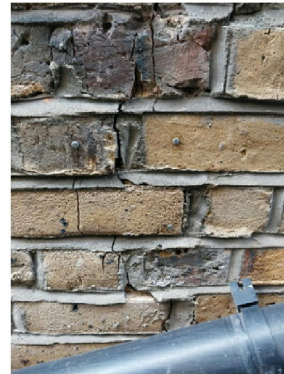


Crack Monitoring

Ext lhs above 1st window


	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	04/01/23	24/02/23	21/04/23	12/06/23	07/08/23	06/10/23	06/12/23	02/02/24
H	69.42	69.66	69.72	69.92	69.79	70.14	70.23	69.85
Taken by	JY	JY	JY	N.M	BA	BA	BA	BA
Callipers	2032	2032	6878	850	9083	9083	9083	9083

Ext lhs above 1st window - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	04/01/23	24/02/23	21/04/23	12/06/23	07/08/23	06/10/23	06/12/23	02/02/24
H	-0.02	0.22	0.28	0.48	0.35	0.7	0.79	0.41

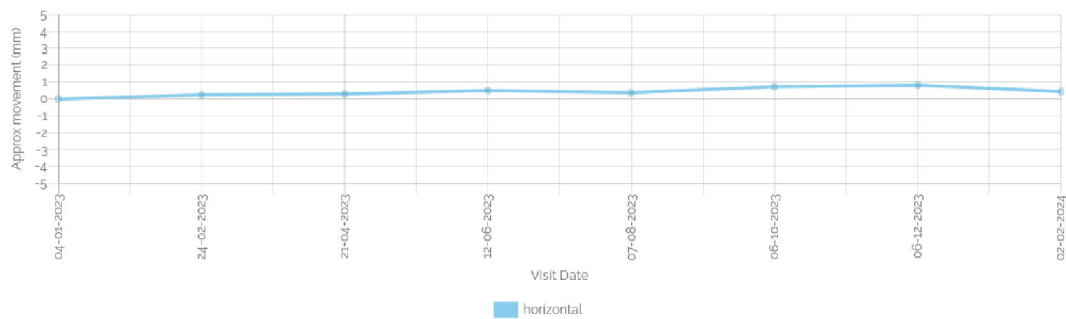

Ext lhs above 1st window - Visit #1

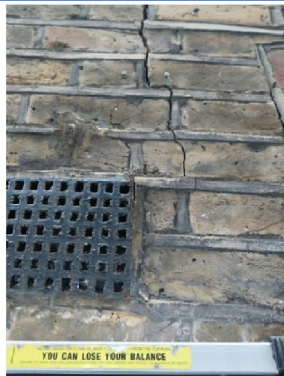

Ext lhs above 1st window - Visit #6

