

Noise and Dust Monitoring Report

Project Ref.: 20543

Period: 01 December 2023 to 31 December 2023

Site Address:

100 Grey's Inn Road, London

For:

Erith Contractors Ltd

Erith House,

Queen Street

Erith

DA8 1RP



Contents

Introduction:	3
Monitoring Locations:	
Equipment:	
Thresholds and Alerts:	
Monitoring Results:	
Noise Survey	
Dust Survey	
Dust our ver	

Date	Document No./Revision version	Comments
10 January 2024	20239.SummaryReport202312	Noise/vibration/dust data – report generated



Introduction:

Environmental Sensors Ltd. has been appointed by Erith Contractors Ltd. to undertake noise/dust monitoring at the 100 Grey's Inn Road, London.

This monitoring report presents data for the period from 01 December 2023 to 31 December 2023 and it is marked as 20543. Summary Report 202312.

Monitoring Locations:

Noise and dust monitors have been installed on site as per site-plan attached below.



Figure Indicative Sipe Plan (ref. Google Maps)

The locations have been marked as:

L1: Site Courtyard L2: Clerkenwell Rd

L3: Grey's Inn Rd

Equipment:

The following equipment has been used during the survey:

- 3No. Convergence Instruments Class 1 noise data loggers
- 1No. PM10 monitors



In Location 1 there have been installed noise and dust monitoring station, while in Location 2 and Location 3 a noise monitoring station only.

The equipment had been calibrated prior to on-site installation.

Thresholds and Alerts:

Noise and dust alerts trigger levels have been agreed and presented below.

Noise Trigger Levels:

Location 1

	Receiver of Alert	Trigger level and integration period				
RED	Steven.Gillam@erith.com	78dB L _{Aeq 1} hour	75dB LAeq 10 hours (Monday – Friday)			
	steven.dillam@entin.com	75dB LAeq 1 hour	72dB LAeq 5 hours (Saturday)			

Location 2 & Location 3

	Receiver of Alert	Trigger level and i	ntegration period
RED	Steven.Gillam@erith.com	83dB L _{Aeq 1 hour}	82dB L _{Aeq 10} hours (Monday – Friday)
KED	Steven.dinam@entil.com	78dB LAeq 1 hour	75dB LAeq 5 hours (Saturday)

Dust Trigger Levels (PM10):


	Receiver of Alert	Trigger level and integration period
RED	Steven.Gillam@erith.com	190 ug/m3 1hour


Monitoring Results:

Noise Survey


Noise monitoring results for the period between 01 December 2023 and 31 December 2023 have been present in Figures: 20543. Summary Report 202312. YYYYMM_NTHx where YYYYMM represents year and month of the monitoring period while 'x' — monitoring location. Monitoring results have been also compared against agreed criteria of maximum daily allowed level of $L_{Aeq\ 10h\ 08:00\ -\ 18:00}$ Monday — Friday and $L_{Aeq\ 5h\ 09:00\ -\ 14:00}$ on Saturday. These values have been presented in graphical version below.



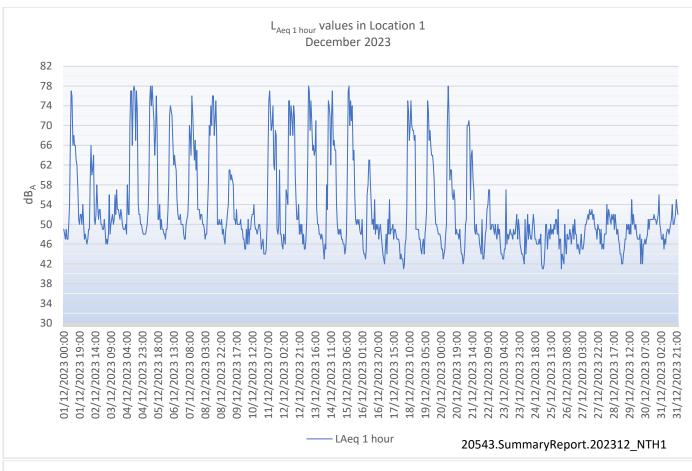

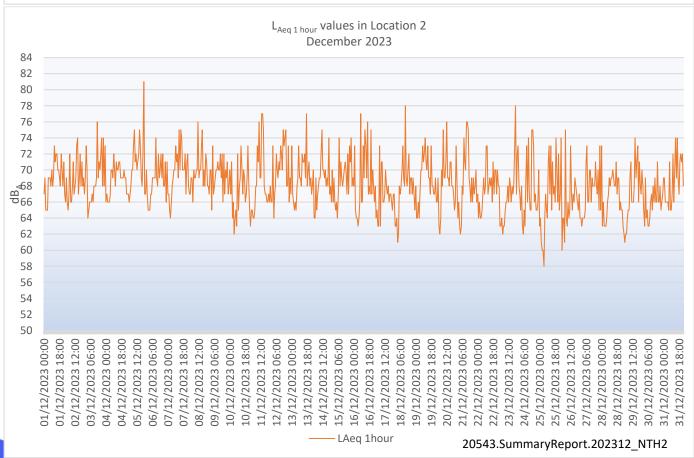



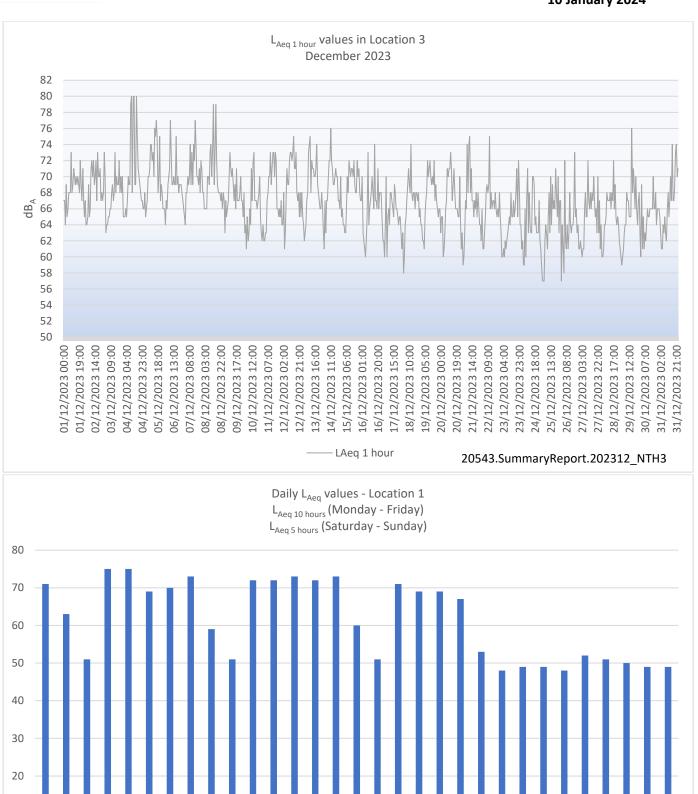

02/12/2023 03/12/2023 04/12/2023

01/12/2023

05/12/2023

06/12/2023 07/12/2023 08/12/2023 09/12/2023 11/12/2023

12/12/2023 13/12/2023 14/12/2023 15/12/2023 16/12/2023 17/12/2023 19/12/2023

20/12/2023 21/12/2023

22/12/2023 23/12/2023

10

0

31/12/2023

26/12/2023 27/12/2023 28/12/2023 29/12/2023 30/12/2023

24/12/2023 25/12/2023







It is expected that some attenuation of the construction noise will be provided due to the distance to closest sensitive receptors. The actual value will differ depending on location of noise source and the receiver. As the monitoring stations are located at the site boundary the difference between the level recorded at the monitoring station and the level at the façade of the receiver will also depend on the distance between the source and the monitoring station.

The noise levels from the point source reduce by 6dB by doubling the distance as per equation:

$$Lp_{R2} = Lp_{R1} - 20 \cdot \text{Log}10 \left(\frac{\text{R2}}{\text{R1}}\right)$$

The distance between monitoring station in Location 1 and closest sensitive receiver's façade is at least 10m while the distance between the source and the monitoring station is approx. 10m. The distance in Location 2 and Location 3 is approx. 20 m. from the monitoring station and the receiver.

Table 1 presents the calculated attenuation of sound due to the distance between microphone (monitoring location) and receiver with consideration of the distance separating the sound source and the monitoring location.

Distance	Distance in meters between monitoring location and receiver													
source to	5	6	7	8	9	10	12	14	16	18	20	25	30	35
microphone	Attenuation of sound due to distance													
5m	6	6.8	7.6	8.3	8.9	9.5	10.6	11.6	12.5	13.3	14	15.6	16.9	18.1
10m	3.5	4.1	4.6	5.1	5.6	6	6.8	7.6	8.3	8.9	9.5	10.9	12	13.1
15m	2.5	2.9	3.3	3.7	4.1	4.4	5.1	5.7	6.3	6.8	7.4	8.5	9.5	10.5
20m	1.9	2.3	2.6	2.9	3.2	3.5	4.1	4.6	5.1	5.6	6	7	8	8.8
25m	1.6	1.9	2.1	2.4	2.7	2.9	3.4	3.9	4.3	4.7	5.1	6	6.8	7.6
30m	1.3	1.6	1.8	2.1	2.3	2.5	2.9	3.3	3.7	4.1	4.4	5.3	6	6.7
35m	1.2	1.4	1.6	1.8	2	2.2	2.6	2.9	3.3	3.6	3.9	4.7	5.4	6

Table 1 The relation of sound reduction to distance of the source and receiver towards monitoring position

The highlighted columns represent the specific site worst case scenario where receivers are around 10m and 20m away from the site.

Dust Survey


Dust monitoring summary results for the period between 01 December 2023 and 31 December 2023 have been presented in Figures:


- 20543.SummaryReport202312.D_YYYYMM_hourly with summary 1 hour averages, where MMM represents the year and MM month of the reporting data.
- 20543.SummaryReport202312.D1 Daily with summary 1 hour averages.

PM10 values were compared against the action threshold level of 190 ug/m³ 1hour average.

Additional criterion of 150 ug/m³ 15-minut average was set as a preventive pre-action trigger. No specific action is required to be undertaken on 15 min exceedances. This level has also been provided for easier comparison with other data sources.



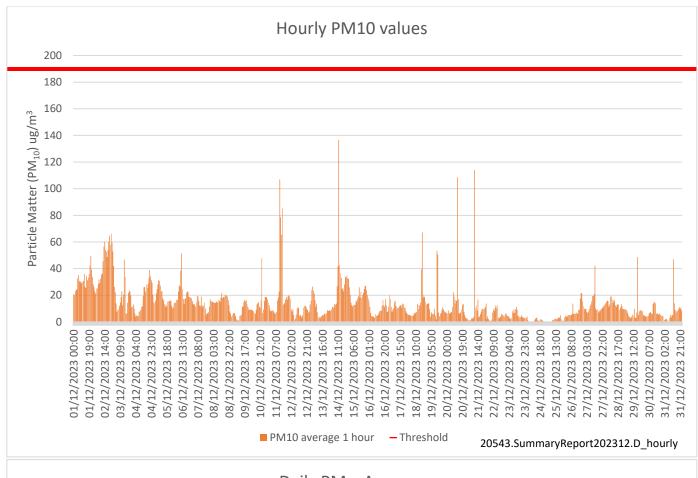

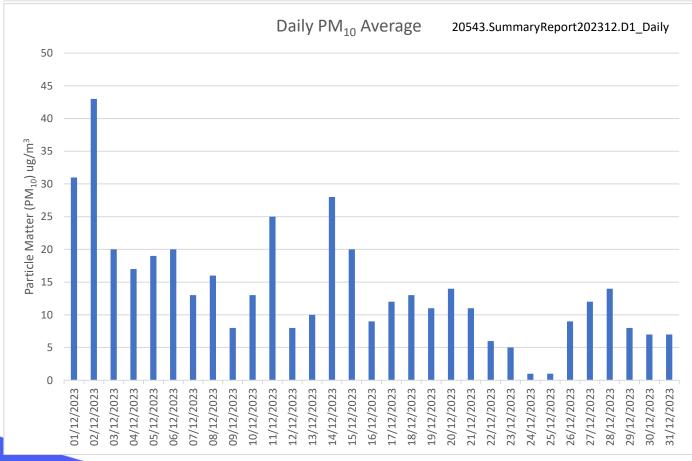



A summary of PM10 values has been present in the table below.

Date	Мах (µg/m³)	Min (µg/m³)	Average (µg/m³)	Number of Exceedance ≥ 150 µg/m³ – 15 min (Pre - Trigger Level)	Number of Exceedance ≥ 190 µg/m³ – 1 hour (Action Level)	Data Capture
01/12/2023	50	19	31	0	0	100 %
02/12/2023	73	20	43	0	0	100 %
03/12/2023	102	5	20	0	0	100 %
04/12/2023	41	4	17	0	0	100 %
05/12/2023	32	10	19	0	0	100 %
06/12/2023	69	9	20	0	0	100 %
07/12/2023	23	5	13	0	0	100 %
08/12/2023	31	6	16	0	0	100 %
09/12/2023	17	0	8	0	0	100 %
10/12/2023	110	4	13	0	0	100 %
11/12/2023	156	6	25	3	0	100 %
12/12/2023	20	1	8	0	0	100 %
13/12/2023	28	2	10	0	0	100 %
14/12/2023	190	7	28	1	0	100 %
15/12/2023	42	10	20	0	0	100 %
16/12/2023	20	3	9	0	0	100 %
17/12/2023	22	6	12	0	0	100 %
18/12/2023	130	4	13	0	0	100 %
19/12/2023	87	1	11	0	0	100 %
20/12/2023	179	3	14	2	0	100 %
21/12/2023	192	1	11	2	0	100 %
22/12/2023	23	0	6	0	0	100 %
23/12/2023	19	2	5	0	0	100 %
24/12/2023	5	0	1	0	0	100 %
25/12/2023	6	0	1	0	0	100 %
26/12/2023	30	2	9	0	0	100 %
27/12/2023	60	6	12	0	0	100 %
28/12/2023	20	8	14	0	0	100 %
29/12/2023	95	2	8	0	0	100 %
30/12/2023	27	4	7	0	0	100 %
31/12/2023	83	0	7	0	0	100 %





List of alerts and actions undertaken.

Noise Red Trigger

No exceedances recorded.

Dust Action Level

No exceedances recorded.