

All aspects of this plan to be strictly adhered to

No Tree to be removed

All trees to be retained and protected

Replacement tree for TPO tree removed as shown

Protective hoarding to be installed prior to main construction phases and to be maintained in place throughout

Hoarding to protect T's 1 & 2

Site hoarding & existing boundary walls to act as protection for trees within adjacent properties

Minimal crown lifting of T1

Site office away from RPA's

Mini piles & floating beam footings to minimise root impact

Storage of chemicals is prohibited near or around the base of trees

Storage of building materials and machinery prohibited on RPA's unless on existing hard-standing

Temporary boarding to be used as ground protection within the RPA's to minimise use of fencing

Washing out of tools and equipment should be done well away from retained trees

All retained trees should be regularly monitored to assess health and potential issues

Arboriculturalist to visit site at regular intervals to check protection measures


Hoarding Specification



Signage



Common causes of Tree Death

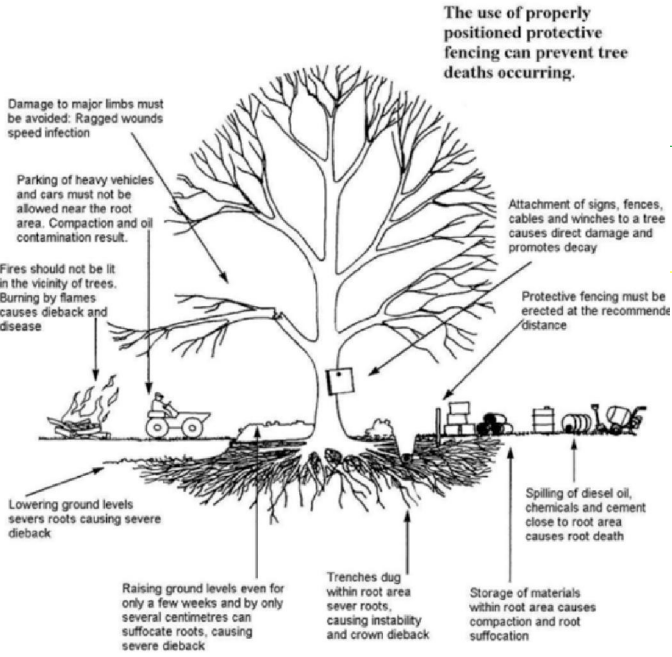

Temporary Ground Protection



Piled Footings to form 'No Dig' Solution

Temporary Ground Protection

1x Ulmus Lutece planted within 1m circumference of demolished tree

Site office/Material Storage

Gondar Gardens

Lounge

Kitchen

WC

Total Area - 37.09m²

Ground Floor Plan

Demolished Ash tree shown in dashed

Contractors Access

Protective Hoarding

T1 Silver Birch

T2 Lime

Material Storage

Tree Protection Plan showing surveyed trees & protection measures

Tree to be Retained

Category A



Trees of high quality with an estimated remaining life expectancy of at least 40 years.

Category B



Trees of moderate quality with an estimated remaining expectancy of at least 20 years.

Category C



Trees of low quality with an estimated remaining life expectancy of at least 10 years, or a stem diameter below 150mm.

Tree to be Removed

Category U



Trees in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years.



Protective Fencing/Hoarding



Contractors Access/Office/Material Storage



No.	Revision/Issue	Date
1		
2		



info@central-londontreesurveys.com
Tel: 0800 6891746

Project Name and Address
**12 SARRE ROAD,
LONDON, NW2 3SL**

Project No 20052	Sheet 1 of 1
Date 2024-07-13 19:55:18	
Scale 1 to 150 at A3	