


LEVEL MONITORING - RELATIVE SURVEY READINGS

Provider Details		Client Details		Risk Address	
Name:	MHN Ltd	Insurance Co.:	Alianz	Occupier:	180 Camden Road Ltd
		Client Name:	Crawford & Co	Address:	180 Camden Road
		Contact:	A Wyse	Address:	London
Date of Issue:	3/8/23	Email:		Town:	
		Client Ref:	SU1904991	County:	
Monitoring Details		Address:	Cartwright House	Post Code:	NW1 9HG
Instruction Date:	5/5/20	Address:	Tottle Road	Tel Home:	
First Reading Date:	02/06/2020	Town:	Riverside Business Park	Tel Work:	
Maximum No Visits:	2	County:	Nottingham	Mobile:	
Anticipated Expiry Date:	Sep 2023	Post Code:	NG2 1RT	Other:	
Monitoring Int:	2 Monthly	Other Email:		Other:	

Target Date:		Reading Date:		Issue Date:											
		25/7/22		19/10/22		2/6/23		2/8/23							
		27/7/22		26/10/22		5/6/23		3/8/23							
Row No.	Point Name	X Co-ordinate	Y Co-ordinate	1	2	3	4	5	6	7	8	9	10	11	12
1		0.00	0.00												
2		0.50	0.00												
3		0.50	-0.50												
4	1	1.00	-1.00	9.0426	9.0416	9.0441	9.0430								
5	2	2.50	-1.00	9.0161	9.0142	9.0192	9.0174								
6		3.00	-0.50												
7		3.00	0.00												
8	3	3.50	0.00	8.8449	8.8411	8.8513	8.8494								
9		3.50	0.15												
10		4.50	0.15												
11	4	4.50	0.00	8.9211	8.9165	8.9304	8.9268								
12	5	4.50	-1.85	10.1875	10.1808	10.1967	10.1917								
13		6.00	-1.85												
14	6	6.00	6.00	10.0084	10.0003	10.0216	10.0204								
15	7	3.00	6.00	8.8527	8.8430	8.8627	8.8630								
16	8	0.50	6.00	8.8610	8.8559	8.8772	8.8772								
17		0.00	6.00												
18															
19															
20															
21															
22															
23															
24															
25															
26															
27															
28															
29															
30															
31															
32															

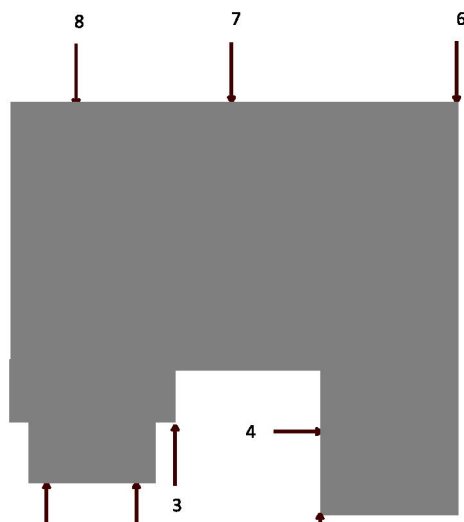

- 03/08/2023
First visit since Oct 22. Trees have since been removed and points have been double checked to confirm movement.
- It was not possible to install all stations within a common brickcourse. Therefore initial readings cannot be interpreted as Distortion Data.
- Rear readings have been made relative to the deep datum. No secondary TBM available.

1

2

5


FRONT

- Further readings to be taken in Oct 23

LEVEL MONITORING - RELATIVE MOVEMENT SKETCH

Client: Crawford & Co




Client Ref: SU1904991

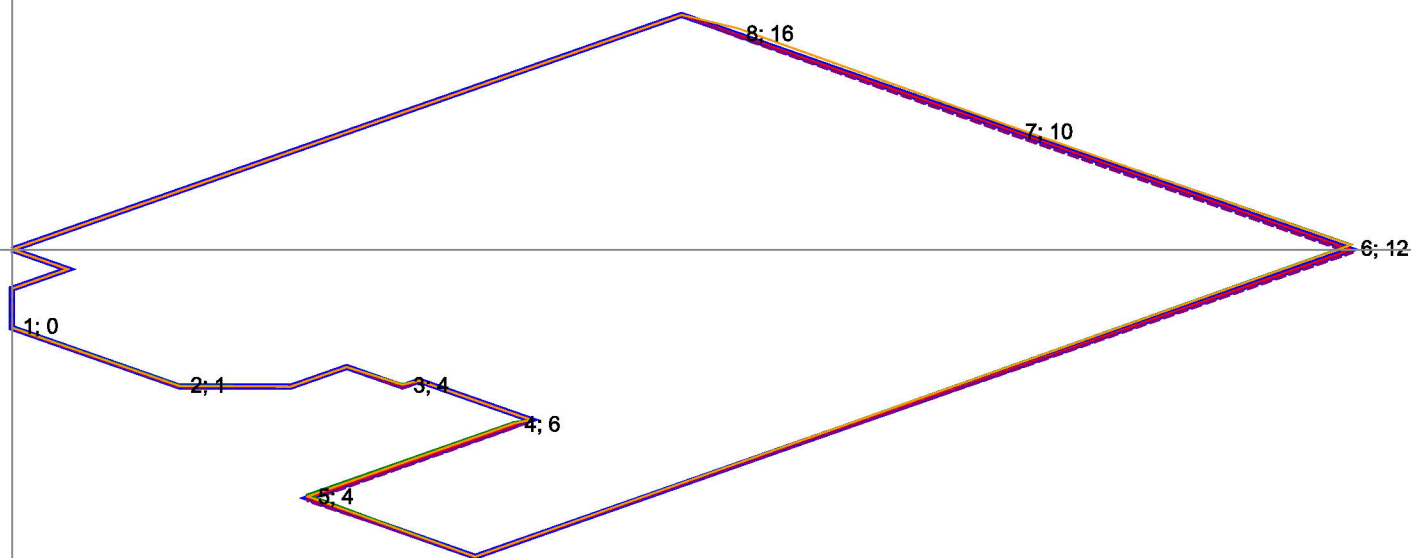

Datum Reading	Reading 1 (25/7/22)	Reading 2 (19/10/22)	Reading 3 (2/6/23)	Reading 4 (2/8/23)	Reading 5 (0/1/00)	Reading 6 (0/1/00)
Reading 7 (0/1/00)	Reading 8 (0/1/00)	Reading 9 (0/1/00)	Reading 10 (0/1/00)	Reading 11 (0/1/00)	Reading 12 (0/1/00)	

Notes:
Vertical distorted scale 1: 5

Point labels give level difference of last reading from original datum in mm.

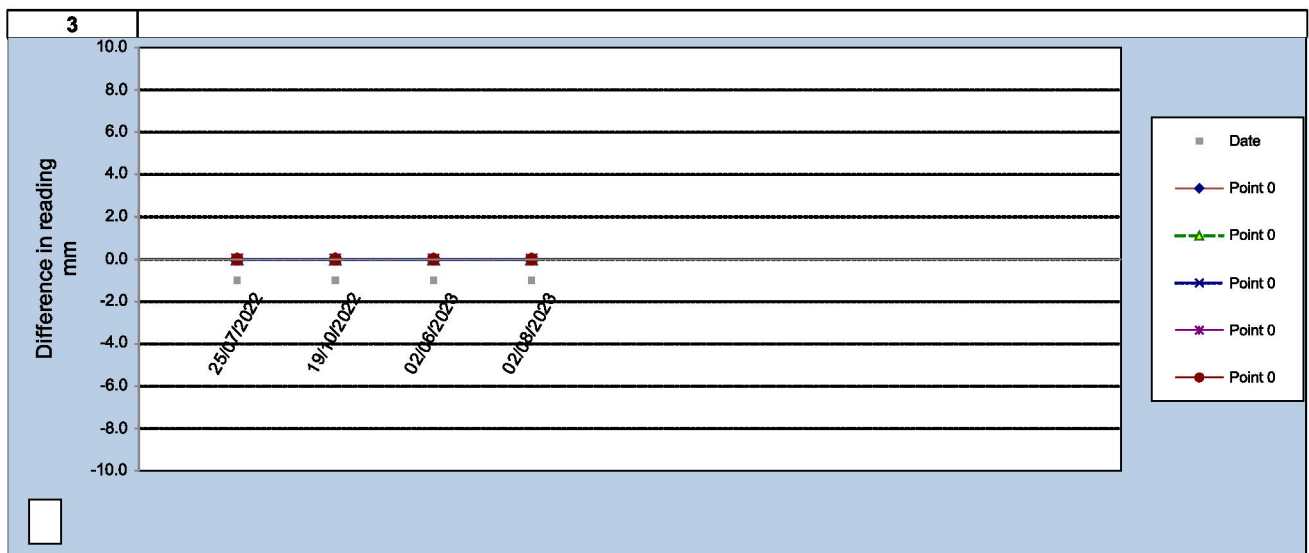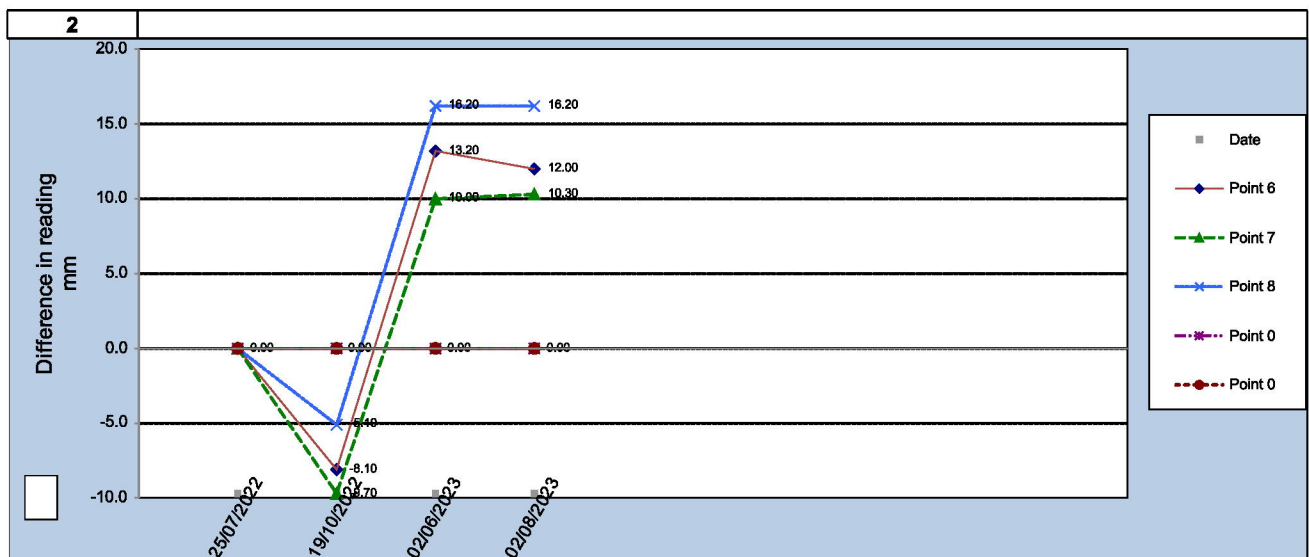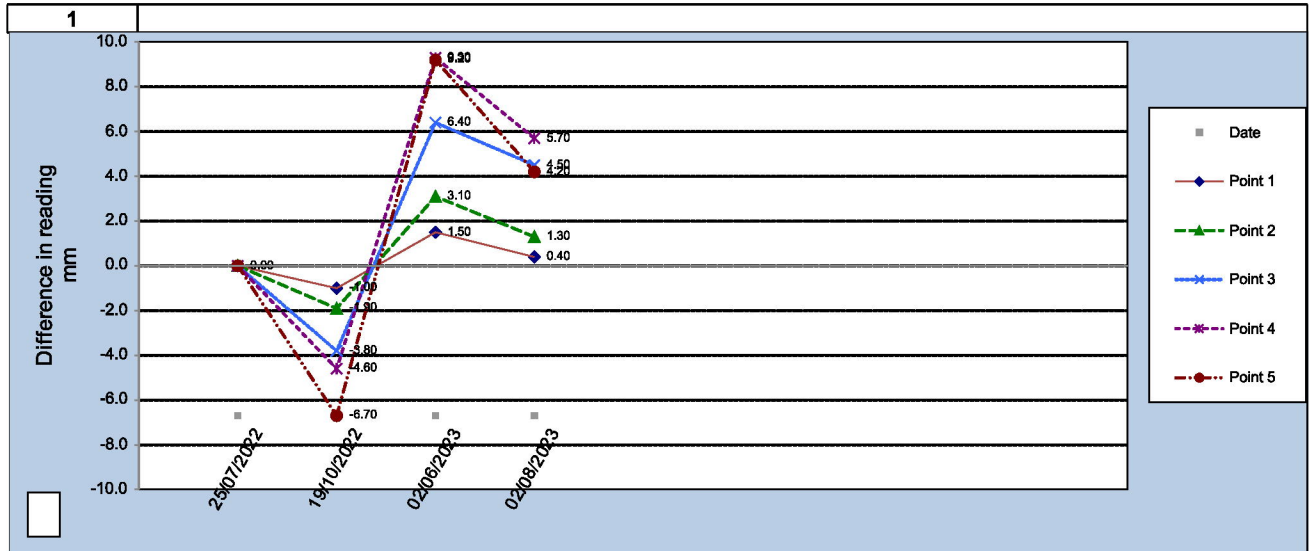

Standard Comments for selection in Readings and Sketch Worksheets
User may edit these as appropriate

Standard Comments	
No Comment	
Standard Comment 1	The Occupier expressed concerns
Standard Comment 2	The Occupier expressed no new concerns
Standard Comment 3	Standard Comment 3
Standard Comment 4	Standard Comment 4
Standard Comment 5	

Standard Bullet
●