


LEVEL MONITORING - RELATIVE SURVEY READINGS

Provider Details		Client Details		Risk Address	
Name:	MHN Ltd	Insurance Co.:	Alianz	Occupier:	180 Camden Road Ltd
		Client Name:	Crawford & Co	Address:	180 Camden Road
Date of Issue:	18/12/23	Contact:	A Wyse	Address:	London
		Email:	monitoring@crawco.co.uk	Town:	
		Client Ref:	SU1904991	County:	
		Address:	Cartwright House	Post Code:	NW1 9HG
		Address:	Tottle Road	Tel Home:	
		Town:	Riverside Business Park	Tel Work:	
		County:	Nottingham	Mobile:	
		Post Code:	NG2 1RT	Other:	
		Other Email:		Other:	

Target Date:		Reading Date:		Issue Date:											
		25/7/22		19/10/22		2/6/23		2/8/23		15/12/23					
		27/7/22		26/10/22		5/6/23		3/8/23		18/12/23					
Row No.	Point Name	X Co-ordinate	Y Co-ordinate	1	2	3	4	5	6	7	8	9	10	11	12
1		0.00	0.00												
2		0.50	0.00												
3		0.50	-0.50												
4	1	1.00	-1.00	9.0426	9.0416	9.0441	9.0430	9.0425							
5	2	2.50	-1.00	9.0161	9.0142	9.0192	9.0174	9.0174							
6		3.00	-0.50												
7		3.00	0.00												
8	3	3.50	0.00	8.8449	8.8411	8.8513	8.8494	8.8494							
9		3.50	0.15												
10		4.50	0.15												
11	4	4.50	0.00	8.9211	8.9165	8.9304	8.9268	8.9269							
12	5	4.50	-1.85	10.1875	10.1808	10.1967	10.1917	10.1926							
13		6.00	-1.85												
14	6	6.00	6.00	10.0084	10.0003	10.0216	10.0204	10.0231							
15	7	3.00	6.00	8.8527	8.8430	8.8627	8.8630	8.8653							
16	8	0.50	6.00	8.8610	8.8559	8.8772	8.8772	8.8798							
17		0.00	6.00												
18															
19															
20															
21															
22															
23															
24															
25															
26															
27															
28															
29															
30															
31															
32															

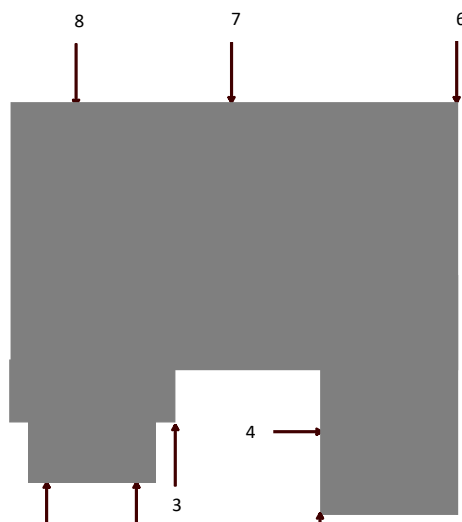

- 18/12/2023
- It was not possible to install all stations within a common brickcourse. Therefore initial readings cannot be interpreted as Distortion Data.
- Rear readings have been made relative to the deep datum. No secondary TBM available.

|
1

|
2

|
5


FRONT

- No further reads to be taken

LEVEL MONITORING - RELATIVE MOVEMENT SKETCH

Client: Crawford & Co




Client Ref: SU1904991

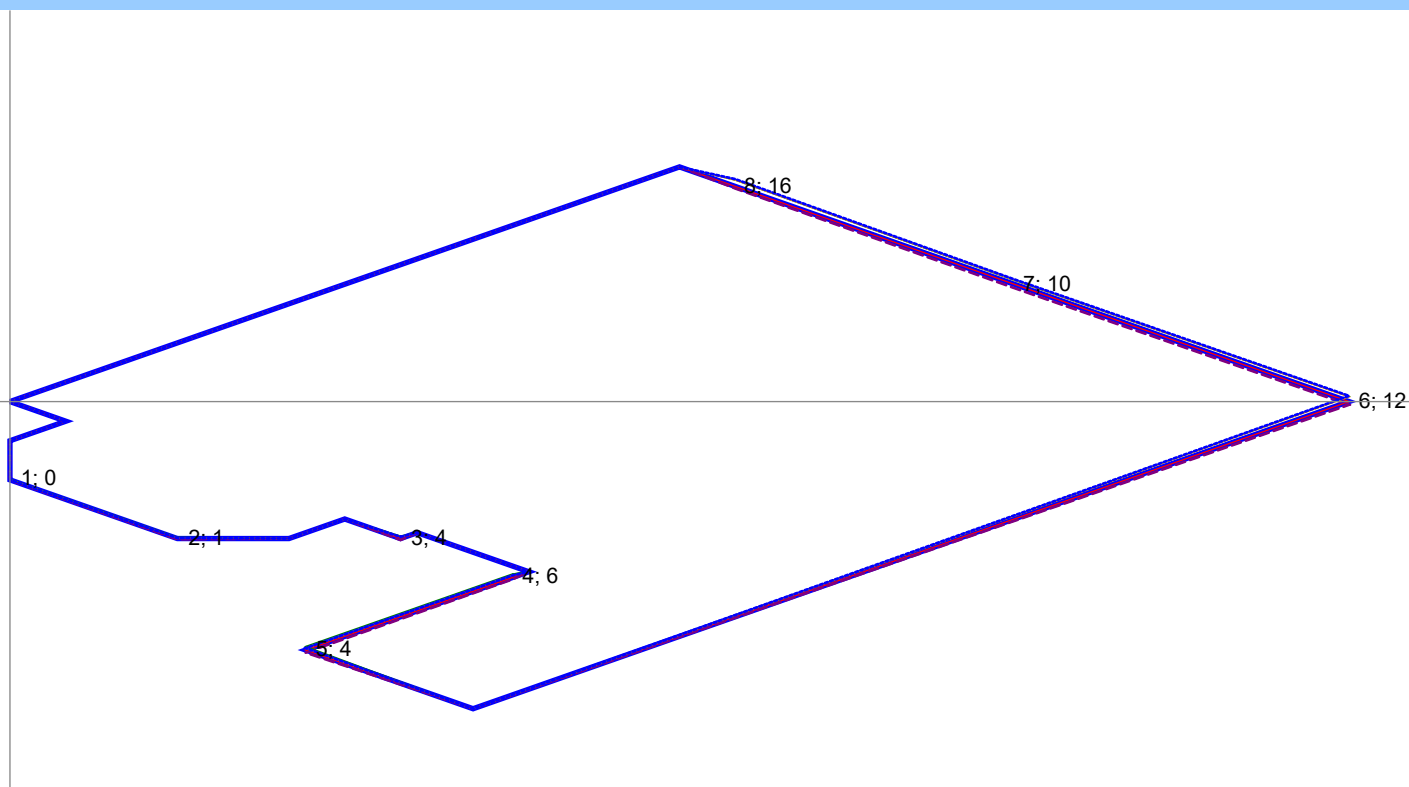

— Datum Reading	— Reading 1 (25/7/22)	- - - Reading 2 (19/10/22)	— Reading 3 (2/6/23)	— Reading 4 (2/8/23)	- - - Reading 5 (15/12/23)	- - - Reading 6 (0/1/00)
- - - Reading 7 (0/1/00)	- - - Reading 8 (0/1/00)	- - - Reading 9 (0/1/00)	- - - Reading 10 (0/1/00)	- - - Reading 11 (0/1/00)	- - - Reading 12 (0/1/00)	

Notes:
Vertical distorted scale 1: 5

Point labels give level difference of last reading from original datum in mm.

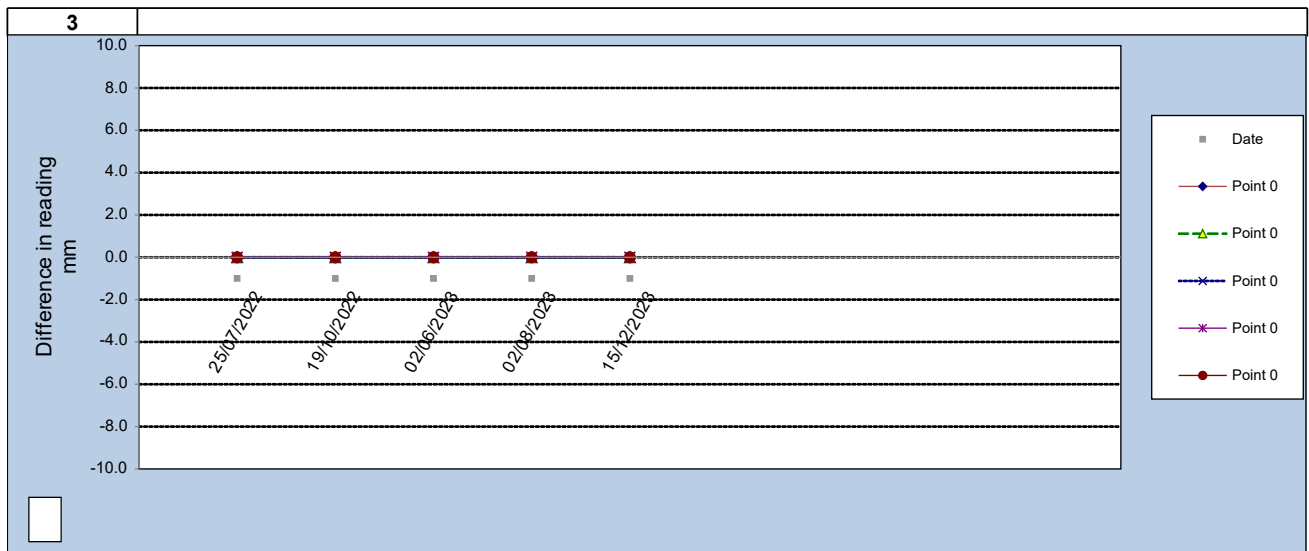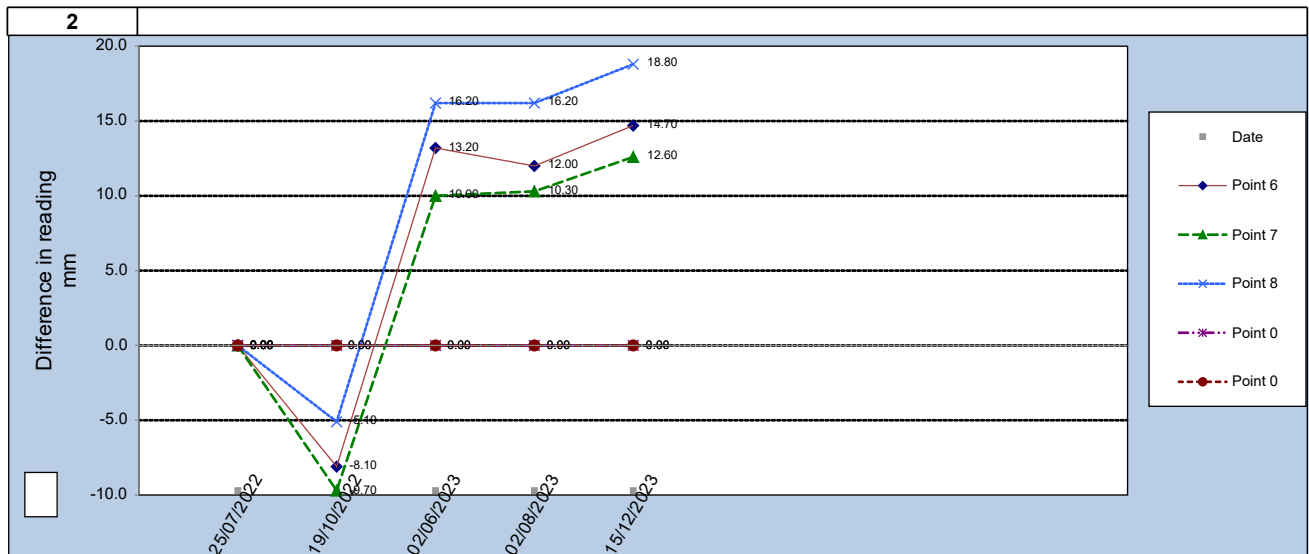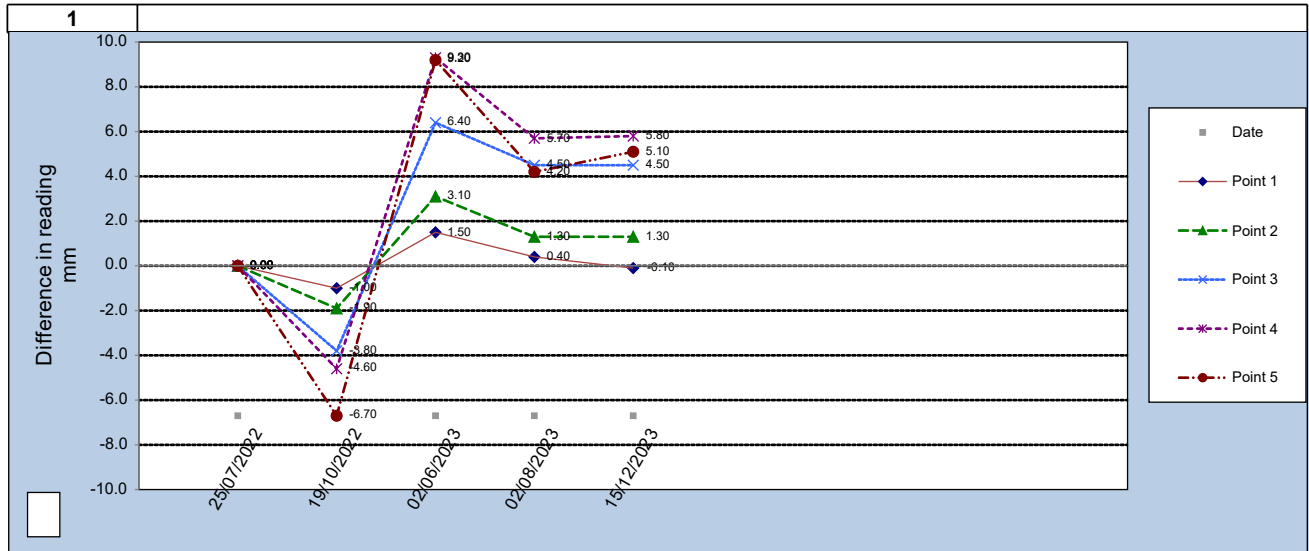

Standard Comments for selection in Readings and Sketch Worksheets
User may edit these as appropriate

Standard Comments	
No Comment	
Standard Comment 1	The Occupier expressed concerns
Standard Comment 2	The Occupier expressed no new concerns
Standard Comment 3	Standard Comment 3
Standard Comment 4	Standard Comment 4
Standard Comment 5	

Standard Bullet
●