




Appendix 1

No. 19 St Paul's Crescent

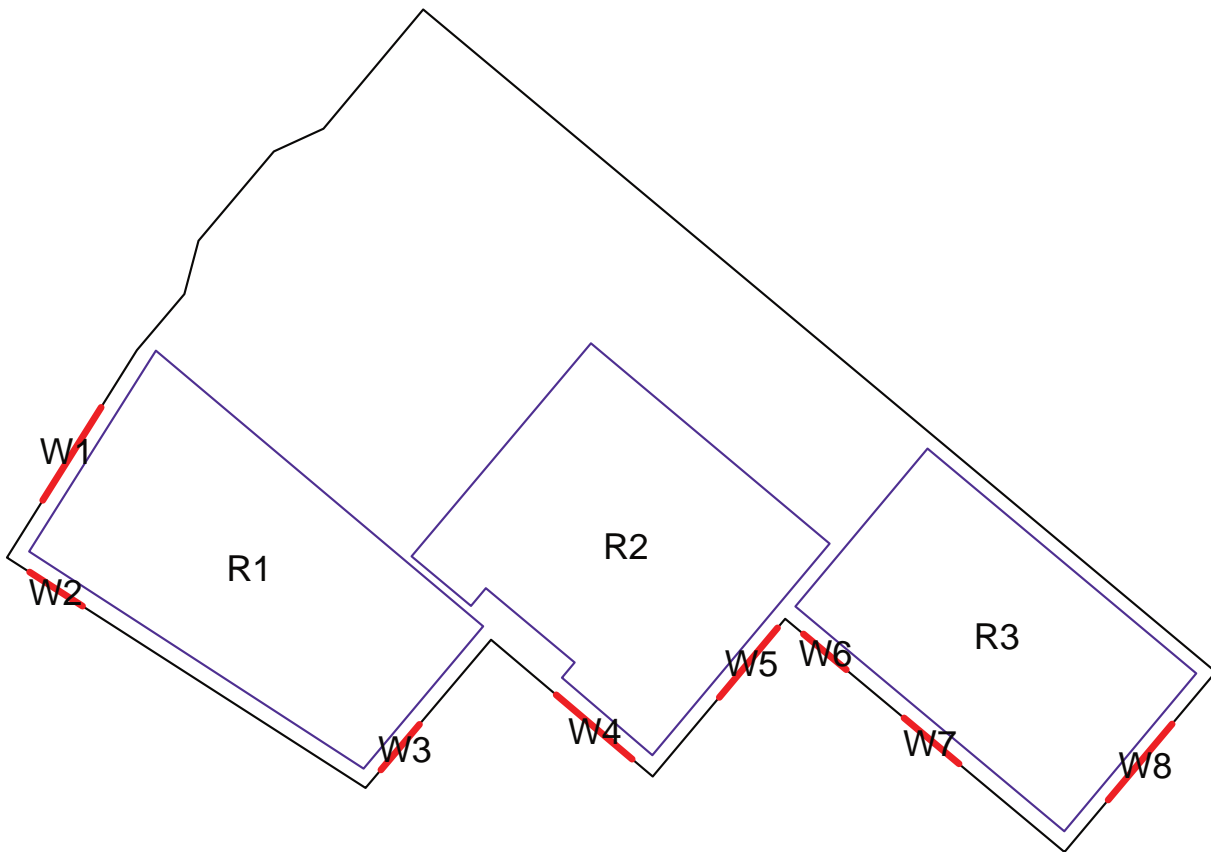

No.19 St Paul's Crescent, Ground Floor



Appendix 2

VSC Results

Floor Ref.	Room Ref.	Room Use.	Window Ref.	Scenario	VSC	Difference	Above / Below
------------	-----------	-----------	-------------	----------	-----	------------	---------------

19 St Paul's Crescent

Ground	R1	Living room	W1	Existing	29.91	1.00	Above
				Proposed	29.91		
Ground	R1	Living room	W2	Existing	30.58	0.89	Above
				Proposed	27.14		
Ground	R1	Living room	W3	Existing	20.57	0.48	Below
				Proposed	9.85		
Ground	R2	Living room	W4	Existing	25.46	0.48	Below
				Proposed	12.28		
Ground	R2	Living room	W5	Existing	16.51	0.84	Above
				Proposed	13.95		
Ground	R3	Kitchen	W6	Existing	17.25	0.51	Below
				Proposed	8.88		
Ground	R3	Kitchen	W7	Existing	24.49	0.59	Below
				Proposed	14.45		
Ground	R3	Kitchen	W8	Existing	28.19	0.99	Above
				Proposed	27.87		

VSC Results

Appendix 3

Daylight Distribution Results

Floor Ref.	Room Ref.	Room Use.	Room Area	Lit Area Existing	Lit Area Proposed	Difference %	Above / Below
------------	-----------	-----------	-----------	-------------------	-------------------	--------------	---------------

19 St Paul's Crescent

Ground	R1	Living room	Area m2 % of room	13.80	13.08 0.95	11.75 0.85	0.90	Above
Ground	R2	Living room	Area m2 % of room	13.26	13.10 0.99	13.10 0.99	1.00	Above
Ground	R3	Kitchen	Area m2 % of room	11.42	11.42 1.00	10.98 0.96	0.96	Above

Daylight Distribution Results

Appendix 4

ADF Results

Floor Ref.	Room Ref.	Room Use.	Window Ref.	Glass Transmittance	Glazed Area	Clear Sky Angle Existing	Clear Sky Angle Proposed	Room Surface Area	Average Surface Reflectance	Below Working Plane Factor	ADF Existing	ADF Proposed	Req'd Value	% Diff	Above/Below
------------	-----------	-----------	-------------	---------------------	-------------	--------------------------	--------------------------	-------------------	-----------------------------	----------------------------	--------------	--------------	-------------	--------	-------------

19 St Paul's Crescent

Ground	R1	Living room	W1	0.68	1.41	66.22	66.22	66.93	0.70	1.00	1.86	1.86	1.50	0.93	Above
			W2	0.68	0.81	66.06	60.91	66.93	0.70	1.00	1.07	0.98			
			W3	0.68	0.41	47.42	30.43	66.93	0.70	1.00	0.39	0.25			
Ground	R2	Living room	W4-L	0.68	0.69	55.84	35.09	72.64	0.70	0.30	0.21	0.13	1.50	0.77	Above
			W4-U	0.68	1.41	61.34	39.70	72.64	0.70	1.00	1.59	1.03			
			W5	0.68	1.74	45.40	41.65	72.64	0.70	1.00	1.45	1.33			
Ground	R3	Kitchen	W6	0.68	0.67	45.42	30.37	55.04	0.70	1.00	0.74	0.49	2.00	0.85	Above
			W7	0.68	0.86	57.24	40.81	55.04	0.70	1.00	1.19	0.85			
			W8	0.68	1.30	63.30	63.02	55.04	0.70	1.00	1.99	1.98			
											3.92	3.33			

ADF Results

Appendix 5

Sunlight Results

Floor Ref.	Room Ref.	Room Use.	Window Ref.	Scenario	Available Sunlight Hours					
					Annual %	Diff %	Above / Below	Winter %	Diff %	Above / Below

19 St Paul's Crescent

Ground	R1	Living room	W1	Existing Proposed	*North Facing					
Ground	R1	Living room	W2	Existing Proposed	63 52	0.83	Above	16 11	0.69	Above
Ground	R1	Living room	W3	Existing Proposed	52 15	0.29	Below	12 0	0.00	Below
Ground	R2	Living room	W4	Existing Proposed	53 21	0.40	Below	14 3	0.21	Below
Ground	R2	Living room	W5	Existing Proposed	41 28	0.68	Above	11 7	0.64	Above
Ground	R3	Kitchen	W6	Existing Proposed	47 30	0.64	Above	15 7	0.47	Above
Ground	R3	Kitchen	W7	Existing Proposed	55 34	0.62	Above	15 7	0.47	Above
Ground	R3	Kitchen	W8	Existing Proposed	55 53	0.96	Above	9 8	0.89	Above

Sunlight Results