


Your ref B1239944

Our ref UM4100AXA

Geo-Serv Limited
17 Hoveden Road
London NW2 3XE

**Consulting
Civil and
Geotechnical
Engineers**

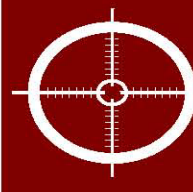

GEO-SERV

monitoring 020 8208 0343 ↩

general enquiries 020 8208 4476

e-mail: mon@geo-serv.com

GAB Robins UK Ltd
Ground Floor□
8 Exchange Quay□
Salford Quay□
Manchester□
M5 3EJ

Issue date: 21/10/2014

following survey No: 4

Monitoring Plus Report

Owners name	Mr Nighy & Ms Quick	Suspected cause	Root-induced shrinkage	Monitoring type	Levels
Address	13 Torriano Avenue□ □ London NW5 2SN	Principal area of damage	To be advised	Installed	31/01/2014
		Damage category	To be advised	No of visits / weeks	tbc @ 7.3
		Surface geology	To be advised	Completion date	tbc
				Status	open
Home phone	07710 510038 - Ms Quick	Feedback from last visit			
Work phone		21/10/14 - Pts 3 & 4 gone due to repairs. Pts 11 & 12 n/a. Support for cill in way.			
Correspondence address		Sketch showing location of monitoring points			
Comment	Max movement 0.0 Focal area 21/10/14 - Initial results show small variations broadly consistent with soil swelling in winter (upwards) and shrinkage in summer (downwards)				
		Front Elevation Drain side of cebra crossing			

Level monitoring results

Survey: By: Date:	1 JW 31/01/2014		2 PD 02/05/2014		3 JW 17/07/2014		4 PD 21/10/2014		5	
Point ID	levels mm	chngs mm	levels mm	chngs mm	levels mm	chngs mm	levels mm	chngs mm	levels mm	chngs mm
Drain	1000.00	0.0	1000.00	0.0	1000.00	0.0	1000.00	0.0	1000.00	0.0
1	2326.76	0.0	2328.63	1.9	2328.14	1.4	2327.01	0.3		
2	2354.90	0.0	2356.53	1.6	2354.51	-0.4	2353.48	-1.4		
3	2374.56	0.0	2379.45	4.9	2371.79	-2.8	gone	#N/A		
4	2488.38	0.0	2490.76	2.4	2486.94	-1.4	gone	#N/A		
5	789.03	0.0	798.25	9.2	793.84	4.8	791.25	2.2		
6	754.30	0.0	753.45	-0.9	750.88	-3.4	748.23	-6.1		
7	835.26	0.0	835.67	0.4	832.93	-2.3	830.19	-5.1		
8	592.57	0.0	593.16	0.6	590.29	-2.3	586.84	-5.7		
9	586.20	0.0	587.35	1.2	583.17	-3.0	580.86	-5.3		
10	586.74	0.0	587.94	1.2	583.68	-3.1	581.55	-5.2		
11	-33.10	0.0	-31.63	1.5	-35.17	-2.1		#N/A		
12	-48.58	0.0	-47.75	0.8	-51.11	-2.5		#N/A		
13	-86.70	0.0	-83.63	3.1	-93.77	-7.1	-97.83	-11.1		

closing error (mm)

-0.02

-0.42

-0.47

-0.16

0.00

