

PART DETAIL SECTION at 1:20


BRICKS LAID IN A FLEMISH GARDEN BOND, HAVING APPROXIMATELY 3 STRETCHERS TO EACH HEADER IN EACH COURSE

HARD MIX MORTAR EXTRUDED ON SURFACE OF BRICK WORK

MORTAR JOINTS MEASURE 10 -15 mm

SURFACE OF SOME BRICKS ERODED BY WEATHER AND CORROSION

SECTION THROUGH WALL A - A at 1:50

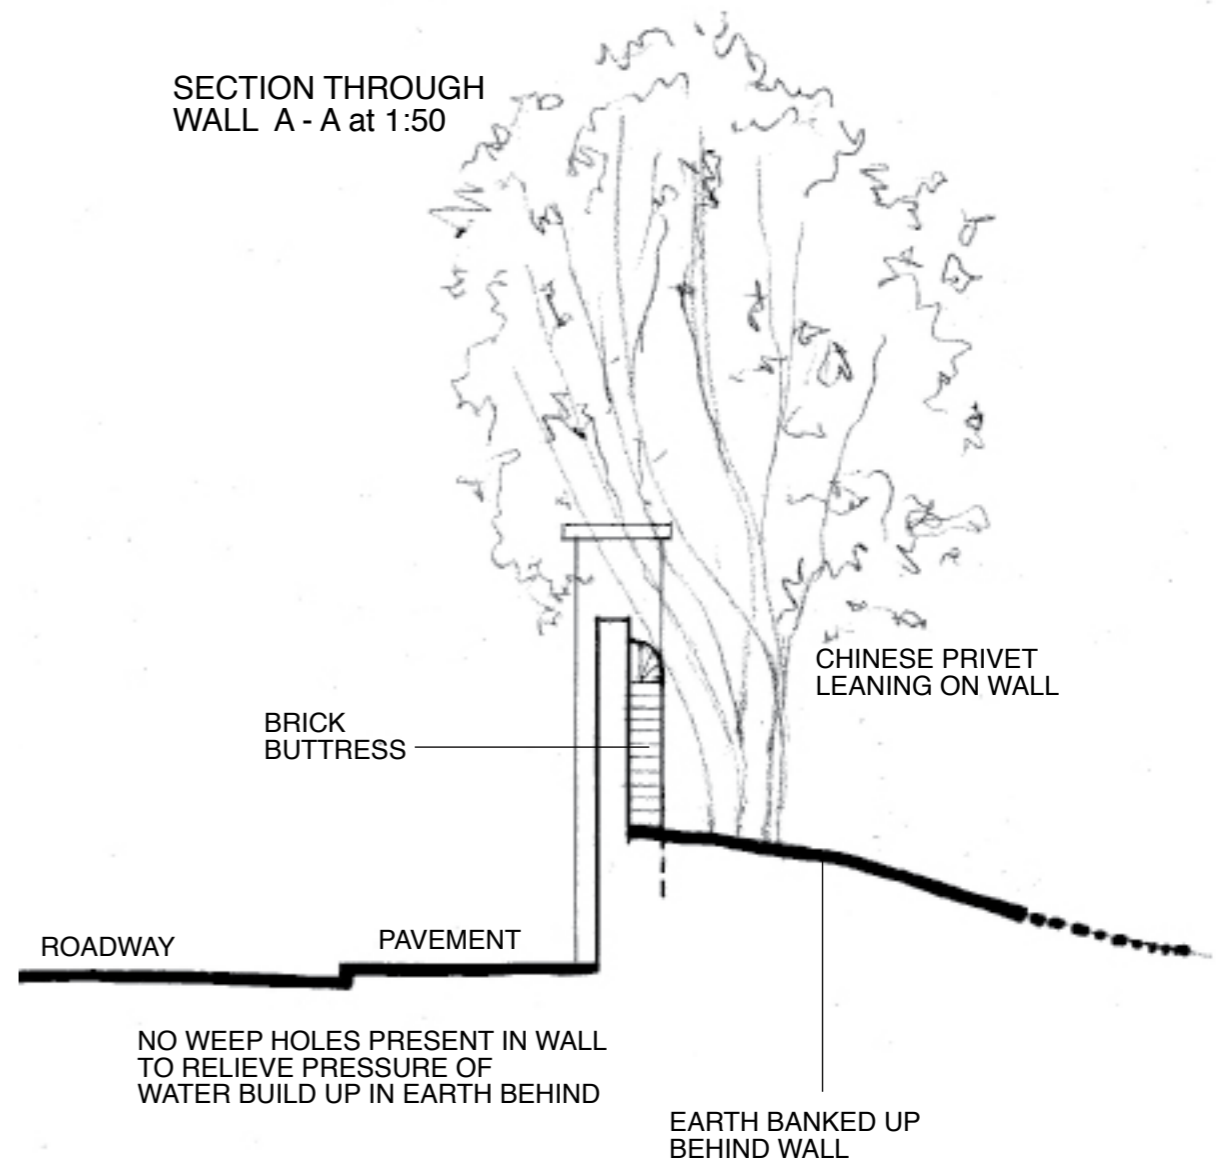


NO WEEP HOLES PRESENT IN WALL TO RELIEVE PRESSURE OF WATER BUILD UP IN EARTH BEHIND

EARTH BANKED UP BEHIND WALL

BRICK PILLAR WITH MASONRY CAPPING

SECTION THROUGH WALL B - B at 1:50

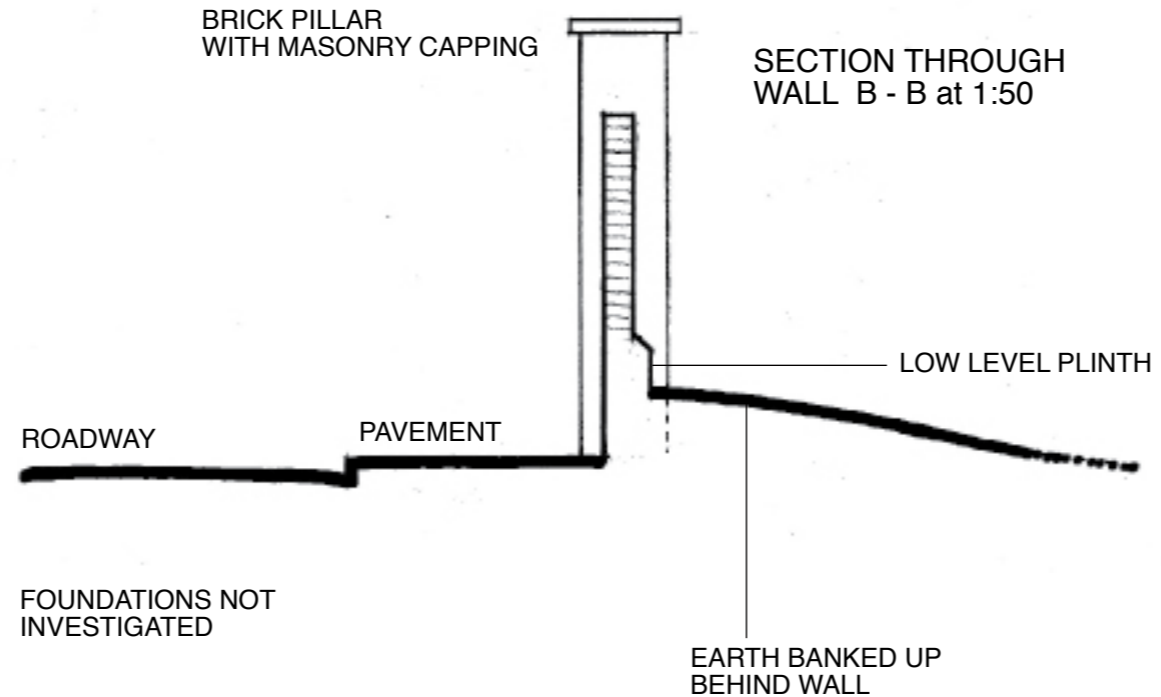

LOW LEVEL PLINTH

FOUNDATIONS NOT INVESTIGATED

EARTH BANKED UP BEHIND WALL

