

**Level Monitoring - Relative Movement Over Time**

Our Ref: 00/29016 Date of Issue 08/01/2015

**Provider Details**

Name: **CET Safehouse**

**Monitoring Details**

Instruction Date:	
First Reading Date:	28/01/2014
Maximum No Visits:	6
Anticipated Expiry Date:	Nov-14
Monitoring Int (Wks):	8

**Client Details**

Insurance Co.:	[REDACTED]
Client Name:	Cunningham Lindsey
Technical Mgr:	[REDACTED]
Email:	
Client Ref:	7498207
Address:	
Tel	
Other Email:	

**Risk Address**


Occupier:	[REDACTED]
Address:	99 Greencroft Gardens
Address:	
Town:	London
County:	
Post Code:	NW6 3PG
Tel Day:	
Tel Eve:	[REDACTED]
Mobile:	
Other:	
Other:	

**Level Monitoring - Site Sketch**

**Our Ref: 00/29016**

**Date of Issue**

**08/01/2015**

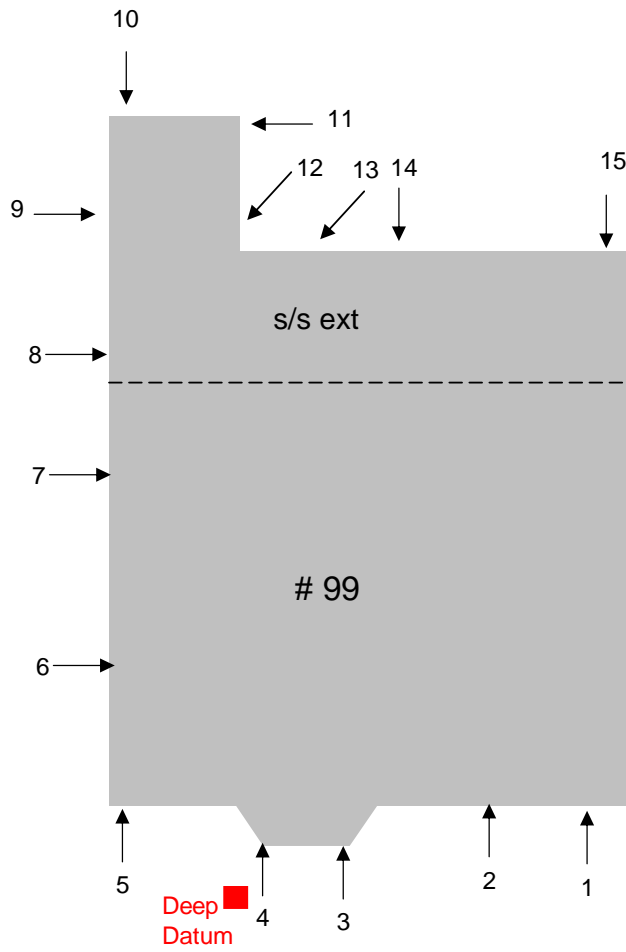

**FRONT**

## Level Monitoring - Comments

**Our Ref:** 00/29016 **Date of Issue** 08/01/2015

28-1-14

PH brought wrong key. No access to rear of property (gated).

23/7/14

tree removed

### Level Monitoring - Reduced Levels

**Our Ref: 00/29016**

**Date of Issue**

**08/01/15**

Reading Date	28/01/14	26/03/14	29/05/14	23/07/14	26/08/14	05/11/14	06/01/15					
Point / Reading	1	2	3	4	5	6	7	8	9	10	11	12
1	11.064	11.064	11.063	11.067	11.066	11.064	11.063					
2	11.054	11.054	11.054	11.057	11.055	11.054	11.053					
3	11.068	11.069	11.070	11.072	11.069	11.069	11.067					
4	11.078	11.078	11.078	11.081	11.081	11.081	11.079					
5	10.998	10.998	10.999	11.001	11.001	11.001	10.999					
6	10.651	10.652	10.651	10.655	10.655	10.655	10.653					
7	10.948	10.949	10.947	10.952	10.953	10.953	10.952					
8	10.407	10.407	10.405	10.410	10.412	10.412	10.411					
9					10.248	10.250	10.248					
10					10.069	10.071	10.070					
11					9.902	9.903	9.903					
12					10.122	10.123	10.123					
13					10.493	10.493	10.494					
14					10.639	10.640	10.641					
15					11.035	11.036	11.038					
Not used												


Highest reduced level is displayed green, lowest reduced level is displayed red



**Level Monitoring - Movement relative to datum against Date**

Our Ref: 00/29016

Issue Date: 08/01/2015

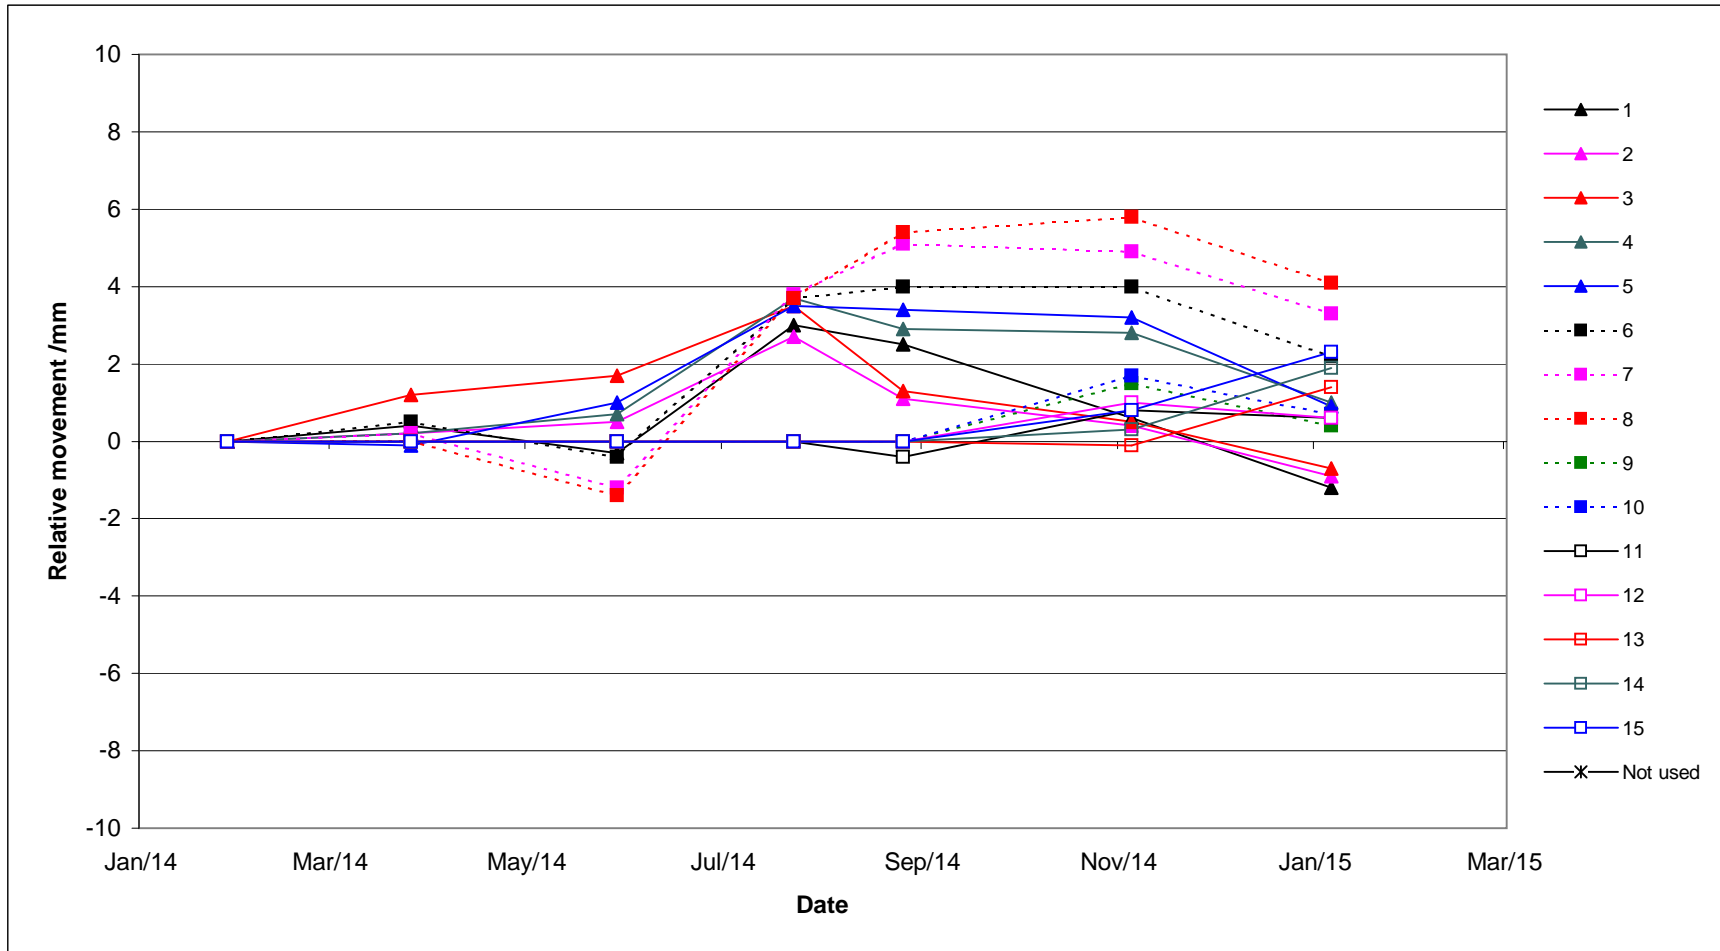



Giving our all

MS ref	Client ref	Client Name	Issue Date
00/29016	7498207	Cunningham Lindsey	08/01/2015

**Stud locations**

1	INT communal hall top floor below window
2	INT communal hall 1st floor below window
3	
4	
5	
6	

**Additional instructions / notes**

Studs nos.	Align-ment	Current C/W	Visit Date										
			28/01/14	26/03/14	29/05/14	23/07/14	26/08/14	05/11/14	06/01/15				
1	V	1.45	55.58	55.77	55.80	55.82	55.82	55.88	55.84				
1	H	1.20	68.90	68.90	68.99	69.21	69.24	69.41	69.28				
1	Check		86.53	86.52	86.52	86.51	86.49	86.51	86.52				
2	H	1.99	61.89	61.63	61.57	62.04	62.30	62.39	62.28				
2	V	1.28	64.19	64.08	64.05	64.27	64.35	64.34	64.34				
2	Check		91.53	91.55	91.55	91.57	91.57	91.57	91.68				
3	H												
3	D												
3	Check												
4	H												
4	D												
4	Check												
5	H												
5	D												
5	Check												
6	H												
6	D												
6	Check												
Customer :			No issues	No issues	No issues	No issues	No issues	No issues	No issues				
New cracking :													
See "current c/w" :													
Calliper nos :			6171	6173	555	6173	1885	6173	9256				
Technician :			AL	AL	Cmc	AL	EK	EK	JM				

**Additional comments : -**

Line 1																			
Line 2																			
Line 3																			

(max = 55 characters per line)



**MS ref** 00/29016     **Client ref** 7498207     **Client Name** Cunningham Lindsey     **Issue Date** 08/01/2015

