



35 GREVILLE ROAD, LONDON NW6 5JB
Basement Impact Assessment: Land Stability
July 2015



Client:
Croft Structural Engineers,
Clock Shop Mews,
Rear of 60 Saxon Rd,
SE25 5EH

Ground and Project Consultants Ltd

35 Greville Road, London NW6 5JB, BIA: Land Stability Report

Copyright of this Report is vested in Ground and Project Consultants Ltd and no part of it may be copied or reproduced by any means without prior written permission from Ground and Project Consultants Ltd. If you have received this Report in error, please destroy all copies in your possession and control and notify Ground and Project Consultants Ltd.

This report has been prepared by Ground and Project Consultants Ltd, with reasonable skill, care and diligence within the agreed scope and terms of contract and taking account of the manpower and resources devoted to it by agreement with its client, and is provided by Ground and Project Consultants Ltd solely for the use of its client, Croft Structural Engineers.

The advice and opinions in this report should be read and relied on only in the context of the report as a whole, taking account of the terms of reference agreed with the client. The findings are based on the information made available to Ground and Project Consultants Ltd at the date of the report (and will have been assumed to be correct) and on current UK standards, codes, technology and practices as at that time. They do not purport to include any manner of legal advice or opinion. New information or changes in conditions and regulatory requirements may occur in future, which will change the conclusions presented here.

This report is confidential to the client, Croft Structural Engineers. Unless otherwise agreed in writing by Ground and Project Consultants Ltd, no other party may use, make use of or rely on the contents of the report. No liability is accepted by Ground and Project Consultants Ltd for any use of this report, other than for the purposes for which it was originally prepared and provided.

Ground and Project Consultants Ltd

35 Greville Road, London NW6 5JB, BIA: Land Stability Report

1. Introduction

Ground and Project Consultants Ltd have been instructed by Croft Structural Engineers to undertake the land stability element of a Basement Impact Assessment compliant with CPG4, for 35 Greville Road, Kilburn, London NW6 5JB. The property is located in the London Borough of Camden in the Kilburn ward, its location is indicated on Figure 1.



Figure 1: Site Location

Ordnance Survey Data © Crown copyright and database right 2015

Ground and Project Consultants Ltd

35 Greville Road, London NW6 5JB, BIA: Land Stability Report

2. Scope and Objective

The scope of this report and approach is as follows:

- A review the existing data supplied by Croft has been carried out, including the proposal drawings produced to date, Ground Investigation data, photos of the building and the background data available through LB Camden's website and other freely available data such as BGS geological information.
- In line with the CPG4 guidance:
 - A detailed assessment of the published and encountered geology
 - Development of a ground model including an assessment of geotechnical properties
 - An engineering interpretation including an assessment of slope stability and potential for ground movements.
- Recommendations for additional work/ monitoring and observation have been provided.

This report and the work to support it has been carried out by Jon Smithson who is a Director of Ground and Project Consultants Ltd and is a Chartered Geologist with 30 years' experience.

Ground and Project Consultants Ltd

35 Greville Road, London NW6 5JB, BIA: Land Stability Report

3. BIA Screening for Slope/Land Stability

A screening exercise has been carried out as per the guidance in CPG4 as follows:

Question	Answer	Action/ Comment
Question 1: Does the existing site include slopes, natural or manmade, greater than 7 degrees? (approximately 1 in 8)	No. The property is located at around 35mAOD and there is no significant change in level across the site.	None
Question 2: Will the proposed re-profiling of landscaping at site change slopes at the property boundary to more than 7deg? (approximately 1 in 8)	No. There are no significant planned changes in surface profile.	None
Question 3: Does the development neighbour land, including railway cuttings and the like, with a slope greater than 7deg? (approximately 1 in 8)	No. The nearest mainline railway lines (underground) are approximately 250m away to the west and north. Underground lines are located approximately 300m and 500m to the west and east respectively.	None
Question 4: Is the site within a wider hillside setting in which the general slope is greater than 7degrees? (approximately 1 in 8)	No, the site is on relatively flat land well away for Hampstead and Primrose Hill. Estimated gradients from OS maps at the property vicinity area of around 1 in 100. Arup Fig 16 confirms no steep slopes in the area.	None
Question 5: Is the London Clay the shallowest strata at the site?	Yes, the geological map (sheet 256) indicates that the site is underlain London Clay with a potential for Head Deposits close to site.	The presence of London Clay close to surface is further discussed in the Impact Assessment.
Question 6: Will any tree/s be felled as part of the proposed development and/or are any works proposed within any tree protection zones where trees are to be retained? (Note that consent is required from LB Camden to undertake work to any tree/s protected by a Tree Protection Order or to tree/s in a Conservation Area if the tree is over certain dimensions).	No but there are mature trees at or close to the property Hand digging is proposed to protect tree roots from damage.	Further discussed in the Impact Assessment.
Question 7: Is there a history of seasonal shrink-swell subsidence in the local area, and/or evidence of such effects at the site?	The structural survey of the property did not reveal any apparent signs of distress. However London Clay is indicated as being present at the property. Head deposits can also have high plasticity.	Further discussed in the Impact Assessment.

Ground and Project Consultants Ltd
35 Greville Road, London NW6 5JB, BIA: Land Stability Report

Question 8: Is the site within 100m of a watercourse or a potential spring line?	Possibly: Figure 11 of the Arup report indicates a 'Lost River' close by to the North West of the property.	This is further discussed in the Impact Assessment.
Question 9: Is the site within an area of previously worked ground?	None known or suspected.	None
Question 10: Is the site within an aquifer? If so, will the proposed basement extend beneath the water table such that dewatering may be required during construction?	No. The London Clay is classified by the Environment Agency as unproductive strata (rock layers with low permeability and negligible significance for water supply or river base flow). However the basement may extend into the water table.	This is further discussed in the Impact Assessment.
Question 11: Is the site within 50m of the Hampstead Heath ponds?	No. The ponds are around 2.5km to the NNE.	None
Question 12: Is the site within 5m of a highway or pedestrian right of way?	Yes. The basement will be within 5m from the highway and pavement.	Health Safety and environmental measures will be required to be integrated into the building contractors' methods of working. This is further discussed in the Impact Assessment.
Question 13: Will the proposed basement significantly increase the differential depth of foundations relative to neighbouring properties?	The base of the basement slab will be 4.3m below the existing ground (garden) level. There is a neighbouring property (37 Greville Road) within 2-3m of the property on the SE side. Basement details of this property are unknown.	This is further discussed in the Impact Assessment.
Question 14: Is the site over (or within the exclusion zone of) any tunnels, e.g. railway lines?	No. Closest railway tunnels are approximately 300m away	None

Ground and Project Consultants Ltd

35 Greville Road, London NW6 5JB, BIA: Land Stability Report

4. Site Information

4.1 Existing Property and Basement Proposals

The property at 35 Greville Road is located on the North East side of the road with Mortimer Crescent forming the North West boundary of the property. The property is located relatively flat ground away from Hampstead and Primrose Hills. The elevation of the site is around 35m AOD. The main west coast and east coast and overground train lines into Euston and King's Cross run around 200m to the north in cutting and underground lines (Bakerloo and Jubilee) run around 300m to the West and 600m to the East respectively. The Grand Union Canal runs some 1.5km to the South of the property.

The property is a (estimated) late Victorian three storey detached house in substantial gardens. The lower floor is a lower ground floor partly sunk into the ground. The existing property has a footprint of approximately 5m². The plot is approximately 550m² with most of the land at the front, i.e. towards Greville Road. The front of the property is approximately 20m from Greville Road itself.

The National Grid reference for the property is TQ2581 8352. The location of the property is provided in Figure 1.

The lower ground floor extends beneath most of the footprint of the property except at the rear. It is also understood that there are a number of mature and semi-mature trees within the gardens of the property.

The basement proposals comprise a single storey construction across virtually the entire footprint of the property and extend beneath part of the front garden approximately 8m from the front of the existing property. The proposals include for a gym, sauna, steam room, study library and rest room. There will be 3 skylights and a new lightwell to the North West side in the garden. The maximum depth of construction will be 4.3m below the garden level.

4.2 Topography

The OS map indicates the property is at around 35m AOD. The ground surface generally flat with estimated gradients of around 1 in 100 local to the property.

4.3 Geology

The available geological mapping (Ref 1.) indicates that the site lies on London Clay which typically comprises a stiff grey fissured clay, weathering to brown near surface. Concretions of argillaceous limestone in nodular form (Claystones) occur throughout the formation. The geological map (North London 256) indicates that the property close to two areas with a 'propensity' for Head Deposits, approximately 1km to the North West and 300m to the East. The Head deposits are probably associated with the higher ground to the North and East. Typically these deposits are thin (<2m) and consist of soft, ochreous brown silty clay with blue-grey mottling in places and angular, frost-shattered fragments of flint occur sporadically throughout. The base of the London Clay is likely to occur some depth below the property. See figure 2 below.

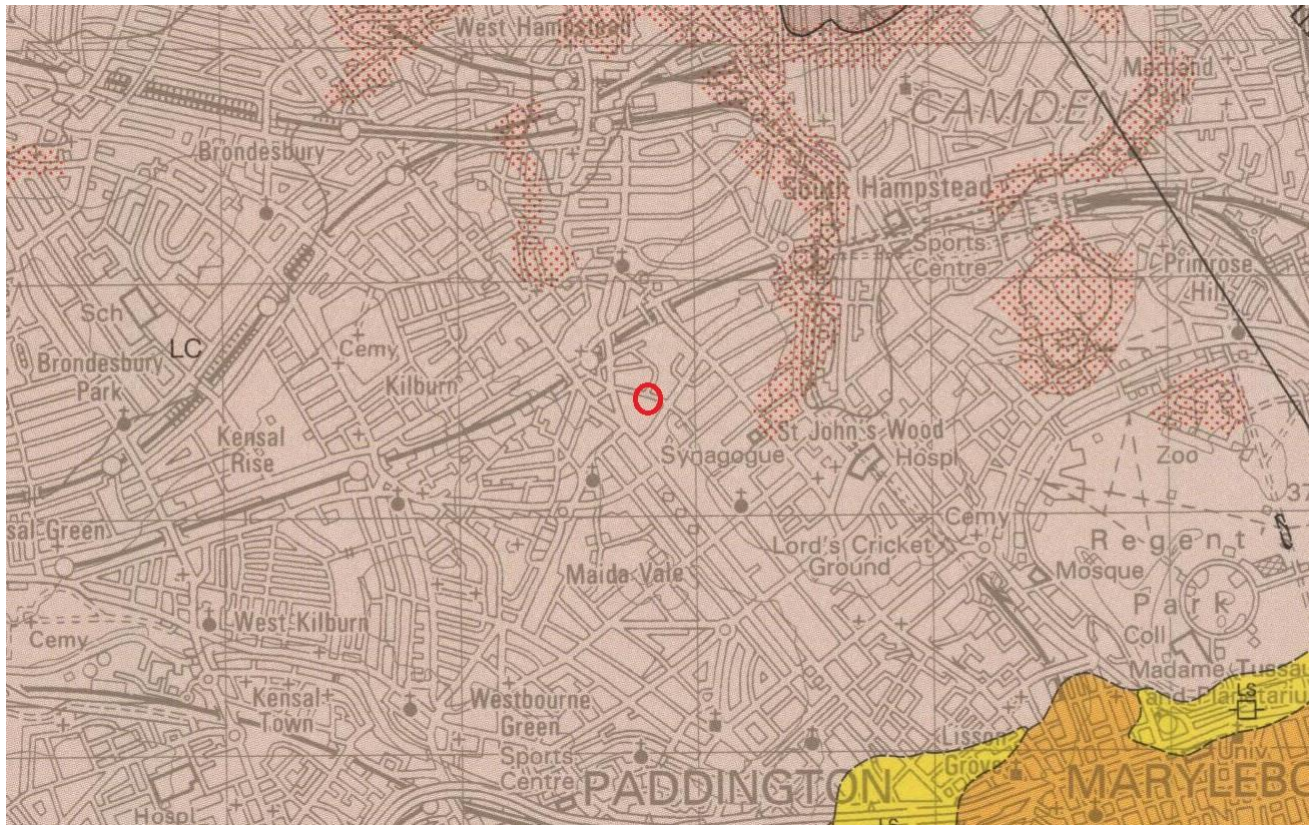


Figure 2: Geology

BGS copyright and database right 2015

4.4 Hydrology and Hydrogeology

The OS Map indicates that the Grand Union Canal is around 1.5km to the South of the site. The Hampstead Ponds are approximately 2.5km to the NNE. There are no springs shown on OS mapping. There is a hidden river indicated on Arup Figure 11, approximately 100m to the North West of the site. This appears to be a tributary of the River Westbourne. The London Clay is classified by the Environment Agency as unproductive strata (rock layers with low permeability and negligible significance for water supply or river base flow).

4.5 Groundsure Environmental Data

The Groundsure report gives a wealth of background data on local environmental issues and hazards. The key issues are summarised in the table below:

Drift Deposits	None are indicated on BGS mapping
Made Ground	None indicated on BGS mapping
Surface and Groundwater Abstraction	There are no surface or groundwater abstraction points within 1km of the site.
Past and Current Local Land Uses	There are a number of 'unspecified tanks' shown on historic maps between 100 and 500m of the property. An electricity sub-station has been present at 105m N of the property for some years.
Shrink/ Swell	There is a moderate Hazard of shrink and swell from the London Clay soils
Landslide	Very Low Risk:.
Soluble Rocks	Negligible Risk

Ground and Project Consultants Ltd
35 Greville Road, London NW6 5JB, BIA: Land Stability Report

Compressible Ground	Negligible Risk
Collapsible Ground	Very Low Risk
Running Sand	Negligible Risk
Mining	None recorded

Ground and Project Consultants Ltd

35 Greville Road, London NW6 5JB, BIA: Land Stability Report

5. Ground Investigation

A ground investigation (GI) has been carried out at the site by Ground & Water Ltd (G&W) and results of these have been made available by G&W. The GI was carried out in July 2015.

The work comprised one window sample borehole (WS1) to 6.00m at the rear of the property along with a dynamic probe to 10m bgl.

The borehole encountered a thin cover of Made Ground 0.60m thick, described as Brown/dark brown gravelly very sandy to sandy clay. Gravel consists of flint, brick and tile fragments. It likely represents reworked natural ground with some man made material associated with the property construction. The London Clay was encountered beneath this to the base of the borehole and was described as a mid-brown and grey mottled silty CLAY, with Selenite crystals noted. Silt lenses were noted throughout.

The dynamic probe indicated relatively low shear strengths to 6m bgl, correlating to soft to firm and firm through to stiff from 6m. These represent relatively low results for London Clay and may indicate disturbance.

No trial pits were excavated at site to inspect foundations due to lack of available access.

A standpipe piezometer was installed in WS1 to 5.00m depth. Groundwater was not encountered during drilling. However return visits in August 2015 by Ground&Water to site dipped groundwater levels at 0.83m bgl and 0.94m bgl.

Laboratory tests were carried out on the samples collected from the borehole. Testing consisted of the following:

4 No. Atterberg Limit test

8 No. moisture content determination

2 No. Soluble Sulphate, pH and related tests for Concrete Classification on soil samples

All of the moisture content tests were conducted in London Clay. These show little variation and no discernible pattern with depth, ranging from 28 to 31%. Atterberg tests were all carried in London Clay and showed consistent values as follows:

- Plastic Limit : 25 to 28%
- Liquid Limit: 75 to 80%
- Plasticity Index: 49 to 53%

The low moisture content relative to liquid and plastic limit (just above plastic limit) suggests a relatively high shear strength and stiff consistency.

6. Conceptual Ground Model

From the above a conceptual Ground model has been developed and is presented in tabular form below:

Strata	Typical Description	Depth at Property encountered in GI	Geotechnical Properties – Tentative Characteristic Values*	Other
Made Ground	Brown silty sandy clay with gravel, gravel is brick, concrete, flint	Ground level to 0.60m	N/A	Made Ground is unlikely to be encountered to a significant depth. It should not be relied upon as a bearing strata. Likely to be deeper in areas of existing foundations and lower ground floor.
London Clay	Soft/Firm becoming stiff silty CLAY with silt lenses	From 0.60m (likely to be deeper in areas close to existing foundations and lower ground floor) to depth unproven	$C' = 0$ $\phi' = 20^\circ$ $C_u = 40$ increasing to 100kN/m^2 at depth. Use 50kN/m^2 at formation**	Clay is of high plasticity.
Groundwater		0.83m bgl	Highest dipped level in August	May significantly vary seasonally or after prolonged wet or dry periods.

Table 3: Summary of Strata Characteristics

*The determination of parameters is tentative due to the lack of test data.

**The undrained shear strength may have been considerably underestimated by the dynamic probing exercise. Strength should be verified by hand held shear vane/ inspection during ground excavation.

Ground and Project Consultants Ltd

35 Greville Road, London NW6 5JB, BIA: Land Stability Report

7. Impact Assessment

There are no major issues which should seriously affect the viability of the construction of the new basement. However the assessment of the geological environment of 35 Greville Road and the screening exercise indicate some areas for further discussion in this report with suggested mitigation where appropriate.

- 7.1 **London Clay:** The basement will be founded in the London Clay. The soils are of high plasticity and high volume change potential. The basement will be founded at around 4.3m bgl, therefore below any seasonal shrink and swell. The London Clay soils are known for their high levels of soluble sulphate. The concrete mix design should take appropriate account of sulphate levels in accordance with BRE Special Digest 1.
- 7.2 **Trees:** Mature and semi-mature trees are located in the garden and in the vicinity of the property. Care should be taken to minimise root damage during construction works. It is understood that hand digging will take place to attempt to minimise root damage. Should trees be removed there is potential for the soils to swell as a result and this should be accounted for in design.
- 7.3 **Watercourses:** There is evidence that a 'lost river', a tributary to the River Westbourne is possibly located to the north west of the property. It is highly unlikely that any culvert or trace of this will be encountered at the site. However vigilance should be exercised during excavations for the basement.
- 7.4 **Groundwater:** Groundwater was encountered above the proposed basement formation level and close to ground level. Whilst the borehole remained dry, the monitoring standpipe did encounter groundwater as high as 0.83m bgl, in a relatively dry summer. It is recommended that a design level of ground surface is used. Groundwater may be encountered during the works, particularly as seepages through sand or silt layers noted in the borehole record within London Clay or at the base of the Made Ground. These should be and should be managed carefully to prevent ground loss particularly through loss of fines and softening of formation. Consideration should be given to limiting the size and time of face exposures during construction should significant flows be encountered during construction. Baseline and ongoing regular monitoring of the building and its immediate neighbours for settlement and movement/distress is highly recommended during building works and for a short period after completion. It is recommended that ongoing monitoring of groundwater levels is carried out during and up to the end of construction of the basement structure.
- 7.5 **Basement Depth:** The basement is proposed to be constructed involving an excavation to approximately 4.3m below the garden level. There is an adjacent building (No.37) approximately 3m to the SW. The proposals to construct the basement involves a 'hit and miss' approach in stages so each 'panel' is separated by 3-5 others from the next open one. It will be important that the building contractor is closely supervised and is experienced in this type of construction. It will be critical to prevent exposed faces from collapse or significant ground loss into the new excavation and temporary face support should be

Ground and Project Consultants Ltd

35 Greville Road, London NW6 5JB, BIA: Land Stability Report

maintained where practicable. Monitoring of movement should be carried out before and during construction up to the end of the construction period.

- 7.6 **Proximity to Pavement/Highway:** Basement construction will occur within 5m of the pavement and highway, on the NW side of the property along Mortimer Crescent. Appropriate Health and Safety measures including hoardings, control of plant movements and materials and waste storage.

8. Conclusions

The methodology and approach of CPG4 has been followed in developing this BIA with respect to Land stability. It is concluded that with the construction of the new basement at 35 Greville Road should not have significant impacts on land stability provided that:

- Groundwater inflow, if encountered, is reduced to a minimum and properly controlled such that there is no significant wash out of fine material. Groundwater levels should be monitored before and during construction.
- The property is close to 37 Greville Road. The construction of the basement should be carried out by a competent building contractor experienced in residential basement construction. Precautions must be taken to maintain the stability of the excavations, prevent significant ground movements and manage groundwater inflows.
- Care should be taken to minimise the disturbance and damage to trees and their roots. Should trees be removed then an assessment of the potential for swelling of the London Clay soils should be carried out.
- Concrete should be designed in accordance with BRE Special Digest 1 accounting for the sulphate conditions anticipated.
- Monitoring of the structures is carried out before and during construction. The exact nature of this monitoring should be determined by the structural engineer.

Ground and Project Consultants Ltd

35 Greville Road, London NW6 5JB, BIA: Land Stability Report

9. References

1. BGS Geological Map Sheet 256.
2. Arup: Camden Geological, Hydrogeological and Hydrological Study.
3. Croft Structural Engineers: Design drawings available at the time of reporting.
4. Ground&Water GWPR1303: Ground Investigation Report: 35 Greville Road, London NW6 5JB.
5. Groundsure Enviroinsight report for 35 Greville Road, GS-2340478

APPENDIX

Groundsure Enviroinsight Report GS-1466122