

REAR.


19 ROMA RD. NW3

24.6.15



1 Basement Plan

EXISTING.

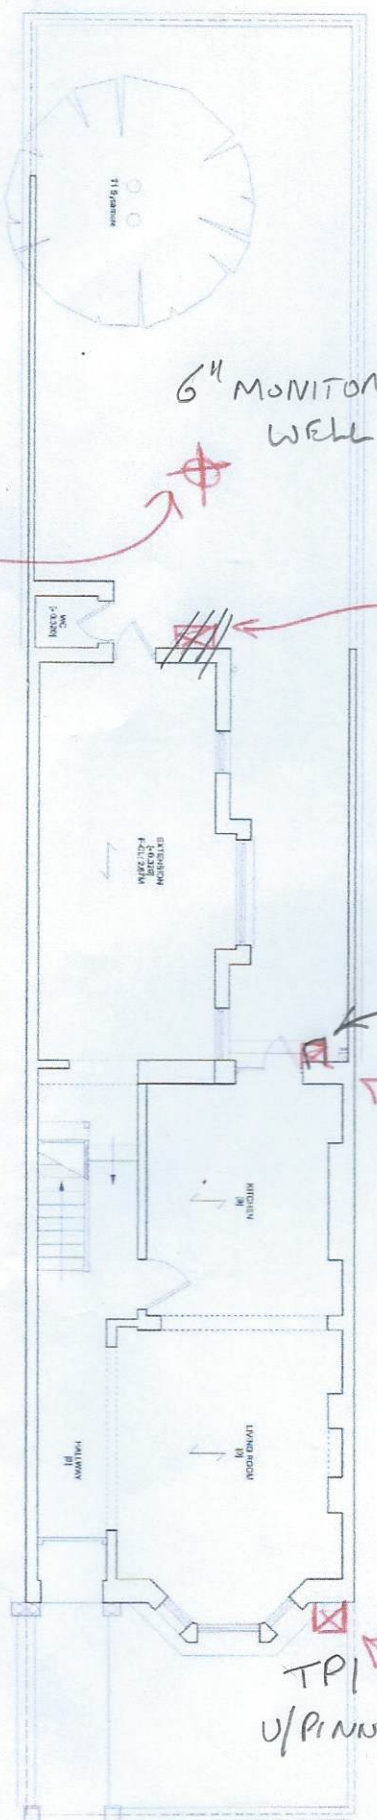

2 Ground Floor Plan

EXISTING.

PLAN.



FRONT.

POINT DRILLING SERVICES

Birdsnest, Oakmead Road, St Osyth, Essex. CO16 8NL. Email: ylowther@aolcom

Telephone: 01255 821004 Mobile 07771533402


SITE INVESTIGATION TRIAL PIT LOG

DATE: 24.6.15

SITE ADDRESS: 19 RONA RD. NW3

TRIALPIT LOG REF: 1

DESCRIPTION:

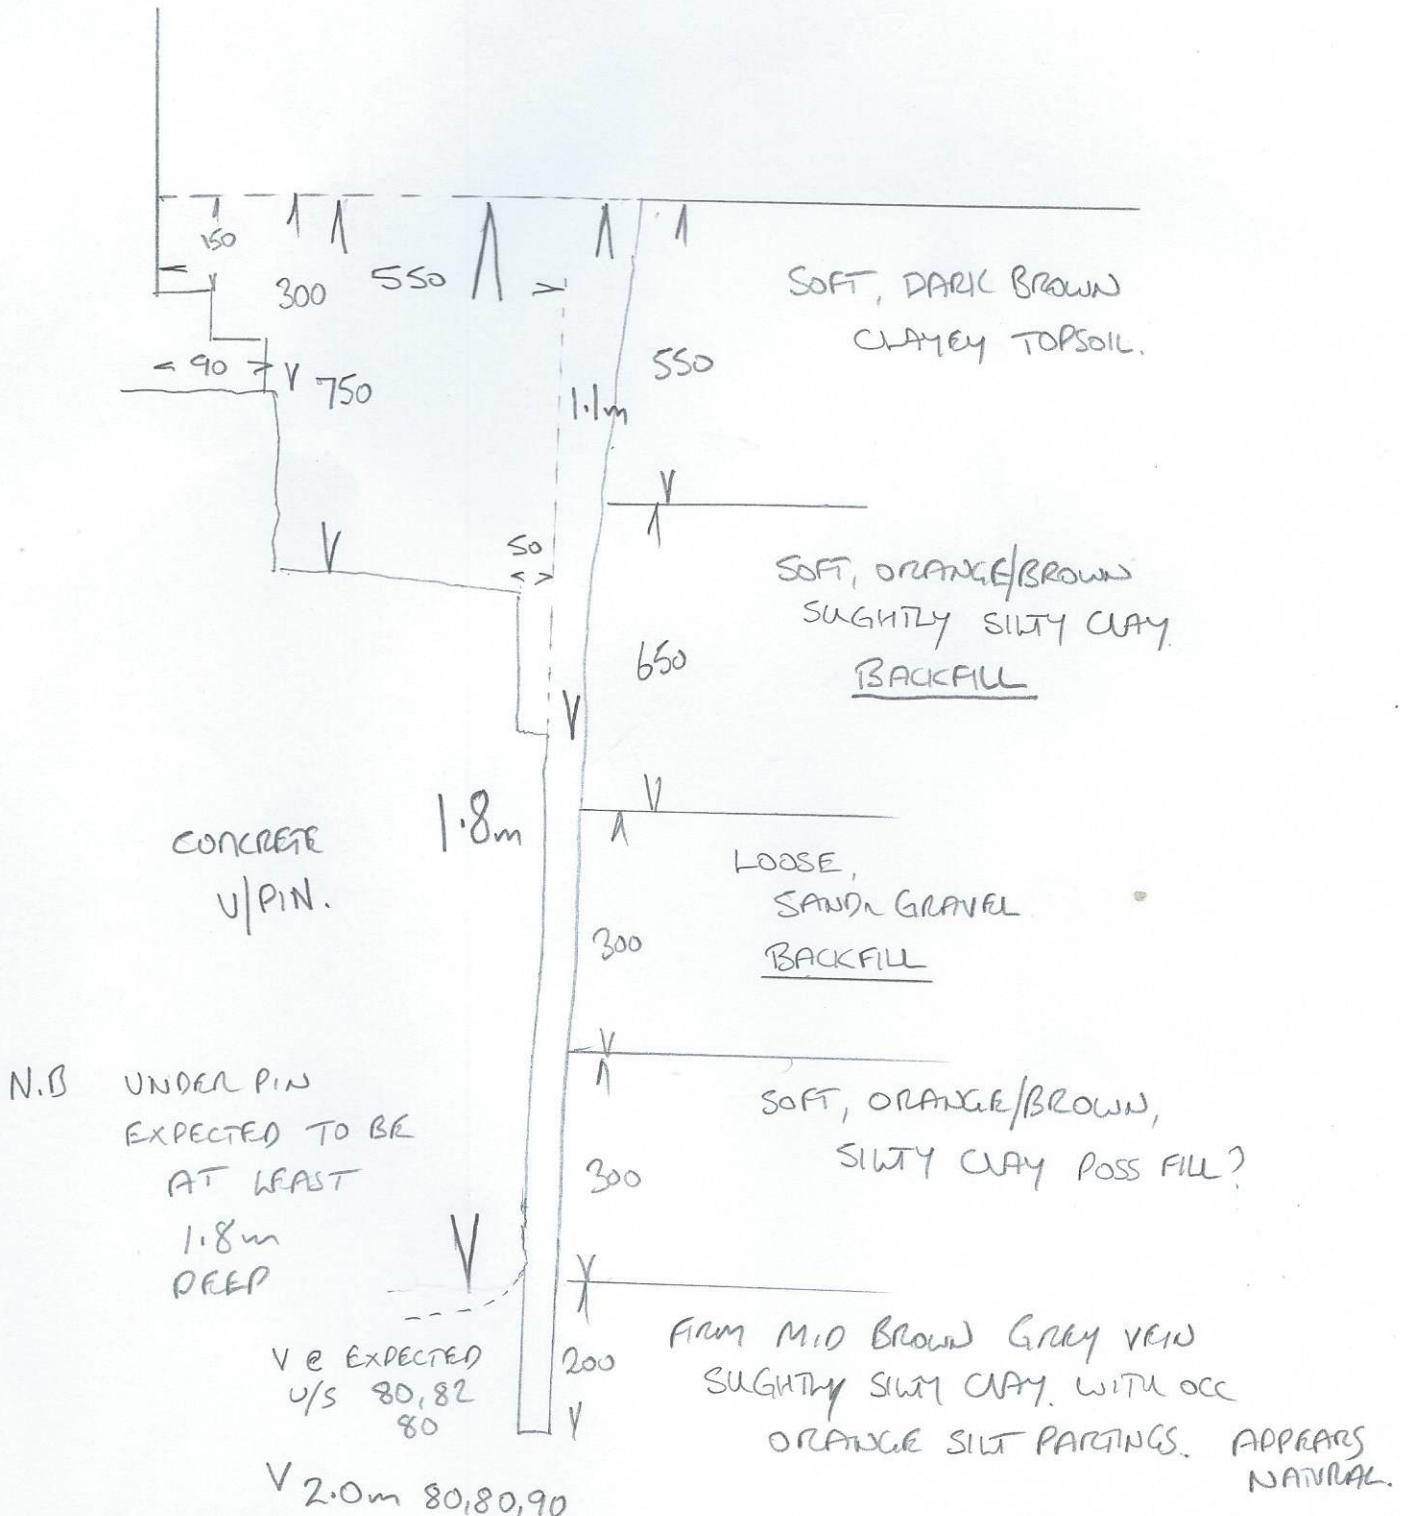

KEY . DISTURBED SAMPLE. V.VANE TEST. MP. MACINTOSH PROBE TEST. R.ROOT SAMPLE.

POINT DRILLING SERVICES

BIRDSNEST, OAKMEAD ROAD ST OSYTH ESSEX CO16 8NL EMAIL: YLOWTHER@AOL.COM

TELEPHONE : 01255 821004 MOBILE : 07771 533 402

SITE INVESTIGATION BOREHOLE LOG

DATE:

24.6.15

SITE ADDRESS:

19 RONA RD. NW3

BOREHOLE LOG REF: 1

DEPTH	DESCRIPTION	6" MONITOR WELL	SOIL/ROOT SAMPLE	TEST RESULT	DEPTH OF TEST
0	COMPACT BLACK, (DRY) SILTY TOPSOIL				
300	COMPACT, DRY DARK BROWN, VERY SUCKY CLAYEY SILTY TOPSOIL. FULL WITH F1 COKE & BRICK FRAGMENTS.				
600	STIFF, (DRY) ORANGE/BROWN SILTY CLAY				
700	SOFT, ORANGE/BROWN SUCKY SILTY CLAY.		o	V 54, 48, 50	1.0
	(HARD AS ROOT GRAD TO 1.7m O.L.A.)		.	V 60, 64, 60	1.5
1.8	DENSE, (STIFF) ORANGE/BROWN, SUCKY SANDY GRAY CLAY (HOGGIN)		a	MP 50+	2.0
2.3	STIFF, MID BROWN GRAY VERT SUCKY SILTY CLAY WITH OCC ORANGE SILT PARTICLES		*	V 120, 100, 114	2.5
2.7	AS ABOVE (FIRM TO STIFF)		.	V 88, 90, 96	3.0
3.3	(CLAY STONE) (VERY SOFT WARM SANDAL)		.	.	
3.4	STIFF, MID BROWN GRAY VERT SUCKY SILTY CLAY WITH OCC ORANGE SILT PARTICLES		.	V 130+	4.0
4.0	AS ABOVE (VERY STIFF)		.	V 130+	5.0
6.0	BR FIRM DRY & O.P.W.		.	V 130+	6.0

KEY : DISTURBED SAMPLE

V: VANE TEST.

MP : MACINTOSH PROBE TEST

R: ROOT SAMPLE