

Ref: Z16177
Project: 43-45 Bedford Square
Title: No. 43 Cantilever Stone Staircase Newel
Post Remedial Details



**Methodology for Repairing Newel
Post Base Fixing:**

1. Carefully remove existing lead caulking by continuously drilling out around base of newel post.
2. Replace with SBD Epoxy Plus low viscosity resin leaving 4mm recess.
3. Fill recess with soft lead shavings carefully heated with fine jewelry maker's blowlamp to match original detail.

Location where repair is to be carried out.


Newel Post Remedial Works Proposals

mnp
mason navarro pledge

Bancroft Court, Hitchin
 Herts. SG5 1LH

| | | | | | |
|---|-------|------------|------|-----------|------|
| Project | | | | Job Ref | |
| 43-45 Bedford Square | | | | 216177 | |
| Sketch | | | | Sketch no | |
| Title Balustrade Remedial Works Details | | | | SK/501 | |
| Sketch By | Date | Checked by | Date | Revision | Date |
| JL | 07.16 | | | | |

PROPOSED BALUSTRADE TIE BAR DETAIL (CHECK FOR TRANSFER) ALREADY PRESENT ON TREAD 25.
 N.T.S.

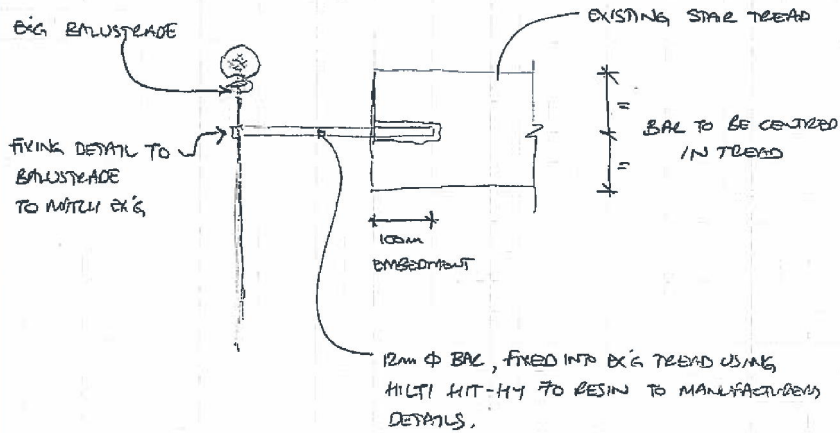

ELEVATION ON TREAD
 N.T.S.

