

Level Monitoring - Relative Movement Over Time

Our Ref: 00/30237

Date of Issue 18/07/16

Provider Details

Name: **CET**

Monitoring Details

Instruction Date:	24/09/15
First Reading Date:	22/10/15
Maximum No Visits:	6
Anticipated Expiry Date:	
Monitoring Int (Wks):	8 Weekly

Client Details

Insurance Co.:	
Client Name:	Cunningham Lindsey
Technical Mgr:	Yiu-Shan Wong
Email:	
Client Ref:	6095485
Address:	
Tel:	
Other Email:	

Risk Address


Occupier:	[REDACTED]
Address:	54 Compayne Gardens
Address:	
Town:	London
County:	
Post Code:	NW6 3RY
Tel Day:	0345 2601515
Tel Eve:	
Mobile:	
Other:	
Other:	

Level Monitoring - Site Sketch

Our Ref: 00/30237

Date of Issue

18/07/16

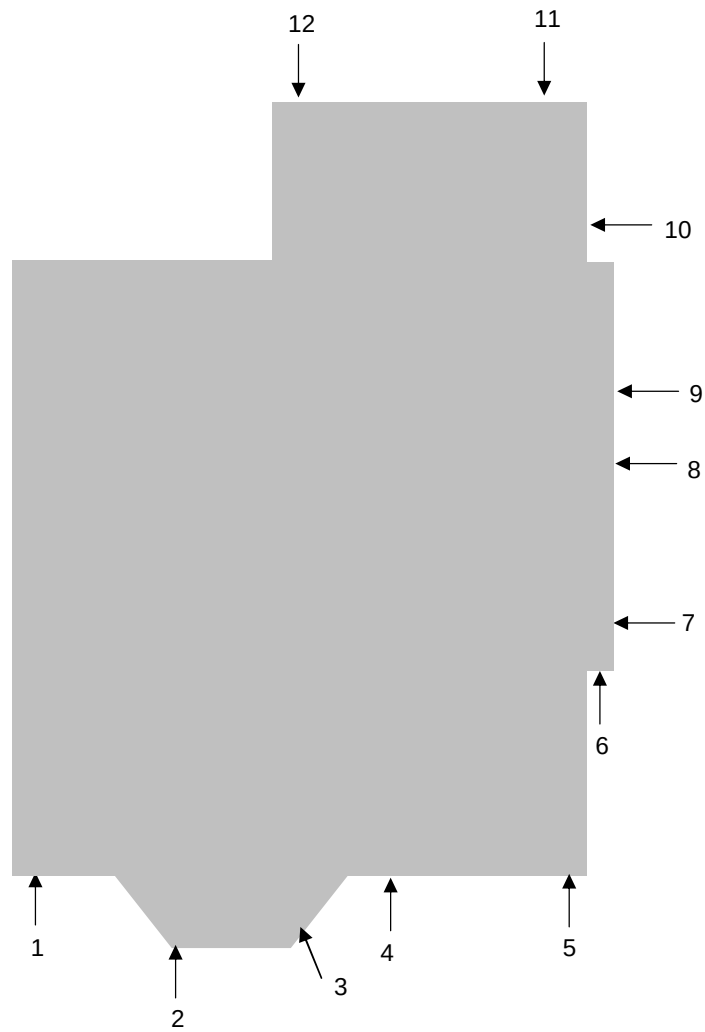

FRONT

Level Monitoring - Comments

Our Ref: 00/30237

Date of Issue

18/07/16

Level Monitoring - Reduced Levels

Our Ref: 00/30237

Date of Issue

18/07/16

Reading Date	22/10/15	18/12/15	26/02/16	05/05/16	13/07/16							
Point / Reading	1	2	3	4	5	6	7	8	9	10	11	12
1	10.785	10.788	10.792	10.792	10.791							
2	11.165	11.170	11.174	11.174	11.173							
3	11.159	11.164	11.170	11.170	11.169							
4	10.693	10.698	10.705	10.705	10.704							
5	10.455	10.458	10.469	10.470	10.469							
6	10.502	10.505	10.515	10.516	10.515							
7	11.103	11.101	11.105	11.105	11.105							
8	10.734	10.733	10.735	10.735	10.734							
9	10.719	10.721	10.722	10.721	10.720							
10	10.562	10.564	10.565	10.565	10.564							
11	10.561	10.563	10.565	10.565	10.565							
12	10.513	10.516	10.520	10.520	10.521							
Not used												
Not used												
Not used												
Not used												

Highest reduced level is displayed green, lowest reduced level is displayed red

Level Monitoring - Relative Movement Over Time

Our Ref: 00/30237

Date of Issue


18/07/16

[illegible]

Level Monitoring - Movement relative to datum against Date

Our Ref: 00/30237

Issue Date: 18/07/16

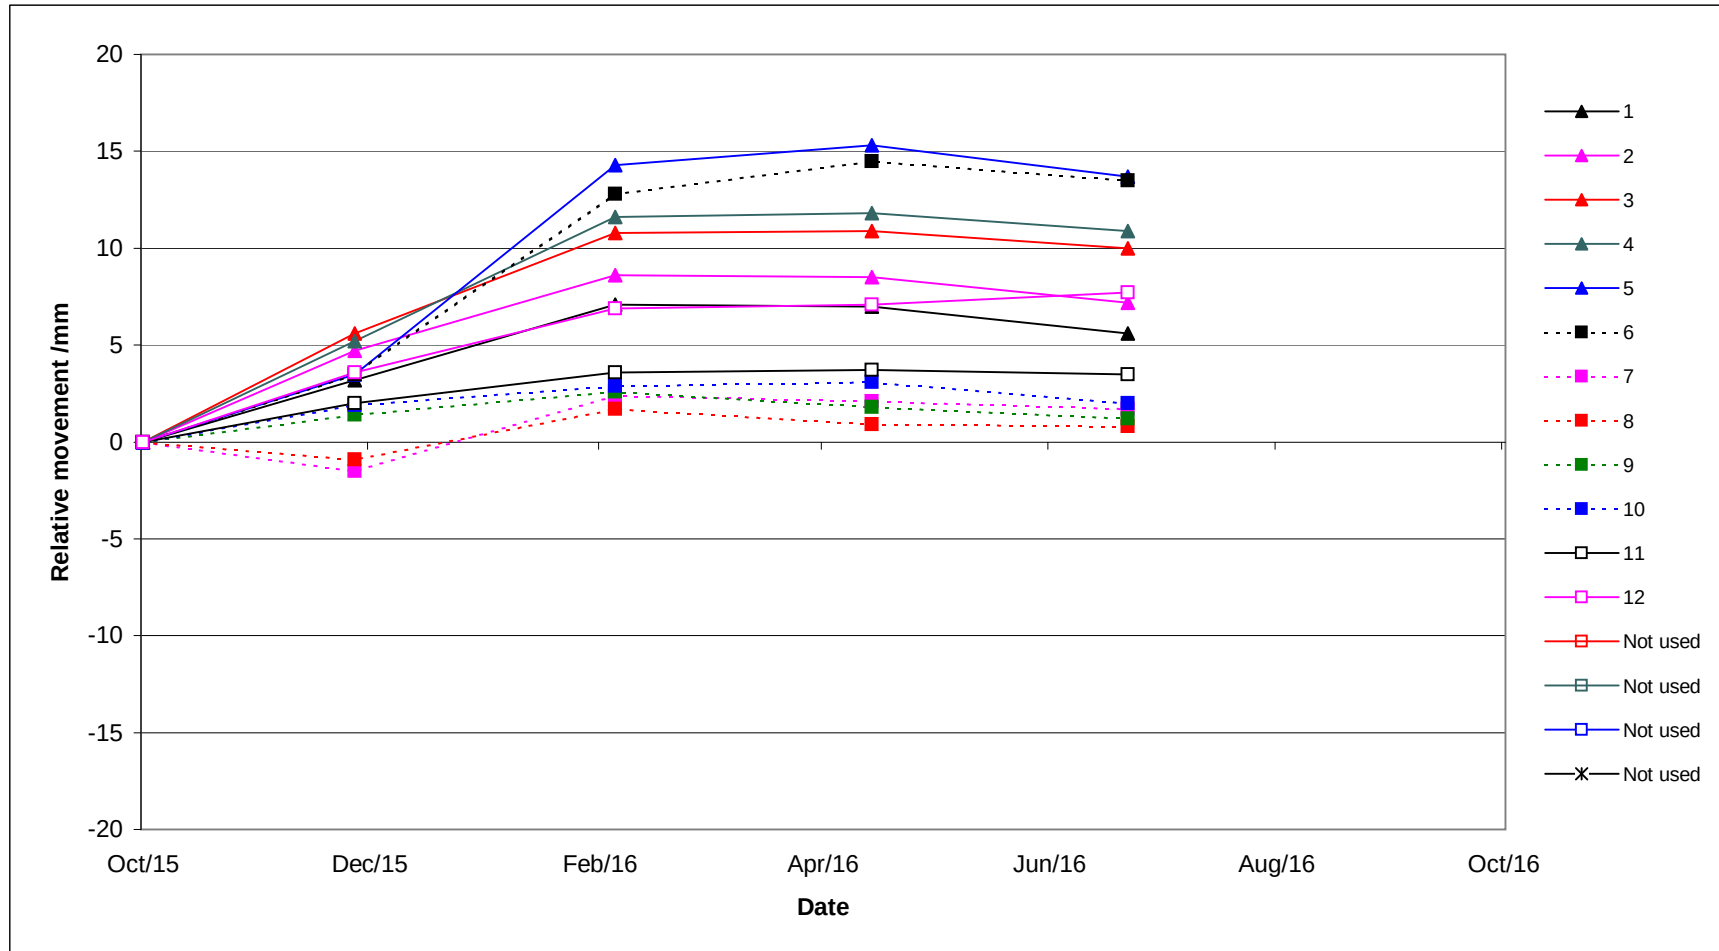



Giving our all

MS ref	Client ref	Client Name	Issue Date
00/30237	6095485	Cunningham Lindsey	18/07/16

Stud locations

1	EXT - RH elevation junction with main building near front above gas box
2	INT - Flat 2 , rear lounge L/H side juntion
3	INT - Flst 2 , front bedroom R/H side junction
4	
5	
6	

Additional instructions / notes

Studs nos.	Align-ment	Current C/W	Visit Date										
			22/10/15	18/12/15	26/02/16	05/05/16	13/07/16						
1=2	H		74.65	73.00	68.54	68.24	68.17						
2=3	D		114.70	112.87	107.86	107.34	107.38						
1=3	Check		79.61	79.64	79.60	79.58	79.57						
4=5	H	1.05	79.20	77.98	77.34	77.19	77.42						
4=6	D		92.38	90.97	90.73	90.19	90.49						
5=6	Check		53.73	53.71	53.68	53.62	53.68						
7=8	H		66.66	65.00	61.47	61.20	60.68						
7=9	D		84.81	83.12	78.99	78.26	76.10						
8=9	Check		44.62	44.60	44.55	44.50	44.51						
4	H												
4	D												
4	Check												
5	H												
5	D												
5	Check												
6	H												
6	D												
6	Check												
	Customer :	No issues	No issues	No issues	No issues	No issues							
	New cracking :												
	See "current c/w" :												
	Calliper nos :	6173	6173	2860	2860	9256							
	Technician :	AL/DD	AL/NM	AL/NM	AL/DD	JM							

Additional comments : -

Line 1													
Line 2													
Line 3													

(max = 55 characters per line)

MS ref	Client ref	Client Name	Issue Date
00/30237	6095485	Cunningham Lindsey	18/07/16

