

table continued from previous page...

Building	Level	Location	Item / Product Examined	Material Description	Risk Level (Material Score)	Initial Control Recommendation
Bacton Low Rise, Block H - Flat 210	2	002/Bedroom	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 210	3	001/Stairs	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 210	3	002/Bathroom	toilet cistern	Asbestos-containing composite	R3 (4)	Remove
Bacton Low Rise, Block H - Flat 210	3	002/Bathroom	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 210	3	003/Bedroom	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 210	4	001/Bedroom	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 211	0	001/ Entrance Lobby	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 211	0	001/ Entrance Lobby	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 211	0	001/ Entrance Lobby	boxing around electric	Asbestos-containing insulating board	R2 (6)	Remove
Bacton Low Rise, Block H - Flat 211	0	001/ Entrance Lobby	boxing around electric	Asbestos-containing insulating board	R2 (6)	Remove
Bacton Low Rise, Block H - Flat 211	1	001/Stairs	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 211	1	002/Kitchen/Living room	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 211	2	001/ Stairs	adhesive to concrete floor	Asbestos-containing bituminous product	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 211	2	002/Bedroom	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 211	2	003/Bedroom	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 211	3	001/Stairs	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 211	3	002/Bathroom	toilet cistern	Asbestos-containing composite	R3 (4)	Remove
Bacton Low Rise, Block H - Flat 211	3	002/Bathroom	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 211	3	003/Bedroom	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 211	4	001/Bedroom	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 212	-3	001/Stairs	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 212	-3	002/Bathroom	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 212	-3	003/Bedroom	boxing within cupboard	Asbestos-containing insulating board	R2 (7)	Remove
Bacton Low Rise, Block H - Flat 212	-3	003/Bedroom	panels to shelves	Asbestos-containing insulating board	R2 (7)	Remove
Bacton Low Rise, Block H - Flat 212	-3	003/Bedroom	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 212	-2	001/Stairs/Bedroom	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 212	-2	002/Bedroom	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 212	-1	001/Stairs	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove

table continued from previous page...

Building	Level	Location	Item / Product Examined	Material Description	Risk Level (Material Score)	Initial Control Recommendation
Bacton Low Rise, Block H - Flat 212	-1	002/Kitchen/Living room	boxing within cupboard	Asbestos-containing insulating board	R3 (6)	Remove
Bacton Low Rise, Block H - Flat 212	-1	002/Kitchen/Living room	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 212	0	001/ Entrance Lobby	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 212	0	001/ Entrance Lobby	boxing around electric	Asbestos-containing insulating board	R2 (6)	Remove
Bacton Low Rise, Block H - Flat 213	-3	001/Stairs	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 213	-3	002/Bathroom	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 213	-3	003/Bedroom	panels to shelves	Asbestos-containing insulating board	R2 (7)	Remove
Bacton Low Rise, Block H - Flat 213	-3	003/Bedroom	boxing within cupboard	Asbestos-containing insulating board	R2 (7)	Remove
Bacton Low Rise, Block H - Flat 213	-3	003/Bedroom	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 213	-2	002/Bedroom	adhesive backing to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 213	-1	001/Stairs	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 213	-1	002/Kitchen/Living room	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 213	-1	002/Kitchen/Living room	boxing within cupboard	Asbestos-containing insulating board	R3 (6)	Remove
Bacton Low Rise, Block H - Flat 213	0	001/ Entrance Lobby	boxing around electric	Asbestos-containing insulating board	R2 (6)	Remove
Bacton Low Rise, Block H - Flat 213	0	001/ Entrance Lobby	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 213	2	001/Stairs/Bedroom	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 214	0	001/ Entrance Lobby	boxing around electric	Asbestos-containing insulating board	R2 (6)	Remove
Bacton Low Rise, Block H - Flat 214	0	001/ Entrance Lobby	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 214	1	001/Stairs	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 214	1	002/Kitchen/Living room	panels to shelves	Asbestos-containing insulating board	R2 (7)	Remove
Bacton Low Rise, Block H - Flat 214	1	002/Kitchen/Living room	boxing within cupboard	Asbestos-containing insulating board	R2 (7)	Remove
Bacton Low Rise, Block H - Flat 214	1	002/Kitchen/Living room	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 214	2	001/ Stairs	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 214	2	002/Bedroom	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove

table continued from previous page...

Building	Level	Location	Item / Product Examined	Material Description	Risk Level (Material Score)	Initial Control Recommendation
Bacton Low Rise, Block H - Flat 214	2	003/Bedroom	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 214	3	001/Stairs	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 214	3	002/Bathroom	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 214	3	003/Bedroom	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 214	4	001/Bedroom	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 215	0	001/Stairs	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 215	0	001/Stairs	panel to electrics	Asbestos-containing insulating board	R3 (6)	Remove
Bacton Low Rise, Block H - Flat 215	1	002/Kitchen/Living room	boxing within cupboard	Asbestos-containing insulating board	R2 (7)	Remove
Bacton Low Rise, Block H - Flat 215	1	002/Kitchen/Living room	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 215	2	001/ Stairs	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 215	2	002/Bedroom	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 215	2	003/Bedroom	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 215	3	001/Stairs	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 215	3	002/Bathroom	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 215	3	003/Bedroom	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 215	4	001/Bedroom	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 217	-3	001/Stairs	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 217	-3	002/Bathroom	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 217	-2	001/Stairs	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 217	-2	002/Bedroom	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 217	-2	003/Bedroom	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 217	-1	001/Stairs	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 217	-1	002/Kitchen/Living room	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 217	0	001/ Entrance Lobby	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 217	0	001/ Entrance Lobby	panel around electric cupboard	Asbestos-containing insulating board	R3 (6)	Remove
Bacton Low Rise, Block H - Flat 219	0	001/Stairs	panel to electrics	Asbestos-containing insulating board	R3 (6)	Remove

table continued from previous page...

Building	Level	Location	Item / Product Examined	Material Description	Risk Level (Material Score)	Initial Control Recommendation
Bacton Low Rise, Block H - Flat 219	0	001/Stairs	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 219	1	001/Stairs	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 219	1	002/Kitchen/Living room	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 219	2	001/ Stairs	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 219	2	002/Bedroom	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 219	2	003/Bedroom	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 219	3	001/Stairs	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 219	3	002/Bathroom	adhesive to concrete floor	Asbestos-containing bitumen adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 219	3	003/Bedroom	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove
Bacton Low Rise, Block H - Flat 219	4	001/Bedroom	floor covering	Asbestos-containing vinyl tile & adhesive	R3 (3)	Remove

### Summary of Areas Excluded & Not Fully Accessed During Survey

Building	Level	Location	Item / Product Examined	Accessibility	Access Comments
Nothing to report					

## Introduction

This report aims to:

- Introduce pertinent legislation relating to the management of asbestos in non-domestic premises
- Outline the sample testing and inspection methodology employed by the surveyor
- Relate the significance of the report contents to the Control of Asbestos Regulations (2012)
- Detail survey findings compliant with HSG 264
- Serve as a reference document to assist in making further steps towards the management of any asbestos containing materials in the premises
- Provide the information necessary to compile an asbestos management plan compliant with the Control of Asbestos Regulations (2012)
- Form an asbestos register

Regulation 4 of the Control of Asbestos Regulations (2012) states the obligations that persons defined as "duty holders" have to manage asbestos containing materials in non-domestic premises. This instrument defines a duty holder as being:

*"Every person who has, by virtue of a contract or tenancy, an obligation of any extent in relation to the maintenance or repair of non-domestic premises or any means of access thereto or egress there from; or*

*In relation to any part of non-domestic premises where there is no such contract or tenancy, every person who, to any extent, has control of that part of non-domestic premises or any means of access thereto or egress there from" - **CAR, 2012.***

Regulation 4 also states the following:

*"In order to enable him [sic "dutyholder"] to manage the risk from asbestos in non-domestic premises, the dutyholder shall ensure that a suitable and sufficient assessment is carried out as to whether asbestos is or is liable to be present in the premises"*

This report satisfies this requirement, unless stated otherwise, by detailing the inspection findings reporting the presence of asbestos containing materials in those areas given in the survey inspection detail.

Health and Safety Guidance - Publication "Asbestos: The Survey Guide (HSG 264)" details the material assessment that must be carried out to determine the risk posed by asbestos containing materials in buildings. This material risk assessment has been carried out on those materials strongly presumed or proven to contain asbestos. The resulting material assessment risk ratings can (in conjunction with the management recommendation made for these materials) then be used to form the basis of an asbestos management plan.

Where possible the surveyor has attempted to interpret the needs of the client in their demolition works however the reader must satisfy themselves that the report includes those areas affected by demolition works.

## Buildings Included in Survey Scope

Site Address: **Block H, Bacton Low Rise, Haverstock Road, London, NW5 4PS**

Surveyed Buildings: **Bacton Low Rise, Block H - Communal Area, Bacton Low Rise, Block H - Flat 203, Bacton Low Rise, Block H - Flat 204, Bacton Low Rise, Block H - Flat 205, Bacton Low Rise, Block H - Flat 206, Bacton Low Rise, Block H - Flat 207, Bacton Low Rise, Block H - Flat 208, Bacton Low Rise, Block H - Flat 209, Bacton Low Rise, Block H - Flat 210, Bacton Low Rise, Block H - Flat 210, Bacton Low Rise, Block H - Flat 211, Bacton Low Rise, Block H - Flat 211, Bacton Low Rise, Block H - Flat 212, Bacton Low Rise, Block H - Flat 212, Bacton Low Rise, Block H - Flat 213, Bacton Low Rise, Block H - Flat 213, Bacton Low Rise, Block H - Flat 214, Bacton Low Rise, Block H - Flat 214, Bacton Low Rise, Block H - Flat 215, Bacton Low Rise, Block H - Flat 215, Bacton Low Rise, Block H - Flat 217, Bacton Low Rise, Block H - Flat 217, Bacton Low Rise, Block H - Flat 219, Bacton Low Rise, Block H - Flat 219**

Every effort has been made to identify all asbestos materials so far as was reasonably practical to do so within the scope of the survey and the attached report. Methods used to carry out the survey were agreed with the client prior to any works being commenced by way of acceptance of our contract / quotation.

This survey was conducted in accordance with Health and Safety Guidance - Publication "Asbestos: The Survey Guide (HSG 264)". Lucion Environmental Ltd cannot accept any liability for loss, injury, damage or penalty issues that arise for reasons of survey scope limitations. Lucion Environmental Ltd cannot be held responsible for any damage caused as part of this survey carried out on your behalf. Due to the nature and necessity of sampling for asbestos some damage is unavoidable and will be limited to that necessary for taking of the samples.

The "areas excluded and not fully accessed during survey" section of this report gives details of those buildings, locations and items not accessed at the time of the survey (where appropriate, and if all areas were fully accessed, no items are listed). The "included buildings" list above gives details of those buildings included in the survey scope. The inspection log should be referenced for details of specific locations inspected within these buildings.

The scope of this survey relates only to building or area(s) inspected and does not include any form of investigation of the land on which the building is situated.

Where investigation of an intrusive nature (within the scope of the survey being performed) is needed to discern the presence of a material and the property is occupied during the inspection the level of intrusion may be restricted. As far as is reasonably practicable such restrictions will be indicated within the "areas excluded & not fully accessed during survey" section of this report. Scenarios leading to intrusion restriction may [by way of example] include (but are not limited to) security integrity of the building envelope, significant damage to decorative finishes, risk to the structural integrity of the building, occupation within adjacent areas. Investigations undertaken in such situations may, through circumstantial restrictions, be incomplete. Further investigation works may be required once unrestricted access can be offered.

**Items or areas not covered by this survey that are scheduled to undergo demolition should be investigated prior to commencement of such activities.**

## Site Data

Site ID	91577
Address	Block H, Bacton Low Rise, Haverstock Road, London, NW5 4PS
Property Type	Domestic
Property Build Date	mixed construction age
Property Number of buildings	1
Property Number of rooms	5-10
Property Size	Unknown
Property Construction type	Traditional
Roof Type	Mixed types
Roof Material	Slated or tiled
Property access notes	Access arranged with tenant
Property access restrictions	none
Property unusual features	none
Property in Conservation area?	NO
Listed Building?	NO
Property Plant or equipment installed?	YES

## Survey Methodology

The asbestos survey findings detailed in this report were gathered using documented in house inspection (TOP01.01) and sampling procedures (TOP01.02) that implement the requirements of the Health and Safety Executive Publications HSG 264 (Asbestos: The survey guide) and HSG 248 (Asbestos: The analysts' guide for sampling, analysis and clearance procedures). All asbestos surveys aim to locate as far as is reasonable practical, the presence and extent of any ACMs in the building within the defined scope of the survey (refer HSG 264). This method complies with section 3 of Regulation 4 (CAR, 2012)

## HSG 264 Asbestos: The Survey Guide

Publication HSG 264 sub-divides asbestos surveys into 2 principal types, termed: Management and Refurbishment & Demolition surveys respectively. These survey types may be summarised as follows (both have been shown to allow visualisation of the scope of the present management survey relative to the refurbishment & demolition survey specification and their suggested application/s).

### Management Survey - Standard Sampling, Identification and Assessment

The underlying purpose and inspection methodology of the management survey is to locate the presence, extent and condition by way of sampling and inspection of suspect asbestos containing materials as they are encountered. Where possible, representative samples of materials suspected by the surveyor to contain asbestos are taken and analysed for the presence and type of asbestos fibre present. This survey is intended for integration into a plan for the management of asbestos containing materials under Regulation 4 of CAR (2012). The management surveys offers information allowing routine and simple maintenance works to be carried and this reflects the surveyor's level of intrusion at the time of the inspection. More extensive maintenance or repair work may require additional investigations to be undertaken; the findings of this survey should be checked with this in mind to confirm whether or not they of adequate scope.

### Demolition Survey - Full Access, Sampling and Identification

The refurbishment and demolition survey is fully intrusive (as far as is reasonably practicable) and is aimed at locating all asbestos containing materials within a survey area. Normally, unless otherwise specified (*refer to the Method Statement as listed in **Annotated Plans and Other Additional Documents** section of this document*), it involves fully invasive and possibly destructive investigation of all survey areas, in order to locate and assess all materials suspected as containing asbestos. The survey records only the location and estimated extent of asbestos containing materials. A priority rating has been assigned to asbestos containing materials encountered during the course of the inspection to aid ongoing management of these materials prior to refurbishment (*HSG 264 states a duration in excess of 3 months as requiring ongoing management of ACMs*). Recommendations made for material management are based solely on isolated item inspection and material assessment and may be subject to change in the context of the overall refurbishment works. However the surveyor will default to "remove" as a recommendation within a refurbishment survey. This type of survey is normally recommended prior to refurbishment work commencing in the survey area. There is a specific requirement in CAR (2012) (Regulation 7) for all asbestos containing materials to be removed as far reasonably practicable before demolition.



## Survey Methodology - Important Notes

### Reasonable Skill and Care

Although all survey areas that have been examined are reported in accordance with HSG 264 and documented in house procedures (for the specified survey type) and all reasonable skill and care has been exercised by the surveyor in doing so, it must be realised that no survey can reasonably guarantee beyond doubt that all asbestos containing materials have been located. Reasons for this limitation may include health and safety issues, reasons of practicality, non-access to live equipment and dangerous or contaminated environments or risk of unsafe levels of damage being inflicted on the survey area amongst others, or the location of the material being outside the investigative scope of the survey type undertaken.

### Non-asbestos Materials - A Reasoned Argument

All items examined by the surveyor at the time of the survey are listed in the inspection detail of this report. This detail includes those items believed by the surveyor not to contain asbestos and an appropriate categorisation of their material composition is given. Employing this rationale the surveyor can use experience and judgement to form a reasoned argument that there is evidence to suggest that the material may not contain asbestos. Periodically "non-asbestos" building materials may be sampled by way of a method control to further support the surveyor's argument. These materials do not bear any risk assessment detail.

### Materials Presumed to Contain Asbestos

If the surveyor feels that a reasoned argument against a material containing asbestos cannot be formed, the item in question may be presumed to contain asbestos. This may include, but is not restricted to, areas where access cannot be gained. This scenario attracts the designation "P" in the sampling strategy column of the "Survey Inspection Detail, Sample Test Report and Risk Level Assessment Report" table within this report.

### Materials Strongly Presumed to Contain Asbestos

In the case of a material or materials being encountered that the surveyor suspects, following visual assessment, as containing asbestos but cannot be sampled for reasons of practicality, that material is strongly presumed to contain asbestos. An assessment (where possible) of the material's extent and condition is made. Nota bene: as no definitive assessment of asbestos fibre type contained in the material may be made, this portion of the priority score is based on a strongly presumed worst-case scenario of fibre type commonly contained in the material concerned. This scenario attracts the designation "SP" in the sampling strategy column of the "Survey Inspection Detail, Sample Test Report and Risk Level Assessment Report" table within this report.

### Sampling of Materials

If access to the material permits, a representative sample of the material is taken according to the "sampling strategy". An assessment (where necessary or possible) of the material's extent and condition is made. As no practical sampling strategy can be assured as being entirely representative of the circumstances encountered during surveying, care should be exercised when interpreting results. That is to say that if works are planned that may cause disturbance or require the removal of asbestos containing materials, implementation of a more intense sampling regime may be desirable.

## Material Cross Referencing

In the event of a suspect material being encountered with a frequency that does not permit repeated re-sampling on the grounds of practicality, the surveyor may cross reference this item with one that has already been sampled. To do this the surveyor will ensure that the material is identical in nature (through examining visual appearance e.g. colour) to that of the material to which it is referenced. Nota bene: as no definitive assessment of asbestos fibre type contained in the material may be made, this portion of the priority score is strongly presumed as being the same as that of the material from which it is cross referenced.

## Method of Sample analysis

The bulk asbestos fibre identification results detailed in this report and the appended certificate of bulk analysis were obtained using a documented in house testing procedure (TOP01.03) that implements the requirements of Health and Safety Executive Publication HSG 248, Appendix 2 (Asbestos: The analysts' guide for sampling, analysis and clearance procedures). All samples collected during the course of this survey are tested in accordance with this method.

## HSG 248 Asbestos: The Analysts' Guide for Sampling, Analysis and Clearance Procedures

Publication HSG 248 describes a two stage approach to the detection and subsequent identification of asbestos fibre in bulk (i.e. suspect sample) materials. Initially the microscopist will examine the material under a low power stereo light microscope. The microscopist then performs extensive optical tests using polarised light microscopy in order to confirm or refute that the material contains an asbestos mineral. This technique allows for the detection of the six common forms of asbestos fibre as follows:

Asbestos Fibre Type	Common Nomenclature
Chrysotile	White Asbestos
Amosite	Brown Asbestos
Crocidolite	Blue Asbestos
Fibrous Actinolite	N/A
Fibrous Anthophyllite	N/A
Fibrous Tremolite	N/A

The results of this test are given, where appropriate, in the inspection detail report for each sample taken and are summarised in the management recommendation report. They are also separately detailed in the bulk-analysis report appended to this report. The homogeneity of asbestos containing materials can differ depending on their type. Typically, homogeneous materials include sprayed coatings, insulating board and asbestos cement products. Other materials are typically less homogeneous including pipe lagging (due to patch repairs, hand mixing at time of application), textured coatings (due to low concentration of asbestos fibre and hand application), composites (due to low concentration of asbestos fibre and material matrix) and debris samples (due to the potentially inconsistent occurrences that have led to their presence). Whilst sampling frequencies / techniques and analysis methods attempt to address the issue of non-homogeneity it should be realised that sampling in accordance with HSG 264 and analysis in accordance with HSG 248 cannot always obviate the problems of determining asbestos fibre content in non-homogeneous materials. The results of sample analysis presented in this report therefore pertain to the samples analysed and so relate only to the time at which sampling took place and to the conditions prevailing during that time.

## Sampling Strategy

Product Type	Sampling Strategy
Vinyl, composite floor coverings, surface coverings	One sample per room, or one sample per 40m <sup>2</sup> per product type or colour. Where large expanses of the same material have been used throughout an area, the frequency of sampling may be decreased at the discretion of the surveyor. Associated adhesives, depending on site and material conditions, will either be collected as separate samples or included with the floor covering as a single entity.
Textured Coatings	One composite sample per room or one sample per 9m <sup>2</sup> dependent on similarity of coating type. Where large expanses of the same material have been used throughout an area. The frequency of sampling may be increased or decreased at the discretion of the surveyor.
Gaskets, ropes, woven product, seals, mastics, papers, felts	One sample per product type, or if appropriate, per area or location.
Asbestos containing insulating board	One sample per location or per 25m <sup>2</sup> of continuous product run. The frequency of sampling may be increased or decreased at the discretion of the surveyor dependent on such factors as consistency of product type or occurrence of different board types. The specific nature of this material has been determined on site using the competence and experience of the surveyor. Lucion Environmental accepts no liability for any decision based on this determination and as such it should only be regarded as an opinion. Where doubt exists as to the classification of a board material HSE Approved Code of Practice L143 "Managing and working with asbestos" recommends carrying out a water absorption test. Lucion Environmental will perform this test only upon specific request.
Cement Products	One sample per product type, or if appropriate, per area or location. The specific nature of this material has been determined on site using the competence and experience of the surveyor. Lucion Environmental accepts no liability for any decision based on this determination and as such it should only be regarded as an opinion. Where doubt exists as to the classification of a board material HSE Approved Code of Practice L143 "Managing and working with asbestos" recommends carrying out a water absorption test. Lucion Environmental will perform this test only upon specific request.
Debris	One sample per location, or more at the discretion of the surveyor. Where debris exists in a location quantification can be hindered by a number of factors including paint coverings, air movement, the passage of time etc. The surveyor reports only the material discernable within the confines of the survey sufficient to show that debris exists in a location. Further focused investigation may be needed to determine the extent of debris for the purposes of decontamination.
Insulative Materials	One sample per material product type (to include change in outward appearance) and at least one sample per 10 metre pipe run. In addition, one sample per different product applied to pipe bends.
Sprayed Insulation	One sample per 20m <sup>2</sup> of material

## Results and Findings

The item examination and inspection findings, bulk analysis results, material assessment and initial risk level assessment are reported in the form of an asbestos inspection and testing detail register. The purpose and structure of this register are explained in the proceeding sections.

### Initial Risk Level Assessment

The initial risk level assessments made within this report for those items strongly presumed, or positively proven by sampling and subsequent analysis, to contain asbestos have been made on the basis of the Material Assessment Algorithm detailed within the publications HSG 264 and HSG 227.

This assessment aims to elucidate the potential for a particular material to release hazardous fibres and expose those within the specific area to asbestos dust. The following table gives the scoring strategy for the initial risk level assessment and indicates the scoring degree of those points that are considered, namely product type, condition, surface treatment and asbestos fibre type present.

	Score	Score Category
<b>Product Type</b> An assessment of the inherent risk a product may pose (Product debris is assessed on the product type from which it originates)	1	<b>Asbestos reinforced composites</b> - Plastics / resins / mastics / felts / vinyl tiling / semi rigid paints / decorative finishes / asbestos cement and other such similar bound materials.
	2	<b>Materials of a medium asbestos content including</b> - Asbestos insulating board / millboard / low density insulation board / textiles / gaskets / ropes / papers / debris from asbestos containing composite material and cement.
	3	<b>Materials of a high asbestos content including</b> - Thermal insulation / sprayed asbestos / loose asbestos / packing / filled padding / all other debris.
<b>Material Condition</b> An assessment of the damage or deterioration in condition of product	0	<b>Undamaged</b> - No visible signs of damage
	1	<b>Minor damage</b> - Light material surface abrasion / abrasion to edges
	2	<b>Medium damage</b> - Evidence of loose asbestos fibre protruding from material / poor condition of material is notable
	3	<b>Major damage</b> - Significant damage to materials often resulting in the short-term production of asbestos containing debris / delamination of sprays and thermal insulation / asbestos debris

table continued from previous page...

	Score	Score Category
<p><b>Surface Treatment</b></p> <p>An assessment of the level of fibre retention the surface of a material may be capable of</p>	0	<b>Composite materials</b> - Plastics / resins / mastics / felts / vinyl tiling / semi rigid paints / decorative finishes
	1	<b>Sealed and enclosed materials</b> - Painted asbestos insulating board (with exposed face painted or encapsulated) / enclosed asbestos lagging and sprayed asbestos (as originally installed) / unsealed asbestos cement products
	2	<b>Unsealed and encapsulated materials</b> - Unsealed asbestos insulating board / asbestos lagging, sprayed asbestos and woven material encapsulated (remedially)
	3	<b>Unsealed friable materials</b> - Unsealed asbestos lagging and sprayed asbestos
<p><b>Asbestos Fibre Type</b></p> <p>An assessment of asbestos fibre types propensity to cause asbestos related diseases</p>	1	<b>Serpentine Asbestos</b> - Chrysotile
	2	<b>Amphibole Asbestos</b> - Amosite / Anthophyllite / Tremolite / Actinolite
	3	<b>Amphibole Asbestos</b> - Crocidolite

## Material / Accessibility Score

Following the rating of a material using the above criteria, the resulting aggregated additive material score may be assessed in terms of accessibility to derive an assessment of initial risk level as follows:

	Very Low Risk (2-4)	Low Risk (5-6)	Medium Risk (7-9)	High Risk (10-12)
Normally Inaccessible (1)	R3	R3	R3	R2
Periodically Accessed (2)	R3	R3	R2	R1
Frequently Accessed (3)	R3	R2	R1	R1

The level of access to the ACM determines how easily the product can be reached by the building occupants which could result in a disturbance that causes fibre release, it relates purely to access and does not consider product type.

The above is defined by the following:

1. Normally inaccessible or occasionally accessed:

The ACM will not be accessed or is unlikely to be disturbed.

2. Periodically accessed:

The ACM is likely to be disturbed occasionally.

3. Frequently accessed:

The ACM is routinely and easily disturbed.

## General Interpretation of Risk Assessment Level

Risk Assessment Level	Interpretation of the Recommended Control Action
R1	immediate implementation
R2	as soon as practicable - <i>in interim period material should be regularly inspected and its management planned for</i>
R3	not immediately necessary - <i>material should be regularly inspected and its management planned for</i>

## Recommendations

In addition to the risk assessment level assigned to strongly presumed and identified asbestos containing material, a management control action recommendation is also made. In the case of survey carried out prior to refurbishment or demolition works, the "normal" recommendation will be "remove" as the surveyor assumes that asbestos removal will take place prior to other works commencing (unless the surveyor has been advised otherwise in advance of the survey). However in certain circumstances another recommendation may be made and those commonly used are given in the recommendations table.

The current recommendations conventionally made by the surveyor may include the following:

Recommendation	Description	Notes
Air Monitoring	Sampling of air for asbestos fibre concentration. Necessary where a risk of fibre exposure is present and assessment of such exposure presence or absence is prudent.	UKAS accredited analytical laboratory should perform reassurance air testing.
Access Restriction	Restriction of access to area / location only to personnel wearing appropriate PPE / RPE.	Suitability of RPE / PPE must be carefully assessed and procedure invoked to ensure these control measures are adhered to.
Access Prohibition	Prohibition of access to area / location to all personnel.	Area should be marked clearly as being prohibited to all personnel, possibly in conjunction with asbestos warning stickers.
Environmental Clean	A cleanup of areas following disturbance of asbestos or discovery of loose asbestos dust/debris/material.	The work is not removal (ie requiring physical force) and consists of vacuuming, wiping, picking up and bagging of debris. The work can be either licensed or unlicensed depending on the product and whether exposure is likely to exceed the 4 hour control limit or sporadic and low intensity limit. For licensed work a 4-stage clearance by a UKAS accredited laboratory is required, whilst for non-licensed work appropriate air tests are recommended.
Material Repair	Repair of the material in such a manner as to minimise the release of asbestos fibre.	Repair of materials is recommended by the Health and Safety Executive as an alternative to removal, where reasonably safe to so.
Material Encapsulation	Encapsulation of the material in a manner that ensures the complete enclosure of any remaining asbestos fibres.	Encapsulation of materials is a possible alternative to their removal, where reasonably safe to do so. Works should also be accompanied by appropriate air test performed by a UKAS accredited laboratory.
Material Removal	Removal of the material in instances where it is remaining in situ would lead to a high residual risk level. Or removal may be necessary to permit work within the location. Removal of materials may also be carried out on a preventive basis.	Removal works should be carried out in accordance with the relevant ACOP (approved code of practice), L143
<p><i>Any recommendations made within this report are made on the basis of findings collated at the time of survey. Recommendations should undergo careful client evaluation prior to a final management decision being made. Lucion Environmental Ltd does not accept any responsibility for any works carried out as a result of recommendations made within this report.</i></p>		



## Cited References and Further Reading

1. Control of Asbestos Regulations (2012) ~ The Stationery Office. **ISBN 978-0111521083**
2. Construction (Design and Management) Regulations (2015) ~ The Stationery Office. **ISBN 9780717666263**
3. The Hazardous Waste (England and Wales) Regulations (2005) ~ The Stationery Office. **ISBN 011072685-5**
4. Managing and working with asbestos Control of Asbestos Regulations 2012. Approved Code of Practice & guidance L143 (second edition, 2013) ~ HSE Books. **ISBN 978-0717666188**
5. A Comprehensive Guide to Managing Asbestos in Premises (2002) ~ HSE Books. **ISBN 978-0717623815**
6. Asbestos Essentials: A task manual for building, maintenance and allied trades of non-licensed asbestos work (third edition, 2012) ~ HSE Books. **ISBN 978-0717665037**
7. [Asbestos Essentials Task Sheets \[ http://www.hse.gov.uk/asbestos/essentials/ \]](http://www.hse.gov.uk/asbestos/essentials/) ~ HSE. *electronic downloadable version of the above*
8. Asbestos: The licensed contractors' guide HSG247 (2006) ~ HSE Books. **ISBN 978-0717628742**
9. Asbestos: The analysts' guide for sampling, analysis and clearance procedures HSG248 (2005) ~ HSE Books. **ISBN 978-0717628759**
10. Asbestos: The Survey Guide HSG 264 (second edition, 2012) ~ HSE Books. **ISBN 978-0717665020**
11. The Management of Health and Safety at Work Regulations (1999) ~ The Stationery Office. **ISBN 011085625-2**
12. The Health & Safety at Work etc. Act (1974) ~ The Stationery Office.

# Management Recommendation Detail




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Communal Area	1	001/ Walkway	panels around electric meter cupboards	126253-2	Asbestos-containing insulating board	Amosite, Chrysotile	6	9x 2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 203	0	001/ Entrance Lobby	boxing around electric	126253-6	Asbestos-containing insulating board	Amosite, Chrysotile	7	2 Sqm.	R1	Remove	
Bacton Low Rise, Block H - Flat 203	0	001/ Entrance Lobby	adhesive to concrete floor	126253-5	Asbestos-containing bituminous product	Chrysotile	3	4 Sqm.	R3	Remove	

table continued from previous page...



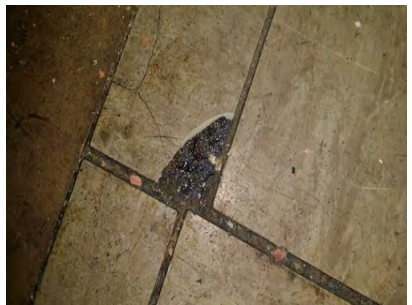
Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 203	1	001/ Stairs	adhesive to concrete floor	126253-5	Asbestos-containing bituminous product	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 203	1	002/ Kitchen & Lounge	adhesive to concrete floor	126253-5	Asbestos-containing bituminous product	Chrysotile	3	14 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 203	2	001/ Stairs	adhesive to concrete floor	126253-5	Asbestos-containing bituminous product	Chrysotile	3	2 Sqm.	R3	Remove	

table continued from previous page...



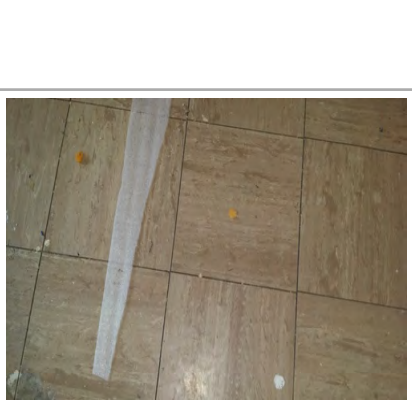

Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 203	2	002/ Bedroom	floor covering	126253-8	Asbestos-containing floor tiles & bituminous product	Chrysotile	3	6 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 203	2	003/ Bedroom	floor covering	126253-8	Asbestos-containing floor tiles & bituminous product	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 203	3	001/ Stairs	floor covering	126253-4	Asbestos-containing floor tiles & bituminous product	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 203	3	001/ Stairs	floor covering	126253-5	Asbestos-containing floor tiles & bituminous product	Chrysotile	3	2 Sqm.	R3	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 203	3	002/ Bedroom	floor covering	126253-5	Asbestos-containing floor tiles & bituminous product	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 203	3	003/ Bathroom	adhesive to concrete floor	126253-5	Asbestos-containing bituminous product	Chrysotile	3	4 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 203	4	001/ Bedroom	floor covering	126253-8	Asbestos-containing floor tiles & bituminous product	Chrysotile	3	12 Sqm.	R3	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 204	0	001/ Entrance Lobby	boxing around electric	126253-2	Asbestos-containing insulating board	Amosite, Chrysotile	6	2 Sqm.	R2	Remove	
Bacton Low Rise, Block H - Flat 204	0	001/ Entrance Lobby	adhesive to concrete floor	126253-1	Asbestos-containing bituminous product	Chrysotile	3	4 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 204	1	001/ Stairs	adhesive to concrete floor	126253-1	Asbestos-containing bituminous product	Chrysotile	3	2 Sqm.	R3	Remove	



table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 204	1	002/ Kitchen & Lounge	adhesive to concrete floor	126253-1	Asbestos-containing bituminous product	Chrysotile	3	14 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 204	2	001/ Stairs	adhesive to concrete floor	126253-1	Asbestos-containing bituminous product	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 204	2	002/ Bedroom	floor covering	126253-4	Asbestos-containing floor tiles & bituminous product	Chrysotile	3	12 Sqm.	R3	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 204	2	003/ Bedroom	floor covering	126253-4	Asbestos-containing floor tiles & bituminous product	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 204	3	001/ Stairs	floor covering	126253-4	Asbestos-containing floor tiles & bituminous product	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 204	3	002/ Bedroom	floor covering	126253-4	Asbestos-containing floor tiles & bituminous product	Chrysotile	3	12 Sqm.	R3	Remove	



table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 204	3	003/ Bathroom	adhesive to concrete floor	126253-4	Asbestos-containing bituminous product	Chrysotile	3	4 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 204	3	004/ Toilet	adhesive to concrete floor	126253-4	Asbestos-containing bituminous product	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 204	4	001/ Bedroom	floor covering	126253-4	Asbestos-containing floor tiles & bituminous product	Chrysotile	3	12 Sqm.	R3	Remove	

table continued from previous page...


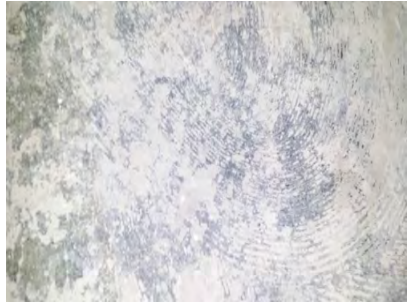

Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 205	-3	001/Stairs & Cupboard	bitumen to concrete floor	126253-9	Asbestos-containing bitumen adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 205	-3	002/Bathroom	bitumen to concrete floor	126253-9	Asbestos-containing bitumen adhesive	Chrysotile	3	8 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 205	-3	003/Bedroom	panel to shelf	126253-10	Asbestos-containing insulating board	Amosite, Chrysotile	6	2 Sqm.	R3	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 205	-3	003/Bedroom	bitumen to concrete floor	126253-9	Asbestos-containing bitumen adhesive	Chrysotile	3	8 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 205	-2	001/Stairs	bitumen to concrete floor	126253-9	Asbestos-containing bitumen adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 205	-2	002/Bedroom 1	bitumen to concrete floor	126253-9	Asbestos-containing bitumen adhesive	Chrysotile	3	8 Sqm.	R3	Remove	

table continued from previous page...


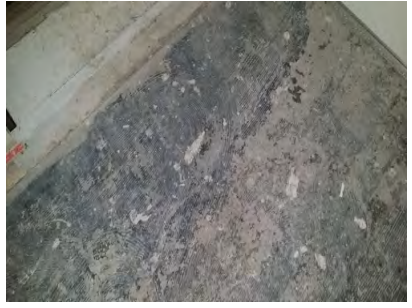

Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 205	-2	003/ Bedroom 2	bitumen to concrete floor	126253-9	Asbestos-containing bitumen adhesive	Chrysotile	3	8 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 205	-1	001/Stairs	bitumen to concrete floor	126253-9	Asbestos-containing bitumen adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 205	-1	002/ Kitchen/ Living room	bitumen to concrete floor	126253-9	Asbestos-containing bitumen adhesive	Chrysotile	3	12 Sqm.	R3	Remove	

table continued from previous page...

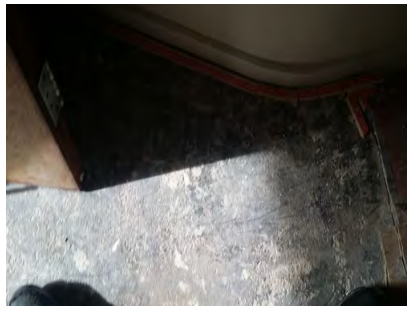
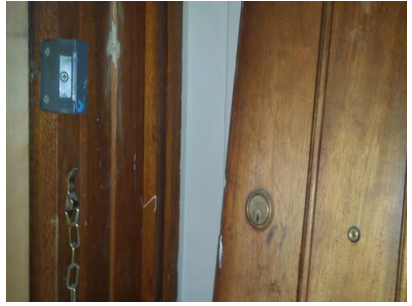

Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 205	0	001/ Entrance Lobby	bitumen to concrete floor	126253-9	Asbestos-containing bitumen adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 205	0	001/ Entrance Lobby	panel to electrics	126253-10	Asbestos-containing insulating board	Amosite, Chrysotile	6	2 Lm.	R3	Remove	
Bacton Low Rise, Block H - Flat 206	0	001/ Entrance Lobby	panel to electrics	126253-13	Asbestos-containing insulating board	Amosite, Chrysotile	6	2 Lm.	R3	Remove	



table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 206	0	001/ Entrance Lobby	floor covering	126253-12	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 206	1	001/Stairs	floor covering	126253-12	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 206	1	002 /Kitchen / Living room	boxing within cupboard	126253-14	Asbestos-containing insulating board	Amosite, Chrysotile	6	4 Sqm.	R2	Remove	

table continued from previous page...



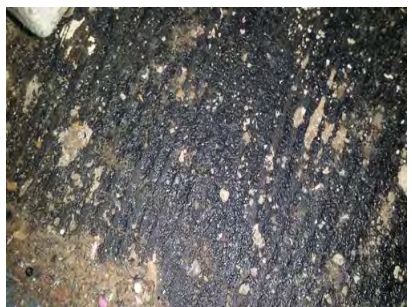
Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 206	1	002 /Kitchen / Living room	floor covering	126253-12	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 206	1	002 /Kitchen / Living room	panels to shelves	126253-14	Asbestos-containing insulating board	Amosite, Chrysotile	7	2 Sqm.	R1	Remove	
Bacton Low Rise, Block H - Flat 206	2	001/Stairs	adhesive to concrete floor	126253-12	Asbestos-containing bitumen adhesive	Chrysotile	3	2 Sqm.	R3	Remove	

table continued from previous page...



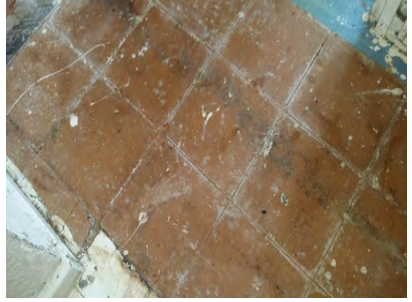
Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 206	2	002/Bedroom 1	floor covering	126253-12	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 206	2	003/Bedroom 2	adhesive to concrete floor	126253-12	Asbestos-containing bitumen adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 206	3	001/Stairs	floor covering	126253-12	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	2 Sqm.	R3	Remove	



table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 206	3	003/ Bathroom	adhesive to concrete floor	126253-12	Asbestos-containing bitumen adhesive	Chrysotile	3	6 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 206	3	003/ Bedroom 3	floor covering	126253-12	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 206	4	001/ Bedroom 4	floor covering	126253-12	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	4 Sqm.	R3	Remove	

table continued from previous page...


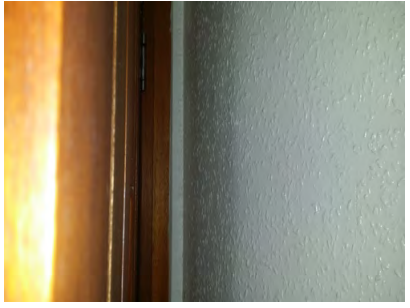

Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 207	0	001/ Entrance Lobby	adhesive to concrete floor	126253-16	Asbestos-containing bituminous product	Chrysotile	3	4 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 207	0	001/ Entrance Lobby	boxing around electric	126253-17	Asbestos-containing insulating board	Amosite, Chrysotile	6	2 Sqm.	R2	Remove	
Bacton Low Rise, Block H - Flat 207	1	001/ Stairs	adhesive to concrete floor	126253-16	Asbestos-containing bituminous product	Chrysotile	3	2 Sqm.	R3	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 207	1	002/ Kitchen/ Living room	panels to shelves	126253-18	Asbestos-containing insulating board	Amosite, Chrysotile	7	2 Sqm.	R1	Remove	
Bacton Low Rise, Block H - Flat 207	1	002/ Kitchen/ Living room	boxing within cupboard	126253-18	Asbestos-containing insulating board	Amosite, Chrysotile	7	4 Sqm.	R2	Remove	
Bacton Low Rise, Block H - Flat 207	1	002/ Kitchen/ Living room	adhesive to concrete floor	126253-16	Asbestos-containing bituminous product	Chrysotile	3	12 Sqm.	R3	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 207	2	001/ Stairs	adhesive to concrete floor	126253-16	Asbestos-containing bituminous product	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 207	2	002/ Bedroom 1	adhesive to concrete floor	126253-16	Asbestos-containing bituminous product	Chrysotile	3	6 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 207	2	003/ Bedroom 2	floor covering	126253-21	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	6 Sqm.	R3	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 207	3	001/Stairs	floor covering	126253-21	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 207	3	002/Bathroom	floor covering	126253-21	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	6 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 207	3	003/Bedroom	floor covering	126253-21	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	10 Sqm.	R3	Remove	



table continued from previous page...


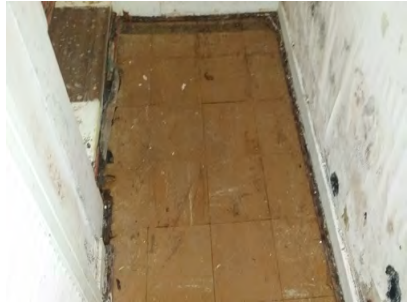

Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 207	4	001/ Bedroom	floor covering	126253-21	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	10 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 208	-3	001/Stairs	floor covering	126253-22	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 208	-3	002/ Bathroom	floor covering	126253-22	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	8 Sqm.	R3	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 208	-3	003/ Bedroom	boxing within cupboard	126253-24	Asbestos-containing insulating board	Amosite, Chrysotile	7	4 Sqm.	R2	Remove	
Bacton Low Rise, Block H - Flat 208	-3	003/ Bedroom	floor covering	126253-22	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 208	-3	003/ Bedroom	panels to shelves	126253-24	Asbestos-containing insulating board	Amosite, Chrysotile	7	2 Sqm.	R1	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 208	-2	001/Stairs/Bedroom	floor covering	126253-22	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 208	-2	002/Bedroom	floor covering	126253-22	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	8 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 208	-1	001/Stairs	floor covering	126253-22	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	4 Sqm.	R3	Remove	



table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 208	-1	002/ Kitchen/ Living room	sub floor	126253-22	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 208	-1	002/ Kitchen/ Living room	boxing within cupboard	126253-24	Asbestos-containing insulating board	Amosite, Chrysotile	7	4 Sqm.	R2	Remove	
Bacton Low Rise, Block H - Flat 208	0	001/ Entrance Lobby	floor covering	126253-22	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	4 Sqm.	R3	Remove	

table continued from previous page...

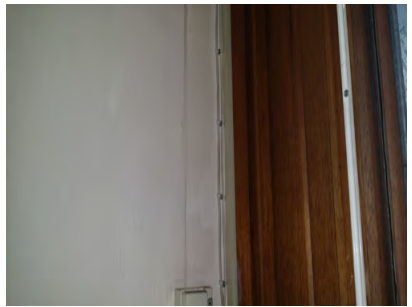


Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 208	0	001/ Entrance Lobby	boxing around electric	126253-23	Asbestos-containing insulating board	Amosite, Chrysotile	6	2 Sqm.	R2	Remove	
Bacton Low Rise, Block H - Flat 209	-3	001/Stairs	adhesive to concrete floor	126253-26	Asbestos-containing bitumen adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 209	-3	002/ Bathroom	toilet cistern	126253-30	Asbestos-containing composite	Amosite	4	1 No.	R3	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 209	-3	002/ Bathroom	adhesive to concrete floor	126253-22	Asbestos-containing bitumen adhesive	Chrysotile	3	8 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 209	-3	003/ Bedroom	floor covering	126253-29	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 209	-3	003/ Bedroom	boxing within cupboard	126253-31	Asbestos-containing insulating board	Amosite, Chrysotile	7	4 Sqm.	R2	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 209	-3	003/Bedroom	panels to shelves	126253-31	Asbestos-containing insulating board	Amosite, Chrysotile	7	2 Sqm.	R2	Remove	
Bacton Low Rise, Block H - Flat 209	-2	001/Stairs/Bedroom	adhesive to concrete floor	126253-26	Asbestos-containing bitumen adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 209	-2	002/Bedroom	floor covering	126253-29	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	8 Sqm.	R3	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 209	-1	001/Stairs	adhesive to concrete floor	126253-26	Asbestos-containing bitumen adhesive	Chrysotile	3	4 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 209	-1	002/ Kitchen/ Living room	adhesive to concrete floor	126253-26	Asbestos-containing bitumen adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 209	0	001/ Entrance Lobby	boxing around electric	126253-27	Asbestos-containing insulating board	Amosite, Chrysotile	6	2 Sqm.	R2	Remove	

table continued from previous page...



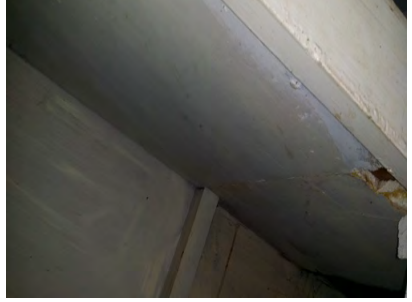
Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 209	0	001/ Entrance Lobby	adhesive backing to concrete floor	126253-26	Asbestos-containing bitumen adhesive	Chrysotile	3	4 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 210	1	001/Stairs	adhesive to concrete floor	126253-34	Asbestos-containing bitumen adhesive	Chrysotile	3	4 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 210	1	002/ Kitchen/ Living room	panel to shelf in cupboard	126253-35	Asbestos-containing insulating board	Amosite, Chrysotile	7	1 Sqm.	R2	Remove	



table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 210	1	002/ Kitchen/ Living room	boxing within cupboard	126253-35	Asbestos-containing insulating board	Amosite, Chrysotile	7	4 Sqm.	R2	Remove	
Bacton Low Rise, Block H - Flat 210	1	002/ Kitchen/ Living room	adhesive to concrete floor	126253-34	Asbestos-containing bitumen adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 210	2	001/ Stairs	adhesive to concrete floor	126253-34	Asbestos-containing bituminous product	Chrysotile	3	2 Sqm.	R3	Remove	



table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 210	2	001/Stairs/Bedroom	adhesive to concrete floor	126253-32	Asbestos-containing bitumen adhesive	Chrysotile	3	8 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 210	2	002/Bedroom	floor covering	126253-32	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 210	3	001/Stairs	floor covering	126253-34	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	2 Sqm.	R3	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 210	3	002/ Bathroom	toilet cistern	126253-37	Asbestos-containing composite	Amosite	4	1 No.	R3	Remove	
Bacton Low Rise, Block H - Flat 210	3	002/ Bathroom	adhesive to concrete floor	126253-34	Asbestos-containing bitumen adhesive	Chrysotile	3	6 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 210	3	003/ Bedroom	floor covering	126253-32	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	10 Sqm.	R3	Remove	

table continued from previous page...



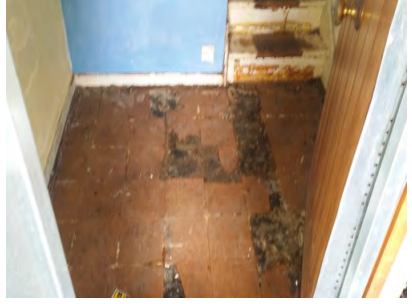
Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 210	4	001/ Bedroom	floor covering	126253-32	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	10 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 211	0	001/ Entrance Lobby	adhesive to concrete floor	126253-38	Asbestos-containing bitumen adhesive	Chrysotile	3	4 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 211	0	001/ Entrance Lobby	floor covering	126253-32	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	4 Sqm.	R3	Remove	

table continued from previous page...

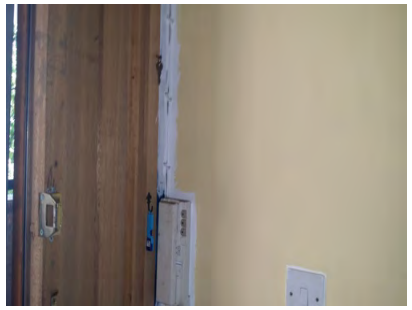


Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 211	0	001/ Entrance Lobby	boxing around electric	126253-33	Asbestos-containing insulating board	Amosite, Chrysotile	6	2 Sqm.	R2	Remove	
Bacton Low Rise, Block H - Flat 211	0	001/ Entrance Lobby	boxing around electric	126253-39	Asbestos-containing insulating board	Amosite, Chrysotile	6	2 Sqm.	R2	Remove	
Bacton Low Rise, Block H - Flat 211	1	001/Stairs	adhesive to concrete floor	126253-38	Asbestos-containing bitumen adhesive	Chrysotile	3	4 Sqm.	R3	Remove	

table continued from previous page...

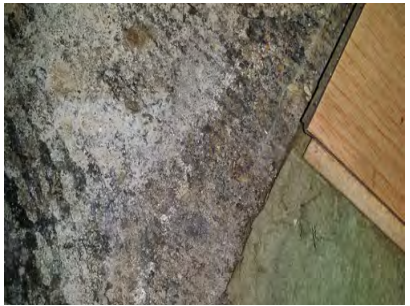

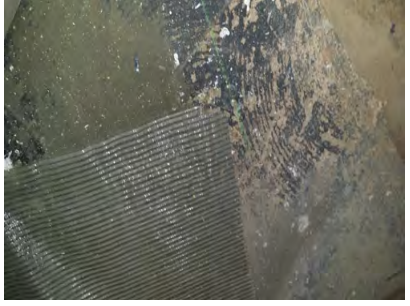
Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 211	1	002/ Kitchen/ Living room	adhesive to concrete floor	126253-38	Asbestos-containing bitumen adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 211	2	001/ Stairs	adhesive to concrete floor	126253-38	Asbestos-containing bituminous product	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 211	2	002/ Bedroom	adhesive to concrete floor	126253-38	Asbestos-containing bitumen adhesive	Chrysotile	3	12 Sqm.	R3	Remove	



table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 211	2	003/Bedroom	floor covering	126253-42	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 211	3	001/Stairs	adhesive to concrete floor	126253-38	Asbestos-containing bitumen adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 211	3	002/Bathroom	toilet cistern	126253-43	Asbestos-containing composite	Amosite	4	1 No.	R3	Remove	



table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 211	3	002/ Bathroom	adhesive to concrete floor	126253-38	Asbestos-containing bitumen adhesive	Chrysotile	3	6 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 211	3	003/ Bedroom	adhesive to concrete floor	126253-38	Asbestos-containing bitumen adhesive	Chrysotile	3	10 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 211	4	001/ Bedroom	adhesive to concrete floor	126253-38	Asbestos-containing bitumen adhesive	Chrysotile	3	10 Sqm.	R3	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 212	-3	001/Stairs	adhesive to concrete floor	126253-44	Asbestos-containing bitumen adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 212	-3	002/Bathroom	adhesive to concrete floor	126253-44	Asbestos-containing bitumen adhesive	Chrysotile	3	8 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 212	-3	003/Bedroom	boxing within cupboard	126253-49	Asbestos-containing insulating board	Amosite, Chrysotile	7	4 Sqm.	R2	Remove	

table continued from previous page...


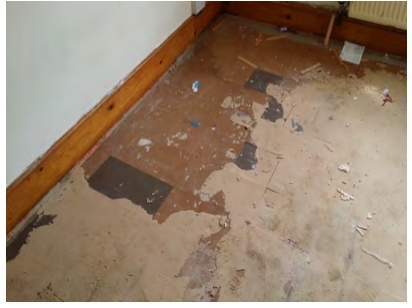

Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 212	-3	003/ Bedroom	panels to shelves	126253-49	Asbestos-containing insulating board	Amosite, Chrysotile	7	2 Sqm.	R2	Remove	
Bacton Low Rise, Block H - Flat 212	-3	003/ Bedroom	floor covering	126253-46	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 212	-2	001/Stairs/ Bedroom	floor covering	126253-46	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	12 Sqm.	R3	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 212	-2	002/ Bedroom	floor covering	126253-46	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 212	-1	001/Stairs	floor covering	126253-46	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 212	-1	002/ Kitchen/ Living room	boxing within cupboard	126253-48	Asbestos-containing insulating board	Amosite, Chrysotile	6	2 Sqm.	R3	Remove	

table continued from previous page...


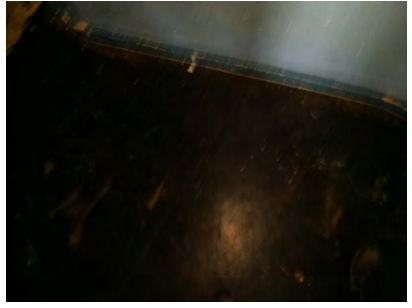
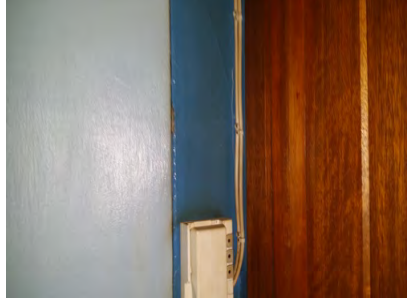
Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 212	-1	002/ Kitchen/ Living room	adhesive to concrete floor	126253-44	Asbestos-containing bitumen adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 212	0	001/ Entrance Lobby	adhesive to concrete floor	126253-44	Asbestos-containing bitumen adhesive	Chrysotile	3	4 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 212	0	001/ Entrance Lobby	boxing around electric	126253-45	Asbestos-containing insulating board	Amosite, Chrysotile	6	2 Sqm.	R2	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 213	-3	001/Stairs	adhesive to concrete floor	126253-50	Asbestos-containing bitumen adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 213	-3	002/Bathroom	adhesive to concrete floor	126253-50	Asbestos-containing bitumen adhesive	Chrysotile	3	8 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 213	-3	003/Bedroom	panels to shelves	126253-52	Asbestos-containing insulating board	Amosite, Chrysotile	7	2 Sqm.	R2	Remove	



table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 213	-3	003/ Bedroom	boxing within cupboard	126253-52	Asbestos-containing insulating board	Amosite, Chrysotile	7	4 Sqm.	R2	Remove	
Bacton Low Rise, Block H - Flat 213	-3	003/ Bedroom	adhesive to concrete floor	126253-50	Asbestos-containing bitumen adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 213	-2	002/ Bedroom	adhesive backing to concrete floor	126253-50	Asbestos-containing bitumen adhesive	Chrysotile	3	12 Sqm.	R3	Remove	

table continued from previous page...


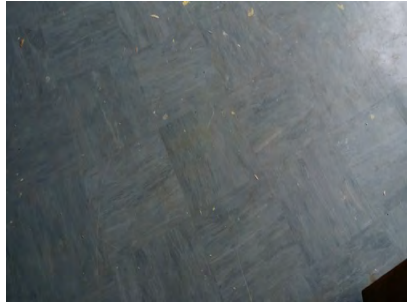

Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 213	-1	001/Stairs	floor covering	126253-50	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 213	-1	002/ Kitchen/ Living room	adhesive to concrete floor	126253-50	Asbestos-containing bitumen adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 213	-1	002/ Kitchen/ Living room	boxing within cupboard	126253-52	Asbestos-containing insulating board	Amosite, Chrysotile	6	2 Sqm.	R3	Remove	

table continued from previous page...

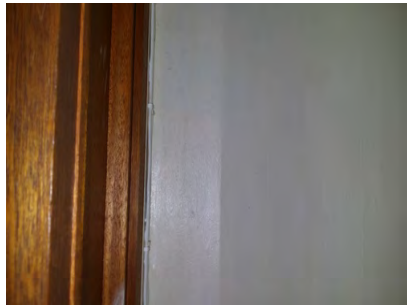
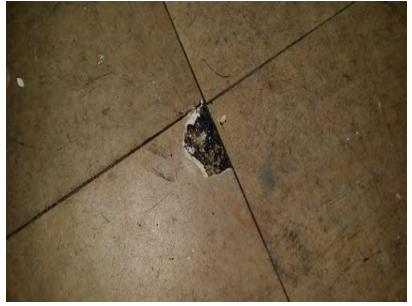

Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 213	0	001/ Entrance Lobby	boxing around electric	126253-51	Asbestos-containing insulating board	Amosite, Chrysotile	6	2 Lm.	R2	Remove	
Bacton Low Rise, Block H - Flat 213	0	001/ Entrance Lobby	adhesive to concrete floor	126253-50	Asbestos-containing bitumen adhesive	Chrysotile	3	4 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 213	2	001/Stairs/ Bedroom	adhesive to concrete floor	126253-50	Asbestos-containing bitumen adhesive	Chrysotile	3	12 Sqm.	R3	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 214	0	001/ Entrance Lobby	boxing around electric	126253-55	Asbestos-containing insulating board	Amosite, Chrysotile	6	2 Sqm.	R2	Remove	
Bacton Low Rise, Block H - Flat 214	0	001/ Entrance Lobby	adhesive to concrete floor	126253-54	Asbestos-containing bitumen adhesive	Chrysotile	3	4 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 214	1	001/Stairs	adhesive to concrete floor	126253-54	Asbestos-containing bitumen adhesive	Chrysotile	3	4 Sqm.	R3	Remove	

table continued from previous page...



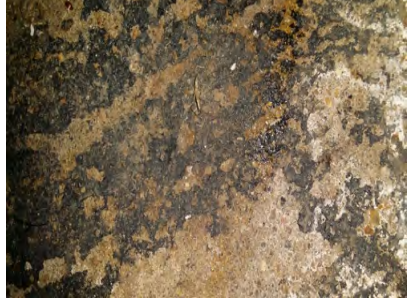
Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 214	1	002/ Kitchen/ Living room	panels to shelves	126253-57	Asbestos-containing insulating board	Amosite, Chrysotile	7	2 Sqm.	R2	Remove	
Bacton Low Rise, Block H - Flat 214	1	002/ Kitchen/ Living room	boxing within cupboard	126253-57	Asbestos-containing insulating board	Amosite, Chrysotile	7	4 Sqm.	R2	Remove	
Bacton Low Rise, Block H - Flat 214	1	002/ Kitchen/ Living room	adhesive to concrete floor	126253-54	Asbestos-containing bitumen adhesive	Chrysotile	3	12 Sqm.	R3	Remove	

table continued from previous page...

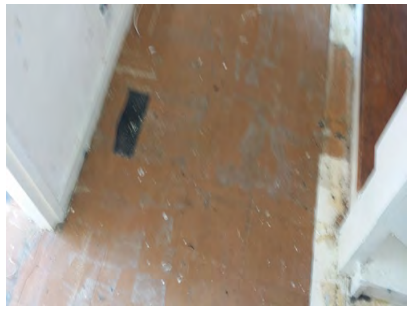

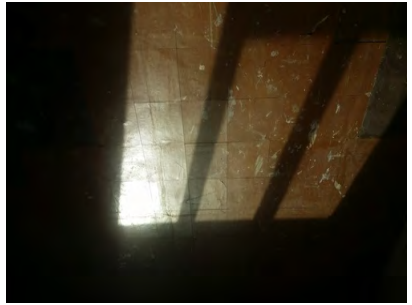
Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 214	2	001/ Stairs	floor covering	126253-58	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 214	2	002/ Bedroom	floor covering	126253-58	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	8 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 214	2	003/ Bedroom	floor covering	126253-58	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	12 Sqm.	R3	Remove	



table continued from previous page...



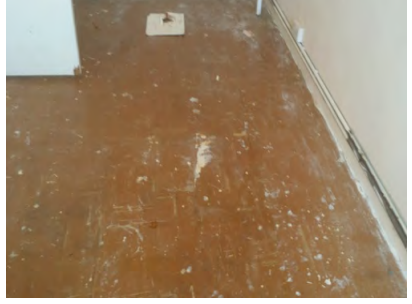
Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 214	3	001/Stairs	floor covering	126253-58	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 214	3	002/Bathroom	adhesive to concrete floor	126253-54	Asbestos-containing bitumen adhesive	Chrysotile	3	6 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 214	3	003/Bedroom	floor covering	126253-58	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	10 Sqm.	R3	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 214	4	001/Bedroom	floor covering	126253-58	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	10 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 215	0	001/Stairs	floor covering	126253-62	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	4 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 215	0	001/Stairs	panel to electrics	126253-63	Asbestos-containing insulating board	Amosite, Chrysotile	6	2 Lm.	R3	Remove	

table continued from previous page...


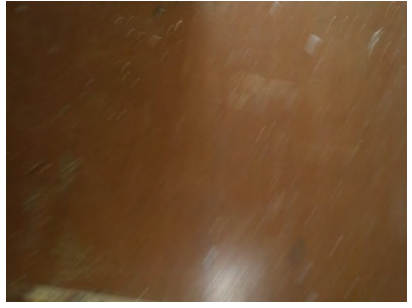

Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 215	1	002/ Kitchen/ Living room	boxing within cupboard	126253-65	Asbestos-containing insulating board	Amosite, Chrysotile	7	4 Sqm.	R2	Remove	
Bacton Low Rise, Block H - Flat 215	1	002/ Kitchen/ Living room	adhesive to concrete floor	126253-54	Asbestos-containing bitumen adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 215	2	001/ Stairs	floor covering	126253-62	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 215	2	002/ Bedroom	floor covering	126253-62	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	8 Sqm.	R3	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 215	2	003/Bedroom	floor covering	126253-62	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 215	3	001/Stairs	floor covering	126253-62	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 215	3	002/Bathroom	adhesive to concrete floor	126253-62	Asbestos-containing bitumen adhesive	Chrysotile	3	6 Sqm.	R3	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 215	3	003/Bedroom	floor covering	126253-62	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	10 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 215	4	001/Bedroom	floor covering	126253-62	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	10 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 217	-3	001/Stairs	adhesive to concrete floor	126253-60	Asbestos-containing bitumen adhesive	Chrysotile	3	2 Sqm.	R3	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 217	-3	002/ Bathroom	adhesive to concrete floor	126253-60	Asbestos-containing bitumen adhesive	Chrysotile	3	8 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 217	-2	001/Stairs	adhesive to concrete floor	126253-60	Asbestos-containing bitumen adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 217	-2	002/ Bedroom	adhesive to concrete floor	126253-60	Asbestos-containing bitumen adhesive	Chrysotile	3	12 Sqm.	R3	Remove	



table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 217	-2	003/Bedroom	adhesive to concrete floor	126253-60	Asbestos-containing bitumen adhesive	Chrysotile	3	12 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 217	-1	001/Stairs	adhesive to concrete floor	126253-60	Asbestos-containing bitumen adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 217	-1	002/ Kitchen/ Living room	adhesive to concrete floor	126253-60	Asbestos-containing bitumen adhesive	Chrysotile	3	12 Sqm.	R3	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 217	0	001/ Entrance Lobby	adhesive to concrete floor	126253-60	Asbestos-containing bitumen adhesive	Chrysotile	3	4 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 217	0	001/ Entrance Lobby	panel around electric cupboard	126253-59	Asbestos-containing insulating board	Amosite, Chrysotile	6	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 219	0	001/Stairs	panel to electrics	126253-68	Asbestos-containing insulating board	Amosite, Chrysotile	6	2 Lm.	R3	Remove	

table continued from previous page...


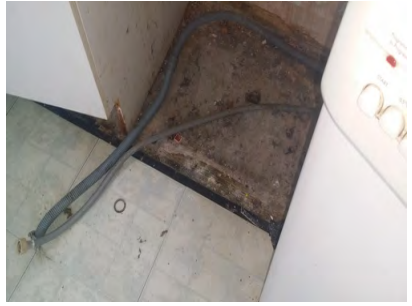

Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 219	0	001/Stairs	floor covering	126253-67	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	4 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 219	1	001/Stairs	floor covering	126253-67	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	4 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 219	1	002/ Kitchen/ Living room	adhesive to concrete floor	126253-67	Asbestos-containing bitumen adhesive	Chrysotile	3	12 Sqm.	R3	Remove	

table continued from previous page...




Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 219	2	001/ Stairs	floor covering	126253-67	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 219	2	002/ Bedroom	floor covering	126253-67	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	8 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 219	2	003/ Bedroom	floor covering	126253-67	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	12 Sqm.	R3	Remove	

table continued from previous page...





Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 219	3	001/Stairs	floor covering	126253-67	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	2 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 219	3	002/Bathroom	adhesive to concrete floor	126253-67	Asbestos-containing bitumen adhesive	Chrysotile	3	6 Sqm.	R3	Remove	
Bacton Low Rise, Block H - Flat 219	3	003/Bedroom	floor covering	126253-67	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	10 Sqm.	R3	Remove	

table continued from previous page...

Building	Level	Location	Item / Product Examined	Sample No.	Material Description	Fibre Type	Material Score	Extent	Risk Level Assessment	Initial Control Recommendation	Photograph
Bacton Low Rise, Block H - Flat 219	4	001/ Bedroom	floor covering	126253-67	Asbestos-containing vinyl tile & adhesive	Chrysotile	3	10 Sqm.	R3	Remove	

## Areas Excluded & Not Fully Accessed During Survey

⊖ Asbestos should be presumed to be present within Locations and Items not accessed until a further assessment can be performed.


💬 Additional surveyor comments.

Building	Level	Location	Item / Product Examined	Accessibility	Surveyor Additional Comments At Time Of Survey	Photograph
Nothing to report						

## Survey Inspection Detail, Sample Test Report and Risk Level Assessment Report

⊖ Asbestos should be presumed to be present within Locations and Items not accessed until a further assessment can be performed.



 Additional surveyor comments.

Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 001/ Garage 90						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	brick										
floor	concrete										
Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 002/ Garage 89						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	brick										
floor	concrete										
Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 003/ Entrance Lobby						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
cladding to entrance door	wood										
Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 004/ Garage 88						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	brick										
floor	concrete										
pipework	metal										
pipe lagging	man made mineral fibre										

Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 005/ Garage 87						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	brick										
floor	concrete										
pipework	metal										
pipe lagging	man made mineral fibre										

Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 006/ Garage 86						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	brick										
floor	concrete										
pipework	metal										
pipe lagging	man made mineral fibre										

Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 007/ Garage 85						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	brick										
floor	concrete										
pipework	metal										
pipe lagging	man made mineral fibre										

Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 008/ Garage 84						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	brick										
floor	concrete										
pipework	metal										

table continued from previous page...

Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 008/ Garage 84						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
pipe lagging	man made mineral fibre										

Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 009/ Garage 83						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	brick										
floor	concrete										
pipework	metal										
pipe lagging	man made mineral fibre										

Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 010/ Garage 82						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	brick										
floor	concrete										
pipework	metal										
pipe lagging	man made mineral fibre										

Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 011/ Garage 81						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	brick										
floor	concrete										
pipework	metal										
pipe lagging	man made mineral fibre										

Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 012/ Garage 80						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	brick										
floor	concrete										
pipework	metal										
pipe lagging	man made mineral fibre										

Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 013/ Garage 79						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	brick										
floor	concrete										
pipework	metal										
pipe lagging	man made mineral fibre										

Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 014/ Garage 78						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	brick										
floor	concrete										
pipework	metal										
pipe lagging	man made mineral fibre										

Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 015/ Garage 75						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	brick										
floor	concrete										
pipework	metal										

table continued from previous page...

Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 015/ Garage 75						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
pipe lagging	man made mineral fibre										

Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 015/ Garage 77						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	brick										
floor	concrete										
pipework	metal										
pipe lagging	man made mineral fibre										

Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 016/ Garage 74						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	brick										
floor	concrete										
pipework	metal										
pipe lagging	man made mineral fibre										

Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 016/ Garage 76						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	brick										
floor	concrete										
pipework	metal										
pipe lagging	man made mineral fibre										

Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 017/ Garage						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	brick										
floor	concrete										
pipework	metal										
pipe lagging	man made mineral fibre										

Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 018/ Garage						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	brick										
floor	concrete										
pipework	metal										
pipe lagging	man made mineral fibre										

Building: Bacton Low Rise, Block H - Communal Area			Level: 0		Location: 019/ Bin Store						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
soil pipe	metal										

Building: Bacton Low Rise, Block H - Communal Area			Level: 1		Location: 001/ Walkway						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	brick										
floor	concrete										



table continued from previous page...




Building: Bacton Low Rise, Block H - Communal Area			Level: 1		Location: 001/ Walkway						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
panels around electric meter cupboards	Asbestos-containing insulating board	Cross Reference	126253-2	9x 2 Sqm.	2	1	1	Amosite, Chrysotile	6	2	
outside storage cupboards	brick & concrete construction										
pipework within outside storage cupboards	metal										
lagging to pipework within outside storage cupboards	man made mineral fibre										
cladding to outside storage cupboards	wood										
Building: Bacton Low Rise, Block H - Flat 203			Level: 0		Location: 001/ Entrance Lobby						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
adhesive to concrete floor	Asbestos-containing bituminous product	Sample	126253-5	4 Sqm.	1	1	0	Chrysotile	3	3	
floor	concrete										
electrics	modern										
boxing around electric	Asbestos-containing insulating board	Sample	126253-6	2 Sqm.	2	2	1	Amosite, Chrysotile	7	3	
Building: Bacton Low Rise, Block H - Flat 203			Level: 1		Location: 001/ Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										

table continued from previous page...



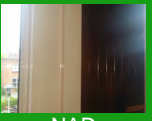



Building: Bacton Low Rise, Block H - Flat 203			Level: 1		Location: 001/ Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
walls	concrete										
floor covering	modern vinyl tiles										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bituminous product	Cross Reference	126253-5	2 Sqm.	1	1	0	Chrysotile	3	2	 R3
Building: Bacton Low Rise, Block H - Flat 203			Level: 1		Location: 002/ Kitchen & Lounge						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	modern vinyl tiles										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bituminous product	Cross Reference	126253-5	14 Sqm.	1	1	0	Chrysotile	3	2	 R3
panels to external wall	insulating board	Sample	126253-7								 NAD
boiler	modern										
boxing	wood										
within boxing	pipework metal										
Building: Bacton Low Rise, Block H - Flat 203			Level: 2		Location: 001/ Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										

table continued from previous page...

Building: Bacton Low Rise, Block H - Flat 203			Level: 2		Location: 001/ Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
walls	concrete										
floor covering	modern vinyl tiles										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bituminous product	Cross Reference	126253-5	2 Sqm.	1	1	0	Chrysotile	3	2	 R3

Building: Bacton Low Rise, Block H - Flat 203			Level: 2		Location: 002/ Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	Asbestos-containing floor tiles & bituminous product	Sample	126253-8	6 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
panels to external wall	insulating board	Cross Reference	126253-7								 NAD

Building: Bacton Low Rise, Block H - Flat 203			Level: 2		Location: 003/ Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										

table continued from previous page...

Building: Bacton Low Rise, Block H - Flat 203			Level: 2		Location: 003/ Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
floor covering	Asbestos-containing floor tiles & bituminous product	Cross Reference	126253-8	12 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
panels to external wall	insulating board	Cross Reference	126253-7								 NAD
Building: Bacton Low Rise, Block H - Flat 203			Level: 3		Location: 001/ Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	Asbestos-containing floor tiles & bituminous product	Cross Reference	126253-5	2 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
panel to understairs	plasterboard										
Building: Bacton Low Rise, Block H - Flat 203			Level: 3		Location: 001/ Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	Asbestos-containing floor tiles & bituminous product	Cross Reference	126253-4	2 Sqm.	1	1	0	Chrysotile	3	3	R3
floor	concrete										
panel to understairs	plasterboard										





Building: Bacton Low Rise, Block H - Flat 203			Level: 3		Location: 002/ Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	Asbestos-containing floor tiles & bituminous product	Cross Reference	126253-5	12 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
panels to external walls	insulating board	Cross Reference	126253-7								 NAD
Building: Bacton Low Rise, Block H - Flat 203			Level: 3		Location: 003/ Bathroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
adhesive to concrete floor	Asbestos-containing bituminous product	Cross Reference	126253-5	4 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
panels to external walls	insulating board	Cross Reference	126253-7								 NAD
bath panel	plastic										
Building: Bacton Low Rise, Block H - Flat 203			Level: 4		Location: 001/ Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										

table continued from previous page...




Building: Bacton Low Rise, Block H - Flat 203			Level: 4		Location: 001/ Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
walls	concrete										
floor covering	Asbestos-containing floor tiles & bituminous product	Cross Reference	126253-8	12 Sqm.	1	1	0	Chrysotile	3	3	
floor	concrete										
Building: Bacton Low Rise, Block H - Flat 204			Level: 0		Location: 001/ Entrance Lobby						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
adhesive to concrete floor	Asbestos-containing bituminous product	Sample	126253-1	4 Sqm.	1	1	0	Chrysotile	3	3	
floor	concrete										
electrics	modern										
boxing around electric	Asbestos-containing insulating board	Sample	126253-2	2 Sqm.	2	1	1	Amosite, Chrysotile	6	3	
Building: Bacton Low Rise, Block H - Flat 204			Level: 1		Location: 001/ Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	modern vinyl tiles										
floor	concrete										



table continued from previous page...




Building: Bacton Low Rise, Block H - Flat 204			Level: 1		Location: 001/ Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
adhesive to concrete floor	Asbestos-containing bituminous product	Cross Reference	126253-1	2 Sqm.	1	1	0	Chrysotile	3	2	 R3
Building: Bacton Low Rise, Block H - Flat 204			Level: 1		Location: 002/ Kitchen & Lounge						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	modern vinyl tiles										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bituminous product	Cross Reference	126253-1	14 Sqm.	1	1	0	Chrysotile	3	2	 R3
panels to external wall	insulating board	Sample	126253-3								 NAD
boiler	modern										
Building: Bacton Low Rise, Block H - Flat 204			Level: 2		Location: 001/ Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	modern vinyl tiles										
floor	concrete										

table continued from previous page...





Building: Bacton Low Rise, Block H - Flat 204			Level: 2		Location: 001/ Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
adhesive to concrete floor	Asbestos-containing bituminous product	Cross Reference	126253-1	2 Sqm.	1	1	0	Chrysotile	3	2	 R3
Building: Bacton Low Rise, Block H - Flat 204			Level: 2		Location: 002/ Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	Asbestos-containing floor tiles & bituminous product	Sample	126253-4	12 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
panels to external wall	insulating board	Cross Reference	126253-3								 NAD
Building: Bacton Low Rise, Block H - Flat 204			Level: 2		Location: 003/ Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	Asbestos-containing floor tiles & bituminous product	Cross Reference	126253-4	12 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										

table continued from previous page...





Building: Bacton Low Rise, Block H - Flat 204			Level: 2		Location: 003/ Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
panels to external wall	insulating board	Cross Reference	126253-3								 NAD
Building: Bacton Low Rise, Block H - Flat 204			Level: 3		Location: 001/ Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	Asbestos-containing floor tiles & bituminous product	Cross Reference	126253-4	2 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
panel to understairs	plasterboard										
Building: Bacton Low Rise, Block H - Flat 204			Level: 3		Location: 002/ Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	Asbestos-containing floor tiles & bituminous product	Cross Reference	126253-4	12 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
panels to external walls	insulating board	Cross Reference	126253-3								 NAD

table continued from previous page...






Building: Bacton Low Rise, Block H - Flat 204			Level: 3		Location: 002/ Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
riser panels within wooden cupboard	wood										
Building: Bacton Low Rise, Block H - Flat 204			Level: 3		Location: 003/ Bathroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
adhesive to concrete floor	Asbestos-containing bituminous product	Cross Reference	126253-4	4 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
panels to external walls	insulating board	Cross Reference	126253-3								 NAD
bath panel	plastic										
Building: Bacton Low Rise, Block H - Flat 204			Level: 3		Location: 004/ Toilet						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
adhesive to concrete floor	Asbestos-containing bituminous product	Cross Reference	126253-4	2 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										

table continued from previous page...

Building: Bacton Low Rise, Block H - Flat 204			Level: 3		Location: 004/ Toilet						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
panels to external walls	insulating board	Cross Reference	126253-3								 NAD
toilet cistern	ceramic										
boxing	wood										
Building: Bacton Low Rise, Block H - Flat 204			Level: 4		Location: 001/ Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	Asbestos-containing floor tiles & bituminous product	Cross Reference	126253-4	12 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
Building: Bacton Low Rise, Block H - Flat 205			Level: -3		Location: 001/Stairs & Cupboard						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	plaster on masonry										
bitumen to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-9	2 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										





Building: Bacton Low Rise, Block H - Flat 205			Level: -3		Location: 002/Bathroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	plaster on masonry										
bitumen to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-9	8 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
panels to external wall	insulating board	Cross Reference	126253-11								 NAD
Building: Bacton Low Rise, Block H - Flat 205			Level: -3		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	plaster on masonry										
bitumen to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-9	8 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
panels to external wall	insulating board	Cross Reference	126253-11								 NAD
boxing	wood										
within boxing	no asbestos observed										



table continued from previous page...










Building: Bacton Low Rise, Block H - Flat 205			Level: -3		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
panel to shelf	Asbestos-containing insulating board	Cross Reference	126253-10	2 Sqm.	2	1	1	Amosite, Chrysotile	6	2	 R3
Building: Bacton Low Rise, Block H - Flat 205			Level: -2		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	plaster on masonry										
bitumen to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-9	2 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
Building: Bacton Low Rise, Block H - Flat 205			Level: -2		Location: 002/Bedroom 1						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	plaster on masonry										
bitumen to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-9	8 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										

table continued from previous page...

Building: Bacton Low Rise, Block H - Flat 205			Level: -2		Location: 002/Bedroom 1						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
panels to external wall	insulating board	Cross Reference	126253-11								 NAD
Building: Bacton Low Rise, Block H - Flat 205			Level: -2		Location: 003/Bedroom 2						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	plaster on masonry										
bitumen to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-9	8 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
panels to external wall	insulating board	Cross Reference	126253-11								 NAD
Building: Bacton Low Rise, Block H - Flat 205			Level: -1		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	plaster on masonry										
bitumen to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-9	2 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										

Building: Bacton Low Rise, Block H - Flat 205			Level: -1		Location: 002/Kitchen/Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	plaster on masonry										
bitumen to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-9	12 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
panels to external wall	insulating board	Sample	126253-11								 NAD
boxing in kitchen	wood										
within boxing	no asbestos observed										
Building: Bacton Low Rise, Block H - Flat 205			Level: 0		Location: 001/Entrance Lobby						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	plaster on masonry										
bitumen to concrete floor	Asbestos-containing bitumen adhesive	Sample	126253-9	2 Sqm.	1	1	0	Chrysotile	3	3	 R3
electrics	modern										
panel to electrics	Asbestos-containing insulating board	Sample	126253-10	2 Lm.	2	1	1	Amosite, Chrysotile	6	2	 R3





Building: Bacton Low Rise, Block H - Flat 206			Level: 0		Location: 001/Entrance Lobby						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	plaster on masonry										
floor covering	Asbestos-containing vinyl tile & adhesive	Sample	126253-12	2 Sqm.	1	1	0	Chrysotile	3	3	 R3
electrics	modern										
panel to electrics	Asbestos-containing insulating board	Sample	126253-13	2 Lm.	2	1	1	Amosite, Chrysotile	6	2	 R3
Building: Bacton Low Rise, Block H - Flat 206			Level: 1		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	plaster on masonry										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-12	2 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
Building: Bacton Low Rise, Block H - Flat 206			Level: 1		Location: 002 /Kitchen / Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	plaster on masonry										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-12	12 Sqm.	1	1	0	Chrysotile	3	3	 R3

table continued from previous page...





Building: Bacton Low Rise, Block H - Flat 206			Level: 1		Location: 002 /Kitchen / Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
floor	concrete										
boxing within cupboard	Asbestos-containing insulating board	Sample	126253-14	4 Sqm.	2	1	1	Amosite, Chrysotile	6	3	 R2
panel to external wall	insulating board	Sample	126253-15								 NAD
boiler	modern										
panels to shelves	Asbestos-containing insulating board	Cross Reference	126253-14	2 Sqm.	2	1	2	Amosite, Chrysotile	7	3	 R1
Building: Bacton Low Rise, Block H - Flat 206			Level: 2		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	plaster on masonry										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-12	2 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
floor covering	modern vinyl tile										
Building: Bacton Low Rise, Block H - Flat 206			Level: 2		Location: 002/Bedroom 1						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										

table continued from previous page...








Building: Bacton Low Rise, Block H - Flat 206			Level: 2		Location: 002/Bedroom 1						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
walls	plaster on masonry										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-12	12 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
panel to external wall	insulating board	Cross Reference	126253-15								 NAD
Building: Bacton Low Rise, Block H - Flat 206			Level: 2		Location: 003/Bedroom 2						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	plaster on masonry										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-12	12 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
panel to external wall	insulating board	Cross Reference	126253-15								 NAD
floor covering	ceramics										
Building: Bacton Low Rise, Block H - Flat 206			Level: 3		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										







table continued from previous page...

Building: Bacton Low Rise, Block H - Flat 206			Level: 3		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
walls	plaster on masonry										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-12	2 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										

Building: Bacton Low Rise, Block H - Flat 206			Level: 3		Location: 003/Bathroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	plaster on masonry										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-12	6 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
panel to external wall	insulating board	Cross Reference	126253-15								 NAD
cistern	ceramic										
boxing	wood										
within boxing	no asbestos observed										
bath panel	wood										
within bath panel	no asbestos observed										

Building: Bacton Low Rise, Block H - Flat 206			Level: 3		Location: 003/Bedroom 3						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										

table continued from previous page...

Building: Bacton Low Rise, Block H - Flat 206			Level: 3		Location: 003/Bedroom 3						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
walls	plaster on masonry										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-12	12 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
panel to external wall	insulating board	Cross Reference	126253-15								 NAD
boxing within cupboard	wood										
Building: Bacton Low Rise, Block H - Flat 206			Level: 4		Location: 001/Bedroom 4						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	plaster on masonry										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-12	4 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
panel to external wall	insulating board	Cross Reference	126253-15								 NAD
floor covering	modern vinyl tile										




Building: Bacton Low Rise, Block H - Flat 207			Level: 0		Location: 001/ Entrance Lobby						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
adhesive to concrete floor	Asbestos-containing bituminous product	Sample	126253-16	4 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
electrics	modern										
boxing around electric	Asbestos-containing insulating board	Sample	126253-17	2 Sqm.	2	1	1	Amosite, Chrysotile	6	3	 R2
Building: Bacton Low Rise, Block H - Flat 207			Level: 1		Location: 001/ Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bituminous product	Cross Reference	126253-16	2 Sqm.	1	1	0	Chrysotile	3	2	 R3
Building: Bacton Low Rise, Block H - Flat 207			Level: 1		Location: 002/Kitchen/Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										

table continued from previous page...




Building: Bacton Low Rise, Block H - Flat 207			Level: 1		Location: 002/Kitchen/Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
adhesive to concrete floor	Asbestos-containing bituminous product	Cross Reference	126253-16	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
floor covering	modern vinyl tile										
boxing within cupboard	Asbestos-containing insulating board	Sample	126253-18	4 Sqm.	2	1	2	Amosite, Chrysotile	7	2	 R2
panel to external wall	insulating board	Sample	126253-19								 NAD
boxing to sink	wood										
within boxing	no asbestos observed										
sink pad	bituminous product	Sample	126253-20								 NAD
panels to shelves	Asbestos-containing insulating board	Cross Reference	126253-18	2 Sqm.	2	1	2	Amosite, Chrysotile	7	3	 R1
Building: Bacton Low Rise, Block H - Flat 207			Level: 2		Location: 001/ Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										

table continued from previous page...





Building: Bacton Low Rise, Block H - Flat 207			Level: 2		Location: 001/ Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
adhesive to concrete floor	Asbestos-containing bituminous product	Cross Reference	126253-16	2 Sqm.	1	1	0	Chrysotile	3	2	 R3
Building: Bacton Low Rise, Block H - Flat 207			Level: 2		Location: 002/Bedroom 1						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bituminous product	Cross Reference	126253-16	6 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-19								 NAD
Building: Bacton Low Rise, Block H - Flat 207			Level: 2		Location: 003/Bedroom 2						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Sample	126253-21	6 Sqm.	1	1	0	Chrysotile	3	2	 R3

table continued from previous page...

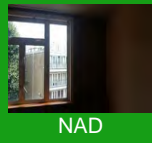


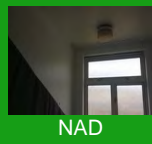
Building: Bacton Low Rise, Block H - Flat 207			Level: 2		Location: 003/Bedroom 2						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
panel to external wall	insulating board	Cross Reference	126253-19								
Building: Bacton Low Rise, Block H - Flat 207			Level: 3		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-21	2 Sqm.	1	1	0	Chrysotile	3	2	
Building: Bacton Low Rise, Block H - Flat 207			Level: 3		Location: 002/Bathroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-21	6 Sqm.	1	1	0	Chrysotile	3	2	
panel to external wall	insulating board	Cross Reference	126253-19								
bath panel	wood										



table continued from previous page...




Building: Bacton Low Rise, Block H - Flat 207			Level: 3		Location: 002/Bathroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
within bath panel	no asbestos observed										
within wooden boxing	no asbestos observed										
toilet cistern	ceramic										
Building: Bacton Low Rise, Block H - Flat 207			Level: 3		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-21	10 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-19								 NAD
within wooden boxing	no asbestos observed										
Building: Bacton Low Rise, Block H - Flat 207			Level: 4		Location: 001/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-21	10 Sqm.	1	1	0	Chrysotile	3	2	 R3

table continued from previous page...





Building: Bacton Low Rise, Block H - Flat 207			Level: 4		Location: 001/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
panel to external wall	insulating board	Cross Reference	126253-19								 NAD
Building: Bacton Low Rise, Block H - Flat 208			Level: -3		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-22	2 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
Building: Bacton Low Rise, Block H - Flat 208			Level: -3		Location: 002/Bathroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-22	8 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-25								 NAD
within wooden boxing	no asbestos observed										

table continued from previous page...





Building: Bacton Low Rise, Block H - Flat 208			Level: -3		Location: 002/Bathroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
toilet cistern	ceramics										
within wooden bath panel	no asbestos observed										
Building: Bacton Low Rise, Block H - Flat 208			Level: -3		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-22	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
boxing within cupboard	Asbestos-containing insulating board	Cross Reference	126253-24	4 Sqm.	2	1	2	Amosite, Chrysotile	7	2	 R2
panel to external wall	insulating board	Cross Reference	126253-25								 NAD
panels to shelves	Asbestos-containing insulating board	Cross Reference	126253-24	2 Sqm.	2	1	2	Amosite, Chrysotile	7	3	 R1
Building: Bacton Low Rise, Block H - Flat 208			Level: -2		Location: 001/Stairs/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										

table continued from previous page...

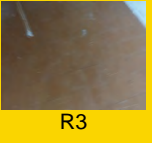
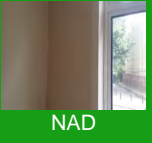

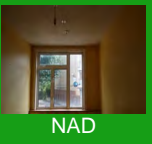




Building: Bacton Low Rise, Block H - Flat 208			Level: -2		Location: 001/Stairs/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-22	12 Sqm.	1	1	0	Chrysotile	3	2	
panel to external wall	insulating board	Cross Reference	126253-25								
Building: Bacton Low Rise, Block H - Flat 208			Level: -2		Location: 002/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-22	8 Sqm.	1	1	0	Chrysotile	3	2	
panel to external wall	insulating board	Cross Reference	126253-25								
Building: Bacton Low Rise, Block H - Flat 208			Level: -1		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										

table continued from previous page...

Building: Bacton Low Rise, Block H - Flat 208			Level: -1		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-22	4 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
Building: Bacton Low Rise, Block H - Flat 208			Level: -1		Location: 002/Kitchen/Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
sub floor	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-22	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
floor covering	modern vinyl tile										
boxing within cupboard	Asbestos-containing insulating board	Sample	126253-24	4 Sqm.	2	1	2	Amosite, Chrysotile	7	2	 R2
panel to external wall	insulating board	Sample	126253-25								 NAD
boxing to sink	wood										
within boxing	no asbestos observed										




Building: Bacton Low Rise, Block H - Flat 208			Level: 0		Location: 001/ Entrance Lobby						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Sample	126253-22	4 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
electrics	modern										
boxing around electric	Asbestos-containing insulating board	Sample	126253-23	2 Sqm.	2	1	1	Amosite, Chrysotile	6	3	 R2
Building: Bacton Low Rise, Block H - Flat 209			Level: -3		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-26	2 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
Building: Bacton Low Rise, Block H - Flat 209			Level: -3		Location: 002/Bathroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										

table continued from previous page...






Building: Bacton Low Rise, Block H - Flat 209			Level: -3		Location: 002/Bathroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-22	8 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-28								 NAD
within wooden boxing	no asbestos observed										
toilet cistern	Asbestos-containing composite	Sample	126253-30	1 No.	1	1	0	Amosite	4	3	 R3
within wooden bath panel	no asbestos observed										
Building: Bacton Low Rise, Block H - Flat 209			Level: -3		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-29	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
boxing within cupboard	Asbestos-containing insulating board	Sample	126253-31	4 Sqm.	2	1	2	Amosite, Chrysotile	7	2	 R2



table continued from previous page...





Building: Bacton Low Rise, Block H - Flat 209			Level: -3		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
panel to external wall	insulating board	Cross Reference	126253-28								 NAD
panels to shelves	Asbestos-containing insulating board	Cross Reference	126253-31	2 Sqm.	2	1	2	Amosite, Chrysotile	7	2	 R2
Building: Bacton Low Rise, Block H - Flat 209			Level: -2		Location: 001/Stairs/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-26	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-28								 NAD
Building: Bacton Low Rise, Block H - Flat 209			Level: -2		Location: 002/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										

table continued from previous page...





Building: Bacton Low Rise, Block H - Flat 209			Level: -2		Location: 002/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
floor covering	Asbestos-containing vinyl tile & adhesive	Sample	126253-29	8 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-25								 NAD
Building: Bacton Low Rise, Block H - Flat 209			Level: -1		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-26	4 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
Building: Bacton Low Rise, Block H - Flat 209			Level: -1		Location: 002/Kitchen/Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-26	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
floor covering	modern vinyl tile										

table continued from previous page...








Building: Bacton Low Rise, Block H - Flat 209			Level: -1		Location: 002/Kitchen/Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
panel to external wall	insulating board	Sample	126253-28								 NAD
boxing to sink	wood										
within boxing	no asbestos observed										
Building: Bacton Low Rise, Block H - Flat 209			Level: 0		Location: 001/ Entrance Lobby						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
adhesive backing to concrete floor	Asbestos-containing bitumen adhesive	Sample	126253-26	4 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
electrics	modern										
boxing around electric	Asbestos-containing insulating board	Sample	126253-27	2 Sqm.	2	1	1	Amosite, Chrysotile	6	3	 R2
Building: Bacton Low Rise, Block H - Flat 210			Level: 1		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										

table continued from previous page...

Building: Bacton Low Rise, Block H - Flat 210			Level: 1		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Sample	126253-34	4 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
Building: Bacton Low Rise, Block H - Flat 210			Level: 1		Location: 002/Kitchen/Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-34	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
floor covering	modern vinyl tile										
panel to external wall	insulating board	Sample	126253-36								 NAD
boxing to sink	wood										
within boxing	no asbestos observed										
boxing within cupboard	Asbestos-containing insulating board	Sample	126253-35	4 Sqm.	2	1	2	Amosite, Chrysotile	7	2	 R2
panel to shelf in cupboard	Asbestos-containing insulating board	Cross Reference	126253-35	1 Sqm.	2	1	2	Amosite, Chrysotile	7	2	 R2

Building: Bacton Low Rise, Block H - Flat 210			Level: 2		Location: 001/ Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bituminous product	Cross Reference	126253-34	2 Sqm.	1	1	0	Chrysotile	3	2	 R3

Building: Bacton Low Rise, Block H - Flat 210			Level: 2		Location: 001/Stairs/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-32	8 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-36								 NAD

Building: Bacton Low Rise, Block H - Flat 210			Level: 2		Location: 002/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										

table continued from previous page...












Building: Bacton Low Rise, Block H - Flat 210			Level: 2		Location: 002/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-32	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-36								 NAD
Building: Bacton Low Rise, Block H - Flat 210			Level: 3		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-34	2 Sqm.	1	1	0	Chrysotile	3	2	 R3
Building: Bacton Low Rise, Block H - Flat 210			Level: 3		Location: 002/Bathroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-34	6 Sqm.	1	1	0	Chrysotile	3	2	 R3

table continued from previous page...

Building: Bacton Low Rise, Block H - Flat 210			Level: 3		Location: 002/Bathroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
panel to external wall	insulating board	Cross Reference	126253-36								 NAD
bath panel	wood										
within bath panel	no asbestos observed										
within wooden boxing	no asbestos observed										
toilet cistern	Asbestos-containing composite	Sample	126253-37	1 No.	1	1	0	Amosite	4	3	 R3
Building: Bacton Low Rise, Block H - Flat 210			Level: 3		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-32	10 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-36								 NAD
within wooden boxing	no asbestos observed										



Building: Bacton Low Rise, Block H - Flat 210			Level: 4		Location: 001/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-32	10 Sqm.	1	1	0	Chrysotile	3	2	 R3

Building: Bacton Low Rise, Block H - Flat 211			Level: 0		Location: 001/ Entrance Lobby						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Sample	126253-32	4 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
electrics	modern										
boxing around electric	Asbestos-containing insulating board	Sample	126253-33	2 Sqm.	2	1	1	Amosite, Chrysotile	6	3	 R2

Building: Bacton Low Rise, Block H - Flat 211			Level: 0		Location: 001/ Entrance Lobby						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	wood			4 Sqm.	1	1	0			3	
floor	concrete										

table continued from previous page...





Building: Bacton Low Rise, Block H - Flat 211			Level: 0		Location: 001/ Entrance Lobby						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
electrics	modern										
boxing around electric	Asbestos-containing insulating board	Sample	126253-39	2 Sqm.	2	1	1	Amosite, Chrysotile	6	3	 R2
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Sample	126253-38	4 Sqm.	1	1	0	Chrysotile	3	2	 R3
Building: Bacton Low Rise, Block H - Flat 211			Level: 1		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-38	4 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
Building: Bacton Low Rise, Block H - Flat 211			Level: 1		Location: 002/Kitchen/Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-38	12 Sqm.	1	1	0	Chrysotile	3	2	 R3

table continued from previous page...








Building: Bacton Low Rise, Block H - Flat 211			Level: 1		Location: 002/Kitchen/Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
panel to external wall	insulating board	Sample	126253-40								 NAD
boxing to sink	wood										
within boxing	no asbestos observed										
boiler	modern										
panel to boiler	insulating board	Sample	126253-41								 NAD
Building: Bacton Low Rise, Block H - Flat 211			Level: 2		Location: 001/ Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bituminous product	Cross Reference	126253-38	2 Sqm.	1	1	0	Chrysotile	3	2	 R3
Building: Bacton Low Rise, Block H - Flat 211			Level: 2		Location: 002/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										

table continued from previous page...

Building: Bacton Low Rise, Block H - Flat 211			Level: 2		Location: 002/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-38	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-40								 NAD

Building: Bacton Low Rise, Block H - Flat 211			Level: 2		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Sample	126253-42	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-40								 NAD

Building: Bacton Low Rise, Block H - Flat 211			Level: 3		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										

table continued from previous page...





Building: Bacton Low Rise, Block H - Flat 211			Level: 3		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-38	2 Sqm.	1	1	0	Chrysotile	3	2	 R3
Building: Bacton Low Rise, Block H - Flat 211			Level: 3		Location: 002/Bathroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-38	6 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-40								 NAD
bath panel	wood										
within bath panel	no asbestos observed										
within wooden boxing	no asbestos observed										
toilet cistern	Asbestos-containing composite	Sample	126253-43	1 No.	1	1	0	Amosite	4	3	 R3
Building: Bacton Low Rise, Block H - Flat 211			Level: 3		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										

table continued from previous page...




Building: Bacton Low Rise, Block H - Flat 211			Level: 3		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-38	10 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-40								 NAD
within wooden boxing	no asbestos observed										
Building: Bacton Low Rise, Block H - Flat 211			Level: 4		Location: 001/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-38	10 Sqm.	1	1	0	Chrysotile	3	2	 R3
Building: Bacton Low Rise, Block H - Flat 212			Level: -3		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										

table continued from previous page...










Building: Bacton Low Rise, Block H - Flat 212			Level: -3		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-44	2 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
Building: Bacton Low Rise, Block H - Flat 212			Level: -3		Location: 002/Bathroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-44	8 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-47								 NAD
within wooden boxing	no asbestos observed										
within wooden bath panel	no asbestos observed										
Building: Bacton Low Rise, Block H - Flat 212			Level: -3		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										



table continued from previous page...

Building: Bacton Low Rise, Block H - Flat 212			Level: -3		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-46	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
boxing within cupboard	Asbestos-containing insulating board	Sample	126253-49	4 Sqm.	2	1	2	Amosite, Chrysotile	7	2	 R2
panel to external wall	insulating board	Cross Reference	126253-47								 NAD
panels to shelves	Asbestos-containing insulating board	Cross Reference	126253-49	2 Sqm.	2	1	2	Amosite, Chrysotile	7	2	 R2
Building: Bacton Low Rise, Block H - Flat 212			Level: -2		Location: 001/Stairs/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-46	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-47								 NAD







Building: Bacton Low Rise, Block H - Flat 212			Level: -2		Location: 002/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-46	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-47								 NAD
Building: Bacton Low Rise, Block H - Flat 212			Level: -1		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Sample	126253-46	2 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
Building: Bacton Low Rise, Block H - Flat 212			Level: -1		Location: 002/Kitchen/Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										

table continued from previous page...

Building: Bacton Low Rise, Block H - Flat 212			Level: -1		Location: 002/Kitchen/Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-44	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Sample	126253-47								 NAD
boxing to sink	wood										
within boxing	no asbestos observed										
boiler	modern										
boxing within cupboard	Asbestos-containing insulating board	Sample	126253-48	2 Sqm.	2	1	1	Amosite, Chrysotile	6	2	 R3
Building: Bacton Low Rise, Block H - Flat 212			Level: 0		Location: 001/ Entrance Lobby						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
electrics	modern										
boxing around electric	Asbestos-containing insulating board	Sample	126253-45	2 Sqm.	2	1	1	Amosite, Chrysotile	6	3	 R2
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Sample	126253-44	4 Sqm.	1	1	0	Chrysotile	3	2	 R3














Building: Bacton Low Rise, Block H - Flat 213			Level: -3		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-50	2 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
Building: Bacton Low Rise, Block H - Flat 213			Level: -3		Location: 002/Bathroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-50	8 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-53								 NAD
within wooden boxing	no asbestos observed										
within wooden bath panel	no asbestos observed										
Building: Bacton Low Rise, Block H - Flat 213			Level: -3		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										

table continued from previous page...

Building: Bacton Low Rise, Block H - Flat 213			Level: -3		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-50	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
boxing within cupboard	Asbestos-containing insulating board	Cross Reference	126253-52	4 Sqm.	2	1	2	Amosite, Chrysotile	7	2	 R2
panel to external wall	insulating board	Cross Reference	126253-53								 NAD
panels to shelves	Asbestos-containing insulating board	Cross Reference	126253-52	2 Sqm.	2	1	2	Amosite, Chrysotile	7	2	 R2
Building: Bacton Low Rise, Block H - Flat 213			Level: -2		Location: 002/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive backing to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-50	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-53								 NAD

Building: Bacton Low Rise, Block H - Flat 213			Level: -1		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-50	2 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
Building: Bacton Low Rise, Block H - Flat 213			Level: -1		Location: 002/Kitchen/Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-50	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Sample	126253-53								 NAD
boxing to sink	wood										
within boxing	no asbestos observed										
boiler	modern										
boxing within cupboard	Asbestos-containing insulating board	Sample	126253-52	2 Sqm.	2	1	1	Amosite, Chrysotile	6	2	 R3







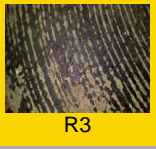
Building: Bacton Low Rise, Block H - Flat 213			Level: 0		Location: 001/ Entrance Lobby						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
electrics	modern										
boxing around electric	Asbestos-containing insulating board	Sample	126253-51	2 Lm.	2	1	1	Amosite, Chrysotile	6	3	 R2
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Sample	126253-50	4 Sqm.	1	1	0	Chrysotile	3	2	 R3
Building: Bacton Low Rise, Block H - Flat 213			Level: 2		Location: 001/Stairs/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-50	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-53								 NAD
Building: Bacton Low Rise, Block H - Flat 214			Level: 0		Location: 001/ Entrance Lobby						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										



table continued from previous page...

Building: Bacton Low Rise, Block H - Flat 214			Level: 0		Location: 001/ Entrance Lobby						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
walls	concrete										
floor covering	wood										
floor	concrete										
electrics	modern										
boxing around electric	Asbestos-containing insulating board	Sample	126253-55	2 Sqm.	2	1	1	Amosite, Chrysotile	6	3	 R2
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Sample	126253-54	4 Sqm.	1	1	0	Chrysotile	3	2	 R3

Building: Bacton Low Rise, Block H - Flat 214			Level: 1		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-54	4 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										

Building: Bacton Low Rise, Block H - Flat 214			Level: 1		Location: 002/Kitchen/Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										

table continued from previous page...

Building: Bacton Low Rise, Block H - Flat 214			Level: 1		Location: 002/Kitchen/Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-54	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Sample	126253-56								 NAD
boxing to sink	wood										
within boxing	no asbestos observed										
boiler	modern										
boxing within cupboard	Asbestos-containing insulating board	Sample	126253-57	4 Sqm.	2	1	2	Amosite, Chrysotile	7	2	 R2
panels to shelves	Asbestos-containing insulating board	Cross Reference	126253-57	2 Sqm.	2	1	2	Amosite, Chrysotile	7	2	 R2
Building: Bacton Low Rise, Block H - Flat 214			Level: 2		Location: 001/ Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Sample	126253-58	2 Sqm.	1	1	0	Chrysotile	3	2	 R3




Building: Bacton Low Rise, Block H - Flat 214			Level: 2		Location: 002/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-58	8 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-56								 NAD
Building: Bacton Low Rise, Block H - Flat 214			Level: 2		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-58	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-56								 NAD
Building: Bacton Low Rise, Block H - Flat 214			Level: 3		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										

table continued from previous page...




Building: Bacton Low Rise, Block H - Flat 214			Level: 3		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-58	2 Sqm.	1	1	0	Chrysotile	3	2	 R3
Building: Bacton Low Rise, Block H - Flat 214			Level: 3		Location: 002/Bathroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-54	6 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-56								 NAD
bath panel	wood										
within bath panel	no asbestos observed										
within wooden boxing	no asbestos observed										
Building: Bacton Low Rise, Block H - Flat 214			Level: 3		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										

table continued from previous page...





Building: Bacton Low Rise, Block H - Flat 214			Level: 3		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-58	10 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-56								 NAD
within wooden boxing	no asbestos observed										
Building: Bacton Low Rise, Block H - Flat 214			Level: 4		Location: 001/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-58	10 Sqm.	1	1	0	Chrysotile	3	2	 R3
Building: Bacton Low Rise, Block H - Flat 215			Level: 0		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Sample	126253-62	4 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										

table continued from previous page...




Building: Bacton Low Rise, Block H - Flat 215			Level: 0		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
panel to electrics	Asbestos-containing insulating board	Sample	126253-63	2 Lm.	2	1	1	Amosite, Chrysotile	6	2	 R3
Building: Bacton Low Rise, Block H - Flat 215			Level: 1		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	vinyl tile & adhesive	Cross Reference	126253-61								 NAD
floor	concrete										
Building: Bacton Low Rise, Block H - Flat 215			Level: 1		Location: 002/Kitchen/Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-54	12 Sqm.	1	1	0	Chrysotile	3	2	R3
panel to external wall	insulating board	Sample	126253-64								 NAD
boxing to sink	wood										
within boxing	no asbestos observed										
boiler	modern										

table continued from previous page...











Building: Bacton Low Rise, Block H - Flat 215			Level: 1		Location: 002/Kitchen/Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
boxing within cupboard	Asbestos-containing insulating board	Sample	126253-65	4 Sqm.	2	1	2	Amosite, Chrysotile	7	2	 R2
panels to shelves	insulating board	Sample	126253-66								 NAD
Building: Bacton Low Rise, Block H - Flat 215			Level: 2		Location: 001/ Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-62	2 Sqm.	1	1	0	Chrysotile	3	2	 R3
Building: Bacton Low Rise, Block H - Flat 215			Level: 2		Location: 002/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-62	8 Sqm.	1	1	0	Chrysotile	3	2	 R3



table continued from previous page...

Building: Bacton Low Rise, Block H - Flat 215			Level: 2		Location: 002/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
panel to external wall	insulating board	Cross Reference	126253-64								 NAD
Building: Bacton Low Rise, Block H - Flat 215			Level: 2		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-62	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-64								 NAD
Building: Bacton Low Rise, Block H - Flat 215			Level: 3		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-62	2 Sqm.	1	1	0	Chrysotile	3	2	 R3

Building: Bacton Low Rise, Block H - Flat 215			Level: 3		Location: 002/Bathroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-62	6 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-64								 NAD
bath panel	wood										
within bath panel	no asbestos observed										
within wooden boxing	no asbestos observed										

Building: Bacton Low Rise, Block H - Flat 215 Level: 3 Location: 002/Bathroom

No Records were taken at this Location

Building: Bacton Low Rise, Block H - Flat 215 Level: 3 Location: 003/Bedroom


Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-62	10 Sqm.	1	1	0	Chrysotile	3	2	 R3

table continued from previous page...





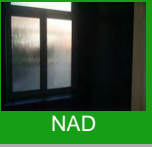

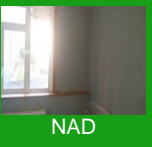
Building: Bacton Low Rise, Block H - Flat 215			Level: 3		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
panel to external wall	insulating board	Cross Reference	126253-64								
within wooden boxing	no asbestos observed										
Building: Bacton Low Rise, Block H - Flat 215			Level: 4		Location: 001/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-62	10 Sqm.	1	1	0	Chrysotile	3	2	
Building: Bacton Low Rise, Block H - Flat 217			Level: -3		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-60	2 Sqm.	1	1	0	Chrysotile	3	3	
floor	concrete										
Building: Bacton Low Rise, Block H - Flat 217			Level: -3		Location: 002/Bathroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										

table continued from previous page...

Building: Bacton Low Rise, Block H - Flat 217			Level: -3		Location: 002/Bathroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-60	8 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-61								 NAD
within wooden boxing	no asbestos observed										
within wooden bath panel	no asbestos observed										
toilet cistern	ceramics										
Building: Bacton Low Rise, Block H - Flat 217			Level: -3		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	bitumen adhesive	Cross Reference	126253-61								 NAD
panel to external wall	insulating board	Cross Reference	126253-61								 NAD


Building: Bacton Low Rise, Block H - Flat 217			Level: -2		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-60	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
Building: Bacton Low Rise, Block H - Flat 217			Level: -2		Location: 002/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-60	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-61								 NAD
Building: Bacton Low Rise, Block H - Flat 217			Level: -2		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										

table continued from previous page...





Building: Bacton Low Rise, Block H - Flat 217			Level: -2		Location: 003/Bedroom						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-60	12 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel to external wall	insulating board	Cross Reference	126253-61								 NAD
Building: Bacton Low Rise, Block H - Flat 217			Level: -1		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-60	2 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
Building: Bacton Low Rise, Block H - Flat 217			Level: -1		Location: 002/Kitchen/Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-60	12 Sqm.	1	1	0	Chrysotile	3	2	 R3

table continued from previous page...








Building: Bacton Low Rise, Block H - Flat 217			Level: -1		Location: 002/Kitchen/Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
panel to external wall	insulating board	Sample	126253-61								 NAD
boxing to sink	wood										
within boxing	no asbestos observed										
Building: Bacton Low Rise, Block H - Flat 217			Level: 0		Location: 001/ Entrance Lobby						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
electrics	modern										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Sample	126253-60	4 Sqm.	1	1	0	Chrysotile	3	2	 R3
panel around electric cupboard	Asbestos-containing insulating board	Sample	126253-59	2 Sqm.	2	1	1	Amosite, Chrysotile	6	2	 R3
Building: Bacton Low Rise, Block H - Flat 219			Level: 0		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										



table continued from previous page...

Building: Bacton Low Rise, Block H - Flat 219			Level: 0		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
floor covering	Asbestos-containing vinyl tile & adhesive	Sample	126253-67	4 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
panel to electrics	Asbestos-containing insulating board	Sample	126253-68	2 Lm.	2	1	1	Amosite, Chrysotile	6	2	 R3
Building: Bacton Low Rise, Block H - Flat 219			Level: 1		Location: 001/Stairs						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor covering	Asbestos-containing vinyl tile & adhesive	Cross Reference	126253-67	4 Sqm.	1	1	0	Chrysotile	3	3	 R3
floor	concrete										
Building: Bacton Low Rise, Block H - Flat 219			Level: 1		Location: 002/Kitchen/Living room						
Item / Product Examined	Material Description	Sampling Strategy	Sample No.	Extent	Product Score	Material Condition	Surface Treatment	Fibre Id.	Material Score	Accessibility Score	Risk Level Assessment
ceiling	concrete										
walls	concrete										
floor	concrete										
adhesive to concrete floor	Asbestos-containing bitumen adhesive	Cross Reference	126253-67	12 Sqm.	1	1	0	Chrysotile	3	2	 R3