



**General Notes**


1. Drawings shall be referred to for structural work only unless otherwise stated and read in conjunction with Architect's, Service Engineer's and Sub-Contractor's drawings.
2. The Contractor shall check all levels and dimensions, any errors or omissions are to be reported at once to the Engineer.
3. For General Notes refer to no. 9100-DRG-99YY-GN002.

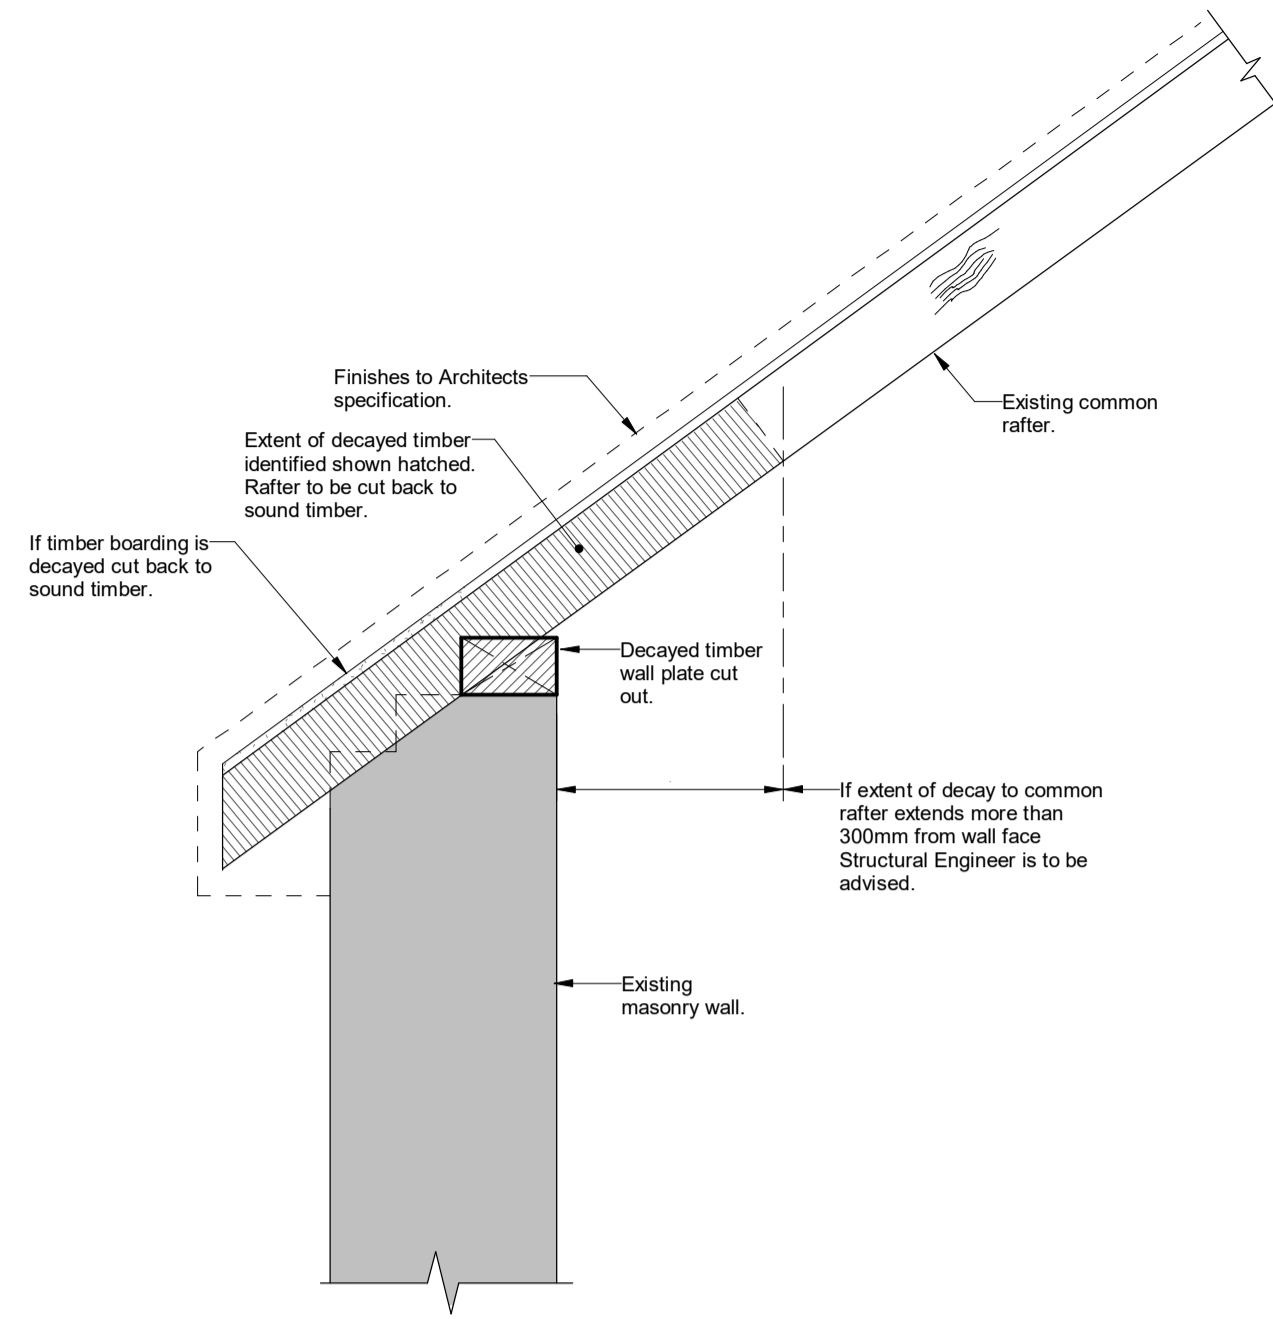


**Detail 1: Decayed Common Rafter and Wall Plate Existing Detail**  
scale 1 : 10

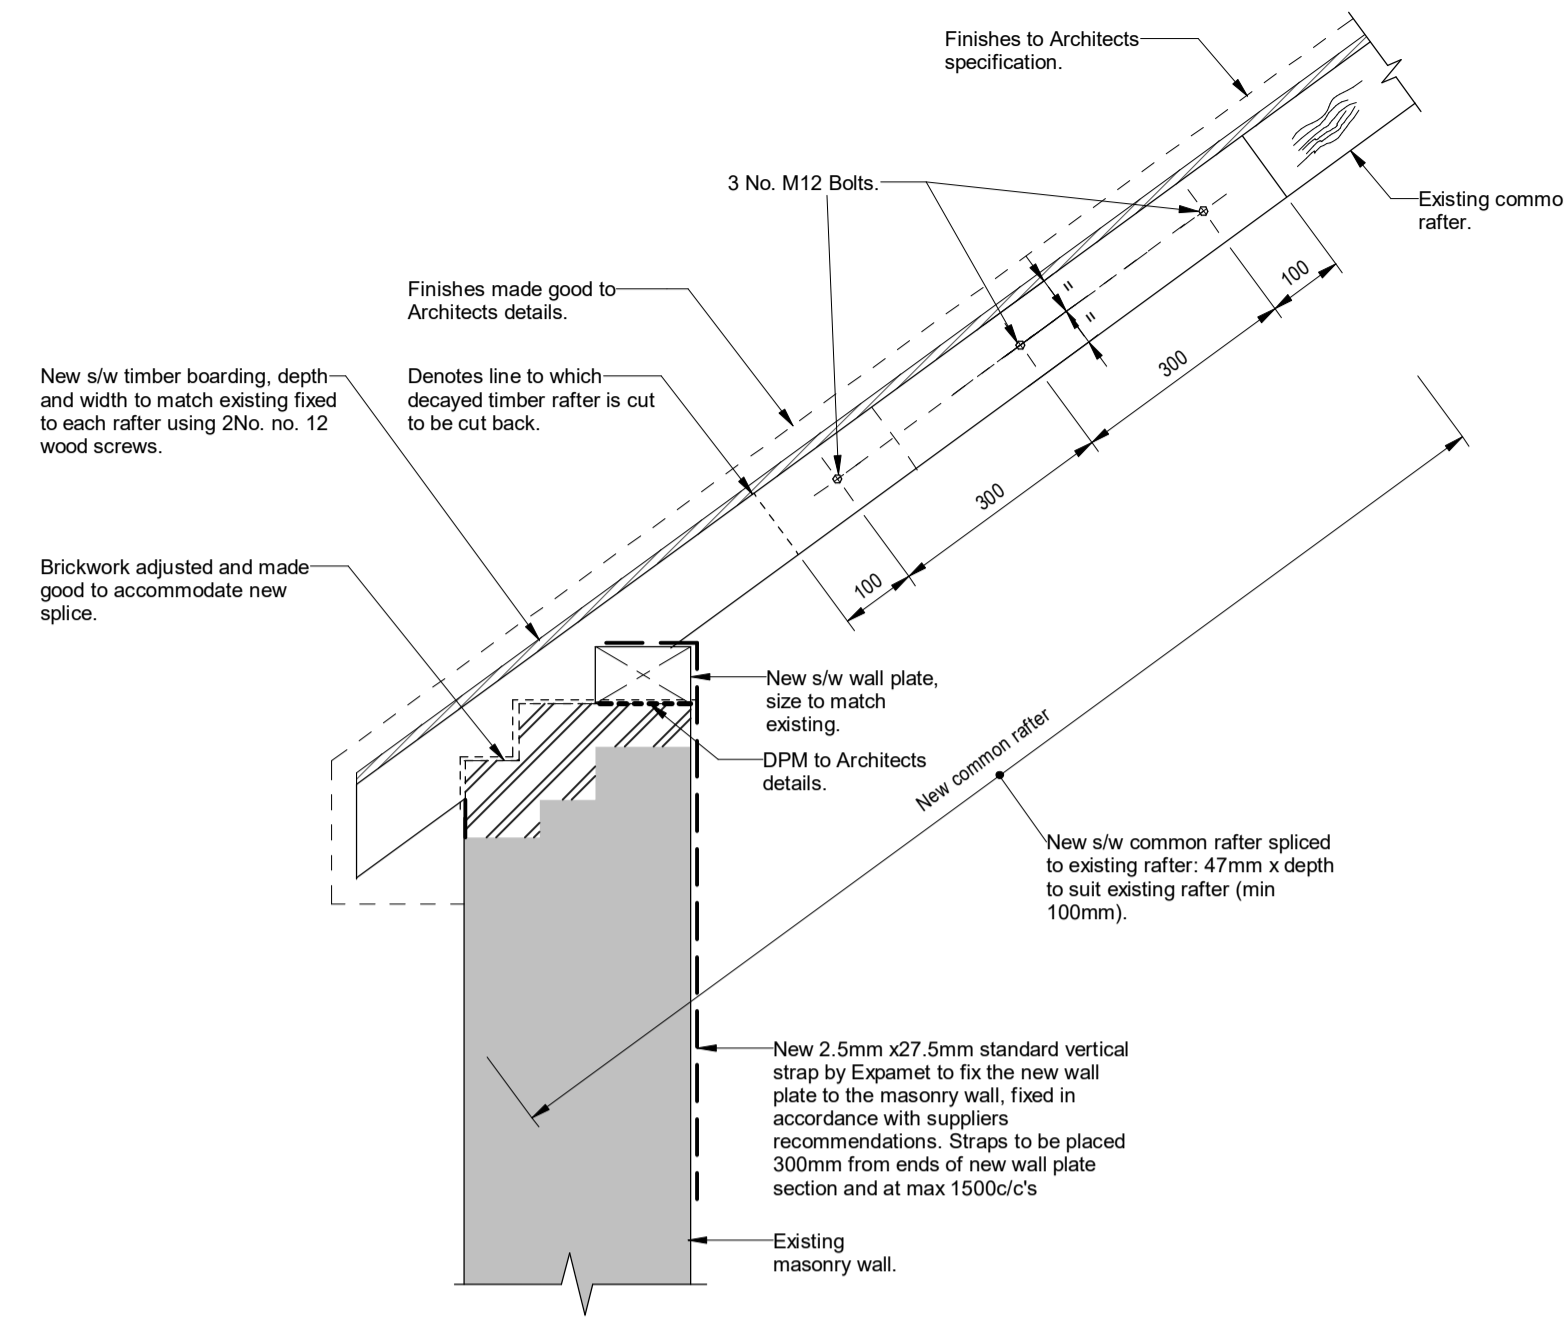


**Detail 2: Decayed Common Rafter and Wall Plate Proposed Splice Detail**  
scale 1 : 10

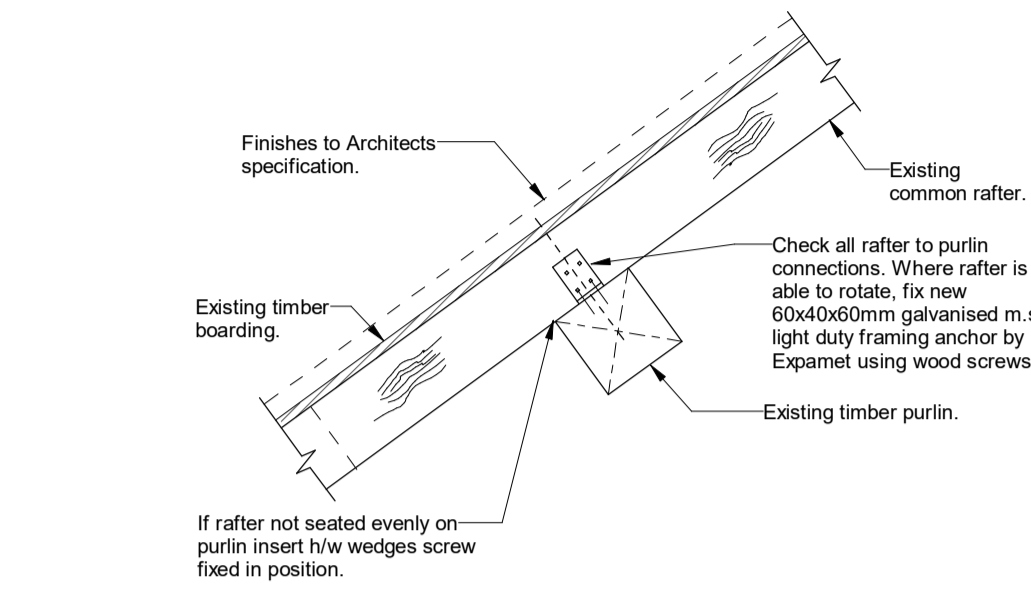


**Detail 3: Common Rafter to Purlin Connections**  
scale 1 : 10

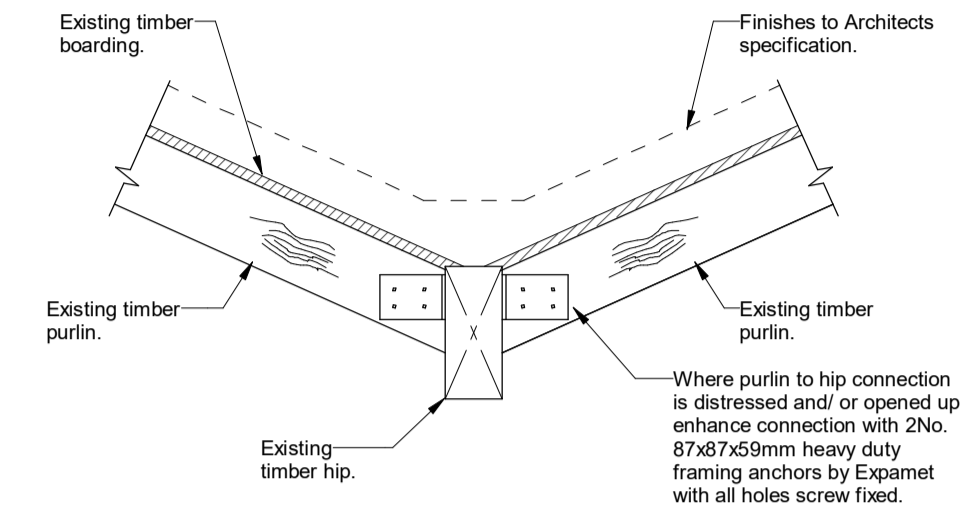

**Detail 4: Purlin to Hip Connection Repair**  
scale 1 : 10

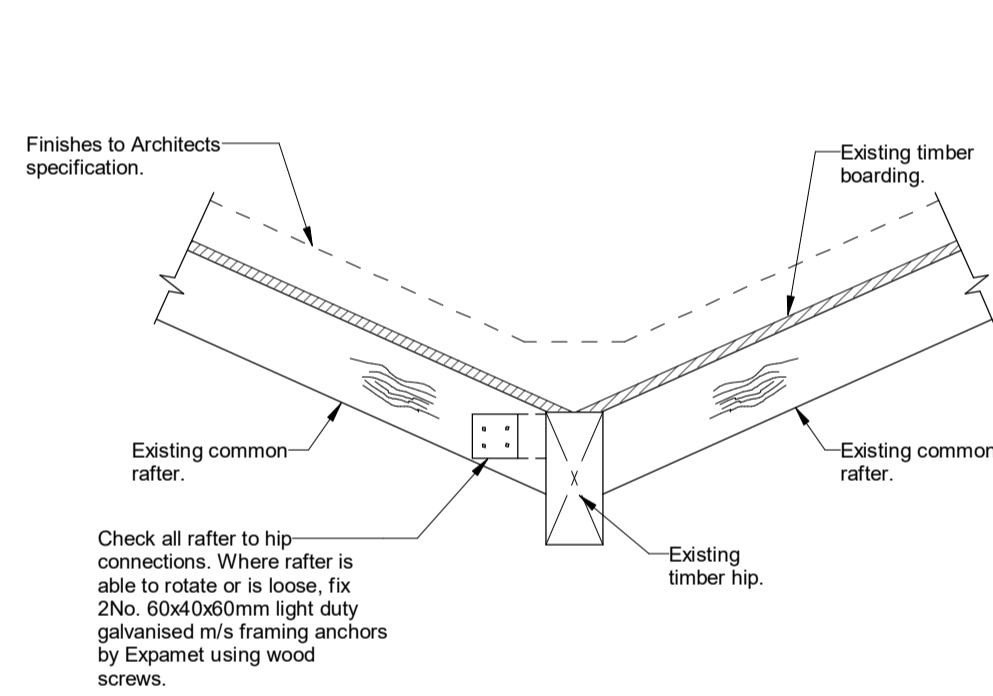

**Detail 5: Rafter to Hip Connection Detail**  
scale 1 : 10

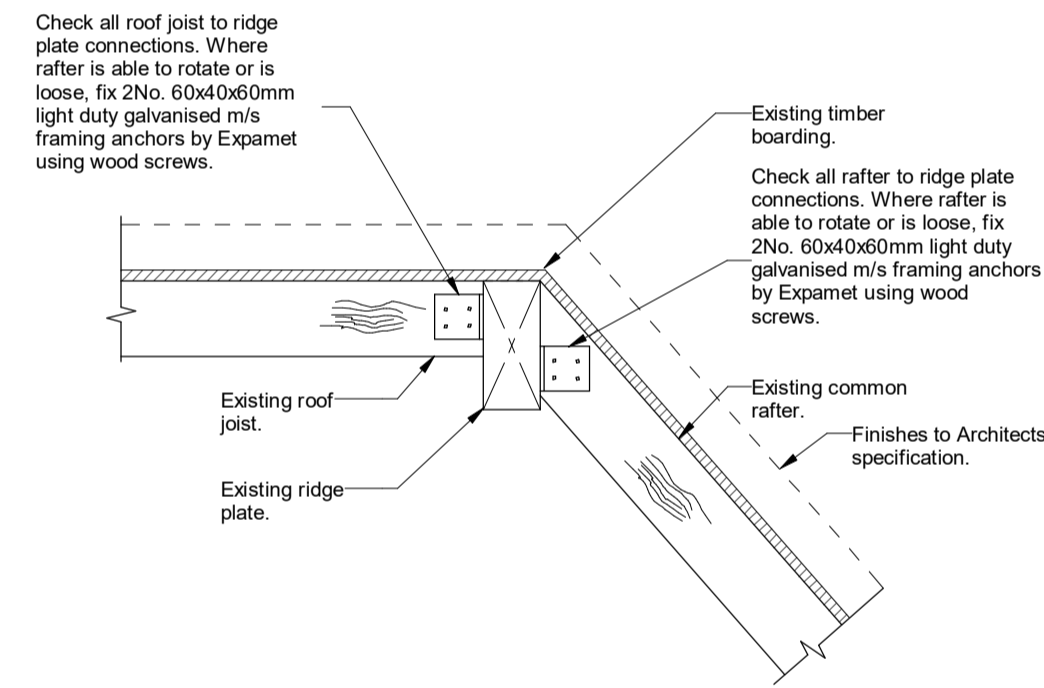

**Detail 6: Rafter/Roof Joist to Ridge Plate Detail**  
scale 1 : 10

REV	DATE	DESCRIPTION	BY	CHKD
A	12.09.16	Issued for Construction.	DA	TP
-	03.08.16	First Issue	DA	TP

**CONSTRUCTION**



TITLE:  
**Generic Roof Repair Details**

PROJECT:  
**Project No:11581  
Kidderpore Avenue**

SCALE: A1@ As Shown    DATE: July16    DRAWN: DA    CHKD: TP

DRG NO.    REV.  
**9100-DRG-00YY-DE011    A**

