

Level Monitoring - Relative Movement Over Time

Our Ref: 31262 Date of Issue 08/12/17

Provider Details

Name: CET

Monitoring Details

Instruction Date:	23/01/17
First Reading Date:	28/03/17
Maximum No Visits:	6
Anticipated Expiry Date:	
Monitoring Int (Wks):	8

Client Details

Insurance Co.:	
Client Name:	Cunningham Lindsey
Technical Mgr:	
Email:	
Client Ref:	6353138
Address:	
Tel	
Other Email:	

Risk Address


Occupier:	
Address:	32 South Villas
Address:	
Town:	London
County:	
Post Code:	NW1 9BT
Tel Day:	
Tel Eve:	
Mobile:	
Other:	
Other:	

Level Monitoring - Site Sketch

Our Ref: 31262

Date of Issue

08/12/17

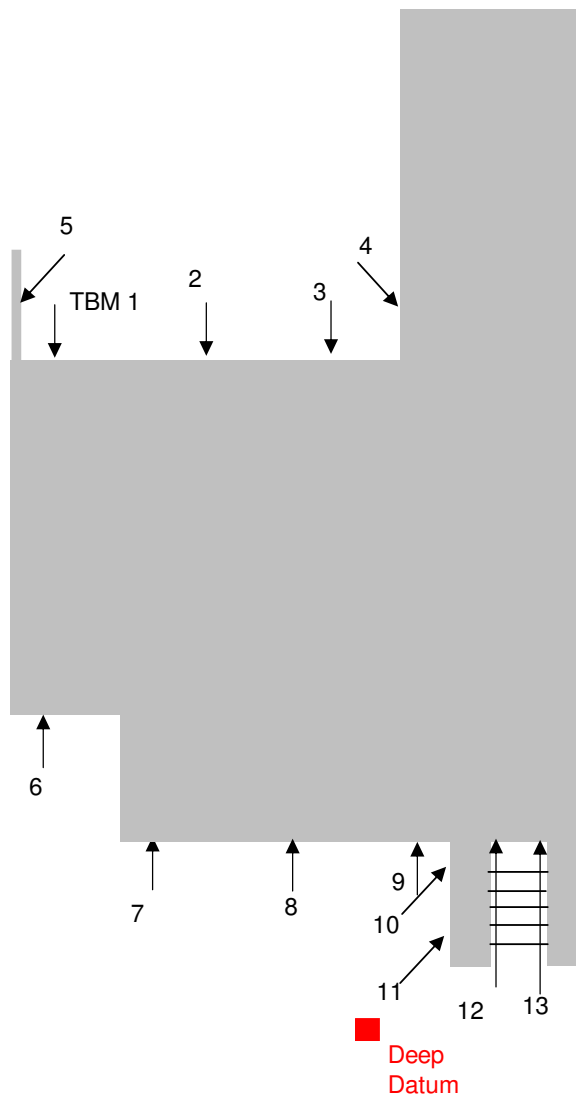



Level Monitoring - Comments

Our Ref: 31262

Date of Issue

08/12/17

Level Monitoring - Reduced Levels

Our Ref: 31262

Date of Issue 08/12/17

Reading Date	28/03/17	26/05/17	21/07/17	06/10/17	08/12/17		6	7	8	9	10	11	12
Point / Reading	1	2	3	4	5								
1	10.0000	10.0000	10.0000	10.0000	10.0000								
2	9.9999	10.0017	9.9953	9.9943	9.9976								
3	10.1325	10.1341	10.1360	10.1381	10.1396								
4	10.3953	10.3971	10.3910	10.3915	10.3923								
5	10.4447	10.4455	10.4444	10.4429	10.4430								
6	10.4627	10.4619	10.4628	10.4634	10.4649								
7	10.5350	10.5348	10.5356	10.5360	10.5379								
8	10.5273	10.5270	10.5302	10.5300	10.5319								
9	9.8759	9.8755	9.8756	9.8758	9.8772								
10	10.3580	10.3586	10.3561	10.3571	10.3591								
11	10.3767	10.3763	10.3748	10.3751	10.3772								
12	12.6808	12.6800	12.6804	12.6793	12.6828								
13	12.8486	12.8497	12.8503	12.8489	12.8523								
14													
15													
Not used													

Highest reduced level is displayed green, lowest reduced level is displayed red



Level Monitoring - Relative Movement Over Time

Our Ref: 31262

Date of Issue 08/12/17


[illegible]

Level Monitoring - Movement relative to datum against Date

Our Ref: 31262

Issue Date:

08/12/17

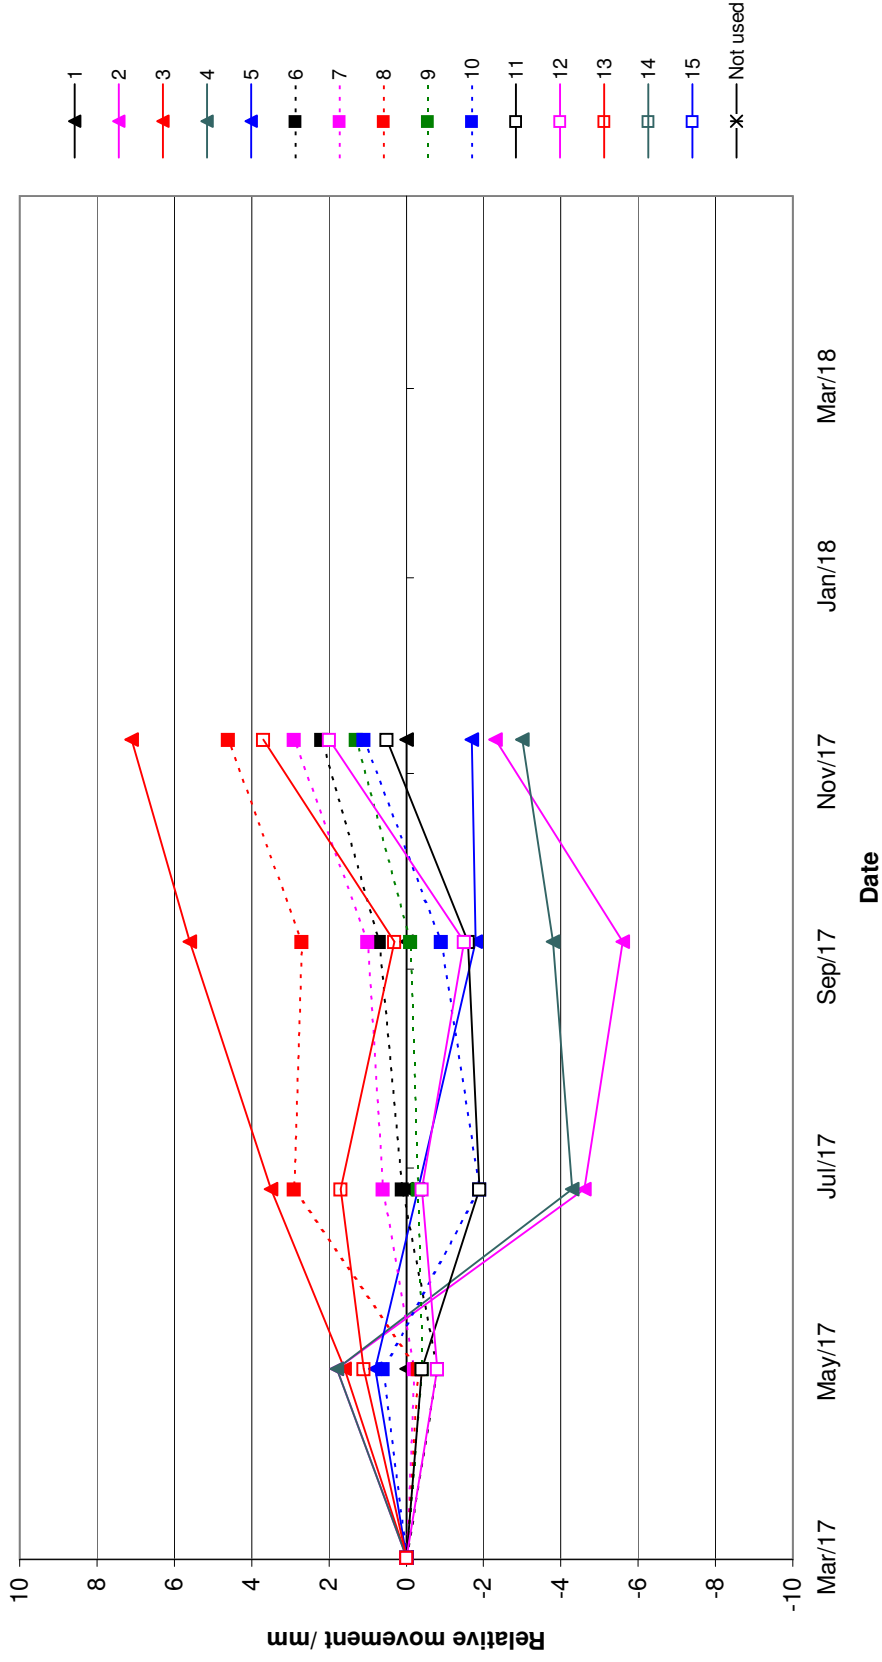



Giving our all

MS ref	Client ref	Client Name	Issue Date
31262	6353138	Cunningham Lindsey	08/12/17

Stud locations

1	EXT rear elevation above 1st floor door lintel
2	EXT rear elevation above 1st floor door by light
3	INT front porch LHS junction with main house
4	EXT front porch LHS above door to understairs
5	EXT front porch LHS above door to basement flat
6	

Additional instructions / notes

Studs nos.	Align-ment	Current C/W	Visit Date					
			28/03/17	26/05/17	21/07/17	06/10/17	08/12/17	
1	V	5.41	44.01	43.44	46.43	47.49	47.60	
1	D							
1	Check							
2	H	15.81	75.72	75.47	75.82	75.86	75.92	
2	D							
2	Check							
3	H	9.95	51.05	50.97	52.06	52.46	52.43	
3	D							
3	Check							
4	H	3.88	66.73	66.80	68.10	68.31	67.78	
4	D							
4	Check							
5	V	9.15	64.16	64.25	65.20	66.26	66.55	
5	D							
5	Check							
6	H							
6	D							
6	Check							
Customer :				No issues	No issues	No issues	No issues	
New cracking :								
See "current c/w" :								
Calliper nos :				9256	9256	2860	9839	
Technician :				JM	JM	AJZ	AJZ	

Additional comments : -

Line 1
Line 2
Line 3

(max = 55 characters per line)



Giving our all

MS ref	Client ref	Client Name	Issue Date
31262	6353138	Cunningham Lindsey	08/12/17

