

Site Details:

Gondor Gardens, Gondor Gardens, West Hampstead, NW6 1QF


Client Ref: EMS_418652_559409
Report Ref: EMS-418652_559409
Grid Ref: 524838, 185309

Map Name: 1:10,000 Raster

Map date: 2002

Scale: 1:10,000

Printed at: 1:10,000

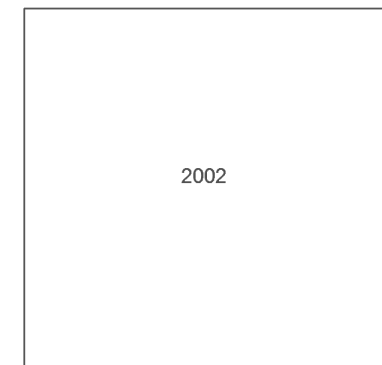

Produced by
Groundsure Insights
www.groundsure.com




Supplied by:
www.emapsite.com
sales@emapsite.com

© Crown copyright and database rights 2015 Ordnance Survey 100035207

Production date: 03 May 2017

To view map legend click here [Legend](#)

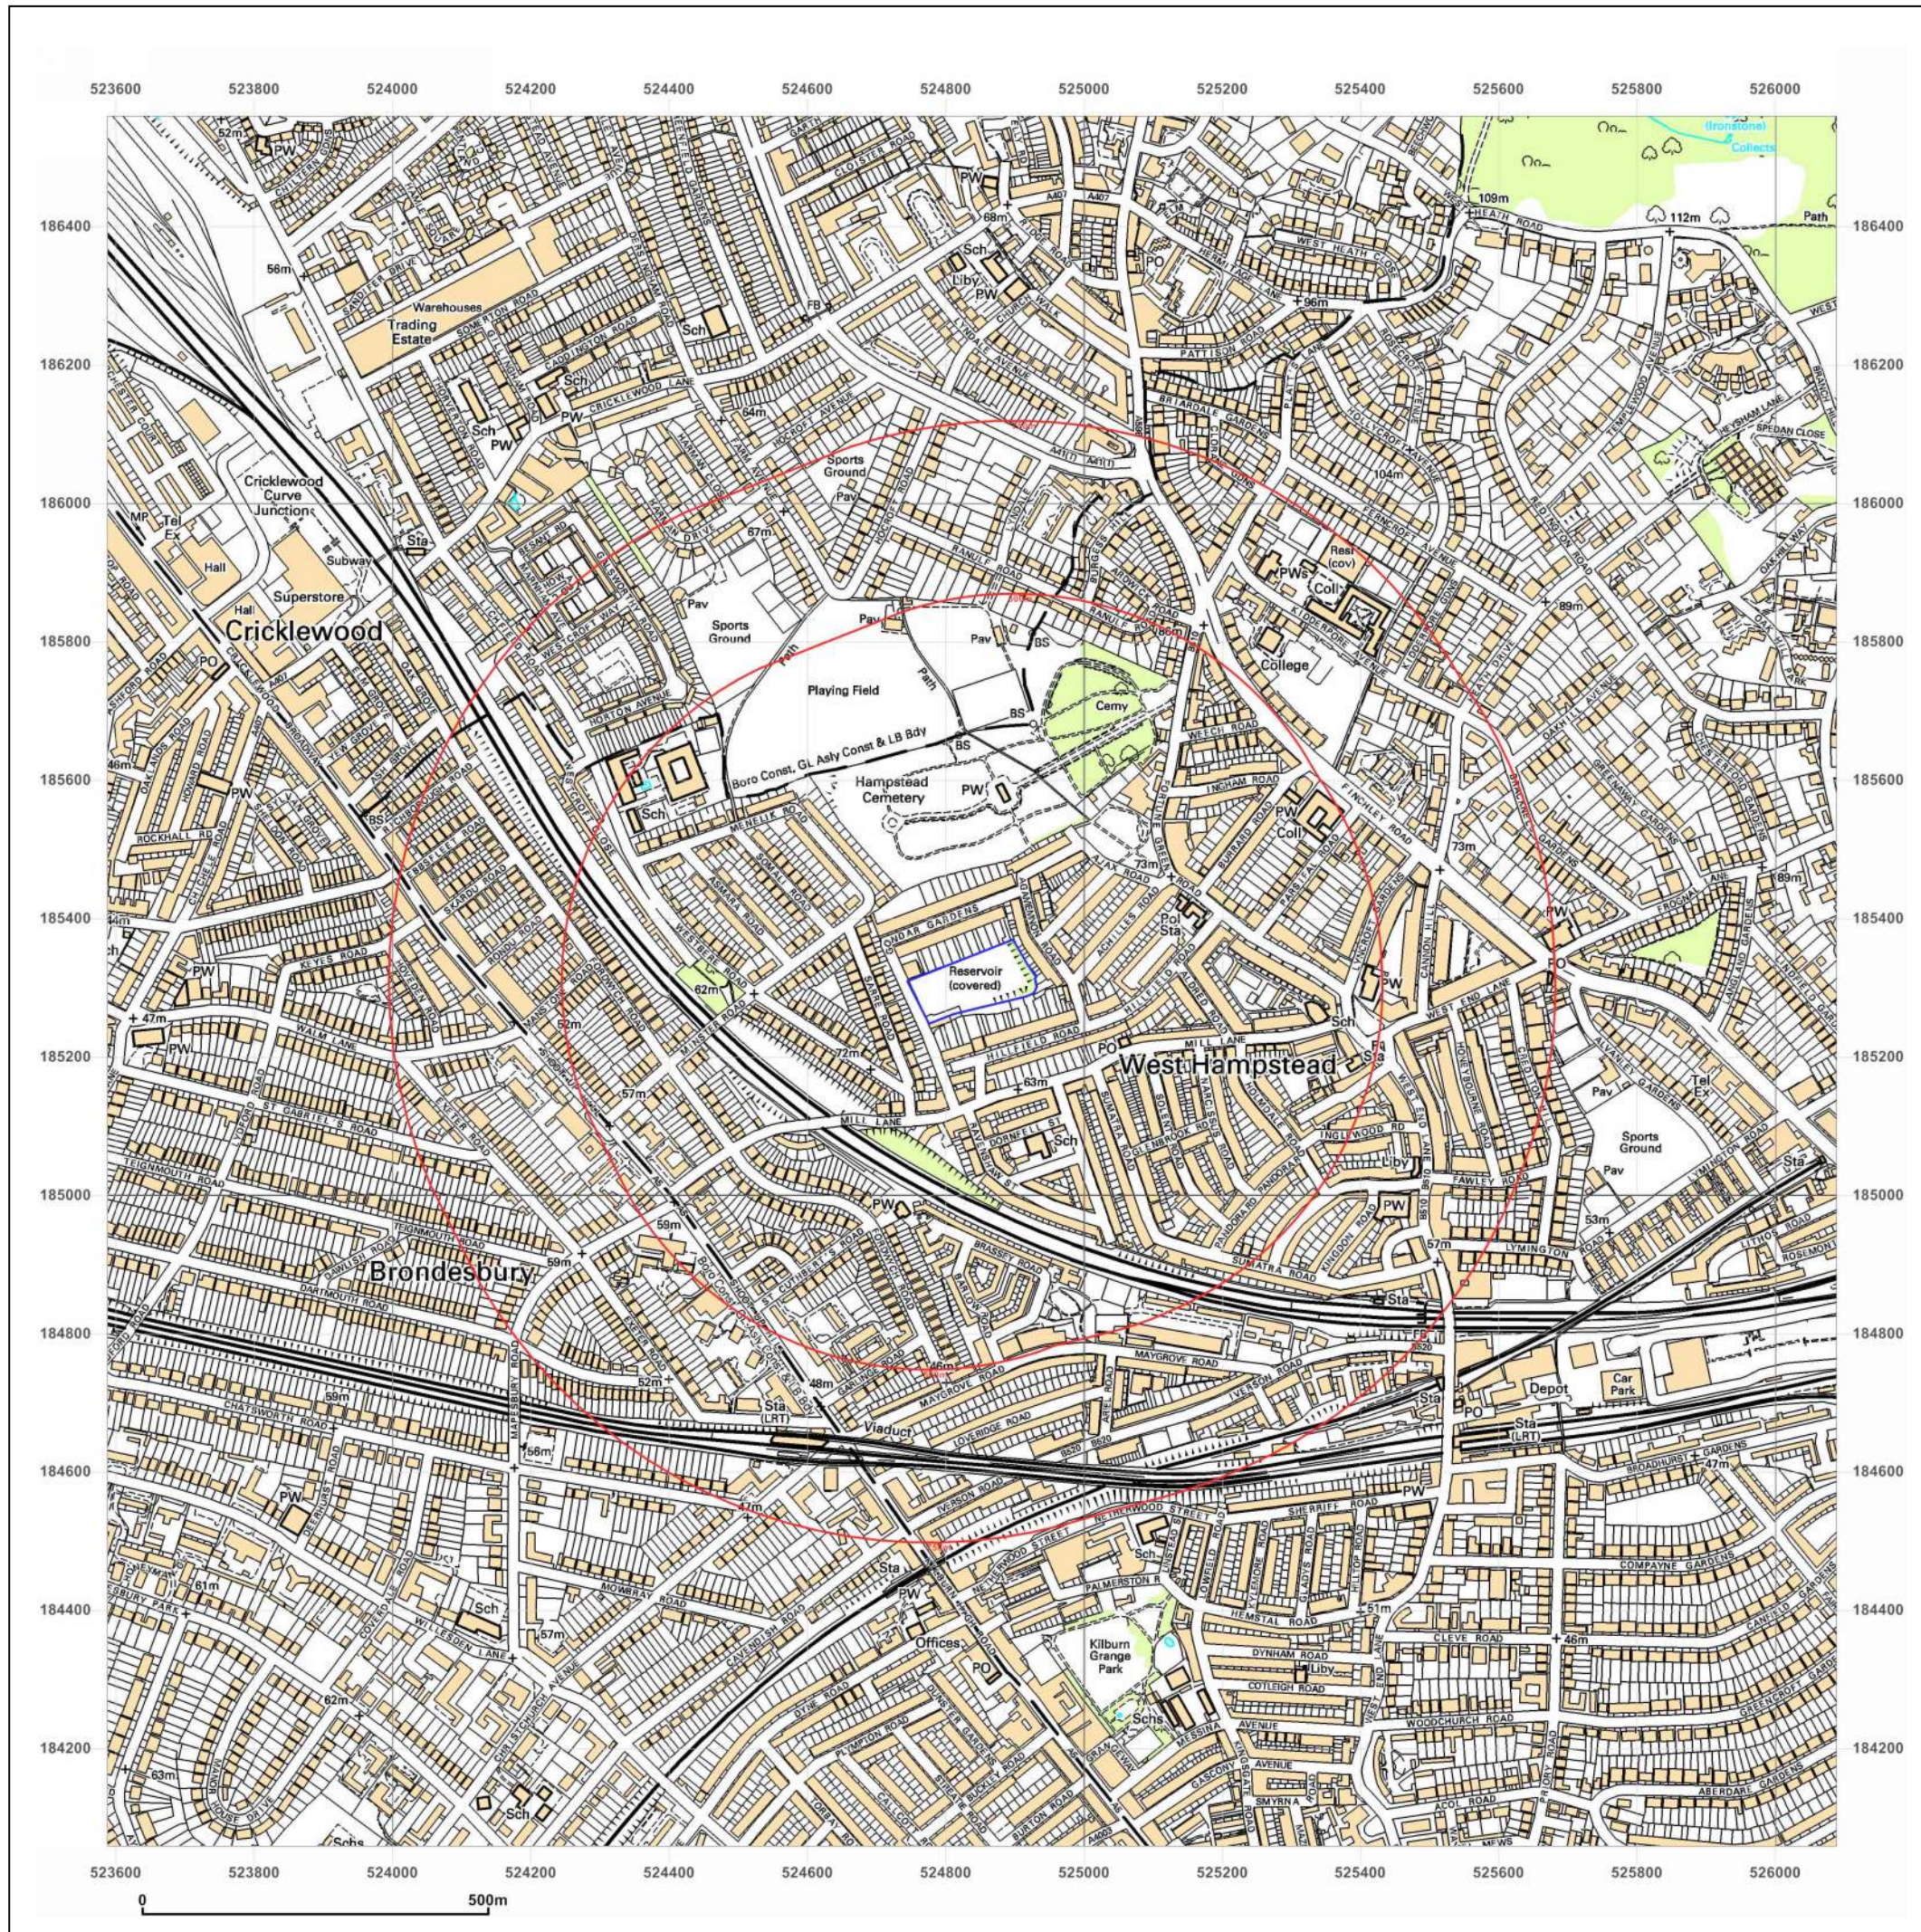

Site Details:

Gondor Gardens, Gondor Gardens, West Hampstead, NW6 1QF

Client Ref: EMS_418652_559409
Report Ref: EMS-418652_559409
Grid Ref: 524838, 185309

Map Name: National Grid

Map date: 2010

Scale: 1:10,000

Printed at: 1:10,000



Produced by
Groundsure Insights
www.groundsure.com




Supplied by:
www.emapsite.com
sales@emapsite.com

© Crown copyright and database rights 2015 Ordnance Survey 100035207

Production date: 03 May 2017

To view map legend click here [Legend](#)

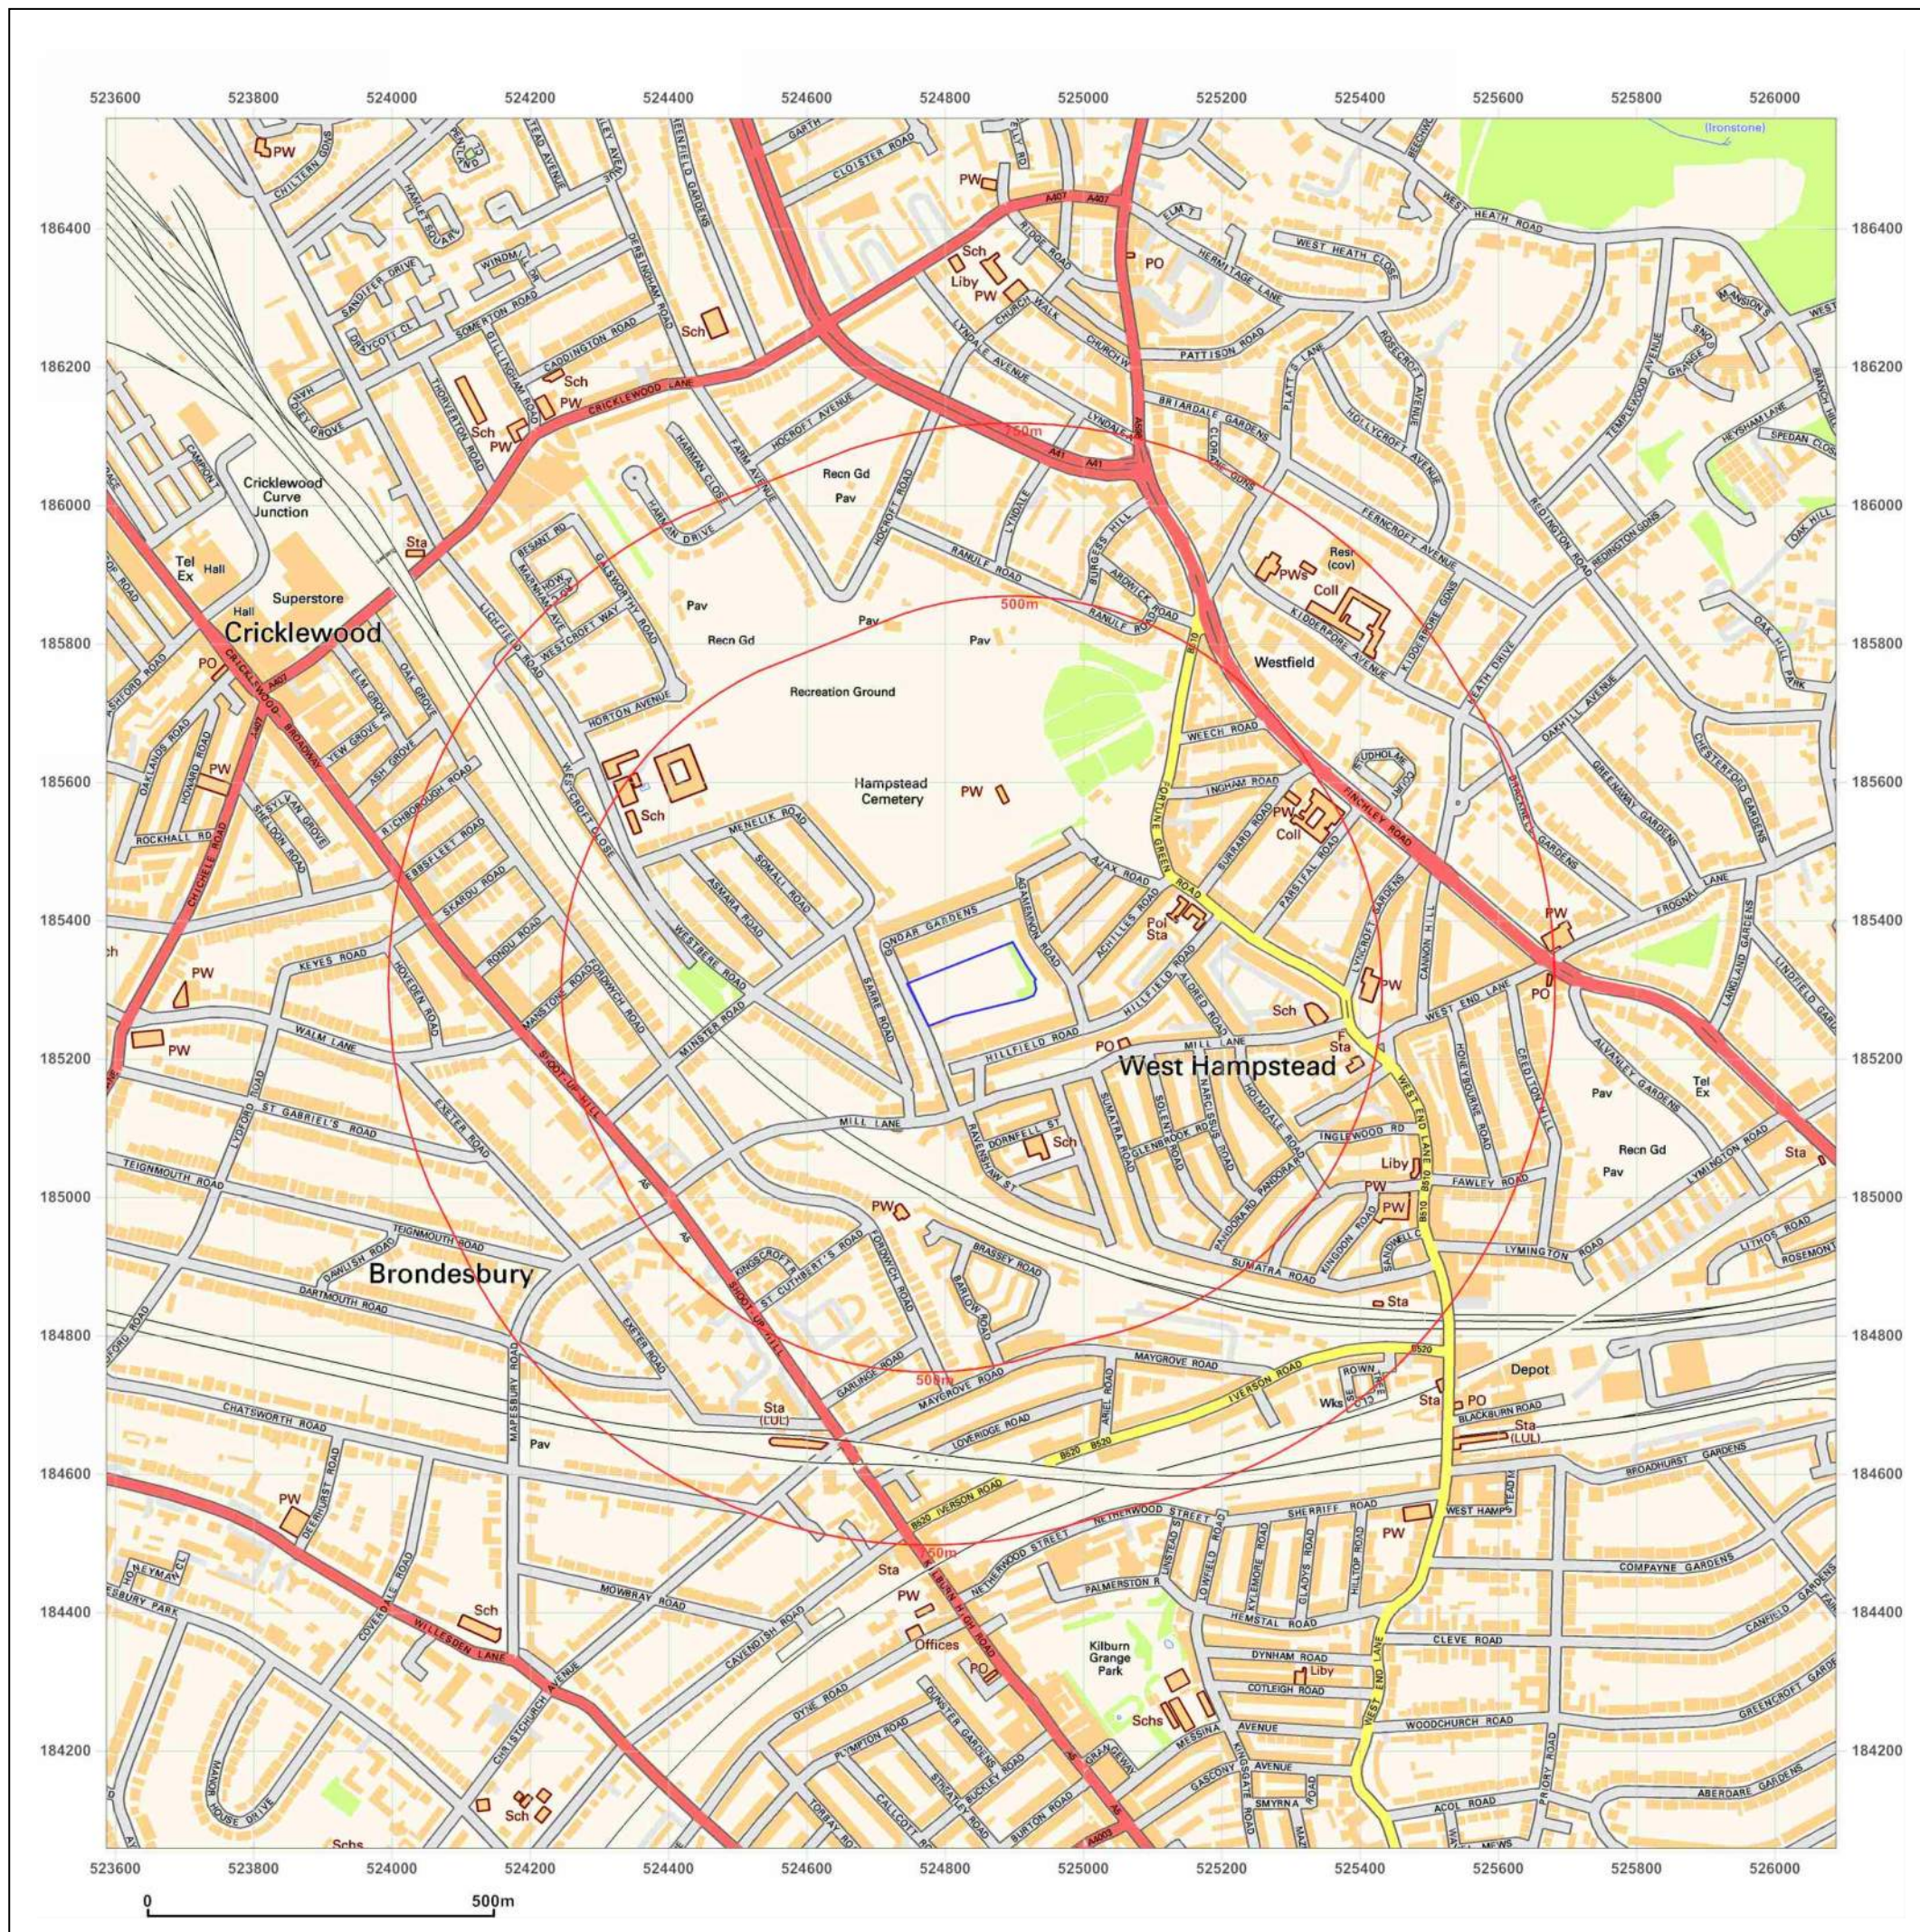

Site Details:

Gondor Gardens, Gondor Gardens, West Hampstead, NW6 1QF



Client Ref: EMS_418652_559409
Report Ref: EMS-418652_559409
Grid Ref: 524838, 185309

Map Name: National Grid

Map date: 2014

Scale: 1:10,000

Printed at: 1:10,000

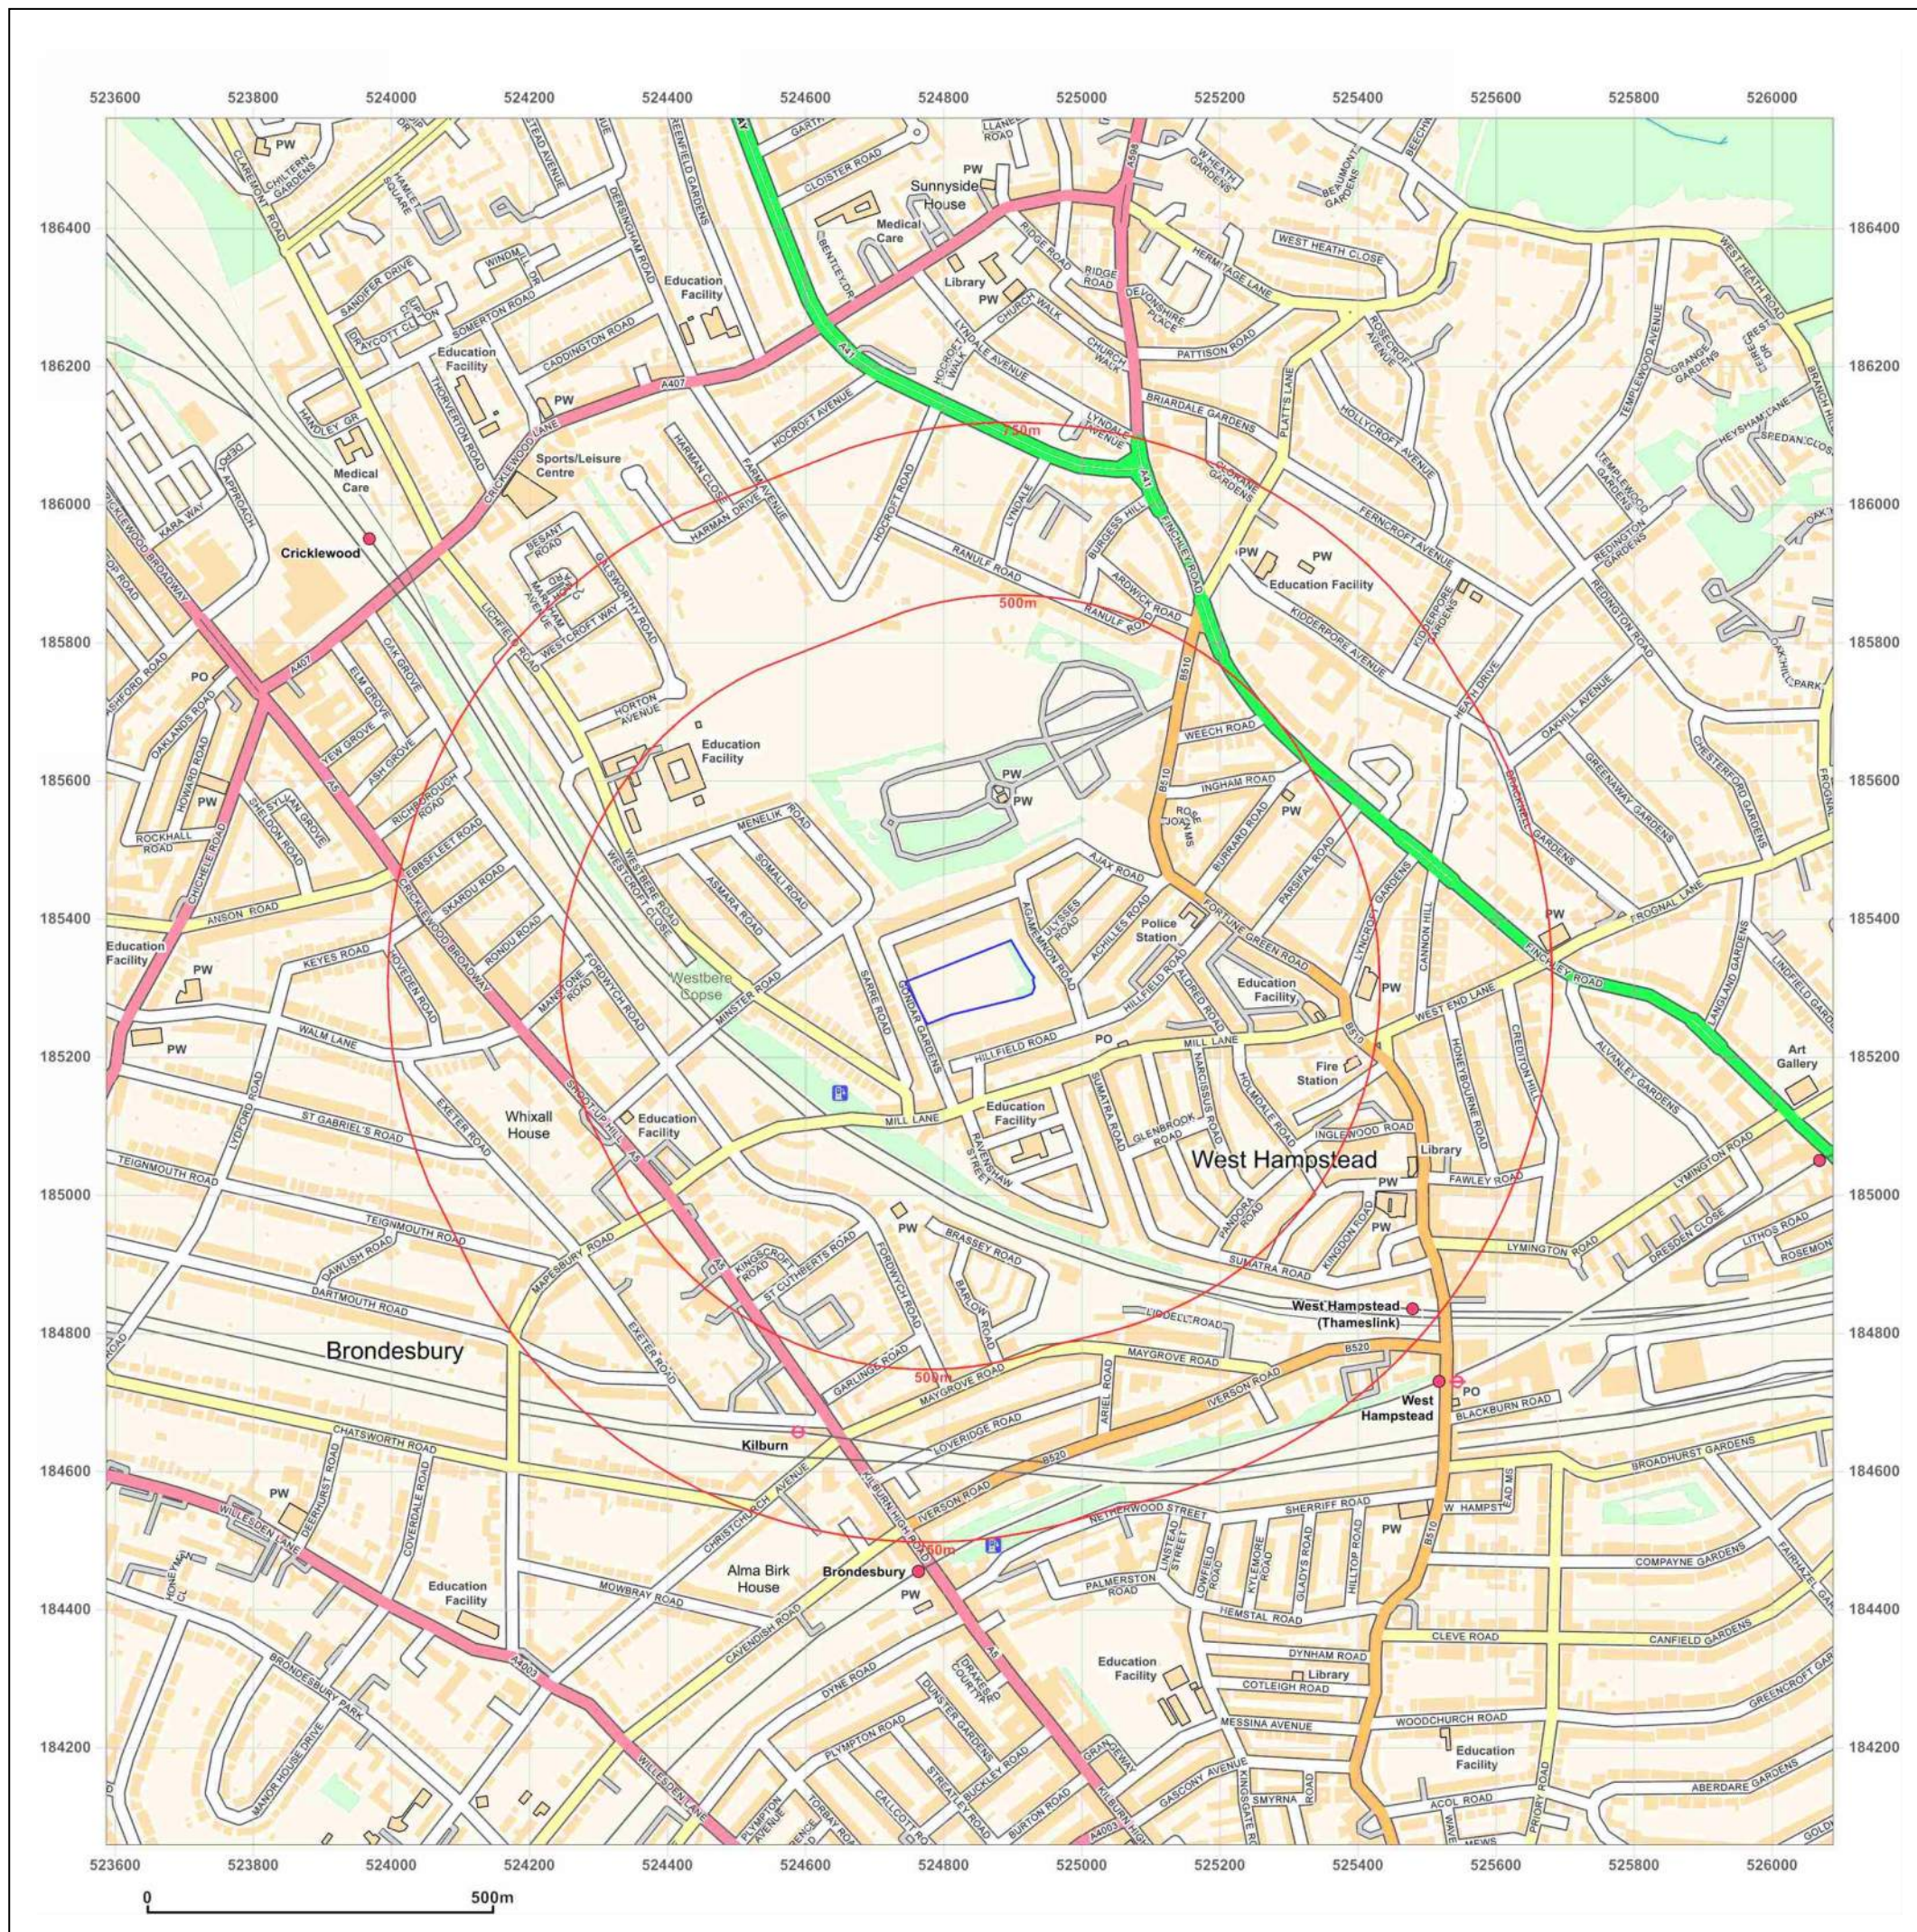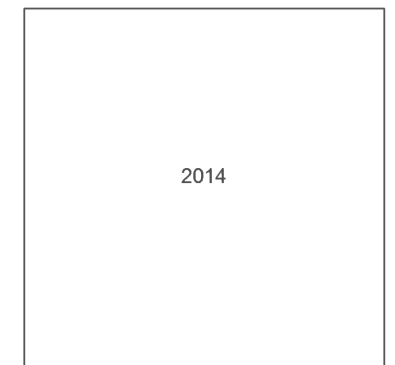

Produced by
Groundsure Insights
www.groundsure.com



Supplied by:
www.emapsite.com
sales@emapsite.com



emapsite

Masdar House, 1 Reading Road,
Eversley, RG27 0RP

Report Reference: EMS-418652_559410

Your Reference: EMS_418652_559410

Report Date 3 May 2017

Report Delivery Method: Email - pdf

Groundsure Geo Insight

Address: Gondor Gardens, Gondor Gardens, West Hampstead, NW6 1QF,

Dear Sir/ Madam,

Thank you for placing your order with Groundsure. Please find enclosed the **Groundsure Geo Insight** as requested.

If you would like further assistance regarding this report then please contact the emapsite customer services team on 0118 9736883 quoting the above report reference number.

Yours faithfully,

emapsite customer services team

Enc.
Groundsure Geo Insight

Groundsure Geo Insight

Address: Gondor Gardens, Gondor Gardens, West Hampstead, NW6 1QF,
Date: 3 May 2017
Reference: EMS-418652_559410
Client: emapsite

NW N NE



SW S SE

Aerial Photograph Capture date: 07-Jun-2015
Grid Reference: 524842,185307
Site Size: 1.25ha

Contents Page

Contents Page.....	3
Overview of Findings.....	5
1:10,000 Scale Availability.....	8
Availability of 1:10,000 Scale Geology Mapping.....	9
1 Geology (1:10,000 scale).....	10
1.1 Artificial Ground Map (1:10,000 scale).....	10
1. Geology 1:10,000 scale.....	11
1.1 Artificial Ground.....	11
1.2 Superficial Deposits and Landslips Map (1:10,000 scale).....	12
1.2 Superficial Deposits and Landslips.....	13
1.2.1 Superficial Deposits/ Drift Geology.....	13
1.2.2 Landslip.....	13
1.3 Bedrock and Faults Map (1:10,000 scale).....	14
1.3 Bedrock and Faults.....	15
1.3.1 Bedrock/ Solid Geology.....	15
1.3.2 Faults.....	15
2 Geology 1:50,000 Scale.....	16
2.1 Artificial Ground Map.....	16
2. Geology 1:50,000 scale.....	17
2.1 Artificial Ground.....	17
2.1.1 Artificial/ Made Ground.....	17
2.1.2 Permeability of Artificial Ground.....	17
2.2 Superficial Deposits and Landslips Map (1:50,000 scale).....	18
2.2 Superficial Deposits and Landslips.....	19
2.2.1 Superficial Deposits/ Drift Geology.....	19
2.2.2 Permeability of Superficial Ground.....	19
2.2.3 Landslip.....	19
2.2.4 Landslip Permeability.....	19
2.3 Bedrock and Faults Map (1:50,000 scale).....	20
2.3 Bedrock, Solid Geology & Faults.....	21
2.3.1 Bedrock/Solid Geology.....	21
2.3.2 Permeability of Bedrock Ground.....	21
2.3.3 Faults.....	21
3 Radon Data.....	22
3.1 Radon Affected Areas.....	22
3.2 Radon Protection.....	22
4 Ground Workings Map.....	23
4 Ground Workings.....	24
4.1 Historical Surface Ground Working Features derived from Historical Mapping.....	24
4.2 Historical Underground Working Features derived from Historical Mapping.....	25
4.3 Current Ground Workings.....	25
5 Mining, Extraction & Natural Cavities.....	27
5.1 Historical Mining.....	27
5.2 Coal Mining.....	27
5.3 Johnson Poole and Bloomer.....	27
5.4 Non-Coal Mining.....	27
5.5 Non-Coal Mining Cavities.....	28
5.6 Natural Cavities.....	28
5.7 Brine Extraction.....	28
5.8 Gypsum Extraction.....	28
5.9 Tin Mining.....	28
5.10 Clay Mining.....	29
6 Natural Ground Subsidence.....	30
6.1 Shrink-Swell Clay Map.....	30
6.2 Landslides Map.....	31
6.3 Ground Dissolution of Soluble Rocks Map.....	32
6.4 Compressible Deposits Map.....	33
6.5 Collapsible Deposits Map.....	34
6.6 Running Sand Map.....	35

6 Natural Ground Subsidence.....	36
6.1 Shrink-Swell Clays.....	36
6.2 Landslides.....	36
6.3 Ground Dissolution of Soluble Rocks.....	37
6.4 Compressible Deposits.....	37
6.5 Collapsible Deposits.....	37
6.6 Running Sands.....	37
7 Borehole Records.....	39
8 Estimated Background Soil Chemistry.....	40
9 Railways and Tunnels Map.....	41
9 Railways and Tunnels.....	42
9.1 Tunnels	42
9.2 Historical Railway and Tunnel Features	42
9.3 Historical Railways.....	43
9.4 Active Railways.....	44
9.5 Railway Projects.....	44

Overview of Findings

The Groundsure Geo Insight provides high quality geo-environmental information that allows geo-environmental professionals and their clients to make informed decisions and be forewarned of potential ground instability problems that may affect the ground investigation, foundation design and possibly remediation options that could lead to possible additional costs.

The report is based on the BGS 1:50,000 and 1:10,000 Digital Geological Map of Great Britain, BGS Geosure data; BRITPITS database; Non-coal mining data and Borehole Records, Coal Authority data including brine extraction areas, PBA non-coal mining and natural cavities database, Johnson Poole and Bloomer mining data and Groundsure's unique database including historical surface ground and underground workings.

For further details on each dataset, please refer to each individual section in the report as listed. Where the database has been searched a numerical result will be recorded. Where the database has not been searched '-' will be recorded.

Section 1: Geology 1:10,000 Scale		
1.1 Artificial Ground	1.1 Is there any Artificial Ground/ Made Ground present beneath the study site at 1:10,000 scale?	No
1.2 Superficial Geology and Landslips	1.2.1 Is there any Superficial Ground/Drift Geology present beneath the study site at 1:10,000 scale?*	No
	1.2.2 Are there any records of landslip within 500m of the study site boundary at 1:10,000 scale?	No
1.3 Bedrock, Solid Geology and Faults	1.3.1 For records of Bedrock and Solid Geology beneath the study site* see the detailed findings section.	
	1.3.2 Are there any records of faults within 500m of the study site boundary at 1:10,000 scale?	No
Section 2: Geology 1:50,000 Scale		
2.1 Artificial Ground	2.1.1 Is there any Artificial Ground/ Made Ground present beneath the study site?	No
	2.1.2 Are there any records relating to permeability of artificial ground within the study site*boundary?	No
2.2 Superficial Geology and Landslips	2.2.1 Is there any Superficial Ground/Drift Geology present beneath the study site?*	No
	2.2.2 Are there any records of permeability of superficial ground within 500m of the study site?	No
	2.2.3 Are there any records of landslip within 500m of the study site boundary?	No
	2.2.4 Are there any records relating to permeability of landslips within the study site* boundary?	No

Section 2: Geology 1:50,000 Scale

2.3 Bedrock, Solid Geology and Faults

2.3.1 For records of Bedrock and Solid Geology beneath the study site* see the detailed findings section.

2.3.2 Are there any records relating to permeability of bedrock ground within the study site boundary?

Yes

2.3.3 Are there any records of faults within 500m of the study site boundary?

No

Section 3: Radon

3. Radon

3.1 Is the property in a Radon Affected Area as defined by the Health Protection Agency (HPA) and if so what percentage of homes are above the Action Level?

The property is not in a Radon Affected Area, as less than 1% of properties are above the Action Level.

3.2 Radon Protection

No radon protective measures are necessary.

Section 4: Ground Workings


	On-site	0-50m	51-250	251-500	501-1000
4.1 Historical Surface Ground Working Features from Small Scale Mapping	6	0	19	Not Searched	Not Searched
4.2 Historical Underground Workings from Small Scale Mapping	0	0	0	0	0
4.3 Current Ground Workings	0	0	0	0	0

Section 5: Mining, Extraction & Natural Cavities

	On-site	0-50m	51-250	251-500	501-1000
5.1 Historical Mining	0	0	0	0	0
5.2 Coal Mining	0	0	0	0	0
5.3 Johnson Poole and Bloomer Mining Area	0	0	0	0	0
5.4 Non-Coal Mining*	0	0	0	0	0
5.5 Non-Coal Mining Cavities	0	0	0	0	0
5.5 Natural Cavities	0	0	0	0	0


Section 5: Mining, Extraction & Natural Cavities	On-site	0-50m	51-250	251-500	501-1000
5.6 Brine Extraction	0	0	0	0	0
5.7 Gypsum Extraction	0	0	0	0	0
5.8 Tin Mining	0	0	0	0	0
5.9 Clay Mining	0	0	0	0	0
Section 6: Natural Ground Subsidence					
6.1 Shrink-Swell Clay	Moderate				
6.2 Landslides	Very Low				
6.3 Ground Dissolution of Soluble Rocks	Negligible				
6.4 Compressible Deposits	Negligible				
6.5 Collapsible Deposits	Very Low				
6.5 Running Sand	Negligible				
Section 7: Borehole Records					
7 BGS Recorded Boreholes	On-site	0-50m	51-250		
	0	0	0		
Section 8: Estimated Background Soil Chemistry					
8 Records of Background Soil Chemistry	On-site	0-50m	51-250		
	1	0	0		
Section 9: Railways and Tunnels					
9.1 Tunnels	On-site	0-50m	51-250	250-500	
	0	0	0	Not Searched	
9.2 Historical Railway and Tunnel Features	0	0	25	Not Searched	
9.3 Historical Railways	0	0	0	Not Searched	
9.4 Active Railways	0	0	18	Not Searched	
9.5 Railway Projects	0	0	0	0	

1:10,000 Scale Availability

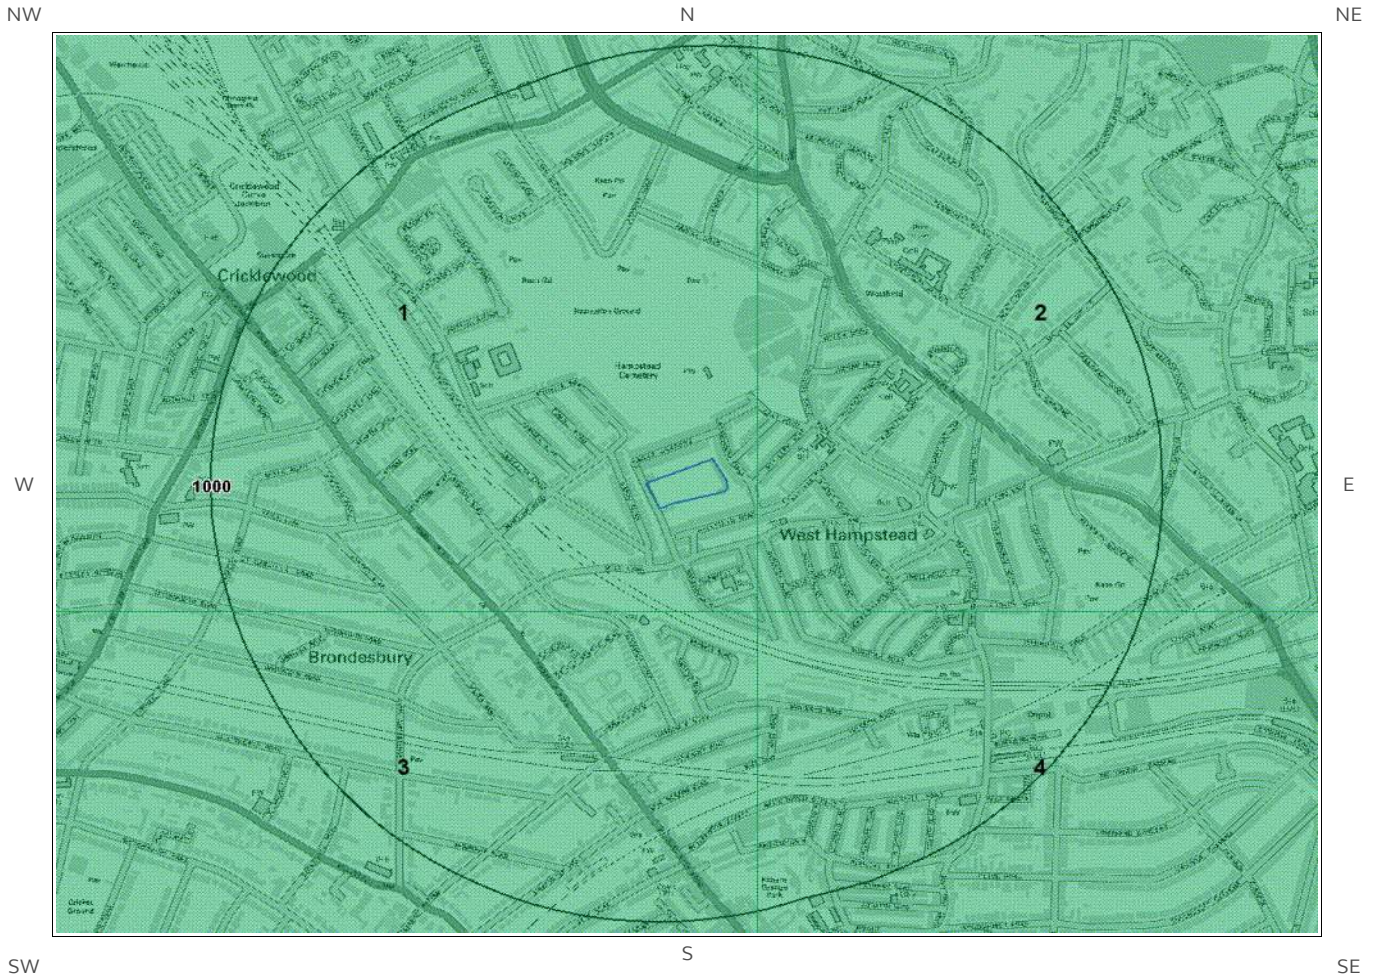

1_10,000 Availability Legend

© Crown copyright and database rights 2017.
 Ordnance Survey license 100035207.

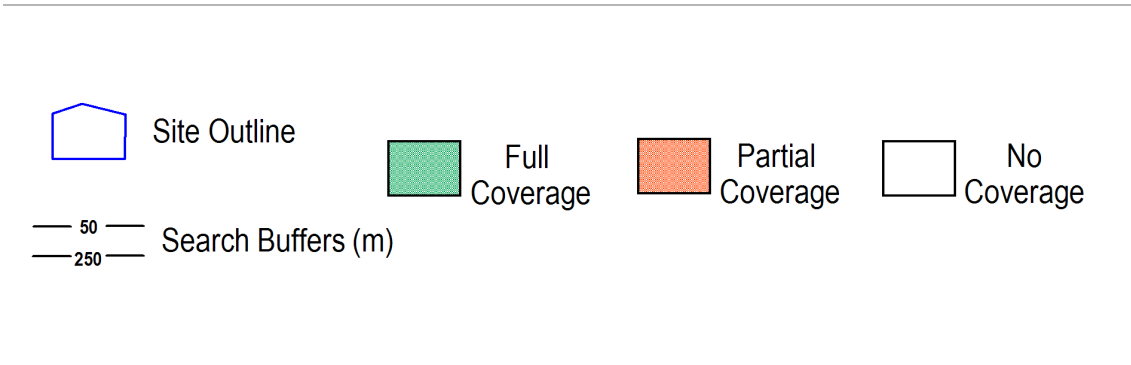

Availability of 1:10,000 Scale Geology Mapping

The following information represents the availability of the key components of the 1:10,000 scale geological data.

ID	Distance	Artificial Coverage	Superficial Coverage	Bedrock Coverage	Mass Movement Coverage
1	0.0	Some deposits are mapped	Full	Full	No coverage
2	69.0	Some deposits are mapped	Full	Full	No coverage
3	248.0	Some deposits are mapped	Full	Full	No coverage
4	299.0	Some deposits are mapped	Full	Full	No coverage


Guidance: The 1:10,000 scale geological interpretation is the most detailed generally available from BGS and is the scale at which most geological surveying is carried out in the field. The database is presented as four types of geology (artificial, mass movement, superficial and bedrock), although not all themes are mapped or available on every map sheet. Therefore a coverage layer showing the availability of the four themes is presented above.

The definitions of coverage are as follows:

Geology	Full Coverage	Partial Coverage	No Coverage
Bedrock	The whole tile has been mapped	Some but not all the tile has been mapped	No coverage
Superficial	The whole tile has been mapped	Some but not all of the tile has been mapped	No coverage
Artificial	Some deposits are mapped on this tile	-	No deposits are mapped
Mass Movement	Some deposits are mapped on this tile	-	No coverage







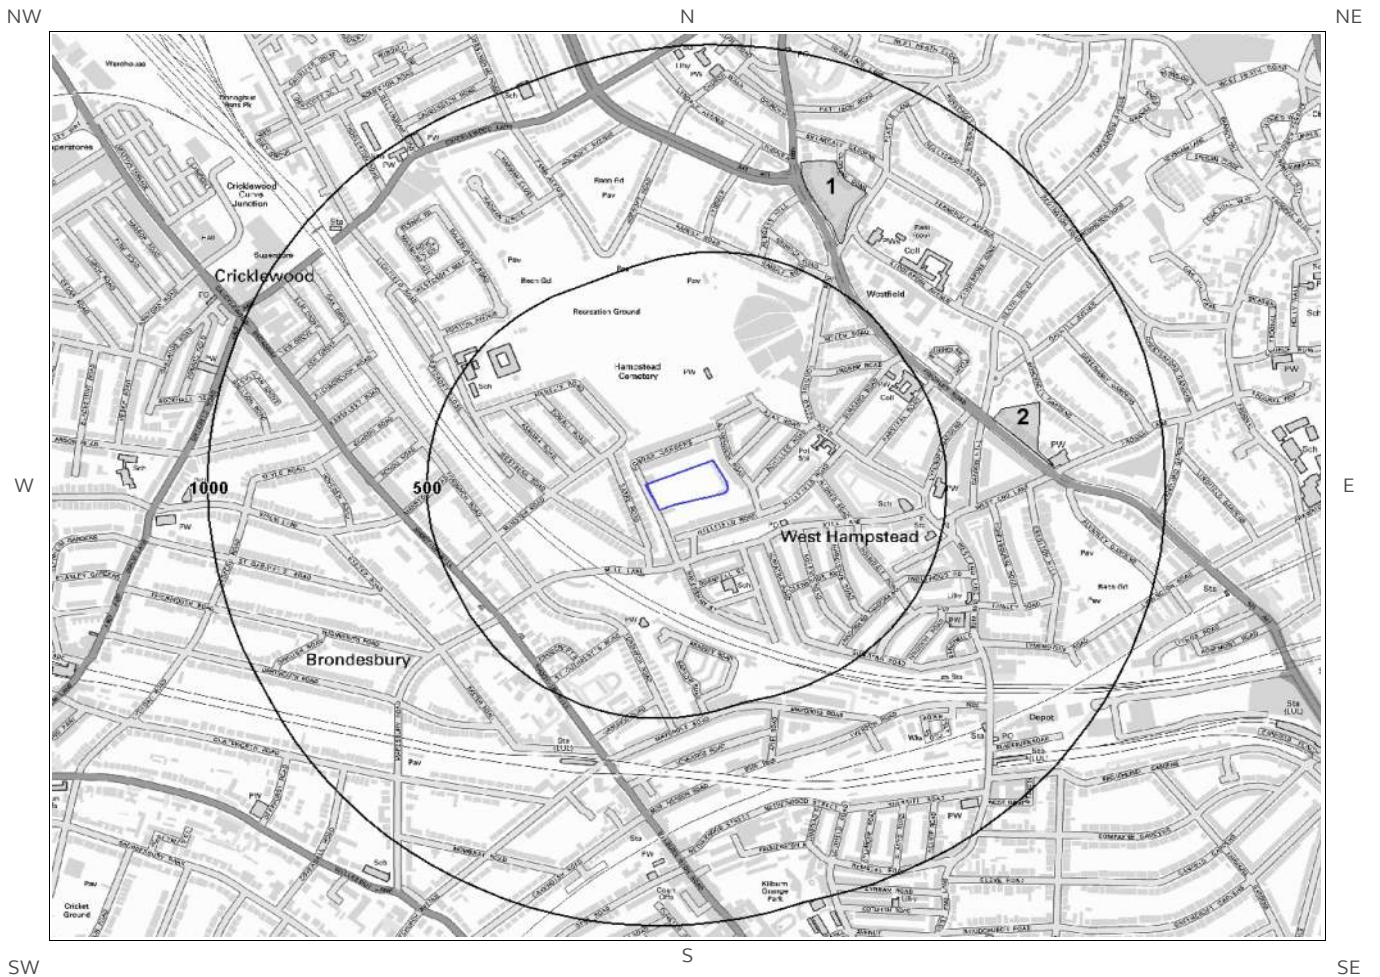

1 Geology (1:10,000 scale).

1.1 Artificial Ground Map (1:10,000 scale)



Artificial Ground Legend

© Crown copyright and database rights 2017.
Ordnance Survey license 100035207.

	Site Outline		Made Ground (undivided)		Disturbed Ground (undivided)
	Search Buffers (m)		Worked Ground (undivided)		Landscaped Ground (undivided)
			Infilled Ground		Reclaimed Ground

1. Geology 1:10,000 scale


1.1 Artificial Ground

The following geological information represented on the mapping is derived from 1:10,000 scale BGS Geological mapping.

Are there any records of Artificial/ Made Ground within 500m of the study site boundary at 1:10,000 scale? No



Database searched and no data found.

1.2 Superficial Deposits and Landslips Map (1:10,000 scale)

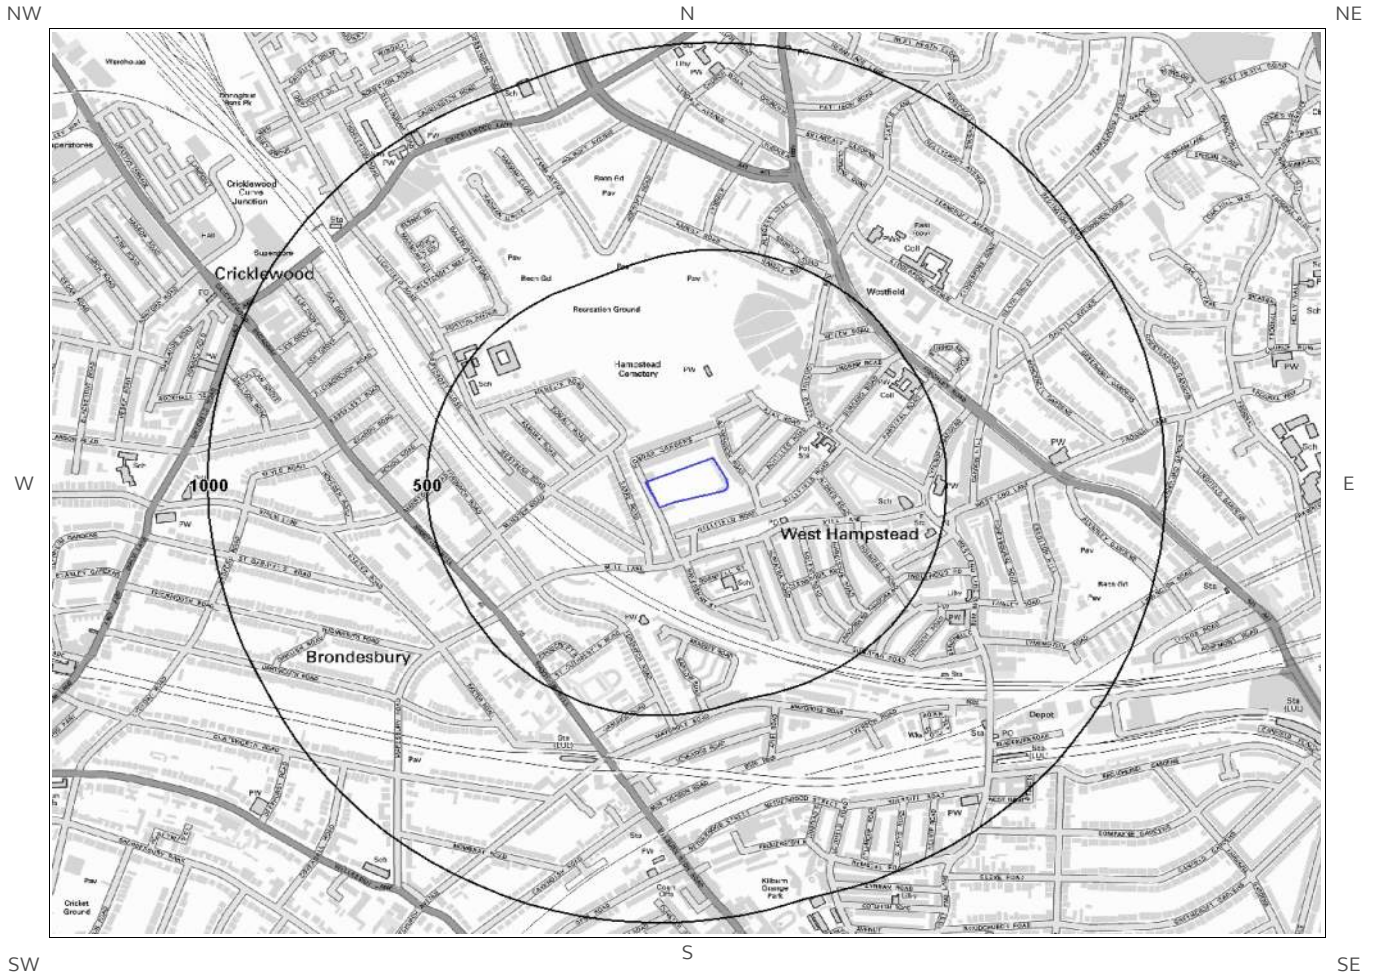

Artificial Ground Legend

© Crown copyright and database rights 2017.
Ordnance Survey license 100035207.

-  Site Outline
-  Search Buffers (m)

1.2 Superficial Deposits and Landslips

The following geological information represented on the mapping is derived from 1:10,000 scale BGS Geological mapping

1.2.1 Superficial Deposits/ Drift Geology

Are there any records of Superficial Deposits/ Drift Geology within 500m of the study site boundary at 1:10,000 scale? No

Database searched and no data found.

1.2.2 Landslip


Are there any records of Landslip within 500m of the study site boundary at 1:10,000 scale? No

Database searched and no data found.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of Great Britain at 1:10,000 scale




This Geology shows the main components as discrete layers, these are: Artificial / Made Ground, Superficial / Drift Geology and Landslips. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nationwide coverage.

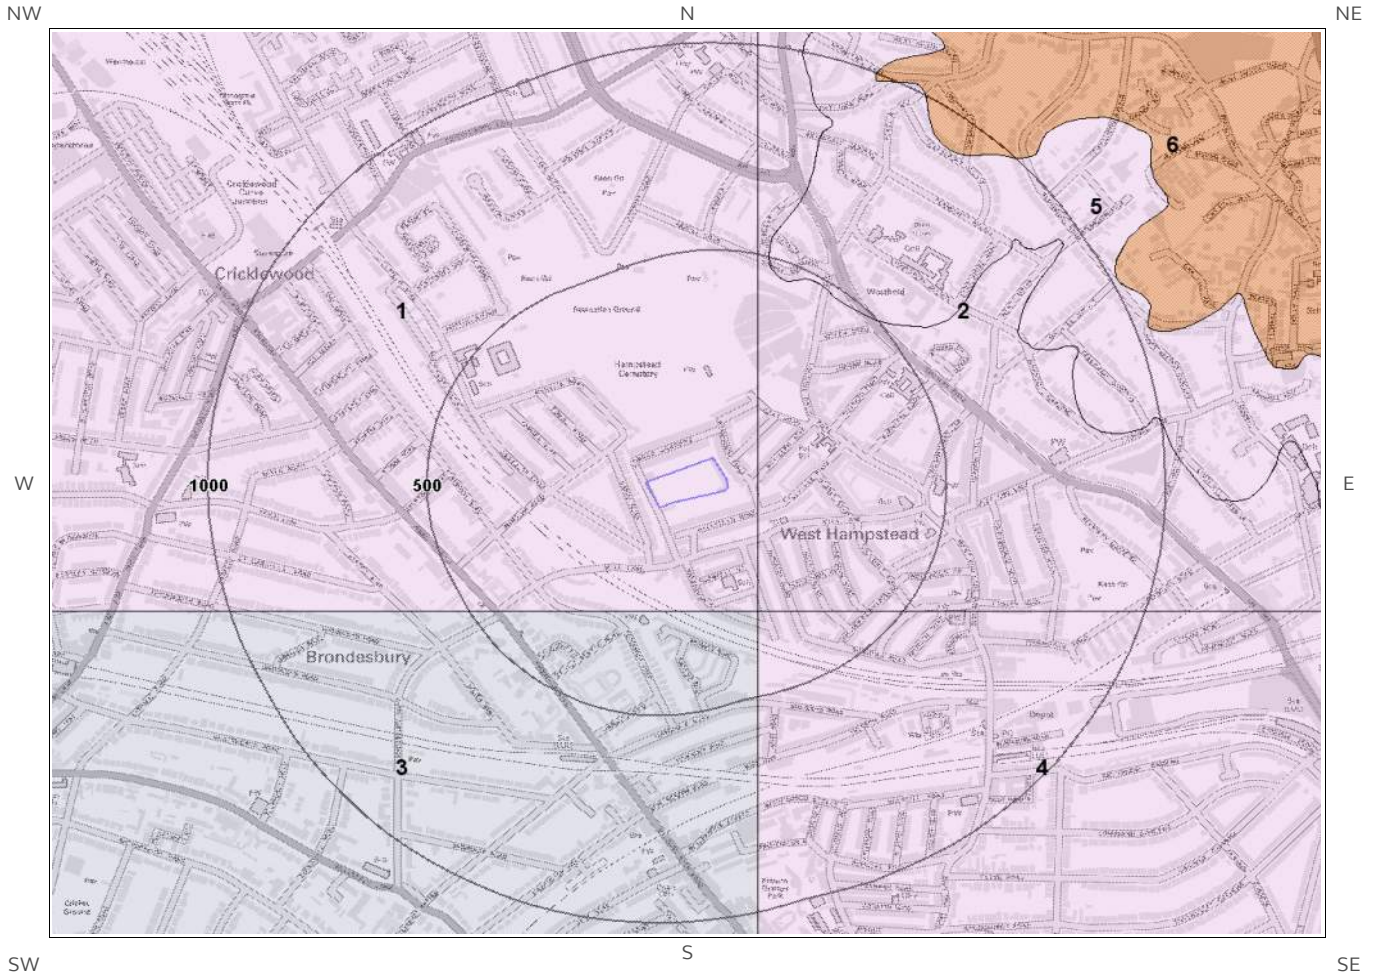1.3 Bedrock and Faults Map (1:10,000 scale)



Bedrock and Faults Legend

© Crown copyright and database rights 2017.
 Ordnance Survey license 100035207.

-  Site Outline
-  500
-  1000
- Search Buffers (m)

1.3 Bedrock and Faults

The following geological information represented on the mapping is derived from 1:10,000 scale BGS Geological mapping.

1.3.1 Bedrock/ Solid Geology

Records of Bedrock/Solid Geology within 500m of the study site boundary at 1:10,000 scale.

ID	Distance (m)	Direction	LEX Code	Description	Rock Age
1	0.0	On Site	LC-CLAY	London Clay Formation - Clay	Eocene Epoch
2	69.0	E	LC-CLAY	London Clay Formation - Clay	Eocene Epoch
3	248.0	S	LC-CLAY	London Clay Formation - Clay	Eocene Epoch
4	299.0	S	LC-CLAY	London Clay Formation - Clay	Eocene Epoch
5	458.0	N	CLGB-SDST	Claygate Member - Sandstone	Eocene Epoch

1.3.2 Faults

Are there any records of Faults within 500m of the study site boundary at 1:10,000 scale? No


Database searched and no data found at this scale.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of great Britain at 1:10,000 scale.

This Geology shows the main components as discrete layers, these are: Bedrock/ Solid Geology and linear features such as Faults. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nationwide coverage.


2 Geology 1:50,000 Scale

2.1 Artificial Ground Map

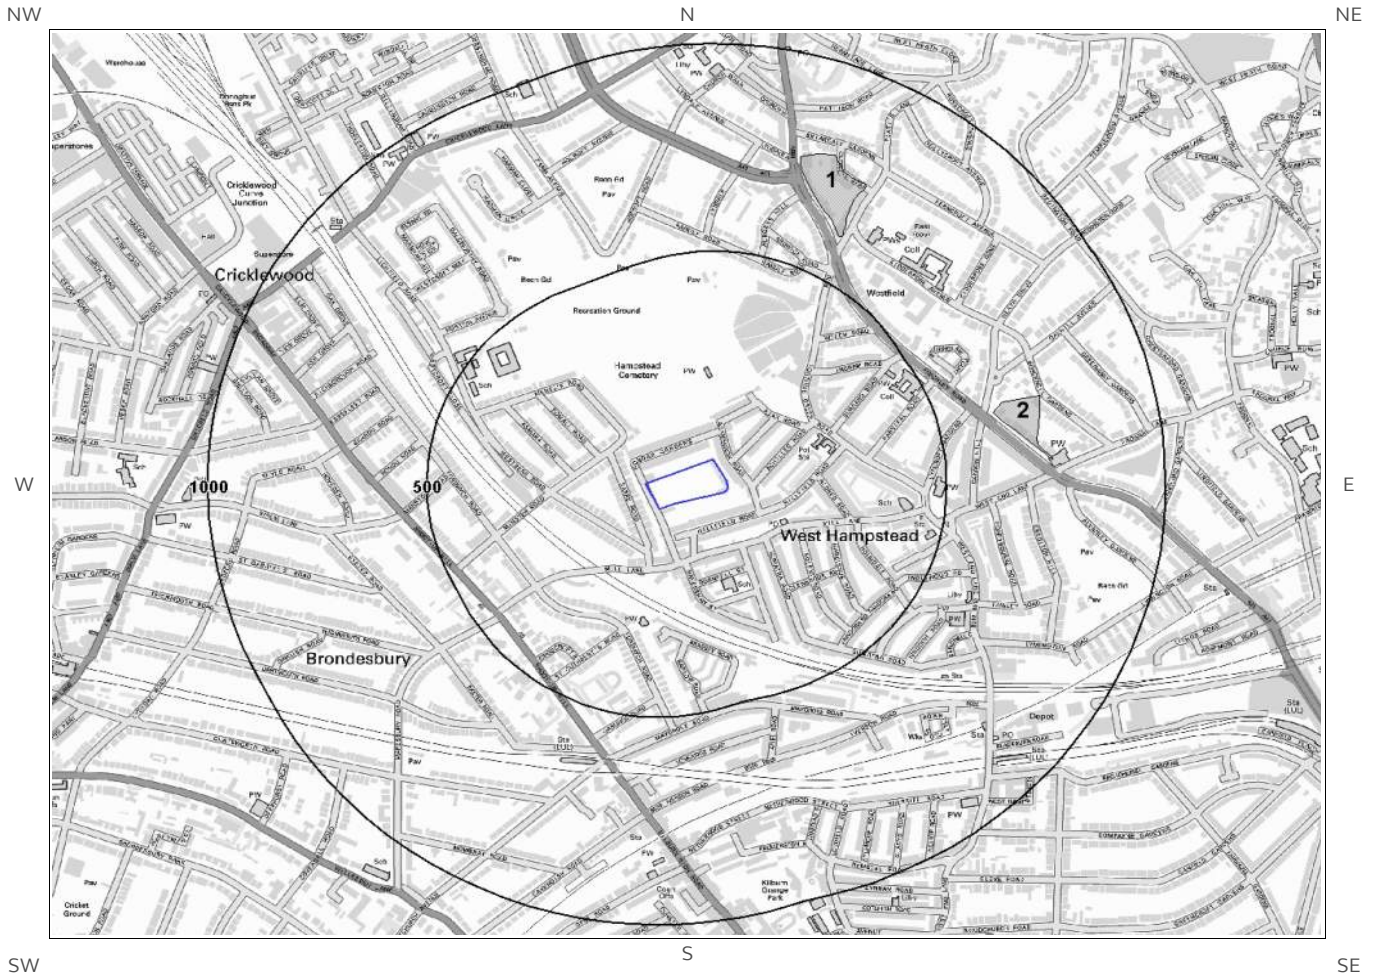

Ground Workings Legend

© Crown copyright and database rights 2017.
 Ordnance Survey license 100035207.

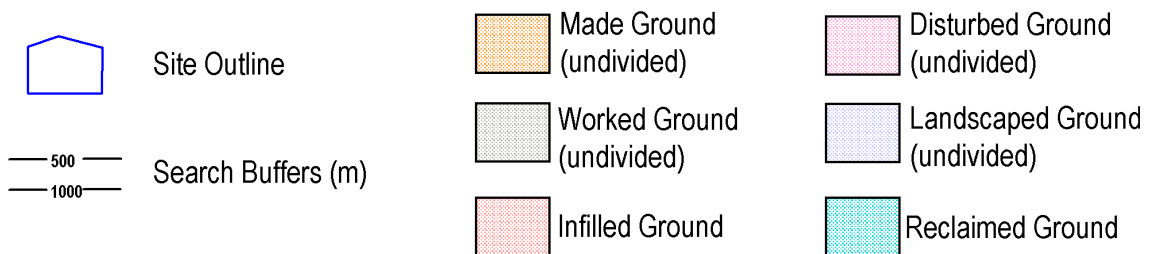

2. Geology 1:50,000 scale

2.1 Artificial Ground

The following geological information represented on the mapping is derived from 1:50,000 scale BGS Geological mapping, Sheet No: 256

2.1.1 Artificial/ Made Ground

Are there any records of Artificial/ Made Ground within 500m of the study site boundary? No


Database searched and no data found.

2.1.2 Permeability of Artificial Ground

Are there any records relating to permeability of artificial ground within the study site boundary? No




Database searched and no data found.

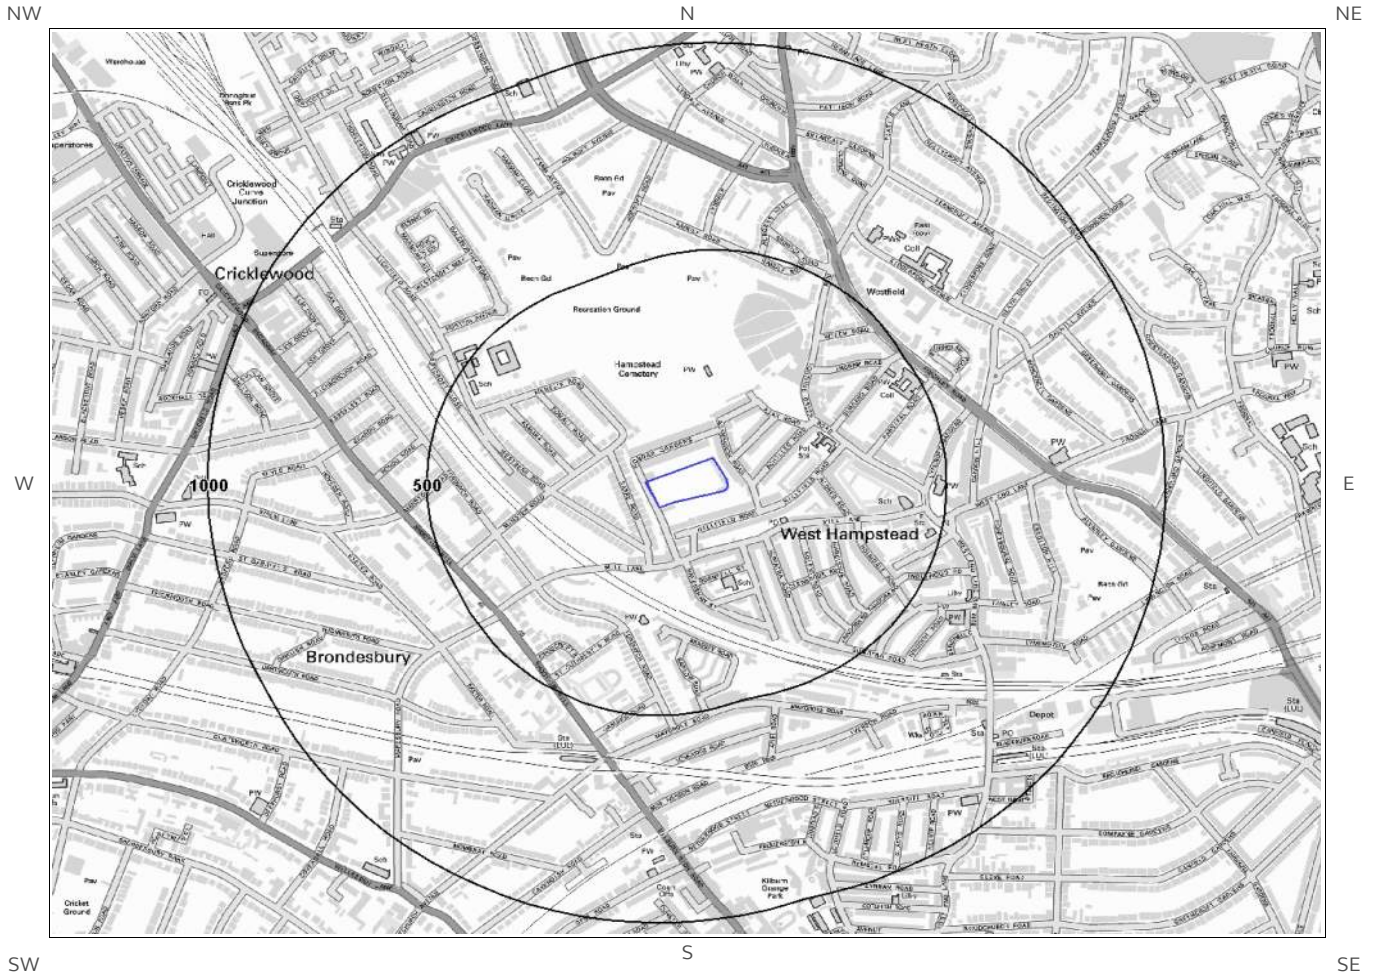2.2 Superficial Deposits and Landslips Map (1:50,000 scale)



Ground Workings Legend

© Crown copyright and database rights 2017.
Ordnance Survey license 100035207.

-  Site Outline
-  500
-  1000
- Search Buffers (m)

2.2 Superficial Deposits and Landslips

2.2.1 Superficial Deposits/ Drift Geology

Are there any records of Superficial Deposits/ Drift Geology within 500m of the study site boundary? No

Database searched and no data found.

2.2.2 Permeability of Superficial Ground

Are there any records relating to permeability of superficial ground within the study site boundary? No

Database searched and no data found.

2.2.3 Landslip

Are there any records of Landslip within 500m of the study site boundary? No

Database searched and no data found.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of Great Britain at 1:50,000 scale.


This Geology shows the main components as discrete layers, there are: Artificial/ Made Ground, Superficial/ Drift Geology and Landslips. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nationwide coverage.

2.2.4 Landslip Permeability

Are there any records relating to permeability of landslips within the study site boundary? No




Database searched and no data found.

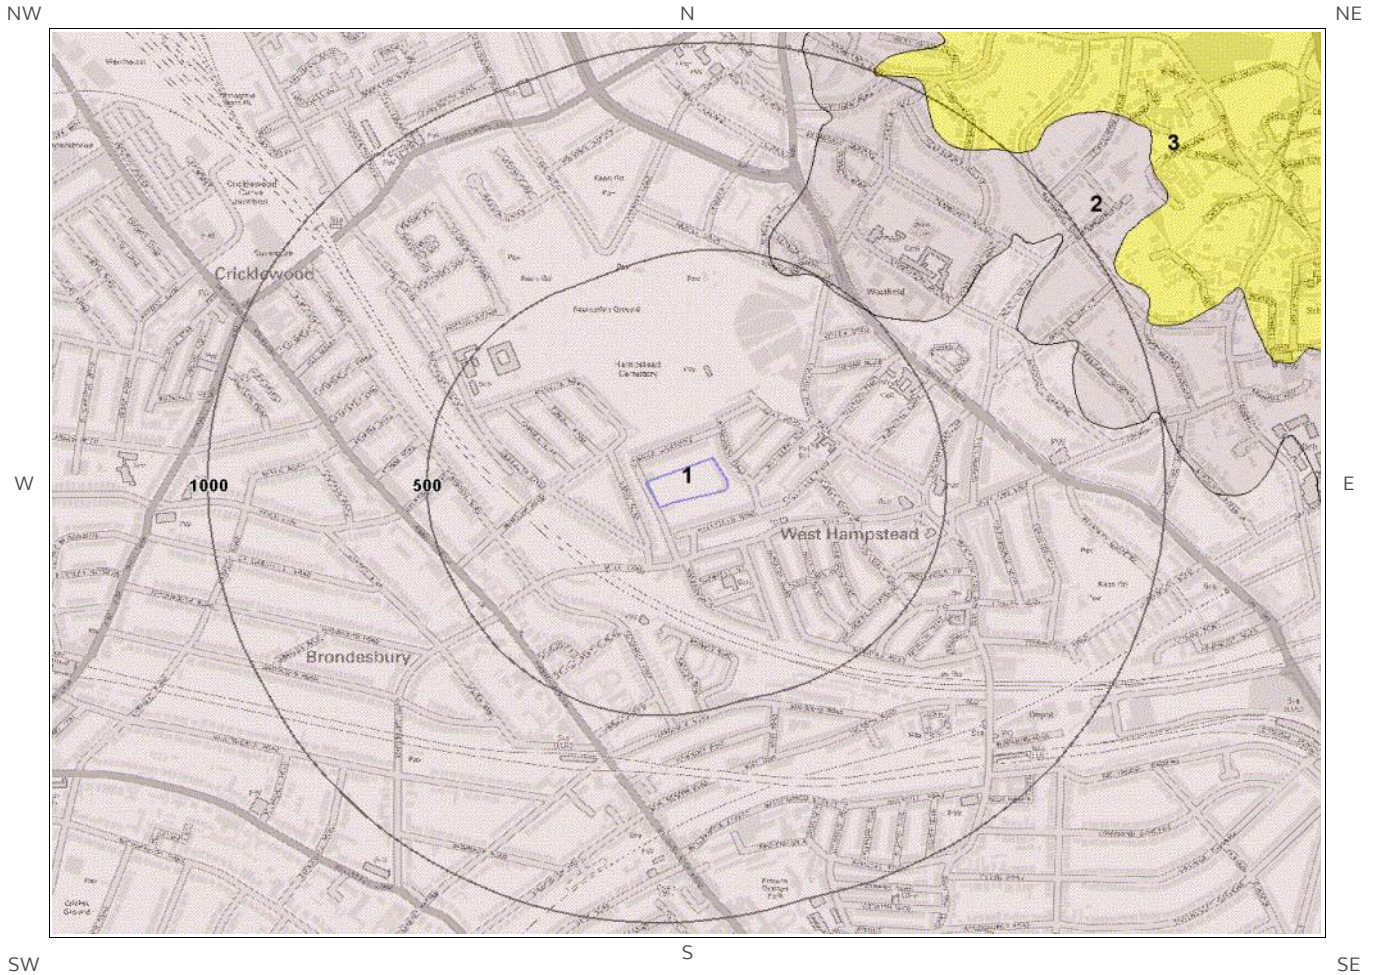2.3 Bedrock and Faults Map (1:50,000 scale)



Ground Workings Legend

© Crown copyright and database rights 2017.
 Ordnance Survey license 100035207.

-  Site Outline
-  500
-  1000
- Search Buffers (m)

2.3 Bedrock, Solid Geology & Faults

The following geological information represented on the mapping is derived from 1:50,000 scale BGS Geological mapping, Sheet No: 256

2.3.1 Bedrock/Solid Geology

Records of Bedrock/Solid Geology within 500m of the study site boundary:

ID	Distance	Direction	LEX Code	Rock Description	Rock Age
1	0.0	On Site	LC-XCZS	LONDON CLAY FORMATION - CLAY, SILT AND SAND	YPRESIAN
2	470.0	N	CLGB-XCZS	CLAYGATE MEMBER - CLAY, SILT AND SAND	YPRESIAN

2.3.2 Permeability of Bedrock Ground

Are there any records relating to permeability of bedrock ground within the study site boundary? Yes

Distance	Direction	Flow Type	Maximum Permeability	Minimum Permeability
0.0	On Site	Mixed	Moderate	Very Low

2.3.3 Faults

Are there any records of Faults within 500m of the study site boundary? No

Database searched and no data found.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of Great Britain at 1:50,000 scale.

This Geology shows the main components as discrete layers, these are: Bedrock/Solid Geology and linear features such as Faults. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nation wide coverage.

3 Radon Data


3.1 Radon Affected Areas

Is the property in a Radon Affected Area as defined by the Health Protection Agency (HPA) and if so what percentage of homes are above the Action Level? The property is not in a Radon Affected Area, as less than 1% of properties are above the Action Level.

3.2 Radon Protection






Is the property in an area where Radon Protection are required for new properties or extensions to existing ones as described in publication BR211 by the Building Research Establishment? No radon protective measures are necessary.

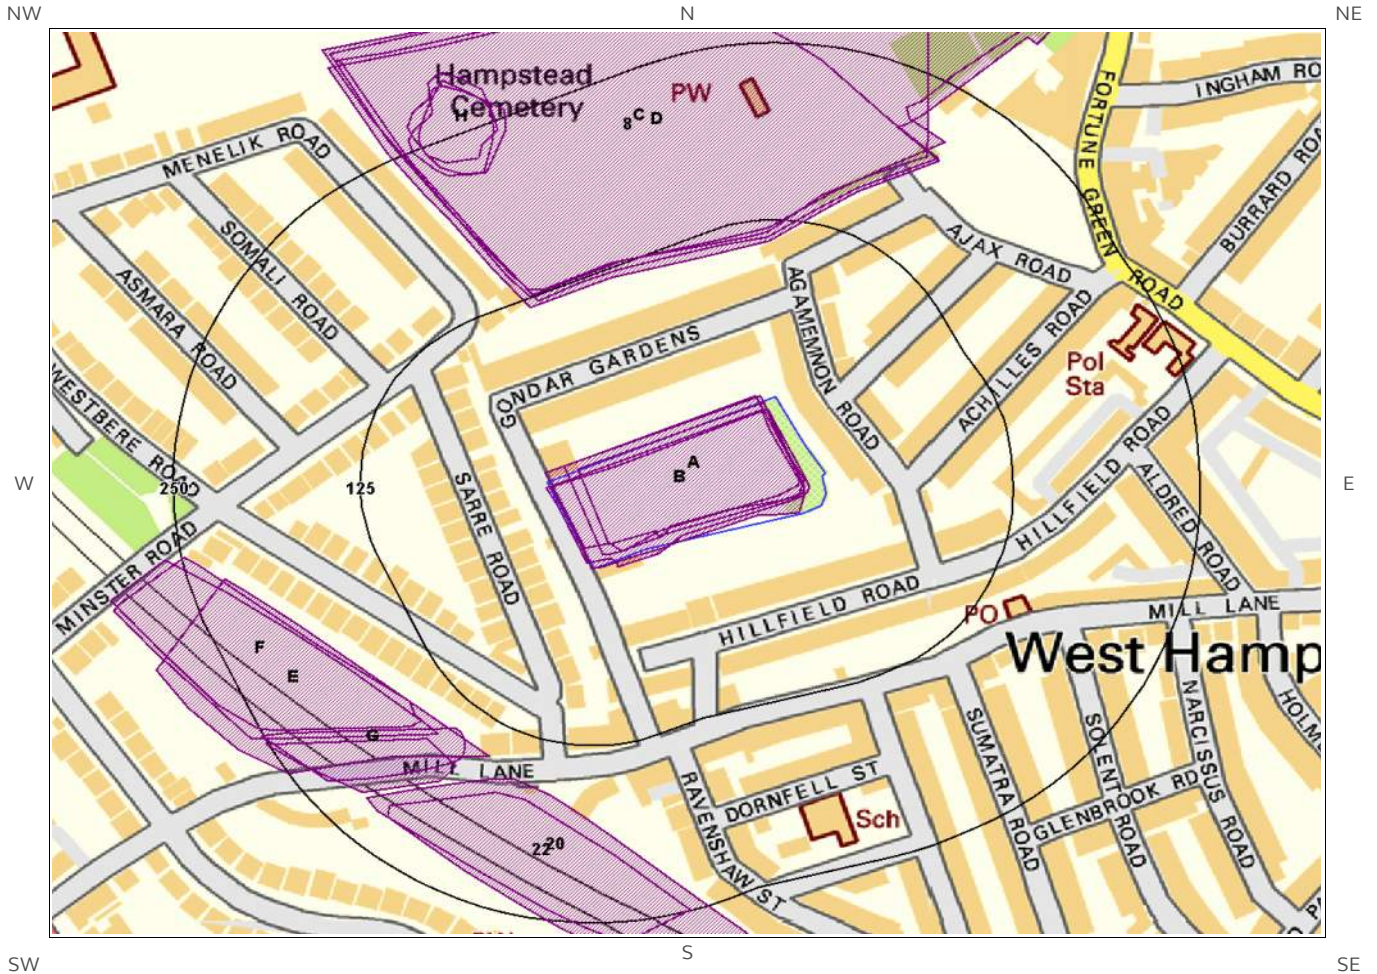4 Ground Workings Map



Ground Workings Legend

© Crown copyright and database rights 2017.
Ordnance Survey license 100035207.

-  Site Outline
-  Historic Surface Ground Workings
-  Historic Underground Workings
-  Current Ground Workings
-  Search Buffers (m)

4 Ground Workings

4.1 Historical Surface Ground Working Features derived from Historical Mapping

This dataset is based on Groundsure's unique Historical Land Use Database derived from 1:10,560 and 1:10,000 scale historical mapping

Are there any Historical Surface Ground Working Features within 250m of the study site boundary? Yes

ID	Distance (m)	Direction	NGR	Use	Date
1B	0.0	On Site	524842 185306	Reservoir	1920
2A	0.0	On Site	524841 185316	Covered Reservoir	1976
3A	0.0	On Site	524841 185316	Covered Reservoir	1993
4B	0.0	On Site	524830 185316	Reservoir	1912
5A	0.0	On Site	524842 185306	Covered Reservoir	1894
6A	0.0	On Site	524834 185314	Reservoir	1940
7D	107.0	N	524862 185627	Cemetery	1920
8	112.0	N	524805 185551	Cemetery	1894
9C	114.0	N	524797 185636	Cemetery	1966
10C	114.0	N	524797 185636	Cemetery	1976
11C	114.0	N	524797 185636	Cemetery	1993
12C	114.0	N	524797 185636	Cemetery	1940
13D	117.0	N	524862 185639	Cemetery	1912
14G	146.0	SW	524621 185117	Cuttings	1866
15E	148.0	SW	524553 185172	Cuttings	1966
16E	148.0	SW	524553 185172	Cuttings	1976
17E	148.0	SW	524553 185172	Cuttings	1993
18F	155.0	SW	524563 185192	Cuttings	1865
19F	158.0	SW	524556 185194	Cuttings	1894
20	158.0	S	524756 185025	Cuttings	1866
21G	164.0	SW	524620 185110	Cuttings	1894

ID	Distance (m)	Direction	NGR	Use	Date
22	169.0	S	524739 185032	Cuttings	1894
23H	219.0	N	524688 185560	Unspecified Heap	1894
24H	219.0	N	524680 185558	Unspecified Heap	1920
25H	230.0	N	524681 185566	Unspecified Heap	1912

4.2 Historical Underground Working Features derived from Historical Mapping

This data is derived from the Groundsure unique Historical Land Use Database. It contains data derived from 1:10,000 and 1:10,560 historical Ordnance Survey Mapping and includes some natural topographical features (Shake Holes for example) as well as manmade features that may have implications for ground stability. Underground and mining features have been identified from surface features such as shafts. The distance that these extend underground is not shown.

Are there any Historical Underground Working Features within 1000m of the study site boundary? No

Database searched and no data found.

4.3 Current Ground Workings

This dataset is derived from the BGS BRITPITS database covering active; inactive mines; quarries; oil wells; gas wells and mineral wharves; and rail deposits throughout the British Isles.

Are there any BGS Current Ground Workings within 1000m of the study site boundary? No

Database searched and no data found.

5 Mining, Extraction & Natural Cavities Map



Mining, Extraction and Natural Cavities Legend

© Crown copyright and database rights 2017.
Ordnance Survey license 100035207.



5 Mining, Extraction & Natural Cavities

5.1 Historical Mining

This dataset is derived from Groundsure unique Historical Land-use Database that are indicative of mining or extraction activities.

Are there any Historical Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.2 Coal Mining

This dataset provides information as to whether the study site lies within a known coal mining affected area as defined by the coal authority.

Are there any Coal Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.3 Johnson Poole and Bloomer

This dataset provides information as to whether the study site lies within an area where JPB hold information relating to mining.

Are there any JPB Mining areas within 1000m of the study site boundary? No

The following information provided by JPB is not represented on mapping: Database searched and no data found.

5.4 Non-Coal Mining

This dataset provides information as to whether the study site lies within an area which may have been subject to non-coal historic mining.

Are there any Non-Coal Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.5 Non-Coal Mining Cavities

This dataset provides information from the Peter Brett Associates (PBA) mining cavities database (compiled for the national study entitled “Review of mining instability in Great Britain, 1990” PBA has also continued adding to this database) on mineral extraction by mining.

Are there any Non-Coal Mining cavities within 1000m of the study site boundary? No

Database searched and no data found.

5.6 Natural Cavities

This dataset provides information based on Peter Brett Associates natural cavities database.

Are there any Natural Cavities within 1000m of the study site boundary? No

Database searched and no data found.

5.7 Brine Extraction

This data provides information from the Coal Authority issued on behalf of the Cheshire Brine Subsidence Compensation Board.

Are there any Brine Extraction areas within 1000m of the study site boundary? No

Database searched and no data found.

5.8 Gypsum Extraction

This dataset provides information on Gypsum extraction from British Gypsum records.

Are there any Gypsum Extraction areas within 1000m of the study site boundary? No

Database searched and no data found.

5.9 Tin Mining

This dataset provides information on tin mining areas and is derived from tin mining records. This search is based upon postcode information to a sector level..

Are there any Tin Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

This dataset provides information on Kaolin and Ball Clay mining from relevant mining records.


Are there any Clay Mining areas within 1000m of the study site boundary?

No

Database searched and no data found.

6 Natural Ground Subsidence

6.1 Shrink-Swell Clay Map

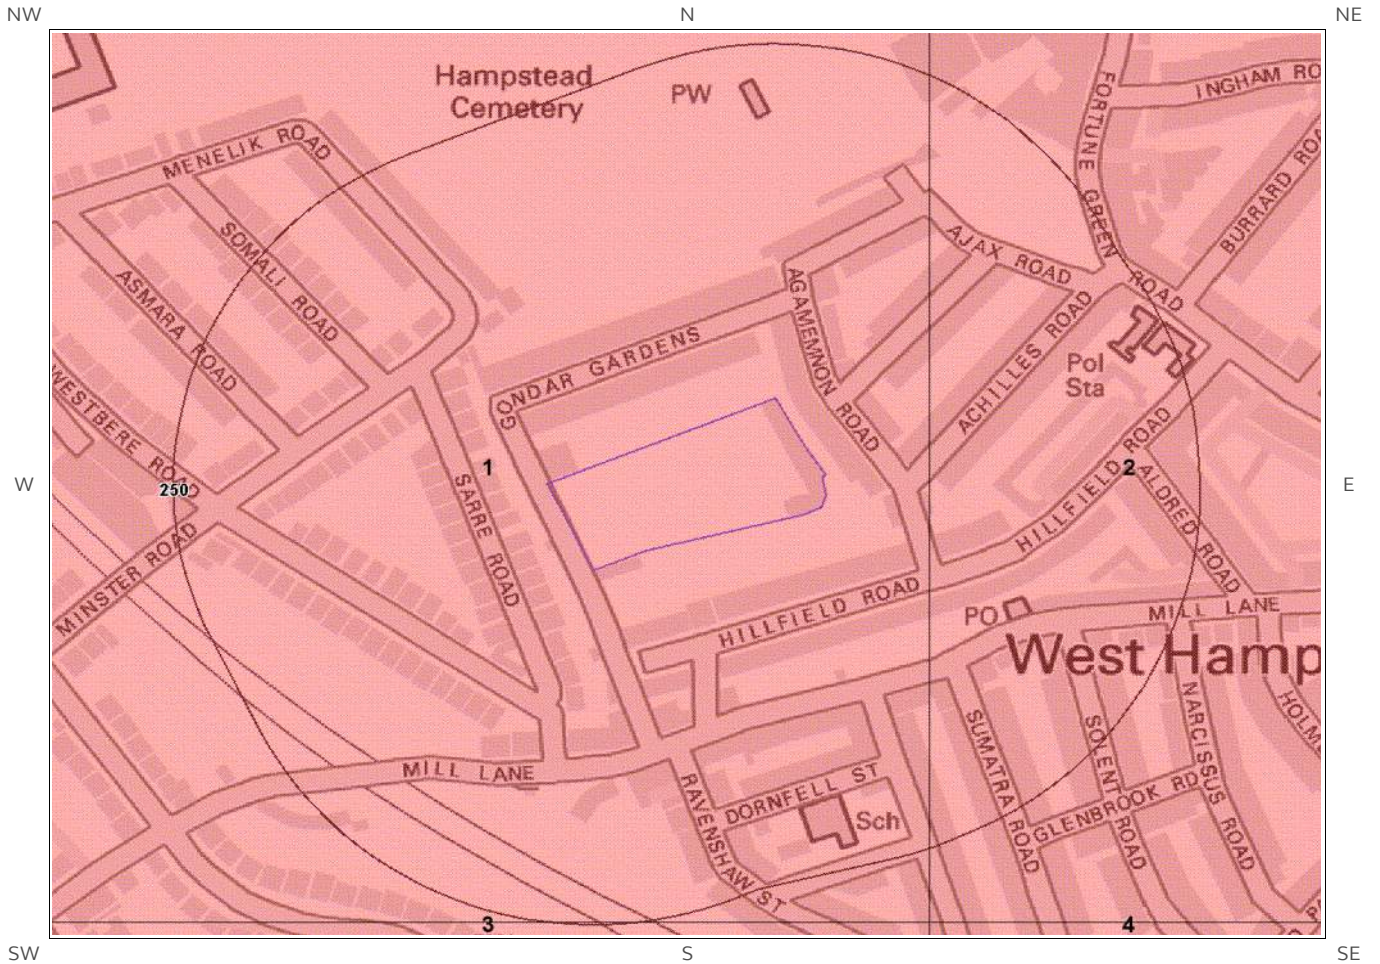


Shrink Swell Clay Legend

© Crown copyright and database rights 2017.
Ordnance Survey license 100035207.



6.2 Landslides Map

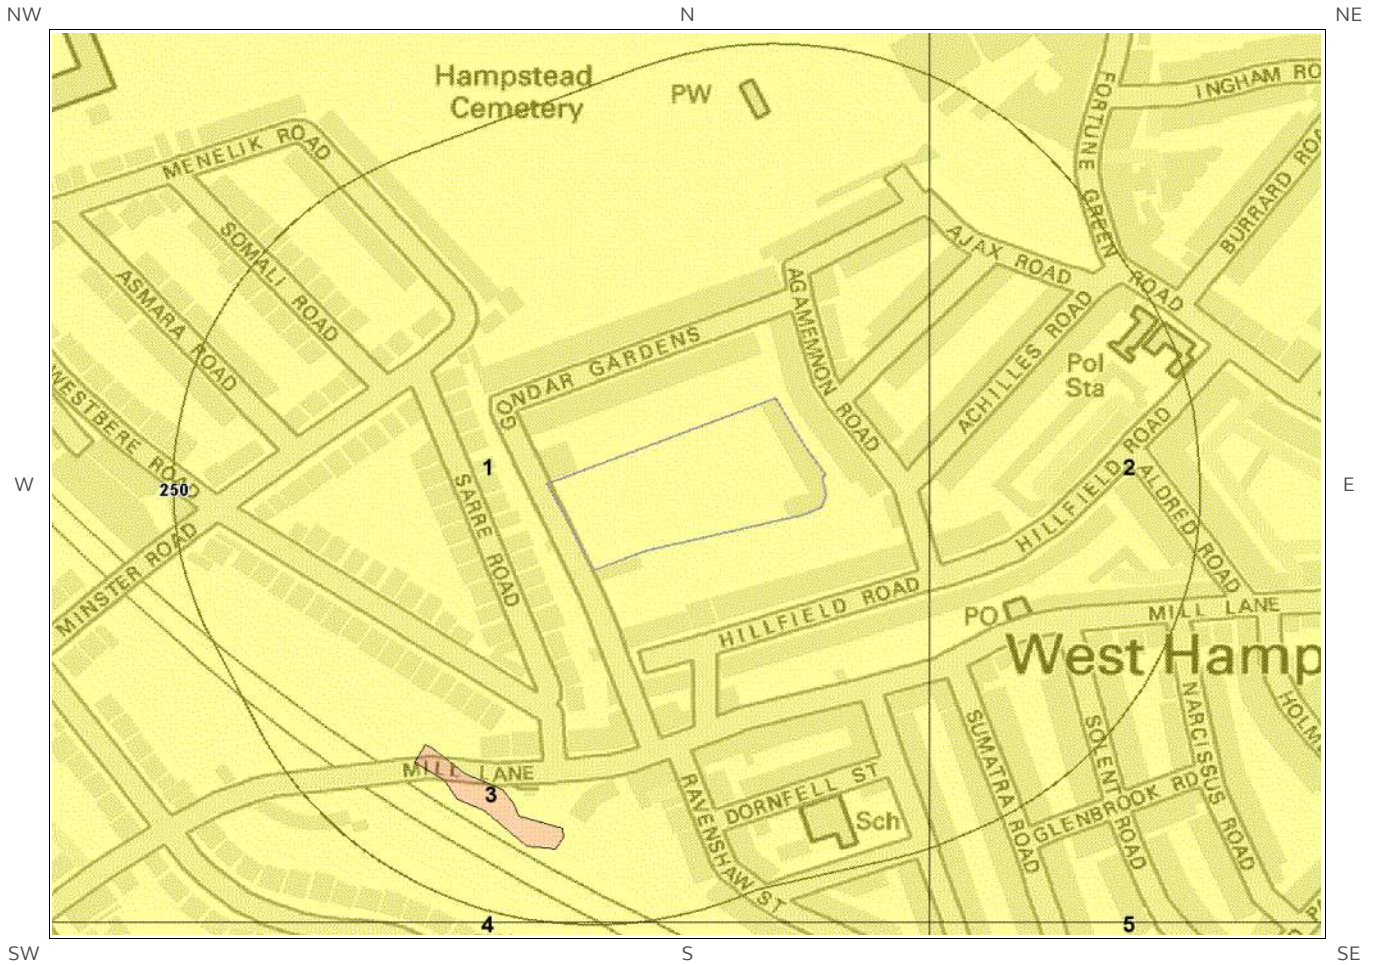


Landslides Legend

© Crown copyright and database rights 2017.
Ordnance Survey license 100035207.



6.3 Ground Dissolution of Soluble Rocks Map

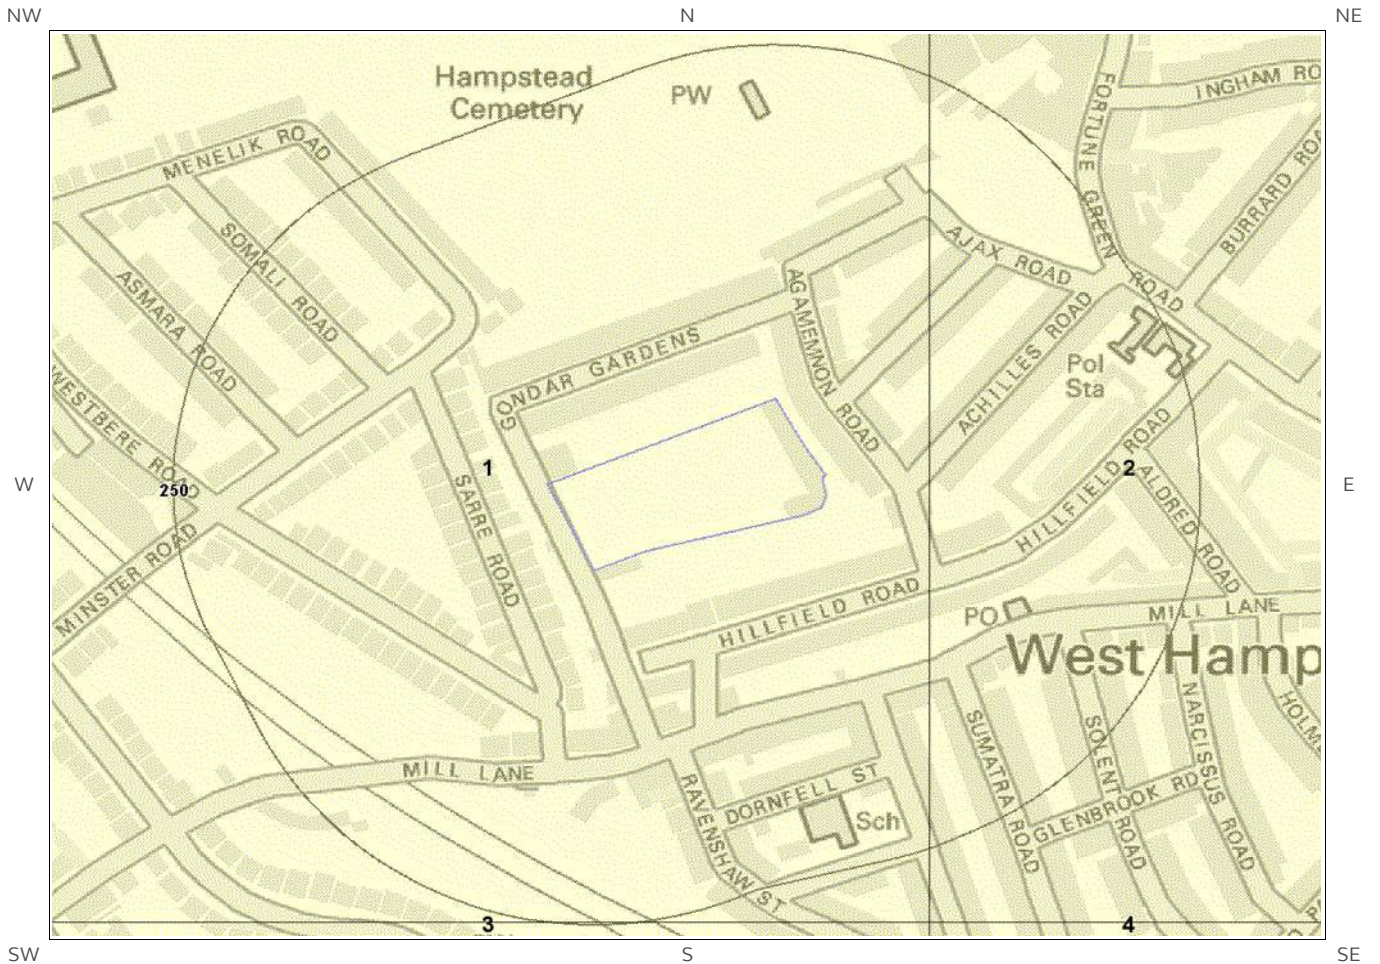


Ground Dissolution Soluble Rocks Legend

© Crown copyright and database rights 2017. Ordnance Survey license 100035207.



6.4 Compressible Deposits Map

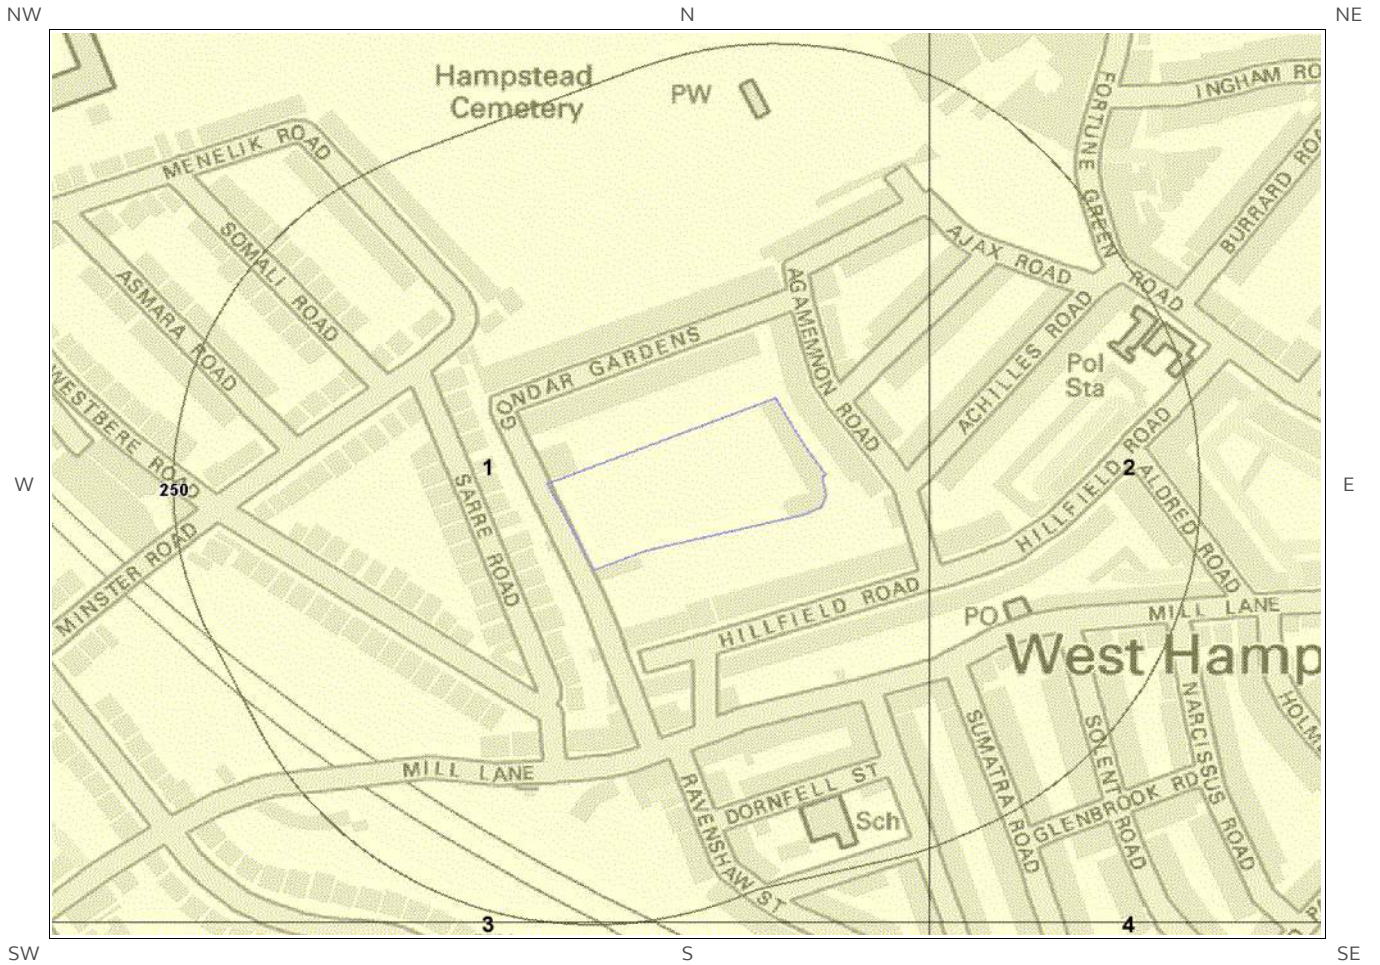

Compressible Deposits Legend

© Crown copyright and database rights 2017.
Ordnance Survey license 100035207.



6.5 Collapsible Deposits Map




Collapsible Deposits Legend

© Crown copyright and database rights 2017.
Ordnance Survey license 100035207.



6.6 Running Sand Map

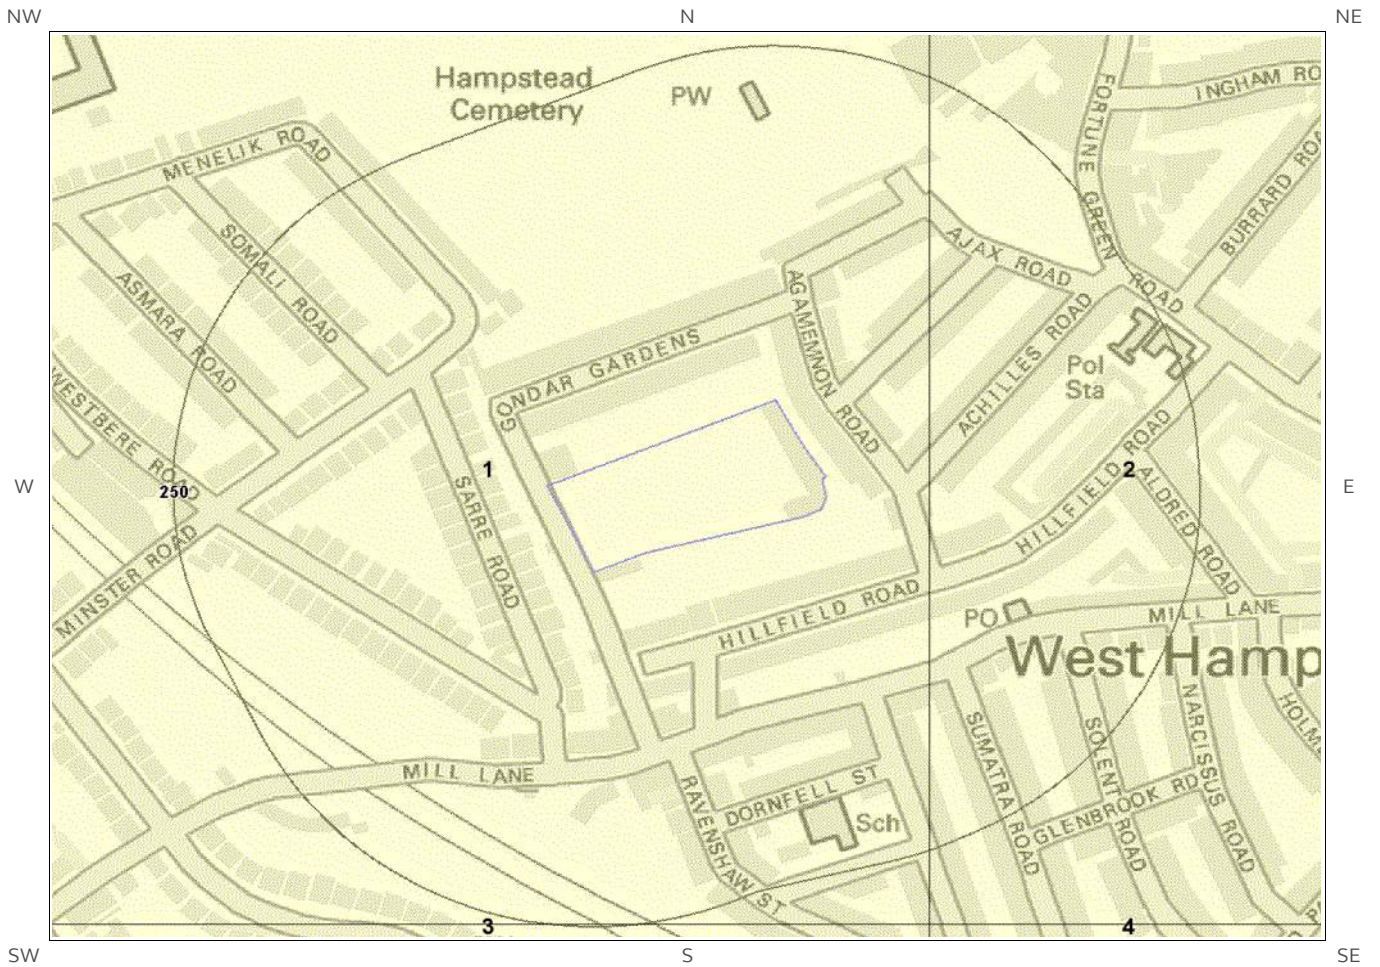

Running Sand Legend

© Crown copyright and database rights 2017.
Ordnance Survey license 100035207.



6 Natural Ground Subsidence

The National Ground Subsidence rating is obtained through the 6 natural ground stability hazard datasets, which are supplied by the British Geological Survey (BGS).

The following GeoSure data represented on the mapping is derived from the BGS Digital Geological map of Great Britain at 1:50,000 scale.

What is the maximum hazard rating of natural subsidence within the study site** boundary? Moderate

6.1 Shrink-Swell Clays

The following Shrink Swell information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Moderate	Ground conditions predominantly high plasticity. Do not plant or remove trees or shrubs near to buildings without expert advice about their effect and management. For new build, consideration should be given to advice published by the National House Building Council (NHBC) and the Building Research Establishment (BRE). There is a probable increase in construction cost to reduce potential shrink-swell problems. For existing property, there is a probable increase in insurance risk during droughts or where vegetation with high moisture demands is present.

6.2 Landslides

The following Landslides information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Very Low	Slope instability problems are unlikely to be present. No special actions required to avoid problems due to landslides. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with landslides.

* This includes an automatically generated 50m buffer zone around the site

6.3 Ground Dissolution of Soluble Rocks

The following Ground Dissolution information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Negligible	Soluble rocks are present, but unlikely to cause problems except under exceptional conditions. No special actions required to avoid problems due to soluble rocks. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with soluble rocks.

6.4 Compressible Deposits

The following Compressible Deposits information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Negligible	No indicators for compressible deposits identified. No special actions required to avoid problems due to compressible deposits. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with compressible deposits.

6.5 Collapsible Deposits

The following Collapsible Rocks information provided by the British Geological Survey:


ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Very Low	Deposits with potential to collapse when loaded and saturated are unlikely to be present. No special ground investigation required or increased construction costs or increased financial risk due to potential problems with collapsible deposits.

6.6 Running Sands

The following Running Sands information provided by the British Geological Survey:


ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Negligible	No indicators for running sand identified. No special actions required to avoid problems due to running sand. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with running sand.

7 Borehole Records Map

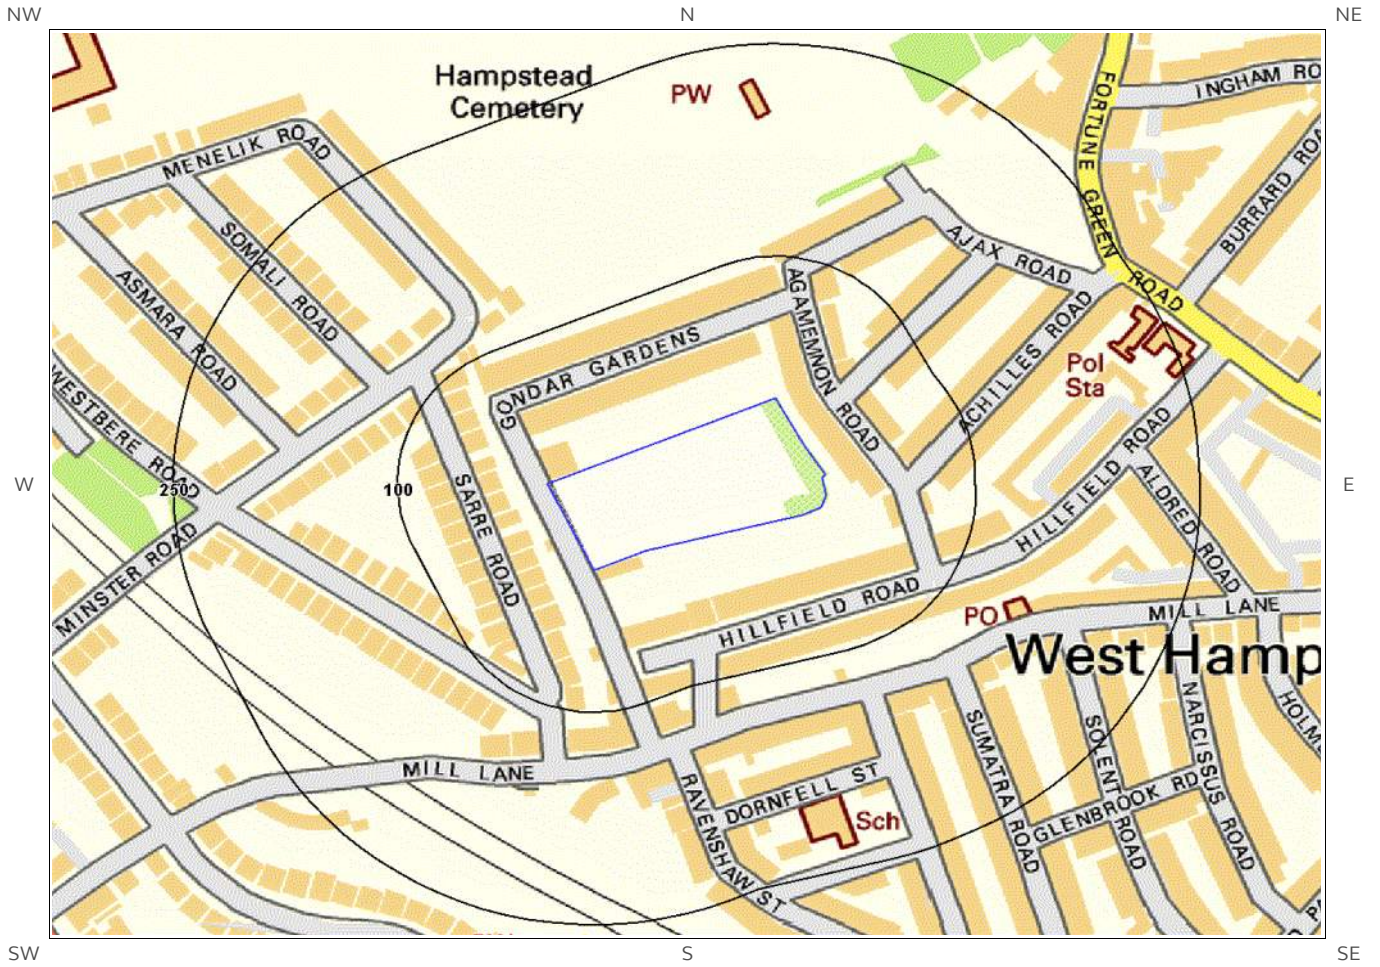

Borehole Records Legend

© Crown copyright and database rights 2017.
Ordnance Survey license 100035207.

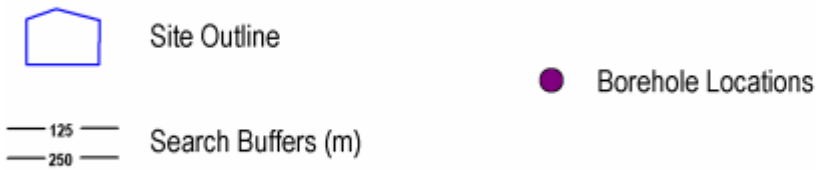

7 Borehole Records

The systematic analysis of data extracted from the BGS Borehole Records database provides the following information.

Records of boreholes within 250m of the study site boundary: 0

Database searched and no data found.

8 Estimated Background Soil Chemistry

Records of background estimated soil chemistry within 250m of the study site boundary:


1

For further information on how this data is calculated and limitations upon its use, please see the Groundsure Geo Insight User Guide, available on request.

Distance (m)	Direction	Sample Type	Arsenic (As)	Cadmium (Cd)	Chromium (Cr)	Nickel (Ni)	Lead (Pb)
0.0	On Site	London	No data	No data	No data	No data	No data

*As this data is based upon underlying 1:50,000 scale geological information, a 50m buffer has been added to the search radius.

9 Railways and Tunnels Map

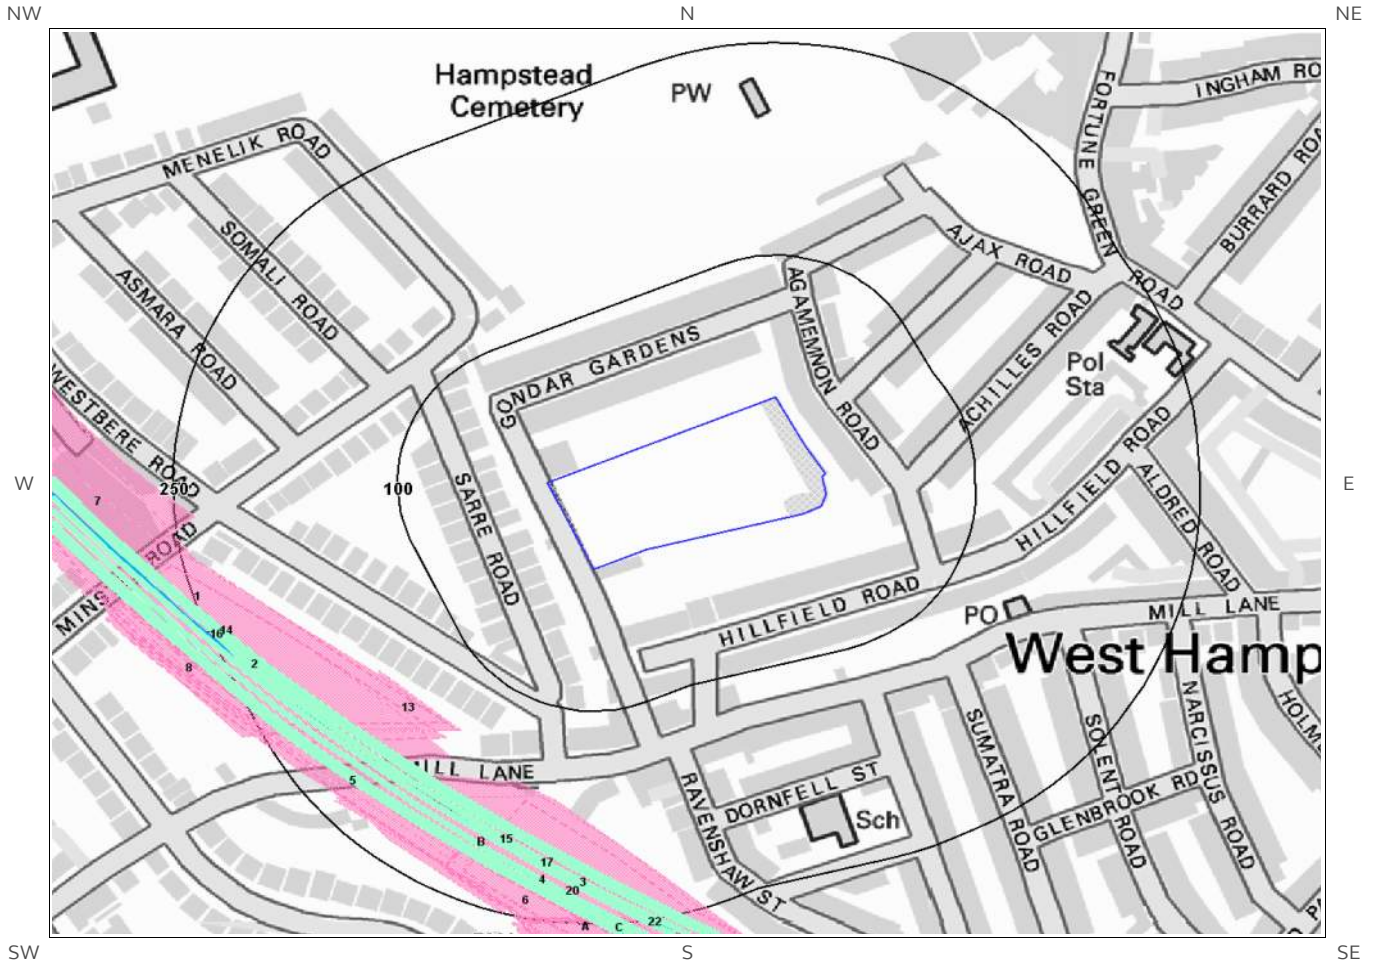

Railways and Tunnels Legend

© Crown copyright and database rights 2017.
Ordnance Survey license 100035207.
© OpenStreetMapContributors

- | | | | |
|--|--|--|---|
| | Underground or Partially Underground Railway / Subway System | | Railway Track (OpenStreetMap) |
| | Site Outline | | High Speed 2 |
| | Search Buffers (m) | | High Speed 2 Revised Proposed Route |
| | Railway Tunnel (OS Mapping) | | Crossrail 1 |
| | Abandoned or Dismantled Railway (OpenStreetMap) | | Railway and/or Tunnel Feature from Historical Mapping |
| | Railway Track (OS Mapping) | | |

9 Railways and Tunnels

9.1 Tunnels

This data is derived from OpenStreetMap and provides information on the possible locations of underground railway systems in the UK - the London Underground, the Tyne & Wear Metro and the Glasgow Subway.

Have any underground railway lines been identified within the study site boundary? No

Have any underground railway lines been identified within 250m of the study site boundary? No

Database searched and no data found.

Any records that have been identified are represented on the Railways and Tunnels Map.

This data is derived from Ordnance Survey mapping and provides information on the possible locations of railway tunnels forming part of the UK overground railway network.

Have any other railway tunnels been identified within the site boundary? No

Have any other railway tunnels been identified within 250m of the site boundary? No

Database searched and no data found.

Any records that have been identified are represented on the Railways and Tunnels Map.

9.2 Historical Railway and Tunnel Features

This data is derived from Groundsure's unique Historical Land-use Database and contains features relating to tunnels, railway tracks or associated works that have been identified from historical Ordnance Survey mapping.

Have any historical railway or tunnel features been identified within the study site boundary? No

Have any historical railway or tunnel features been identified within 250m of the study site boundary? Yes

ID	Distance (m)	Direction	NGR	Details	Date
13	144	SW	n/a	Railway	1915
1	146	SW	523696 186292	Railway Sidings	1938
14	146	SW	n/a	Railway	1896
2	154	SW	524563 185188	Railway Sidings	1920
15	158	S	n/a	Railway	1915
16	162	SW	n/a	Railway	1915
17	164	S	n/a	Railway	1894
3	169	S	525047 184912	Railway Sidings	1894

ID	Distance (m)	Direction	NGR	Details	Date
18B	185	SW	524874 184960	Railway Sidings	1915
19B	188	SW	524871 184958	Railway Sidings	1935
4	191	S	524752 185035	Railway Sidings	1966
20	201	S	524950 184922	Railway Sidings	1896
5	213	SW	524585 185115	Railway Sidings	1949
21	217	SW	524565 185131	Railway Sidings	1953
6	218	SW	524888 184896	Railway Sidings	1920
7	237	W	523567 186330	Railway Sidings	1920
8	237	SW	524509 185178	Railway Sidings	1938
22	238	S	524988 184922	Railway Sidings	1871
9A	246	S	524863 184896	Railway Sidings	1967
10A	246	S	524863 184896	Railway Sidings	1973
23C	248	S	524866 184902	Railway Sidings	1955
24C	248	S	524867 184901	Railway Sidings	1953
25C	248	S	524867 184901	Railway Sidings	1970
11A	249	S	524866 184903	Railway Sidings	1957
12A	249	S	524860 184896	Railway Sidings	1951

Any records that have been identified are represented on the Railways and Tunnels Map.

9.3 Historical Railways

This data is derived from OpenStreetMap and provides information on the possible alignments of abandoned or dismantled railway lines in proximity to the study site.

Have any historical railway lines been identified within the study site boundary? No

Have any historical railway lines been identified within 250m of the study site boundary? No

Database searched and no data found.

Multiple sections of the same track may be listed in the detail above

Any records that have been identified are represented on the Railways and Tunnels Map.

These datasets are derived from Ordnance Survey mapping and OpenStreetMap and provide information on the possible locations of active railway lines in proximity to the study site.

Have any active railway lines been identified within the study site boundary? No

Have any active railway lines been identified within 250m of the study site boundary? Yes

Distance (m)	Direction	Name	Type
183	SW	Not given	Rail
183	SW	Not given	Rail
187	SW	Not given	Rail
187	SW	Not given	Rail
192	SW	Not given	Rail
192	SW	Not given	Rail
193	SW	Not given	Multi Track
193	SW	Not given	Multi Track
197	SW	Midland Main Line	Rail
197	SW	Midland Main Line	Rail
204	SW	Midland Main Line	Rail
204	SW	Midland Main Line	Rail
210	SW	Not given	Rail
210	SW	Not given	Rail
212	SW	Not given	Multi Track
212	SW	Not given	Multi Track
214	SW	Not given	Rail
214	SW	Not given	Rail

Multiple sections of the same track may be listed in the detail above
Any records that have been identified are represented on the Railways and Tunnels Map.

9.5 Railway Projects

These datasets provide information on the location of large scale railway projects High Speed 2 and Crossrail 1 .

Is the study site within 5km of the route of the High Speed 2 rail project? Yes

Is the study site within 500m of the route of the Crossrail 1 rail project? No

Further information on proximity to these routes, the project construction status and associated works can be obtained through the purchase of a Groundsure HS2 and Crossrail 1 Report.

The route data has been digitised from publicly available maps by Groundsure. The route as provided relates to the Crossrail 1 project only, and does not include any details of the Crossrail 2 project, as final details of the route for Crossrail 2 are still under consultation.

Please note that this assessment takes account of both the original Phase 2b proposed route and the amended route proposed in 2016. As the Phase 2b route is still under consultation, Groundsure are providing information on both options until the final route is formally confirmed. Practitioners should take account of this uncertainty when advising clients.

Contact Details

emapsite
Telephone: 0118 9736883
sales@emapsite.com



British Geological Survey Enquiries

Kingsley Dunham Centre
Keyworth, Nottingham NG12 5GG
Tel: 0115 936 3143.
Fax: 0115 936 3276.
Email: enquiries@bgs.ac.uk
Web: www.bgs.ac.uk

BGS Geological Hazards Reports and general geological enquiries



British Gypsum

British Gypsum Ltd
East Leake
Loughborough
Leicestershire
LE12 6HX



The Coal Authority

200 Lichfield Lane
Mansfield
Notts NG18 4RG
Tel: 0345 7626 848
DX 716176 Mansfield 5
www.coal.gov.uk



The Coal
Authority

Public Health England

Public information access office
Public Health England, Wellington House
133-155 Waterloo Road, London, SE1 8UG
<https://www.gov.uk/government/organisations/public-health-england>
Email: enquiries@phe.gov.uk
Main switchboard: 020 7654 8000



Public Health
England

Johnson Poole & Bloomer Limited

Harris and Pearson Building, Brettel Lane
Brierley Hill, West Midlands
DY5 3LH
Tel: +44 (0) 1384 262 000
Email: enquiries.gs@jpb.co.uk
Website: www.jpb.co.uk



Ordnance Survey

Adanac Drive, Southampton
SO16 0AS
Tel: 08456 050505
Website: <http://www.ordnancesurvey.co.uk/>



Getmapping PLC

Virginia Villas, High Street, Hartley Witney,
Hampshire RG27 8NW
Tel: 01252 845444
Website: <http://www.1.getmapping.com/>



Peter Brett Associates
Caversham Bridge House
Waterman Place
Reading
Berkshire RG1 8DN
Tel: +44 (0)118 950 0761 E-mail: reading@pba.co.uk
Website: <http://www.peterbrett.com/home>



Acknowledgements: Ordnance Survey © Crown Copyright and/or Database Right. All Rights Reserved. Licence Number [03421028]. This report has been prepared in accordance with the Groundsure Ltd standard Terms and Conditions of business for work of this nature.

Standard Terms and Conditions

Groundsure's Terms and Conditions can be viewed online at this link:
<https://www.groundsure.com/terms-and-conditions-sept-2016/>