

Room/ Floor	Room Use	Whole Room	Prev sq ft	New sq ft	Loss sq ft	%Loss
R2/152		45.2	34.1	34.1	0.0	0.0
3 Camden Road						
R1/153		88.2	0.0	0.0	0.0	#DIV/0!
R1/154		101.3	17.9	17.9	0.0	0.0
R1/155		101.7	87.2	87.2	0.0	0.0
22 Camden Road						
R1/81	ASSUMED	111.9	110.4	110.4	0.0	0.0
R2/81	ASSUMED	112.3	110.8	110.8	0.0	0.0
R1/82	ASSUMED	112.6	111.1	111.1	0.0	0.0
R2/82	ASSUMED	111.9	110.4	110.4	0.0	0.0
24 Camden Road						
R1/71	ASSUMED	96.4	95.7	95.7	0.0	0.0
R2/71	ASSUMED	113.1	109.5	109.5	0.0	0.0
R1/72	ASSUMED	96.4	95.7	95.7	0.0	0.0
R2/72	ASSUMED	113.1	109.7	109.7	0.0	0.0
26 Camden Road						
R1/61	ASSUMED	114.2	110.7	110.7	0.0	0.0
R2/61	ASSUMED	111.5	106.7	106.7	0.0	0.0
R1/62	ASSUMED	114.2	110.9	110.9	0.0	0.0
R2/62	ASSUMED	111.5	107.2	107.2	0.0	0.0
R1/63	ASSUMED	114.2	106.3	106.3	0.0	0.0
R2/63	ASSUMED	111.5	108.4	108.4	0.0	0.0

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
SUNLIGHT ANALYSIS

NOV 2018

			Window						Room					
			Existing		Proposed				Existing		Proposed			
Room	Window	Room Use	Winter APSH	Annual APSH	Winter APSH	Annual APSH	Winter %Loss	Annual %Loss	Winter APSH	Annual APSH	Winter APSH	Annual APSH	Winter %Loss	Annual %Loss
11 Kentish Town Road														
R1/161	W1/161		11	39	11	39	0.0	0.0	11	39	11	39	0.0	0.0
R2/161	W2/161		11	40	11	40	0.0	0.0	11	40	11	40	0.0	0.0
R1/162	W1/162		12	43	12	43	0.0	0.0	12	43	12	43	0.0	0.0
R2/162	W2/162		12	44	12	44	0.0	0.0	12	44	12	44	0.0	0.0
R1/163	W1/163		11	47	11	47	0.0	0.0						
R1/163	W2/163		14	50	14	50	0.0	0.0	14	50	14	50	0.0	0.0
13 Kentish Town Road														
R3/161	W3/161		10	40	10	40	0.0	0.0						
R3/161	W4/161		10	39	10	39	0.0	0.0	10	40	10	40	0.0	0.0
R4/161	W5/161		10	40	10	40	0.0	0.0	10	40	10	40	0.0	0.0
R3/162	W3/162		12	44	12	44	0.0	0.0						
R3/162	W4/162		12	44	12	44	0.0	0.0	12	44	12	44	0.0	0.0
R4/162	W5/162		12	44	12	44	0.0	0.0	12	44	12	44	0.0	0.0

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
SUNLIGHT ANALYSIS

NOV 2018

Room	Window	Room Use	Window						Room					
			Existing		Proposed		Winter %Loss	Annual %Loss	Existing		Proposed		Winter %Loss	Annual %Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R2/163	W3/163		7	38	7	38	0.0	0.0						
R2/163	W4/163		14	50	14	50	0.0	0.0						
R2/163	W5/163		15	51	15	51	0.0	0.0	15	51	15	51	0.0	0.0
15 Kentish Town Road														
R5/161	W6/161		10	40	10	40	0.0	0.0	10	40	10	40	0.0	0.0
R6/161	W7/161		11	40	11	40	0.0	0.0	11	40	11	40	0.0	0.0
R5/162	W6/162		12	44	12	44	0.0	0.0	12	44	12	44	0.0	0.0
R6/162	W7/162		12	44	12	44	0.0	0.0	12	44	12	44	0.0	0.0
R3/163	W6/163		9	43	9	43	0.0	0.0						
R3/163	W7/163		14	50	14	50	0.0	0.0	14	50	14	50	0.0	0.0
17 Kentish Town Road														
R7/161	W8/161		11	43	11	41	0.0	4.7	11	43	11	41	0.0	4.7
R8/161	W9/161		11	42	11	39	0.0	7.1	11	42	11	39	0.0	7.1
R7/162	W8/162		12	44	12	44	0.0	0.0	12	44	12	44	0.0	0.0

NOV 2018

Window									Room					
			Existing		Proposed				Existing		Proposed			
Room	Window	Room Use	Winter APSH	Annual APSH	Winter APSH	Annual APSH	Winter %Loss	Annual %Loss	Winter APSH	Annual APSH	Winter APSH	Annual APSH	Winter %Loss	Annual %Loss
R8/162	W9/162		12	45	12	44	0.0	2.2	12	45	12	44	0.0	2.2
R4/163	W8/163		14	50	14	50	0.0	0.0						
R4/163	W9/163		15	51	15	51	0.0	0.0	15	51	15	51	0.0	0.0
19 Kentish Town Road														
R1/500	W1/500		8	34	8	31	0.0	8.8						
R1/500	W2/500		8	30	8	27	0.0	10.0	8	36	8	33	0.0	8.3
R2/500	W3/500		7	31	7	28	0.0	9.7						
R2/500	W4/500		8	34	8	29	0.0	14.7						
R2/500	W5/500		8	34	8	29	0.0	14.7	8	35	8	29	0.0	17.1
R1/501	W1/501		11	42	11	39	0.0	7.1						
R1/501	W2/501		11	44	11	39	0.0	11.4	11	44	11	39	0.0	11.4
R1/502	W1/502		12	45	12	43	0.0	4.4						
R1/502	W2/502		12	45	12	41	0.0	8.9	12	45	12	43	0.0	4.4
R1/503	W1/503		10	45	10	45	0.0	0.0						
R1/503	W2/503		14	49	14	49	0.0	0.0	14	49	14	49	0.0	0.0
United Reformed Church														

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
SUNLIGHT ANALYSIS

NOV 2018

Room	Window	Room Use	Window						Room					
			Existing		Proposed		Winter %Loss	Annual %Loss	Existing		Proposed		Winter %Loss	Annual %Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R1/540	W1/540		11	37	8	30	27.3	18.9						
R1/540	W2/540		11	38	9	34	18.2	10.5						
R1/540	W3/540		11	37	8	30	27.3	18.9						
R1/540	W4/540		11	38	9	35	18.2	7.9						
R1/540	W5/540		11	37	8	30	27.3	18.9						
R1/540	W6/540		11	38	9	35	18.2	7.9	11	38	9	35	18.2	7.9
R2/540	W7/540		12	38	9	30	25.0	21.1						
R2/540	W8/540		12	39	9	34	25.0	12.8						
R2/540	W9/540		12	38	9	31	25.0	18.4						
R2/540	W10/540		12	39	9	35	25.0	10.3						
R2/540	W11/540		11	37	8	30	27.3	18.9						
R2/540	W12/540		12	39	8	34	33.3	12.8						
R2/540	W13/540		11	37	8	29	27.3	21.6						
R2/540	W14/540		12	39	8	31	33.3	20.5	12	39	9	35	25.0	10.3
R3/540	W15/540		10	36	7	29	30.0	19.4						
R3/540	W16/540		11	38	7	32	36.4	15.8						
R3/540	W17/540		10	36	8	30	20.0	16.7						
R3/540	W18/540		11	38	9	32	18.2	15.8						
R3/540	W19/540		10	36	8	28	20.0	22.2						
R3/540	W20/540		11	38	8	30	27.3	21.1	12	39	9	34	25.0	12.8
R1/541	W1/541		12	41	12	40	0.0	2.4						
R1/541	W2/541		12	41	12	40	0.0	2.4						

Grand Union House, Camden Existing vs Proposed 151118 With Mango Consent

Grandunion House SUNLIGHT ANALYSIS

NOV 2018

[illegible]

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
SUNLIGHT ANALYSIS

NOV 2018

Room	Window	Room Use	Window						Room					
			Existing		Proposed		Winter %Loss	Annual %Loss	Existing		Proposed		Winter %Loss	Annual %Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R7/901	W66/901	ASSUMED_RESI	5	28	1	14	80.0	50.0	5	28	1	14	80.0	50.0
R8/901	W67/901	ASSUMED_RESI	9	37	4	21	55.6	43.2	9	37	4	21	55.6	43.2
R9/901	W68/901	ASSUMED_RESI	11	40	6	25	45.5	37.5	11	40	6	25	45.5	37.5
R1/902	W1/902	ASSUMED_RESI	29	87	27	83	6.9	4.6	29	87	27	83	6.9	4.6
R2/902	W2/902	ASSUMED_RESI	29	87	27	83	6.9	4.6	29	87	27	83	6.9	4.6
R3/902	W3/902	ASSUMED_RESI	29	87	27	82	6.9	5.7	29	87	27	82	6.9	5.7
R4/902	W4/902	ASSUMED_RESI	28	86	27	79	3.6	8.1						
R4/902	W5/902	ASSUMED_RESI	13	49	9	33	30.8	32.7	28	91	27	79	3.6	13.2
R5/902	W6/902	ASSUMED_RESI	13	49	8	32	38.5	34.7	13	49	8	32	38.5	34.7
R6/902	W7/902	ASSUMED_RESI	13	49	8	30	38.5	38.8	13	49	8	30	38.5	38.8
R7/902	W8/902	ASSUMED_RESI	13	49	8	30	38.5	38.8	13	49	8	30	38.5	38.8
R8/902	W9/902	ASSUMED_RESI	13	49	8	30	38.5	38.8	13	49	8	30	38.5	38.8
R9/902	W10/902	ASSUMED_RESI	6	34	1	18	83.3	47.1	6	34	1	18	83.3	47.1

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
SUNLIGHT ANALYSIS

NOV 2018

Room	Window	Room Use	Window						Room					
			Existing		Proposed		Winter %Loss	Annual %Loss	Existing		Proposed		Winter %Loss	Annual %Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R10/902	W11/902	ASSUMED_RESI	10	44	5	28	50.0	36.4	10	44	5	28	50.0	36.4
R11/902	W12/902	ASSUMED_RESI	12	47	7	29	41.7	38.3	12	47	7	29	41.7	38.3
R1/903	W1/903	ASSUMED_RESI	30	89	27	86	10.0	3.4	30	89	27	86	10.0	3.4
R2/903	W2/903	ASSUMED_RESI	30	89	27	85	10.0	4.5	30	89	27	85	10.0	4.5
R3/903	W3/903	ASSUMED_RESI	30	89	27	84	10.0	5.6	30	89	27	84	10.0	5.6
R4/903	W4/903	ASSUMED_RESI	30	89	27	83	10.0	6.7						
R4/903	W5/903	ASSUMED_RESI	15	52	10	38	33.3	26.9	30	95	27	84	10.0	11.6
R5/903	W6/903	ASSUMED_RESI	15	52	10	38	33.3	26.9	15	52	10	38	33.3	26.9
R6/903	W7/903	ASSUMED_RESI	15	52	9	38	40.0	26.9	15	52	9	38	40.0	26.9
R7/903	W8/903	ASSUMED_RESI	14	51	10	38	28.6	25.5	14	51	10	38	28.6	25.5
R8/903	W9/903	ASSUMED_RESI	14	51	10	38	28.6	25.5	14	51	10	38	28.6	25.5
R9/903	W10/903	ASSUMED_RESI	8	37	3	24	62.5	35.1	8	37	3	24	62.5	35.1
R10/903	W11/903	ASSUMED_RESI	12	48	8	36	33.3	25.0	12	48	8	36	33.3	25.0

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
SUNLIGHT ANALYSIS

NOV 2018

Room	Window	Room Use	Window						Room					
			Existing		Proposed		Winter %Loss	Annual %Loss	Existing		Proposed		Winter %Loss	Annual %Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R11/903	W12/903	ASSUMED_RESI	14	51	10	39	28.6	23.5	14	51	10	39	28.6	23.5
R1/904	W1/904	ASSUMED_RESI	30	89	29	88	3.3	1.1	30	89	29	88	3.3	1.1
R2/904	W2/904	ASSUMED_RESI	30	89	28	87	6.7	2.2	30	89	28	87	6.7	2.2
R3/904	W3/904	ASSUMED_RESI	30	89	27	85	10.0	4.5	30	89	27	85	10.0	4.5
R4/904	W4/904	ASSUMED_RESI	30	89	27	85	10.0	4.5						
R4/904	W5/904	ASSUMED_RESI	15	52	12	42	20.0	19.2	30	95	27	86	10.0	9.5
R5/904	W6/904	ASSUMED_RESI	15	52	12	42	20.0	19.2	15	52	12	42	20.0	19.2
R6/904	W7/904	ASSUMED_RESI	15	52	12	42	20.0	19.2	15	52	12	42	20.0	19.2
R7/904	W8/904	ASSUMED_RESI	15	52	12	43	20.0	17.3	15	52	12	43	20.0	17.3
R8/904	W9/904	ASSUMED_RESI	15	52	12	43	20.0	17.3	15	52	12	43	20.0	17.3
R9/904	W10/904	ASSUMED_RESI	8	39	5	30	37.5	23.1	8	39	5	30	37.5	23.1
R10/904	W11/904	ASSUMED_RESI	12	49	9	40	25.0	18.4	12	49	9	40	25.0	18.4
R11/904	W12/904	ASSUMED_RESI	14	51	11	41	21.4	19.6	14	51	11	41	21.4	19.6

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
SUNLIGHT ANALYSIS

NOV 2018

Room	Window	Room Use	Window						Room					
			Existing		Proposed		Winter %Loss	Annual %Loss	Existing		Proposed		Winter %Loss	Annual %Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R1/905	W1/905	ASSUMED_RESI	30	89	30	89	0.0	0.0	30	89	30	89	0.0	0.0
R2/905	W2/905	ASSUMED_RESI	30	89	29	88	3.3	1.1	30	89	29	88	3.3	1.1
R3/905	W3/905	ASSUMED_RESI	30	89	28	87	6.7	2.2	30	89	28	87	6.7	2.2
R4/905	W4/905	ASSUMED_RESI	30	89	28	87	6.7	2.2						
R4/905	W5/905	ASSUMED_RESI	15	52	12	47	20.0	9.6	30	95	28	91	6.7	4.2
R5/905	W6/905	ASSUMED_RESI	15	52	13	48	13.3	7.7	15	52	13	48	13.3	7.7
R6/905	W7/905	ASSUMED_RESI	15	52	13	49	13.3	5.8	15	52	13	49	13.3	5.8
R7/905	W8/905	ASSUMED_RESI	15	52	13	48	13.3	7.7	15	52	13	48	13.3	7.7
R8/905	W9/905	ASSUMED_RESI	15	52	13	48	13.3	7.7						
R8/905	W10/905	ASSUMED_RESI	0	11	0	10	-	9.1	15	57	13	54	13.3	5.3
R1/906	W1/906		15	49	15	49	0.0	0.0						
R1/906	W2/906		30	89	30	89	0.0	0.0	30	94	30	94	0.0	0.0
R2/906	W3/906		30	89	30	89	0.0	0.0	30	89	30	89	0.0	0.0
R3/906	W4/906		30	89	30	89	0.0	0.0	30	89	30	89	0.0	0.0

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
SUNLIGHT ANALYSIS

NOV 2018

Room	Window	Room Use	Window						Room					
			Existing		Proposed		Winter %Loss	Annual %Loss	Existing		Proposed		Winter %Loss	Annual %Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R4/906	W5/906		30	89	29	88	3.3	1.1						
R4/906	W6/906		15	52	14	51	6.7	1.9	30	95	29	94	3.3	1.1
R5/906	W7/906		15	52	14	50	6.7	3.8	15	52	14	50	6.7	3.8
R6/906	W8/906		15	52	14	50	6.7	3.8	15	52	14	50	6.7	3.8
R7/906	W9/906		15	52	14	50	6.7	3.8						
R7/906	W10/906		0	11	0	11	-	0.0	15	57	14	56	6.7	1.8
Daysun House, Hawley Crescent And 29 Kentish Town Road														
R1/731	W1/731	STUDIO	8	34	3	19	62.5	44.1	8	34	3	19	62.5	44.1
R2/731	W2/731	STUDIO	11	39	6	25	45.5	35.9	11	39	6	25	45.5	35.9
R1/732	W1/732	STUDIO	4	20	0	5	100.0	75.0	4	20	0	5	100.0	75.0
R2/732	W2/732	STUDIO	12	46	6	28	50.0	39.1	12	46	6	28	50.0	39.1
R1/733	W1/733	STUDIO	11	45	6	31	45.5	31.1	11	45	6	31	45.5	31.1
R2/733	W2/733	STUDIO	5	35	1	23	80.0	34.3	5	35	1	23	80.0	34.3

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
SUNLIGHT ANALYSIS

NOV 2018

Room	Window	Room Use	Window						Room					
			Existing		Proposed		Winter %Loss	Annual %Loss	Existing		Proposed		Winter %Loss	Annual %Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R1/734	W1/734	STUDIO	4	40	1	32	75.0	20.0						
R1/734	W2/734	STUDIO	10	47	7	37	30.0	21.3						
R1/734	W3/734	STUDIO	14	51	11	42	21.4	17.6	14	51	11	43	21.4	15.7
31 Kentish Town Road														
R1/31	W1/31	LKD	2	14	0	8	100.0	42.9						
R1/31	W2/31	LKD	0	2	0	2	-	0.0						
R1/31	W3/31	LKD	12	40	7	26	41.7	35.0						
R1/31	W28/31	LKD	7	21	2	8	71.4	61.9	12	42	7	28	41.7	33.3
R3/31	W6/31	LKD	12	32	7	18	41.7	43.8						
R3/31	W7/31	LKD	11	39	6	24	45.5	38.5	12	41	7	27	41.7	34.1
R5/31	W10/31	LKD	11	30	6	15	45.5	50.0						
R5/31	W11/31	LKD	9	37	4	22	55.6	40.5	11	39	6	24	45.5	38.5
R6/31	W12/31	LKD	0	4	0	0	-	100.0						
R6/31	W13/31	LKD	6	30	2	16	66.7	46.7						
R6/31	W14/31	LKD	8	37	3	20	62.5	45.9	8	37	3	20	62.5	45.9
R1/32	W1/32	LKD	3	21	0	13	100.0	38.1						
R1/32	W2/32	LKD	0	3	0	3	-	0.0						
R1/32	W3/32	LKD	13	46	7	29	46.2	37.0						
R1/32	W28/32	LKD	8	29	2	17	75.0	41.4	13	50	7	35	46.2	30.0

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
SUNLIGHT ANALYSIS

NOV 2018

Room	Window	Room Use	Window						Room					
			Existing		Proposed		Winter %Loss	Annual %Loss	Existing		Proposed		Winter %Loss	Annual %Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R3/32	W6/32	LKD	13	36	7	20	46.2	44.4						
R3/32	W7/32	LKD	12	45	6	27	50.0	40.0	13	48	7	30	46.2	37.5
R5/32	W10/32	LKD	12	34	6	19	50.0	44.1						
R5/32	W11/32	LKD	10	43	4	23	60.0	46.5	12	45	6	28	50.0	37.8
R6/32	W12/32	LKD	0	7	0	0	-	100.0						
R6/32	W13/32	LKD	7	34	2	20	71.4	41.2						
R6/32	W14/32	LKD	9	41	3	24	66.7	41.5	9	41	3	25	66.7	39.0
R1/33	W1/33	LKD	8	26	4	18	50.0	30.8						
R1/33	W2/33	LKD	15	39	10	31	33.3	20.5						
R1/33	W3/33	LKD	15	50	10	35	33.3	30.0	16	54	12	42	25.0	22.2
R3/33	W6/33	BEDROOM	14	49	7	32	50.0	34.7						
R3/33	W12/33	BEDROOM	17	43	11	34	35.3	20.9	17	56	11	42	35.3	25.0
R6/33	W9/33	LKD	12	46	5	31	58.3	32.6						
R6/33	W13/33	LKD	14	40	8	27	42.9	32.5	14	51	8	38	42.9	25.5
R7/33	W10/33	LKD	0	8	0	1	-	87.5						
R7/33	W11/33	LKD	11	44	6	31	45.5	29.5						
R7/33	W14/33	LKD	9	37	4	26	55.6	29.7	11	44	6	31	45.5	29.5

Grand Union House, Camden Existing vs Proposed 151118 With Mango Consent

Grandunion House SUNLIGHT ANALYSIS

NOV 2018

[illegible]

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
SUNLIGHT ANALYSIS

NOV 2018

Room	Window	Room Use	Window						Room					
			Existing		Proposed		Winter %Loss	Annual %Loss	Existing		Proposed		Winter %Loss	Annual %Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R1/40	W1/40	ASSUMED	24	74	22	72	8.3	2.7	24	74	22	72	8.3	2.7
R2/40	W2/40	ASSUMED	24	74	22	72	8.3	2.7	24	74	22	72	8.3	2.7
R3/40	W3/40	ASSUMED	24	74	22	72	8.3	2.7	24	74	22	72	8.3	2.7
R4/40	W4/40	ASSUMED	24	73	22	71	8.3	2.7	24	73	22	71	8.3	2.7
R5/40	W5/40	ASSUMED	19	58	17	56	10.5	3.4	19	58	17	56	10.5	3.4
R6/40	W6/40	ASSUMED	23	72	22	71	4.3	1.4	23	72	22	71	4.3	1.4
R7/40	W7/40	ASSUMED	24	77	23	76	4.2	1.3	24	77	23	76	4.2	1.3
R8/40	W8/40	ASSUMED	25	74	24	73	4.0	1.4	25	74	24	73	4.0	1.4
R1/41	W1/41		25	73	23	71	8.0	2.7	25	73	23	71	8.0	2.7
R2/41	W2/41		25	73	23	71	8.0	2.7	25	73	23	71	8.0	2.7
R3/41	W3/41	ASSUMED	24	73	23	72	4.2	1.4	24	73	23	72	4.2	1.4
R4/41	W4/41	ASSUMED	24	73	23	72	4.2	1.4	24	73	23	72	4.2	1.4

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
SUNLIGHT ANALYSIS

NOV 2018

Room	Window	Room Use	Window						Room					
			Existing		Proposed		Winter %Loss	Annual %Loss	Existing		Proposed		Winter %Loss	Annual %Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R5/41	W5/41	ASSUMED	24	72	22	70	8.3	2.8	24	72	22	70	8.3	2.8
R6/41	W6/41	ASSUMED	21	68	20	67	4.8	1.5	21	68	20	67	4.8	1.5
R7/41	W7/41	ASSUMED	25	74	24	73	4.0	1.4	25	74	24	73	4.0	1.4
R8/41	W8/41	ASSUMED	25	75	24	74	4.0	1.3	25	75	24	74	4.0	1.3
R9/41	W9/41	ASSUMED	25	68	24	67	4.0	1.5	25	75	24	74	4.0	1.3
R9/41	W10/41	ASSUMED	25	75	24	74	4.0	1.3						
R1/42	W1/42	ASSUMED	24	48	24	48	0.0	0.0	24	48	24	48	0.0	0.0
R2/42	W2/42	ASSUMED	26	60	25	59	3.8	1.7	26	60	25	59	3.8	1.7
R2/42	W3/42	ASSUMED	26	60	25	59	3.8	1.7						
R3/42	W4/42	ASSUMED	26	60	25	59	3.8	1.7	26	60	25	59	3.8	1.7
R3/42	W5/42	ASSUMED	26	60	25	59	3.8	1.7						
R4/42	W6/42	ASSUMED	26	49	26	49	0.0	0.0	26	49	26	49	0.0	0.0
R5/42	W7/42	ASSUMED	26	73	26	73	0.0	0.0	29	92	29	92	0.0	0.0
R5/42	W10/42	ASSUMED	29	92	29	92	0.0	0.0						
R6/42	W8/42	ASSUMED	23	74	22	73	4.3	1.4						

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
SUNLIGHT ANALYSIS

NOV 2018

Room	Window	Room Use	Window						Room					
			Existing		Proposed		Winter %Loss	Annual %Loss	Existing		Proposed		Winter %Loss	Annual %Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R6/42	W11/42	ASSUMED	28	92	27	91	3.6	1.1	28	92	27	91	3.6	1.1
R7/42	W9/42	ASSUMED	26	50	25	49	3.8	2.0	26	50	25	49	3.8	2.0
1-28 Camden Street														
R1/50	W14/50	ASSUMED	18	50	17	49	5.6	2.0						
R1/50	W15/50	ASSUMED	18	50	17	49	5.6	2.0						
R1/50	W16/50	ASSUMED	18	50	18	50	0.0	0.0	18	50	18	50	0.0	0.0
R2/50	W13/50	ASSUMED	19	51	19	51	0.0	0.0	19	51	19	51	0.0	0.0
R3/50	W12/50	ASSUMED	19	56	19	56	0.0	0.0	19	56	19	56	0.0	0.0
R4/50	W9/50	ASSUMED	19	56	19	56	0.0	0.0						
R4/50	W10/50	ASSUMED	19	56	19	56	0.0	0.0						
R4/50	W11/50	ASSUMED	19	56	19	56	0.0	0.0	19	56	19	56	0.0	0.0
R5/50	W6/50	ASSUMED	19	57	19	57	0.0	0.0						
R5/50	W7/50	ASSUMED	19	57	19	57	0.0	0.0						
R5/50	W8/50	ASSUMED	19	57	19	57	0.0	0.0	20	58	20	58	0.0	0.0
R6/50	W5/50	ASSUMED	19	58	18	57	5.3	1.7	19	58	18	57	5.3	1.7
R7/50	W4/50	ASSUMED	18	60	17	59	5.6	1.7	18	60	17	59	5.6	1.7

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
SUNLIGHT ANALYSIS

NOV 2018

Room	Window	Room Use	Window						Room					
			Existing		Proposed		Winter %Loss	Annual %Loss	Existing		Proposed		Winter %Loss	Annual %Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R8/50	W1/50	ASSUMED	16	58	15	57	6.3	1.7						
R8/50	W2/50	ASSUMED	17	59	16	58	5.9	1.7						
R8/50	W3/50	ASSUMED	17	59	16	58	5.9	1.7	17	59	16	58	5.9	1.7
R1/51	W1/51	ASSUMED	18	49	17	48	5.6	2.0						
R1/51	W2/51	ASSUMED	17	49	16	48	5.9	2.0						
R1/51	W3/51	ASSUMED	17	49	16	48	5.9	2.0	18	50	17	49	5.6	2.0
R2/51	W4/51	ASSUMED	18	51	17	50	5.6	2.0	18	51	17	50	5.6	2.0
R3/51	W8/51	ASSUMED	18	55	17	54	5.6	1.8	18	55	17	54	5.6	1.8
R4/51	W5/51	ASSUMED	19	56	18	55	5.3	1.8						
R4/51	W6/51	ASSUMED	19	56	18	55	5.3	1.8						
R4/51	W7/51	ASSUMED	19	56	18	55	5.3	1.8	19	56	18	55	5.3	1.8
R5/51	W10/51	ASSUMED	19	56	18	55	5.3	1.8						
R5/51	W11/51	ASSUMED	19	56	18	55	5.3	1.8						
R5/51	W12/51	ASSUMED	19	56	18	55	5.3	1.8	19	56	18	55	5.3	1.8
R6/51	W9/51	ASSUMED	20	58	18	56	10.0	3.4	20	58	18	56	10.0	3.4
R7/51	W16/51	ASSUMED	19	58	19	58	0.0	0.0	19	58	19	58	0.0	0.0

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
SUNLIGHT ANALYSIS

NOV 2018

Room	Window	Room Use	Window						Room					
			Existing		Proposed		Winter %Loss	Annual %Loss	Existing		Proposed		Winter %Loss	Annual %Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R8/51	W13/51	ASSUMED	18	60	18	60	0.0	0.0						
R8/51	W14/51	ASSUMED	19	60	19	60	0.0	0.0						
R8/51	W15/51	ASSUMED	18	60	18	60	0.0	0.0	19	61	19	61	0.0	0.0
R1/52	W1/52	ASSUMED	21	55	19	53	9.5	3.6						
R1/52	W2/52	ASSUMED	21	56	19	54	9.5	3.6						
R1/52	W3/52	ASSUMED	21	57	19	55	9.5	3.5	21	57	19	55	9.5	3.5
R2/52	W4/52	ASSUMED	20	56	18	54	10.0	3.6	20	56	18	54	10.0	3.6
R3/52	W8/52	ASSUMED	19	54	18	53	5.3	1.9	19	54	18	53	5.3	1.9
R4/52	W5/52	ASSUMED	19	55	19	55	0.0	0.0						
R4/52	W6/52	ASSUMED	19	54	18	53	5.3	1.9						
R4/52	W7/52	ASSUMED	19	55	19	55	0.0	0.0	19	55	19	55	0.0	0.0
R5/52	W10/52	ASSUMED	19	55	19	55	0.0	0.0						
R5/52	W11/52	ASSUMED	19	55	19	55	0.0	0.0						
R5/52	W12/52	ASSUMED	19	55	19	55	0.0	0.0	19	55	19	55	0.0	0.0
R6/52	W9/52	ASSUMED	20	56	20	56	0.0	0.0	20	56	20	56	0.0	0.0
R7/52	W16/52	ASSUMED	21	57	20	56	4.8	1.8	21	57	20	56	4.8	1.8
R8/52	W13/52	ASSUMED	23	62	22	61	4.3	1.6						

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
SUNLIGHT ANALYSIS

NOV 2018

Room	Window	Room Use	Window						Room					
			Existing		Proposed		Winter %Loss	Annual %Loss	Existing		Proposed		Winter %Loss	Annual %Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R8/52	W14/52	ASSUMED	23	60	22	59	4.3	1.7						
R8/52	W15/52	ASSUMED	23	61	22	60	4.3	1.6	23	62	22	61	4.3	1.6
R1/53	W10/53	ASSUMED	16	39	15	38	6.3	2.6						
R1/53	W14/53	ASSUMED	15	34	14	33	6.7	2.9						
R1/53	W15/53	ASSUMED	15	34	14	33	6.7	2.9	16	39	15	38	6.3	2.6
R2/53	W1/53	ASSUMED	15	33	14	32	6.7	3.0	15	33	14	32	6.7	3.0
R3/53	W2/53	ASSUMED	15	33	14	32	6.7	3.0	15	33	14	32	6.7	3.0
R4/53	W9/53	ASSUMED	16	39	16	39	0.0	0.0						
R4/53	W12/53	ASSUMED	14	33	14	33	0.0	0.0						
R4/53	W13/53	ASSUMED	14	33	14	33	0.0	0.0	16	39	16	39	0.0	0.0
R5/53	W7/53	ASSUMED	16	39	16	39	0.0	0.0						
R5/53	W8/53	ASSUMED	14	33	14	33	0.0	0.0						
R5/53	W11/53	ASSUMED	14	33	14	33	0.0	0.0	16	39	16	39	0.0	0.0
R6/53	W3/53	ASSUMED	14	32	14	32	0.0	0.0	14	32	14	32	0.0	0.0
R7/53	W16/53	ASSUMED	14	32	13	31	7.1	3.1	14	32	13	31	7.1	3.1
R8/53	W4/53	ASSUMED	18	41	17	40	5.6	2.4						
R8/53	W5/53	ASSUMED	14	33	13	32	7.1	3.0						

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
SUNLIGHT ANALYSIS

NOV 2018

Room	Window	Room Use	Window						Room					
			Existing		Proposed		Winter %Loss	Annual %Loss	Existing		Proposed		Winter %Loss	Annual %Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R8/53	W6/53	ASSUMED	16	35	15	34	6.3	2.9	18	41	17	40	5.6	2.4
St Michael's Church														
R1/10	W7/10		1	14	0	5	100.0	64.3						
R1/10	W8/10		1	14	0	6	100.0	57.1						
R1/10	W9/10		3	22	3	22	0.0	0.0	4	36	3	28	25.0	22.2
R3/10	W1/10	CHURCH	14	53	14	46	0.0	13.2						
R3/10	W2/10	CHURCH	4	23	1	9	75.0	60.9						
R3/10	W3/10	CHURCH	0	15	0	15	-	0.0						
R3/10	W4/10	CHURCH	0	17	0	17	-	0.0						
R3/10	W5/10	CHURCH	0	17	0	17	-	0.0						
R3/10	W10/10	CHURCH	0	17	0	17	-	0.0						
R3/10	W11/10	CHURCH	0	17	0	17	-	0.0						
R3/10	W12/10	CHURCH	0	18	0	18	-	0.0						
R3/10	W13/10	CHURCH	0	18	0	18	-	0.0						
R3/10	W14/10	CHURCH	2	20	2	20	0.0	0.0						
R3/10	W15/10	CHURCH	16	61	16	61	0.0	0.0						
R3/10	W16/10	CHURCH	26	76	26	76	0.0	0.0						
R3/10	W17/10	CHURCH	17	64	17	64	0.0	0.0						
R3/10	W18/10	CHURCH	21	60	21	60	0.0	0.0						
R3/10	W19/10	CHURCH	18	57	18	57	0.0	0.0						
R3/10	W20/10	CHURCH	16	55	16	55	0.0	0.0						
R3/10	W21/10	CHURCH	4	21	4	21	0.0	0.0						

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
SUNLIGHT ANALYSIS

NOV 2018

Room	Window	Room Use	Window						Room					
			Existing		Proposed		Winter %Loss	Annual %Loss	Existing		Proposed		Winter %Loss	Annual %Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R3/10	W22/10	CHURCH	15	55	15	55	0.0	0.0						
R3/10	W23/10	CHURCH	4	21	4	21	0.0	0.0						
R3/10	W24/10	CHURCH	15	55	15	54	0.0	1.8						
R3/10	W25/10	CHURCH	4	22	4	22	0.0	0.0						
R3/10	W26/10	CHURCH	16	56	15	50	6.3	10.7						
R3/10	W27/10	CHURCH	3	22	3	23	0.0	-4.5						
R3/10	W28/10	CHURCH	2	21	2	21	0.0	0.0						
R3/10	W29/10	CHURCH	21	63	21	51	0.0	19.0						
R3/10	W30/10	CHURCH	5	26	5	21	0.0	19.2	30	99	28	97	6.7	2.0
9-15 Camden Road, Barnes House														
R6/102	W10/102	KITCHEN	9	12	6	7	33.3	41.7	9	12	6	7	33.3	41.7
R9/102	W13/102	KITCHEN	8	13	6	8	25.0	38.5	8	13	6	8	25.0	38.5
R15/102	W18/102	BEDROOM	7	16	6	11	14.3	31.3	7	16	6	11	14.3	31.3
R16/102	W19/102	KITCHEN	6	16	6	12	0.0	25.0	6	16	6	12	0.0	25.0
R19/102	W26/102	BEDROOM	4	13	4	11	0.0	15.4	4	13	4	11	0.0	15.4
R33/102	W39/102	BEDROOM	17	46	13	37	23.5	19.6	17	46	13	37	23.5	19.6
R6/103	W10/103	KITCHEN	11	17	9	11	18.2	35.3	11	17	9	11	18.2	35.3

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
SUNLIGHT ANALYSIS

NOV 2018

Room	Window	Room Use	Window						Room					
			Existing		Proposed		Winter %Loss	Annual %Loss	Existing		Proposed		Winter %Loss	Annual %Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R9/103	W13/103	KITCHEN	11	17	9	14	18.2	17.6	11	17	9	14	18.2	17.6
R15/103	W18/103	BEDROOM	10	20	8	16	20.0	20.0	10	20	8	16	20.0	20.0
R16/103	W19/103	KITCHEN	9	19	8	16	11.1	15.8	9	19	8	16	11.1	15.8
R19/103	W26/103	BEDROOM	5	15	5	14	0.0	6.7	5	15	5	14	0.0	6.7
R33/103	W39/103	BEDROOM	19	50	16	41	15.8	18.0	19	50	16	41	15.8	18.0
R3/104	W7/104	KITCHEN	16	54	15	51	6.3	5.6	16	54	15	51	6.3	5.6
R11/104	W16/104	KITCHEN	23	66	22	62	4.3	6.1	23	66	22	62	4.3	6.1
R12/104	W17/104	KITCHEN	21	65	20	59	4.8	9.2	21	65	20	59	4.8	9.2
R19/104	W24/104	KITCHEN	19	63	19	62	0.0	1.6	19	63	19	62	0.0	1.6
R23/104	W32/104	KITCHEN	11	52	11	51	0.0	1.9	11	52	11	51	0.0	1.9
R3/105	W7/105	BEDROOM	25	69	24	68	4.0	1.4	25	69	24	68	4.0	1.4
R5/105	W10/105	BEDROOM	25	69	25	69	0.0	0.0						
R5/105	W12/105	BEDROOM	25	69	25	69	0.0	0.0	25	69	25	69	0.0	0.0

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
SUNLIGHT ANALYSIS

NOV 2018

Room	Window	Room Use	Window						Room					
			Existing		Proposed		Winter %Loss	Annual %Loss	Existing		Proposed		Winter %Loss	Annual %Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R7/105	W15/105	BEDROOM	25	69	25	69	0.0	0.0	25	69	25	69	0.0	0.0
R8/105	W16/105	BEDROOM	24	68	24	68	0.0	0.0	24	68	24	68	0.0	0.0
R10/105	W18/105	BEDROOM	21	65	21	65	0.0	0.0	21	65	21	65	0.0	0.0
R11/105	W19/105	BEDROOM	12	55	12	55	0.0	0.0	12	55	12	55	0.0	0.0
5A Camden Road														
R1/110	W1/110		0	7	0	7	-	0.0						
R1/110	W2/110		0	12	0	12	-	0.0						
R1/110	W3/110		0	12	0	12	-	0.0	0	13	0	13	-	0.0

Cumulative Mango Consent Balconies Removed



Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
DAYLIGHT ANALYSIS
BALCONIES REMOVED

NOV 2018

Room	Room Use	Window	EXISTING VSC	PROPOSED VSC	LOSS VSC	%LOSS VSC	Room	Room Use	Window	EXISTING ADF	TOTAL	PROPOSED ADF	TOTAL	TOTAL LOSS	%LOSS ADF
9-15 Camden Road, Barnes House							9-15 Camden Road, Barnes House								
R1/102	RECEPTION	W1/102	21.82	21.73	0.09	0.41	R1/102	RECEPTION	W1/102	1.35	1.35	1.36	1.36	-0.01	-0.59
R2/102	BEDROOM	W2/102	21.98	21.50	0.48	2.18	R2/102	BEDROOM	W2/102	0.82	0.82	0.82	0.82	0.00	0.37
R3/102	RECEPTION	W3/102	21.87	21.35	0.52	2.38	R3/102	RECEPTION	W3/102	0.64		0.64			
R3/102	RECEPTION	W4/102	21.82	21.30	0.52	2.38	R3/102	RECEPTION	W4/102	0.63	1.28	0.63	1.27	0.00	0.16
R5/102	BEDROOM	W5/102	21.92	21.45	0.47	2.14	R5/102	BEDROOM	W5/102	0.94	0.94	0.94	0.94	0.00	0.00
R6/102	KITCHEN	W10/102	24.35	19.61	4.74	19.47	R6/102	KITCHEN	W10/102	1.39	1.39	1.19	1.19	0.19	14.00
R8/102	BEDROOM	W6/102	22.19	21.78	0.41	1.85	R8/102	BEDROOM	W6/102	0.77	0.77	0.77	0.77	0.00	0.00
R9/102	KITCHEN	W13/102	27.63	23.07	4.56	16.50	R9/102	KITCHEN	W13/102	1.47	1.47	1.29	1.29	0.19	12.56
R10/102	RECEPTION	W7/102	22.54	22.20	0.34	1.51	R10/102	RECEPTION	W7/102	0.65		0.65			
R10/102	RECEPTION	W8/102	22.92	22.61	0.31	1.35	R10/102	RECEPTION	W8/102	0.66	1.31	0.66	1.31	0.00	0.00
R15/102	BEDROOM	W18/102	29.02	26.15	2.87	9.89	R15/102	BEDROOM	W18/102	1.43	1.43	1.32	1.32	0.11	7.43
R16/102	KITCHEN	W19/102	28.48	26.15	2.33	8.18	R16/102	KITCHEN	W19/102	1.49	1.49	1.40	1.40	0.09	6.04
R19/102	BEDROOM	W26/102	25.02	23.58	1.44	5.76	R19/102	BEDROOM	W26/102	1.05	1.05	1.01	1.01	0.04	3.82
R23/102	KITCHEN	W28/102	22.24	20.36	1.88	8.45	R23/102	KITCHEN	W28/102	1.25	1.25	1.17	1.17	0.08	6.42
R24/102	BEDROOM	W29/102	25.41	23.17	2.24	8.82	R24/102	BEDROOM	W29/102	1.27	1.27	1.18	1.18	0.08	6.63
R28/102	KITCHEN	W34/102	27.37	24.72	2.65	9.68	R28/102	KITCHEN	W34/102	1.52	1.52	1.41	1.41	0.12	7.56
R29/102	BEDROOM	W38/102	26.02	23.52	2.50	9.61	R29/102	BEDROOM	W38/102	1.34	1.34	1.24	1.24	0.10	7.11

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
DAYLIGHT ANALYSIS
BALCONIES REMOVED

NOV 2018

Room	Room Use	Window	EXISTING VSC	PROPOSED VSC	LOSS VSC	%LOSS VSC	Room	Room Use	Window	EXISTING ADF	TOTAL	PROPOSED ADF	TOTAL	TOTAL LOSS	%LOSS ADF
R32/102	KITCHEN	W35/102	24.91	22.26	2.65	10.64	R32/102	KITCHEN	W35/102	1.37	1.37	1.26	1.26	0.11	7.91
R33/102	BEDROOM	W39/102	20.23	14.31	5.92	29.26	R33/102	BEDROOM	W39/102	1.33	1.33	1.04	1.04	0.28	21.33
R1/103	RECEPTION	W1/103	25.62	25.04	0.58	2.26	R1/103	RECEPTION	W1/103	1.61	1.61	1.60	1.60	0.01	0.81
R2/103	BEDROOM	W2/103	25.69	25.01	0.68	2.65	R2/103	BEDROOM	W2/103	0.97	0.97	0.96	0.96	0.00	0.31
R3/103	RECEPTION	W3/103	25.58	24.93	0.65	2.54	R3/103	RECEPTION	W3/103	0.76		0.76			
R3/103	RECEPTION	W4/103	25.53	24.91	0.62	2.43	R3/103	RECEPTION	W4/103	0.76	1.52	0.76	1.52	0.00	0.13
R5/103	BEDROOM	W5/103	25.60	25.05	0.55	2.15	R5/103	BEDROOM	W5/103	1.12	1.12	1.12	1.12	0.00	0.09
R6/103	KITCHEN	W10/103	28.31	25.10	3.21	11.34	R6/103	KITCHEN	W10/103	1.55	1.55	1.43	1.43	0.13	8.11
R8/103	BEDROOM	W6/103	25.79	25.30	0.49	1.90	R8/103	BEDROOM	W6/103	0.91	0.91	0.91	0.91	0.00	0.00
R9/103	KITCHEN	W13/103	31.91	28.86	3.05	9.56	R9/103	KITCHEN	W13/103	1.62	1.62	1.50	1.50	0.13	7.76
R10/103	RECEPTION	W7/103	26.04	25.60	0.44	1.69	R10/103	RECEPTION	W7/103	0.77		0.77			
R10/103	RECEPTION	W8/103	26.37	25.96	0.41	1.55	R10/103	RECEPTION	W8/103	0.78	1.54	0.78	1.54	0.00	0.00
R15/103	BEDROOM	W18/103	32.59	30.80	1.79	5.49	R15/103	BEDROOM	W18/103	1.54	1.54	1.48	1.48	0.06	4.15
R16/103	KITCHEN	W19/103	32.05	30.57	1.48	4.62	R16/103	KITCHEN	W19/103	1.56	1.56	1.51	1.51	0.05	3.40
R19/103	BEDROOM	W26/103	28.78	27.84	0.94	3.27	R19/103	BEDROOM	W26/103	1.15	1.15	1.12	1.12	0.02	2.09
R23/103	KITCHEN	W28/103	25.65	24.26	1.39	5.42	R23/103	KITCHEN	W28/103	1.33	1.33	1.28	1.28	0.06	4.13
R24/103	BEDROOM	W29/103	29.03	27.37	1.66	5.72	R24/103	BEDROOM	W29/103	1.36	1.36	1.29	1.29	0.06	4.50

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
DAYLIGHT ANALYSIS
BALCONIES REMOVED

NOV 2018

Room	Room Use	Window	EXISTING VSC	PROPOSED VSC	LOSS VSC	%LOSS VSC	Room	Room Use	Window	EXISTING ADF	TOTAL	PROPOSED ADF	TOTAL	TOTAL LOSS	%LOSS ADF
R28/103	KITCHEN	W34/103	31.52	29.61	1.91	6.06	R28/103	KITCHEN	W34/103	1.61	1.61	1.53	1.53	0.08	5.09
R29/103	BEDROOM	W38/103	30.72	28.96	1.76	5.73	R29/103	BEDROOM	W38/103	1.55	1.55	1.48	1.48	0.07	4.53
R32/103	KITCHEN	W35/103	29.70	27.81	1.89	6.36	R32/103	KITCHEN	W35/103	1.48	1.48	1.40	1.40	0.08	5.07
R33/103	BEDROOM	W39/103	24.51	19.29	5.22	21.30	R33/103	BEDROOM	W39/103	1.62	1.62	1.37	1.37	0.25	15.39
R1/104	RECEPTION	W1/104	29.71	28.58	1.13	3.80	R1/104	RECEPTION	W1/104	1.61	1.61	1.58	1.58	0.03	1.86
R2/104	RECEPTION	W4/104	29.26	28.54	0.72	2.46	R2/104	RECEPTION	W4/104	0.76		0.76			
R2/104	RECEPTION	W5/104	29.30	28.65	0.65	2.22	R2/104	RECEPTION	W5/104	0.74	1.50	0.74	1.50	0.00	0.07
R3/104	KITCHEN	W7/104	32.88	28.59	4.29	13.05	R3/104	KITCHEN	W7/104	1.43	1.43	1.28	1.28	0.15	10.16
R4/104	RECEPTION	W6/104	29.42	28.83	0.59	2.01	R4/104	RECEPTION	W6/104	0.76		0.76			
R4/104	RECEPTION	W8/104	29.60	29.08	0.52	1.76	R4/104	RECEPTION	W8/104	0.76	1.52	0.76	1.52	0.00	0.00
R6/104	RECEPTION	W2/104	29.46	28.58	0.88	2.99	R6/104	RECEPTION	W2/104	0.76		0.76			
R6/104	RECEPTION	W3/104	29.31	28.51	0.80	2.73	R6/104	RECEPTION	W3/104	0.76	1.52	0.76	1.51	0.00	0.20
R11/104	KITCHEN	W16/104	36.09	34.35	1.74	4.82	R11/104	KITCHEN	W16/104	1.77	1.77	1.71	1.71	0.07	3.78
R12/104	KITCHEN	W17/104	36.16	34.84	1.32	3.65	R12/104	KITCHEN	W17/104	1.80	1.80	1.75	1.75	0.05	2.78
R19/104	KITCHEN	W24/104	35.35	34.61	0.74	2.09	R19/104	KITCHEN	W24/104	1.44	1.44	1.41	1.41	0.02	1.53
R23/104	KITCHEN	W32/104	32.61	32.17	0.44	1.35	R23/104	KITCHEN	W32/104	1.39	1.39	1.38	1.38	0.01	0.79
R27/104	BEDROOM	W35/104	30.11	29.24	0.87	2.89	R27/104	BEDROOM	W35/104	1.35	1.35	1.32	1.32	0.03	2.37
R28/104	KITCHEN	W36/104	32.52	31.43	1.09	3.35	R28/104	KITCHEN	W36/104	1.64	1.64	1.59	1.59	0.05	2.75

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
DAYLIGHT ANALYSIS
BALCONIES REMOVED

NOV 2018

Room	Room Use	Window	EXISTING VSC	PROPOSED VSC	LOSS VSC	%LOSS VSC	Room	Room Use	Window	EXISTING ADF	TOTAL	PROPOSED ADF	TOTAL	TOTAL LOSS	%LOSS ADF
R31/104	ASSUMED	W40/104	34.55	33.36	1.19	3.44	R31/104	ASSUMED	W40/104	1.66	1.66	1.61	1.61	0.05	2.95
R32/104	ASSUMED	W41/104	35.10	33.90	1.20	3.42	R32/104	ASSUMED	W41/104	1.66	1.66	1.61	1.61	0.05	3.00
R33/104	ASSUMED	W42/104	35.33	34.15	1.18	3.34	R33/104	ASSUMED	W42/104	1.67	1.67	1.62	1.62	0.05	2.94
R37/104	KITCHEN	W49/104	34.92	34.06	0.86	2.46	R37/104	KITCHEN	W49/104	1.82	1.82	1.78	1.78	0.04	2.20
R1/105	BEDROOM	W1/105	33.74	32.51	1.23	3.65	R1/105	BEDROOM	W1/105	0.86	0.86	0.86	0.86	0.00	0.00
R2/105	BEDROOM	W4/105	33.22	32.43	0.79	2.38	R2/105	BEDROOM	W4/105	0.78	0.78	0.78	0.78	0.00	0.00
R3/105	BEDROOM	W7/105	38.41	37.48	0.93	2.42	R3/105	BEDROOM	W7/105	0.96	0.96	0.95	0.95	0.02	1.87
R4/105	BEDROOM	W5/105	33.13	32.53	0.60	1.81	R4/105	BEDROOM	W5/105	0.67		0.67			
R4/105	BEDROOM	W6/105	30.16	30.10	0.06	0.20	R4/105	BEDROOM	W6/105	0.15	0.83	0.15	0.83	0.00	0.00
R5/105	BEDROOM	W10/105	38.29	37.72	0.57	1.49	R5/105	BEDROOM	W10/105	0.81		0.80			
R5/105	BEDROOM	W12/105	38.24	37.97	0.27	0.71	R5/105	BEDROOM	W12/105	0.81	1.62	0.80	1.60	0.01	0.87
R6/105	BEDROOM	W8/105	33.33	32.86	0.47	1.41	R6/105	BEDROOM	W8/105	0.61		0.61			
R6/105	BEDROOM	W9/105	31.46	31.33	0.13	0.41	R6/105	BEDROOM	W9/105	0.14	0.75	0.14	0.75	0.00	0.00
R7/105	BEDROOM	W15/105	37.97	37.80	0.17	0.45	R7/105	BEDROOM	W15/105	0.88	0.88	0.87	0.87	0.00	0.11
R8/105	BEDROOM	W16/105	37.58	37.47	0.11	0.29	R8/105	BEDROOM	W16/105	0.85	0.85	0.85	0.85	0.00	0.00
R9/105	BEDROOM	W13/105	33.99	33.63	0.36	1.06	R9/105	BEDROOM	W13/105	0.61	0.61	0.61	0.61	0.00	0.00
R10/105	BEDROOM	W18/105	36.71	36.63	0.08	0.22	R10/105	BEDROOM	W18/105	0.79	0.79	0.79	0.79	0.00	0.00
R11/105	BEDROOM	W19/105	33.05	33.01	0.04	0.12	R11/105	BEDROOM	W19/105	0.73	0.73	0.73	0.73	0.00	0.00

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
DAYLIGHT ANALYSIS
BALCONIES REMOVED

NOV 2018

Room	Room Use	Window	EXISTING VSC	PROPOSED VSC	LOSS VSC	%LOSS VSC	Room	Room Use	Window	EXISTING ADF	TOTAL	PROPOSED ADF	TOTAL	TOTAL LOSS	%LOSS ADF
R12/105	BEDROOM	W21/105	35.24	34.73	0.51	1.45	R12/105	BEDROOM	W21/105	1.12	1.12	1.11	1.11	0.02	1.43
R13/105	BEDROOM	W22/105	36.78	36.18	0.60	1.63	R13/105	BEDROOM	W22/105	0.89	0.89	0.87	0.87	0.02	1.69
R14/105	BEDROOM	W24/105	37.65	37.04	0.61	1.62	R14/105	BEDROOM	W24/105	1.24	1.24	1.22	1.22	0.02	1.69
R15/105	BEDROOM	W25/105	37.82	37.22	0.60	1.59	R15/105	BEDROOM	W25/105	1.13	1.13	1.11	1.11	0.02	1.60
R21/105	BEDROOM	W20/105	33.60	33.16	0.44	1.31	R21/105	BEDROOM	W20/105	1.06	1.06	1.05	1.05	0.01	1.22
R22/105	BEDROOM	W23/105	37.43	36.80	0.63	1.68	R22/105	BEDROOM	W23/105	1.24	1.24	1.22	1.22	0.02	1.69

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
DAYLIGHT DISTRIBUTION ANALYSIS
BALCONIES REMOVED

Room/ Floor	Room Use	Whole Room	Prev sq ft	New sq ft	Loss sq ft	%Loss
9-15 Camden Road, Barnes House						
R1/102	RECEPTION	155.8	79.9	79.6	0.2	0.3
R2/102	BEDROOM	109.5	49.9	49.9	0.0	0.0
R3/102	RECEPTION	157.9	89.9	89.9	0.0	0.0
R5/102	BEDROOM	80.8	38.2	38.2	0.0	0.0
R6/102	KITCHEN	65.1	62.9	62.9	0.0	0.0
R8/102	BEDROOM	114.3	48.9	48.9	0.0	0.0
R9/102	KITCHEN	71.3	67.9	67.8	0.0	0.0
R10/102	RECEPTION	157.9	107.2	107.2	0.0	0.0
R15/102	BEDROOM	78.3	75.9	75.9	0.0	0.0
R16/102	KITCHEN	72.4	69.6	69.6	0.0	0.0
R19/102	BEDROOM	104.7	87.8	87.8	0.0	0.0
R23/102	KITCHEN	71.5	67.5	67.5	0.0	0.0
R24/102	BEDROOM	82.5	76.6	76.6	0.0	0.0
R28/102	KITCHEN	66.9	64.0	64.0	0.0	0.0
R29/102	BEDROOM	141.5	129.5	128.2	1.3	1.0
R32/102	KITCHEN	74.4	70.3	70.3	0.0	0.0
R33/102	BEDROOM	101.6	97.8	78.1	19.7	20.1
R1/103	RECEPTION	155.8	104.1	104.1	0.0	0.0
R2/103	BEDROOM	109.5	74.9	74.9	0.0	0.0
R3/103	RECEPTION	157.9	114.3	114.3	0.0	0.0
R5/103	BEDROOM	80.8	57.0	57.0	0.0	0.0
R6/103	KITCHEN	65.1	63.4	63.4	0.0	0.0
R8/103	BEDROOM	114.3	72.4	72.4	0.0	0.0
R9/103	KITCHEN	71.3	68.6	68.6	0.0	0.0
R10/103	RECEPTION	157.9	127.9	127.9	0.0	0.0
R15/103	BEDROOM	78.3	75.9	75.9	0.0	0.0
R16/103	KITCHEN	72.4	69.5	69.5	0.0	0.0
R19/103	BEDROOM	104.8	95.4	95.4	0.0	0.0
R23/103	KITCHEN	71.5	68.4	68.4	0.0	0.0
R24/103	BEDROOM	82.5	78.0	78.0	0.0	0.0
R28/103	KITCHEN	66.9	64.7	64.7	0.0	0.0
R29/103	BEDROOM	141.5	131.6	131.6	0.0	0.0
R32/103	KITCHEN	74.4	70.6	70.6	0.0	0.0
R33/103	BEDROOM	101.6	97.8	94.4	3.4	3.5
R1/104	RECEPTION	192.9	175.9	174.9	1.0	0.6
R2/104	RECEPTION	179.6	161.9	161.9	0.0	0.0
R3/104	KITCHEN	83.0	81.5	81.5	0.0	0.0
R4/104	RECEPTION	179.7	166.2	166.2	0.0	0.0
R6/104	RECEPTION	180.7	163.7	163.7	0.0	0.0
R11/104	KITCHEN	68.4	65.8	65.8	0.0	0.0
R12/104	KITCHEN	69.0	67.3	67.3	0.0	0.0
R19/104	KITCHEN	93.3	89.1	89.1	0.0	0.0
R23/104	KITCHEN	92.0	86.4	86.4	0.0	0.0
R27/104	BEDROOM	85.2	81.1	81.1	0.0	0.0

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
DAYLIGHT DISTRIBUTION ANALYSIS
BALCONIES REMOVED

Room/ Floor	Room Use	Whole Room	Prev sq ft	New sq ft	Loss sq ft	%Loss
R28/104	KITCHEN	72.0	70.1	70.1	0.0	0.0
R31/104	ASSUMED	70.5	69.4	69.4	0.0	0.0
R32/104	ASSUMED	70.9	69.9	69.9	0.0	0.0
R33/104	ASSUMED	79.2	77.6	77.6	0.0	0.0
R37/104	KITCHEN	64.6	62.9	62.9	0.0	0.0
R1/105	BEDROOM	92.0	86.9	86.9	0.0	0.0
R2/105	BEDROOM	96.0	87.9	87.9	0.0	0.0
R3/105	BEDROOM	101.1	92.6	92.6	0.0	0.0
R4/105	BEDROOM	114.3	100.9	100.9	0.0	0.0
R5/105	BEDROOM	126.3	123.0	123.0	0.0	0.0
R6/105	BEDROOM	132.6	113.4	113.4	0.0	0.0
R7/105	BEDROOM	111.9	98.3	98.3	0.0	0.0
R8/105	BEDROOM	117.4	103.0	103.0	0.0	0.0
R9/105	BEDROOM	99.5	80.6	80.6	0.0	0.0
R10/105	BEDROOM	122.3	104.7	104.7	0.0	0.0
R11/105	BEDROOM	122.7	102.5	102.5	0.0	0.0
R12/105	BEDROOM	84.4	78.0	78.0	0.0	0.0
R13/105	BEDROOM	115.0	104.7	104.7	0.0	0.0
R14/105	BEDROOM	70.4	67.7	67.7	0.0	0.0
R15/105	BEDROOM	82.8	77.6	77.6	0.0	0.0
R21/105	BEDROOM	84.6	80.3	80.3	0.0	0.0
R22/105	BEDROOM	73.2	69.1	69.1	0.0	0.0

			Window						Room					
			Existing		Proposed				Existing		Proposed			
Room	Window	Room Use	Winter APSH	Annual APSH	Winter APSH	Annual APSH	Winter %Loss	Annual %Loss	Winter APSH	Annual APSH	Winter APSH	Annual APSH	Winter %Loss	Annual %Loss
9-15 Camden Road, Barnes House														
R6/102	W10/102	KITCHEN	17	51	14	45	17.6	11.8	17	51	14	45	17.6	11.8
R9/102	W13/102	KITCHEN	15	52	13	46	13.3	11.5	15	52	13	46	13.3	11.5
R15/102	W18/102	BEDROOM	10	50	9	45	10.0	10.0	10	50	9	45	10.0	10.0
R16/102	W19/102	KITCHEN	9	49	9	45	0.0	8.2	9	49	9	45	0.0	8.2
R19/102	W26/102	BEDROOM	5	37	5	35	0.0	5.4	5	37	5	35	0.0	5.4
R33/102	W39/102	BEDROOM	17	46	13	37	23.5	19.6	17	46	13	37	23.5	19.6
R6/103	W10/103	KITCHEN	19	57	17	50	10.5	12.3	19	57	17	50	10.5	12.3
R9/103	W13/103	KITCHEN	19	57	17	54	10.5	5.3	19	57	17	54	10.5	5.3
R15/103	W18/103	BEDROOM	15	57	13	53	13.3	7.0	15	57	13	53	13.3	7.0
R16/103	W19/103	KITCHEN	13	55	12	52	7.7	5.5	13	55	12	52	7.7	5.5
R19/103	W26/103	BEDROOM	6	42	6	41	0.0	2.4	6	42	6	41	0.0	2.4

Room	Window	Room Use	Window						Room					
			Existing		Proposed		Winter %Loss	Annual %Loss	Existing		Proposed		Winter %Loss	Annual %Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R33/103	W39/103	BEDROOM	19	50	16	41	15.8	18.0	19	50	16	41	15.8	18.0
R3/104	W7/104	KITCHEN	22	60	21	57	4.5	5.0	22	60	21	57	4.5	5.0
R11/104	W16/104	KITCHEN	23	66	22	62	4.3	6.1	23	66	22	62	4.3	6.1
R12/104	W17/104	KITCHEN	24	68	23	62	4.2	8.8	24	68	23	62	4.2	8.8
R19/104	W24/104	KITCHEN	19	63	19	62	0.0	1.6	19	63	19	62	0.0	1.6
R23/104	W32/104	KITCHEN	11	52	11	51	0.0	1.9	11	52	11	51	0.0	1.9
R3/105	W7/105	BEDROOM	25	69	24	68	4.0	1.4	25	69	24	68	4.0	1.4
R5/105	W10/105	BEDROOM	25	69	25	69	0.0	0.0	25	69	25	69	0.0	0.0
R5/105	W12/105	BEDROOM	25	69	25	69	0.0	0.0						
R7/105	W15/105	BEDROOM	25	69	25	69	0.0	0.0	25	69	25	69	0.0	0.0
R8/105	W16/105	BEDROOM	24	68	24	68	0.0	0.0	24	68	24	68	0.0	0.0
R10/105	W18/105	BEDROOM	21	65	21	65	0.0	0.0	21	65	21	65	0.0	0.0
R11/105	W19/105	BEDROOM	12	55	12	55	0.0	0.0	12	55	12	55	0.0	0.0

			Window						Room					
			Existing		Proposed				Existing		Proposed			
Room	Window	Room Use	Winter APSH	Annual APSH	Winter APSH	Annual APSH	Winter %Loss	Annual %Loss	Winter APSH	Annual APSH	Winter APSH	Annual APSH	Winter %Loss	Annual %Loss

Cumulative Mango Consent Balconies Removed 29 Kentish Town Road



Room	Room Use	Window	EXISTING VSC	PROPOSED VSC	LOSS VSC	%LOSS VSC	Room	Room Use	Window	EXISTING ADF	TOTAL	PROPOSED ADF	TOTAL	TOTAL LOSS	%LOSS ADF
Daysun House, Hawley Crescent And 29 Kentish Town Road							Daysun House, Hawley Crescent And 29 Kentish Town Road								
R1/731	STUDIO	W1/731	28.30	18.87	9.43	33.32	R1/731	STUDIO	W1/731	3.33	3.33	2.48	2.48	0.84	25.38
R2/731	STUDIO	W2/731	28.87	19.47	9.40	32.56	R2/731	STUDIO	W2/731	2.25	2.25	1.69	1.69	0.56	25.03
R1/732	STUDIO	W1/732	32.60	21.71	10.89	33.40	R1/732	STUDIO	W1/732	4.63	4.63	3.40	3.40	1.23	26.55
R2/732	STUDIO	W2/732	33.25	22.36	10.89	32.75	R2/732	STUDIO	W2/732	2.52	2.52	1.86	1.86	0.66	26.13
R1/733	STUDIO	W1/733	36.60	24.90	11.70	31.97	R1/733	STUDIO	W1/733	4.07	4.07	3.00	3.00	1.07	26.35
R2/733	STUDIO	W2/733	32.27	22.32	9.95	30.83	R2/733	STUDIO	W2/733	2.59	2.59	1.95	1.95	0.64	24.71
R1/734	STUDIO	W1/734	35.05	27.29	7.76	22.14	R1/734	STUDIO	W1/734	1.62		1.32			
R1/734	STUDIO	W2/734	37.88	29.44	8.44	22.28	R1/734	STUDIO	W2/734	1.73		1.40			
R1/734	STUDIO	W3/734	38.51	29.97	8.54	22.18	R1/734	STUDIO	W3/734	1.75	5.10	1.41	4.13	0.97	19.10

			Window						Room					
			Existing		Proposed				Existing		Proposed			
Room	Window	Room Use	Winter APSH	Annual APSH	Winter APSH	Annual APSH	Winter %Loss	Annual %Loss	Winter APSH	Annual APSH	Winter APSH	Annual APSH	Winter %Loss	Annual %Loss
Daysun House, Hawley Crescent And 29 Kentish Town Road														
R1/731	W1/731	STUDIO	8	34	3	19	62.5	44.1	8	34	3	19	62.5	44.1
R2/731	W2/731	STUDIO	11	39	6	25	45.5	35.9	11	39	6	25	45.5	35.9
R1/732	W1/732	STUDIO	9	40	3	23	66.7	42.5	9	40	3	23	66.7	42.5
R2/732	W2/732	STUDIO	12	46	6	28	50.0	39.1	12	46	6	28	50.0	39.1
R1/733	W1/733	STUDIO	11	45	6	31	45.5	31.1	11	45	6	31	45.5	31.1
R2/733	W2/733	STUDIO	5	35	1	23	80.0	34.3	5	35	1	23	80.0	34.3
R1/734	W1/734	STUDIO	4	40	1	32	75.0	20.0						
R1/734	W2/734	STUDIO	10	47	7	37	30.0	21.3						
R1/734	W3/734	STUDIO	14	51	11	42	21.4	17.6	14	51	11	43	21.4	15.7

Cumulative Mango Consent Balconies Removed 31 Kentish
Town Road



Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
DAYLIGHT ANALYSIS
BALCONIES REMOVED

NOV 2018

Room	Room Use	Window	EXISTING VSC	PROPOSED VSC	LOSS VSC	%LOSS VSC	Room	Room Use	Window	EXISTING ADF	TOTAL	PROPOSED ADF	TOTAL	TOTAL LOSS	%LOSS ADF
31 Kentish Town Road							31 Kentish Town Road								
R1/31	LKD	W1/31	13.58	8.45	5.13	37.78	R1/31	LKD	W1/31	0.24		0.19			
R1/31	LKD	W2/31	10.38	10.38	0.00	0.00	R1/31	LKD	W2/31	0.12		0.12			
R1/31	LKD	W3/31	27.38	18.34	9.04	33.02	R1/31	LKD	W3/31	1.25		0.95			
R1/31	LKD	W28/31	11.94	8.69	3.25	27.22	R1/31	LKD	W28/31	0.85	2.46	0.72	1.98	0.48	19.54
R2/31	BEDROOM	W4/31	19.51	11.87	7.64	39.16	R2/31	BEDROOM	W4/31	0.75		0.56			
R2/31	BEDROOM	W5/31	16.51	10.14	6.37	38.58	R2/31	BEDROOM	W5/31	0.83	1.58	0.63	1.18	0.39	24.98
R3/31	LKD	W6/31	18.68	14.59	4.09	21.90	R3/31	LKD	W6/31	1.36		1.18			
R3/31	LKD	W7/31	28.40	19.72	8.68	30.56	R3/31	LKD	W7/31	3.55	4.91	2.78	3.95	0.96	19.53
R4/31	BEDROOM	W8/31	15.09	9.39	5.70	37.77	R4/31	BEDROOM	W8/31	0.79		0.60			
R4/31	BEDROOM	W9/31	14.57	8.69	5.88	40.36	R4/31	BEDROOM	W9/31	0.96	1.74	0.71	1.32	0.42	24.30
R5/31	LKD	W10/31	17.38	12.77	4.61	26.52	R5/31	LKD	W10/31	1.54		1.29			
R5/31	LKD	W11/31	30.02	22.51	7.51	25.02	R5/31	LKD	W11/31	3.99	5.53	3.25	4.53	1.00	18.06
R6/31	LKD	W12/31	8.54	5.20	3.34	39.11	R6/31	LKD	W12/31	0.14		0.11			
R6/31	LKD	W13/31	12.09	7.91	4.18	34.57	R6/31	LKD	W13/31	0.27		0.21			
R6/31	LKD	W14/31	30.31	23.85	6.46	21.31	R6/31	LKD	W14/31	1.63	2.04	1.37	1.69	0.35	17.17
R1/32	LKD	W1/32	16.72	10.80	5.92	35.41	R1/32	LKD	W1/32	0.28		0.22			
R1/32	LKD	W2/32	10.01	10.01	0.00	0.00	R1/32	LKD	W2/32	0.16		0.16			
R1/32	LKD	W3/32	31.78	21.30	10.48	32.98	R1/32	LKD	W3/32	1.39		1.05			
R1/32	LKD	W28/32	15.86	12.24	3.62	22.82	R1/32	LKD	W28/32	1.01	2.83	0.87	2.29	0.54	19.15
R2/32	BEDROOM	W4/32	23.26	14.38	8.88	38.18	R2/32	BEDROOM	W4/32	0.84		0.62			
R2/32	BEDROOM	W5/32	19.50	12.06	7.44	38.15	R2/32	BEDROOM	W5/32	0.92	1.76	0.69	1.31	0.44	25.30
R3/32	LKD	W6/32	21.22	16.59	4.63	21.82	R3/32	LKD	W6/32	1.48		1.27			

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
DAYLIGHT ANALYSIS
BALCONIES REMOVED

NOV 2018

Room	Room Use	Window	EXISTING VSC	PROPOSED VSC	LOSS VSC	%LOSS VSC	Room	Room Use	Window	EXISTING ADF	TOTAL	PROPOSED ADF	TOTAL	TOTAL LOSS	%LOSS ADF
R3/32	LKD	W7/32	32.84	22.63	10.21	31.09	R3/32	LKD	W7/32	3.97	5.45	3.03	4.30	1.15	21.09
R4/32	BEDROOM	W8/32	18.12	11.55	6.57	36.26	R4/32	BEDROOM	W8/32	0.88		0.68			
R4/32	BEDROOM	W9/32	17.49	10.63	6.86	39.22	R4/32	BEDROOM	W9/32	1.06	1.94	0.80	1.48	0.47	23.97
R5/32	LKD	W10/32	19.86	14.62	5.24	26.38	R5/32	LKD	W10/32	1.68		1.40			
R5/32	LKD	W11/32	34.03	25.23	8.80	25.86	R5/32	LKD	W11/32	4.42	6.10	3.51	4.91	1.19	19.53
R6/32	LKD	W12/32	10.00	6.27	3.73	37.30	R6/32	LKD	W12/32	0.15		0.12			
R6/32	LKD	W13/32	13.90	9.10	4.80	34.53	R6/32	LKD	W13/32	0.29		0.23			
R6/32	LKD	W14/32	33.45	26.06	7.39	22.09	R6/32	LKD	W14/32	1.76	2.20	1.45	1.80	0.40	18.36
R1/33	LKD	W1/33	20.92	14.12	6.80	32.50	R1/33	LKD	W1/33	0.32		0.25			
R1/33	LKD	W2/33	21.85	17.97	3.88	17.76	R1/33	LKD	W2/33	1.20		1.06			
R1/33	LKD	W3/33	36.50	25.21	11.29	30.93	R1/33	LKD	W3/33	1.59	3.10	1.18	2.50	0.61	19.52
R2/33	BEDROOM	W4/33	28.92	19.29	9.63	33.30	R2/33	BEDROOM	W4/33	1.03		0.80			
R2/33	BEDROOM	W5/33	23.45	15.37	8.08	34.46	R2/33	BEDROOM	W5/33	1.09	2.12	0.84	1.64	0.48	22.73
R3/33	BEDROOM	W6/33	37.18	25.89	11.29	30.37	R3/33	BEDROOM	W6/33	7.31		5.46			
R3/33	BEDROOM	W12/33	26.12	21.25	4.87	18.64	R3/33	BEDROOM	W12/33	5.39	12.70	4.71	10.17	2.53	19.95
R4/33	BEDROOM	W15/33	36.84	26.14	10.70	29.04	R4/33	BEDROOM	W15/33	6.77	6.77	5.12	5.12	1.64	24.29
R5/33	BEDROOM	W7/33	23.69	16.73	6.96	29.38	R5/33	BEDROOM	W7/33	1.08		0.88			
R5/33	BEDROOM	W8/33	22.15	14.70	7.45	33.63	R5/33	BEDROOM	W8/33	1.27	2.34	1.00	1.87	0.47	20.02
R6/33	LKD	W9/33	37.59	28.19	9.40	25.01	R6/33	LKD	W9/33	4.87		3.82			
R6/33	LKD	W13/33	24.32	18.78	5.54	22.78	R6/33	LKD	W13/33	1.95	6.81	1.65	5.47	1.34	19.68
R7/33	LKD	W10/33	11.56	7.88	3.68	31.83	R7/33	LKD	W10/33	0.17		0.14			
R7/33	LKD	W11/33	37.58	29.93	7.65	20.36	R7/33	LKD	W11/33	1.98		1.63			

Grand Union House, Camden
Existing vs Proposed 151118
With Mango Consent

Grandunion House
DAYLIGHT ANALYSIS
BALCONIES REMOVED

NOV 2018

Room	Room Use	Window	EXISTING VSC	PROPOSED VSC	LOSS VSC	%LOSS VSC	Room	Room Use	Window	EXISTING ADF	TOTAL	PROPOSED ADF	TOTAL	TOTAL LOSS	%LOSS ADF
R7/33	LKD	W14/33	15.97	10.83	5.14	32.19	R7/33	LKD	W14/33	0.32	2.47	0.26	2.02	0.44	18.01
R1/34	LKD	W1/34	8.15	8.06	0.09	1.10	R1/34	LKD	W1/34	0.92		0.91			
R1/34	LKD	W2/34	8.85	8.62	0.23	2.60	R1/34	LKD	W2/34	1.12		1.10			
R1/34	LKD	W3/34	12.39	10.91	1.48	11.95	R1/34	LKD	W3/34	1.78		1.67			
R1/34	LKD	W4/34	33.69	24.92	8.77	26.03	R1/34	LKD	W4/34	2.70		2.14			
R1/34	LKD	W5/34	28.05	28.05	0.00	0.00	R1/34	LKD	W5/34	1.49	8.01	1.49	7.32	0.69	8.67
R2/34	LD	W6/34	22.40	18.63	3.77	16.83	R2/34	LD	W6/34	1.34		1.19			
R2/34	LD	W7/34	37.52	29.05	8.47	22.57	R2/34	LD	W7/34	4.31	5.65	3.48	4.67	0.98	17.26
R3/34	LKD	W8/34	22.12	17.69	4.43	20.03	R3/34	LKD	W8/34	0.70		0.62			
R3/34	LKD	W9/34	37.97	31.18	6.79	17.88	R3/34	LKD	W9/34	4.16		3.52			
R3/34	LKD	W10/34	38.11	32.09	6.02	15.80	R3/34	LKD	W10/34	1.68		1.45			
R3/34	LKD	W11/34	38.20	32.89	5.31	13.90	R3/34	LKD	W11/34	2.35	8.90	2.05	7.64	1.26	14.19

Room/ Floor	Room Use	Whole Room	Prev sq ft	New sq ft	Loss sq ft	%Loss
31 Kentish Town Road						
R1/31	LKD	407.4	262.7	163.5	99.1	37.7
R2/31	BEDROOM	169.4	155.2	71.6	83.6	53.9
R3/31	LKD	258.2	174.3	121.2	53.1	30.5
R4/31	BEDROOM	133.4	128.4	67.2	61.1	47.6
R5/31	LKD	258.7	221.9	165.3	56.6	25.5
R6/31	LKD	368.6	234.3	149.5	84.8	36.2
R1/32	LKD	407.4	395.5	195.2	200.4	50.7
R2/32	BEDROOM	169.4	167.1	87.9	79.3	47.5
R3/32	LKD	258.2	258.2	131.5	126.8	49.1
R4/32	BEDROOM	133.4	128.6	84.7	43.9	34.1
R5/32	LKD	258.7	258.7	171.6	87.0	33.6
R6/32	LKD	368.6	303.4	162.3	141.1	46.5
R1/33	LKD	407.4	406.1	181.8	224.3	55.2
R2/33	BEDROOM	155.6	146.8	93.5	53.3	36.3
R3/33	BEDROOM	58.6	58.6	58.6	0.0	0.0
R4/33	BEDROOM	50.7	50.7	50.7	0.0	0.0
R5/33	BEDROOM	133.4	132.3	114.0	18.3	13.8
R6/33	LKD	258.7	258.7	198.3	60.4	23.3
R7/33	LKD	368.6	368.0	191.3	176.7	48.0
R1/34	LKD	381.8	381.8	381.8	0.0	0.0
R2/34	LD	382.6	380.7	375.5	5.2	1.4
R3/34	LKD	399.9	398.6	398.6	0.0	0.0

			Window						Room					
			Existing		Proposed				Existing		Proposed			
Room	Window	Room Use	Winter APSH	Annual APSH	Winter APSH	Annual APSH	Winter %Loss	Annual %Loss	Winter APSH	Annual APSH	Winter APSH	Annual APSH	Winter %Loss	Annual %Loss
31 Kentish Town Road														
R1/31	W1/31	LKD	2	21	0	10	100.0	52.4						
R1/31	W2/31	LKD	0	2	0	2	-	0.0						
R1/31	W3/31	LKD	12	40	7	26	41.7	35.0						
R1/31	W28/31	LKD	7	32	2	19	71.4	40.6	12	42	7	28	41.7	33.3
R3/31	W6/31	LKD	12	42	7	28	41.7	33.3						
R3/31	W7/31	LKD	11	39	6	24	45.5	38.5	12	42	7	28	41.7	33.3
R5/31	W10/31	LKD	11	39	6	24	45.5	38.5						
R5/31	W11/31	LKD	9	37	4	22	55.6	40.5	11	40	6	25	45.5	37.5
R6/31	W12/31	LKD	0	4	0	0	-	100.0						
R6/31	W13/31	LKD	6	30	2	16	66.7	46.7						
R6/31	W14/31	LKD	8	37	3	20	62.5	45.9	8	37	3	20	62.5	45.9
R1/32	W1/32	LKD	3	28	0	18	100.0	35.7						
R1/32	W2/32	LKD	0	3	0	3	-	0.0						
R1/32	W3/32	LKD	13	46	7	29	46.2	37.0						
R1/32	W28/32	LKD	8	41	2	29	75.0	29.3	13	52	7	37	46.2	28.8
R3/32	W6/32	LKD	13	47	7	31	46.2	34.0						
R3/32	W7/32	LKD	12	45	6	27	50.0	40.0	13	50	7	32	46.2	36.0

Room	Window	Room Use	Window						Room					
			Existing		Proposed		%Loss	%Loss	Existing		Proposed		%Loss	%Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R5/32	W10/32	LKD	12	43	6	28	50.0	34.9						
R5/32	W11/32	LKD	10	43	4	23	60.0	46.5	12	46	6	29	50.0	37.0
R6/32	W12/32	LKD	0	7	0	0	-	100.0						
R6/32	W13/32	LKD	7	34	2	20	71.4	41.2						
R6/32	W14/32	LKD	9	41	3	24	66.7	41.5	9	41	3	25	66.7	39.0
R1/33	W1/33	LKD	8	33	4	25	50.0	24.2						
R1/33	W2/33	LKD	15	52	10	44	33.3	15.4						
R1/33	W3/33	LKD	15	50	10	35	33.3	30.0	16	58	12	46	25.0	20.7
R3/33	W6/33	BEDROOM	14	49	7	32	50.0	34.7						
R3/33	W12/33	BEDROOM	17	55	11	46	35.3	16.4	17	60	11	46	35.3	23.3
R6/33	W9/33	LKD	12	46	5	31	58.3	32.6						
R6/33	W13/33	LKD	14	53	8	40	42.9	24.5	14	56	8	43	42.9	23.2
R7/33	W10/33	LKD	0	8	0	1	-	87.5						
R7/33	W11/33	LKD	11	44	6	31	45.5	29.5						
R7/33	W14/33	LKD	9	37	4	26	55.6	29.7	11	44	6	31	45.5	29.5
R1/34	W1/34	LKD	0	30	0	29	-	3.3						
R1/34	W2/34	LKD	0	30	0	29	-	3.3						


Room	Window	Room Use	Window						Room					
			Existing		Proposed		%Loss	%Loss	Existing		Proposed		%Loss	%Loss
			Winter APSH	Annual APSH	Winter APSH	Annual APSH			Winter APSH	Annual APSH	Winter APSH	Annual APSH		
R1/34	W3/34	LKD	5	42	2	37	60.0	11.9						
R1/34	W4/34	LKD	15	44	12	35	20.0	20.5						
R1/34	W5/34	LKD	2	31	2	31	0.0	0.0	17	81	14	72	17.6	11.1
R2/34	W6/34	LD	16	50	13	45	18.8	10.0						
R2/34	W7/34	LD	13	44	10	34	23.1	22.7	16	57	13	47	18.8	17.5
R3/34	W8/34	LKD	14	40	11	35	21.4	12.5						
R3/34	W9/34	LKD	12	42	9	36	25.0	14.3						
R3/34	W10/34	LKD	11	41	8	36	27.3	12.2						
R3/34	W11/34	LKD	10	40	7	33	30.0	17.5	14	49	11	44	21.4	10.2

Appendix C – Window Maps







32-52 Camden Street

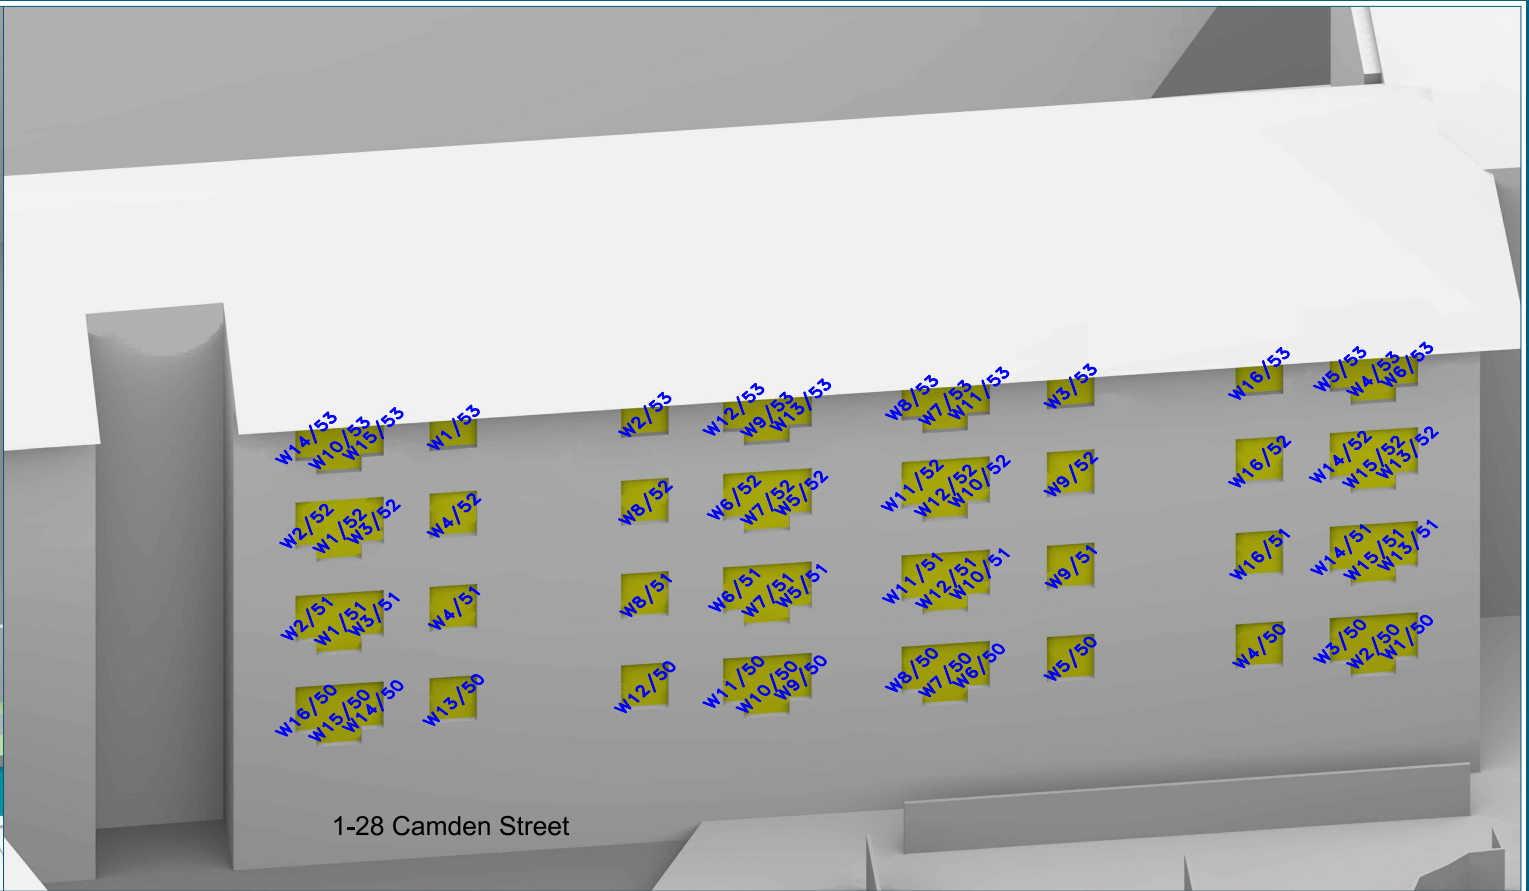

1-28 Camden Street

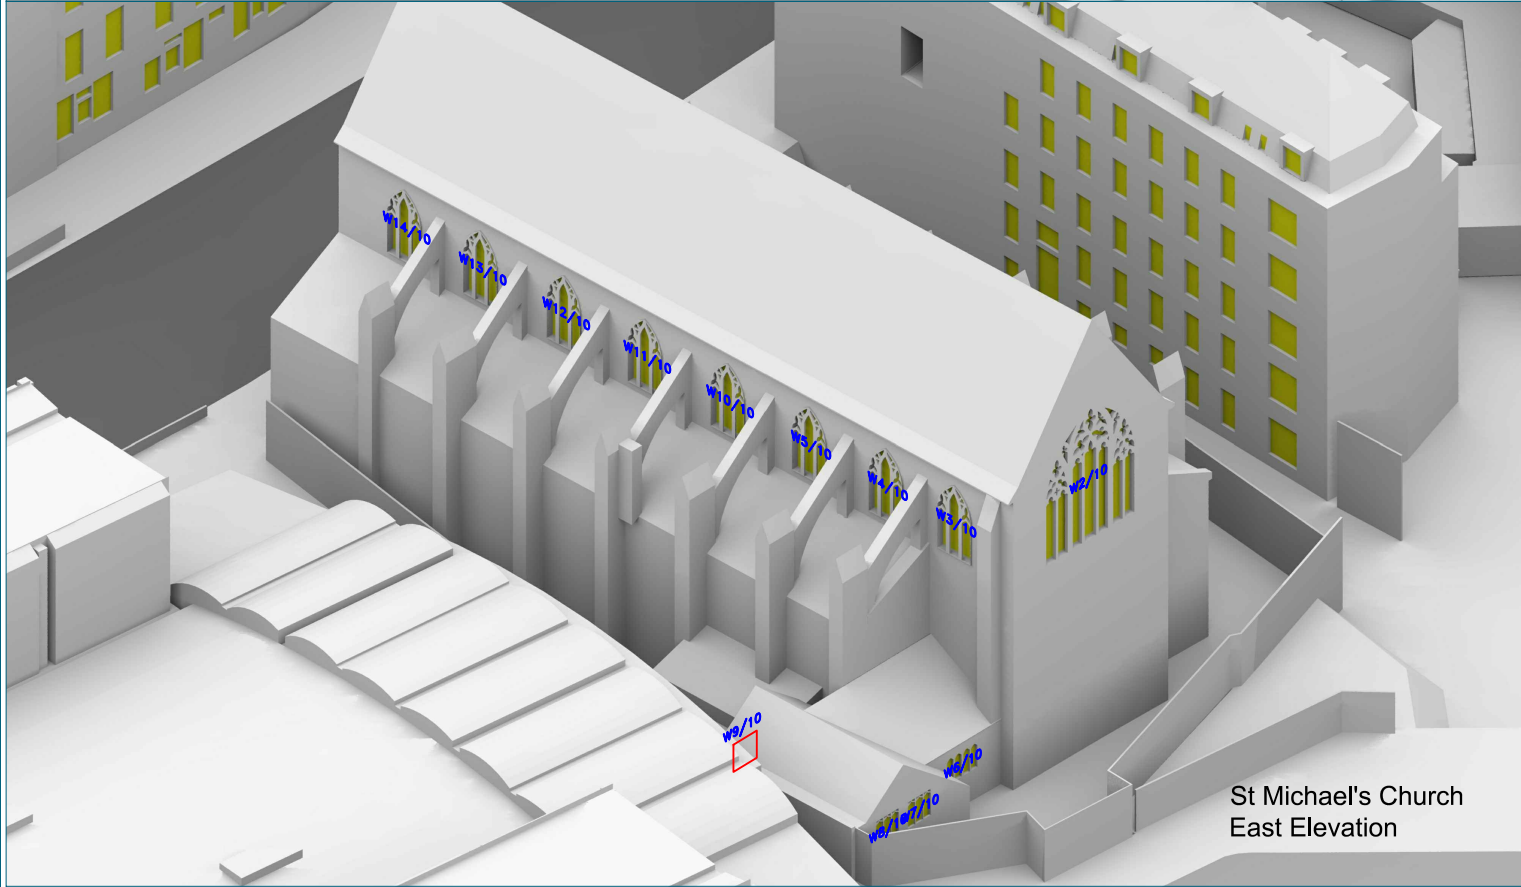

St Michael's Church
East Elevation

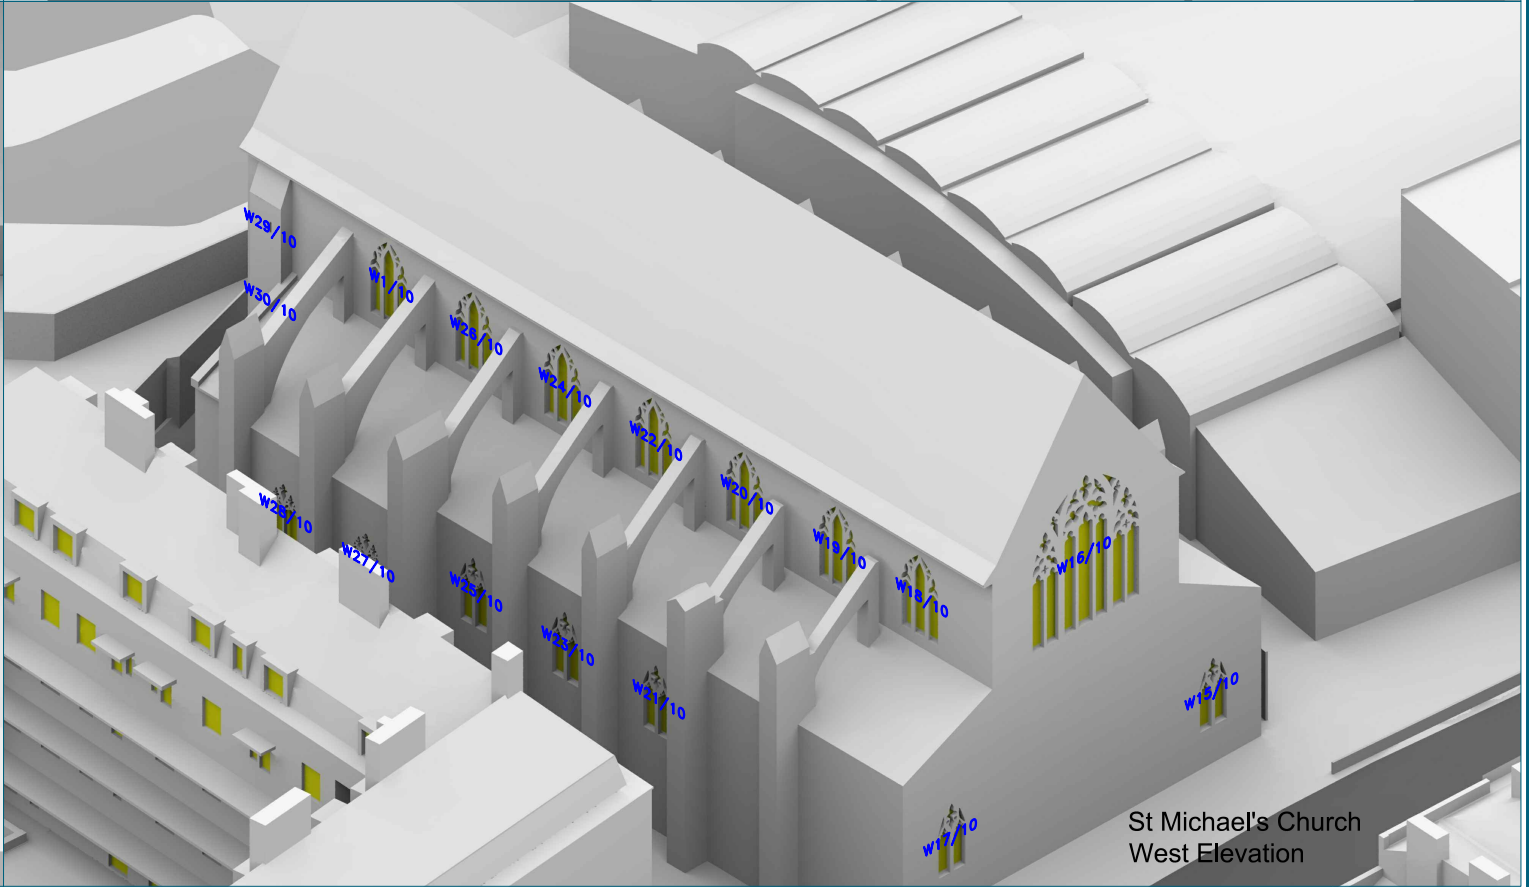

St Michael's Church
West Elevation

Sources: Point 2 Surveyors
Point cloud
Site Photos

ANDREW PHILLIPS
Proposed Info (received 151118)
181112_120_3D_DIA_GUH Model_AP.dwg

Key:

Scheme Confirmed: Date :

Project: Grand Union House,
Camden

Drawn By: JB/JH/SA/CJ Scale: NTS @ A3





Title: Window Locations
Surrounding Buildings

Date: NOV 18

Dwg No: **P1555/WM/01** Rel: 09

Point 2 Surveyors Ltd,
3rd Floor,
17 Slingsby Place,
London WC2E 9AB
0207 836 5828
www.point2surveyors.com

POINT
surveyors

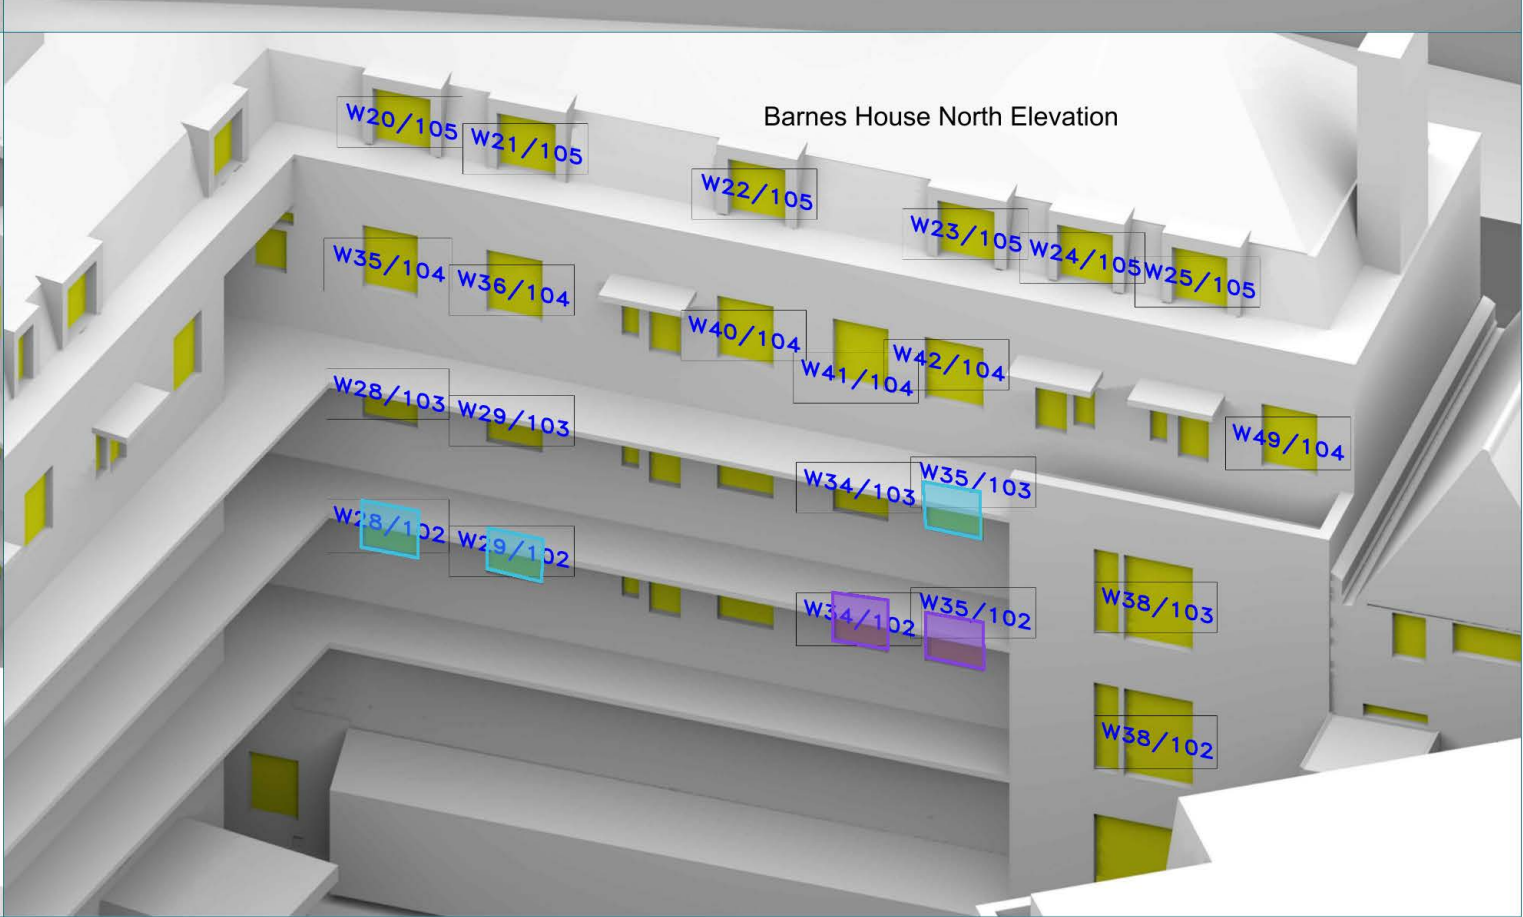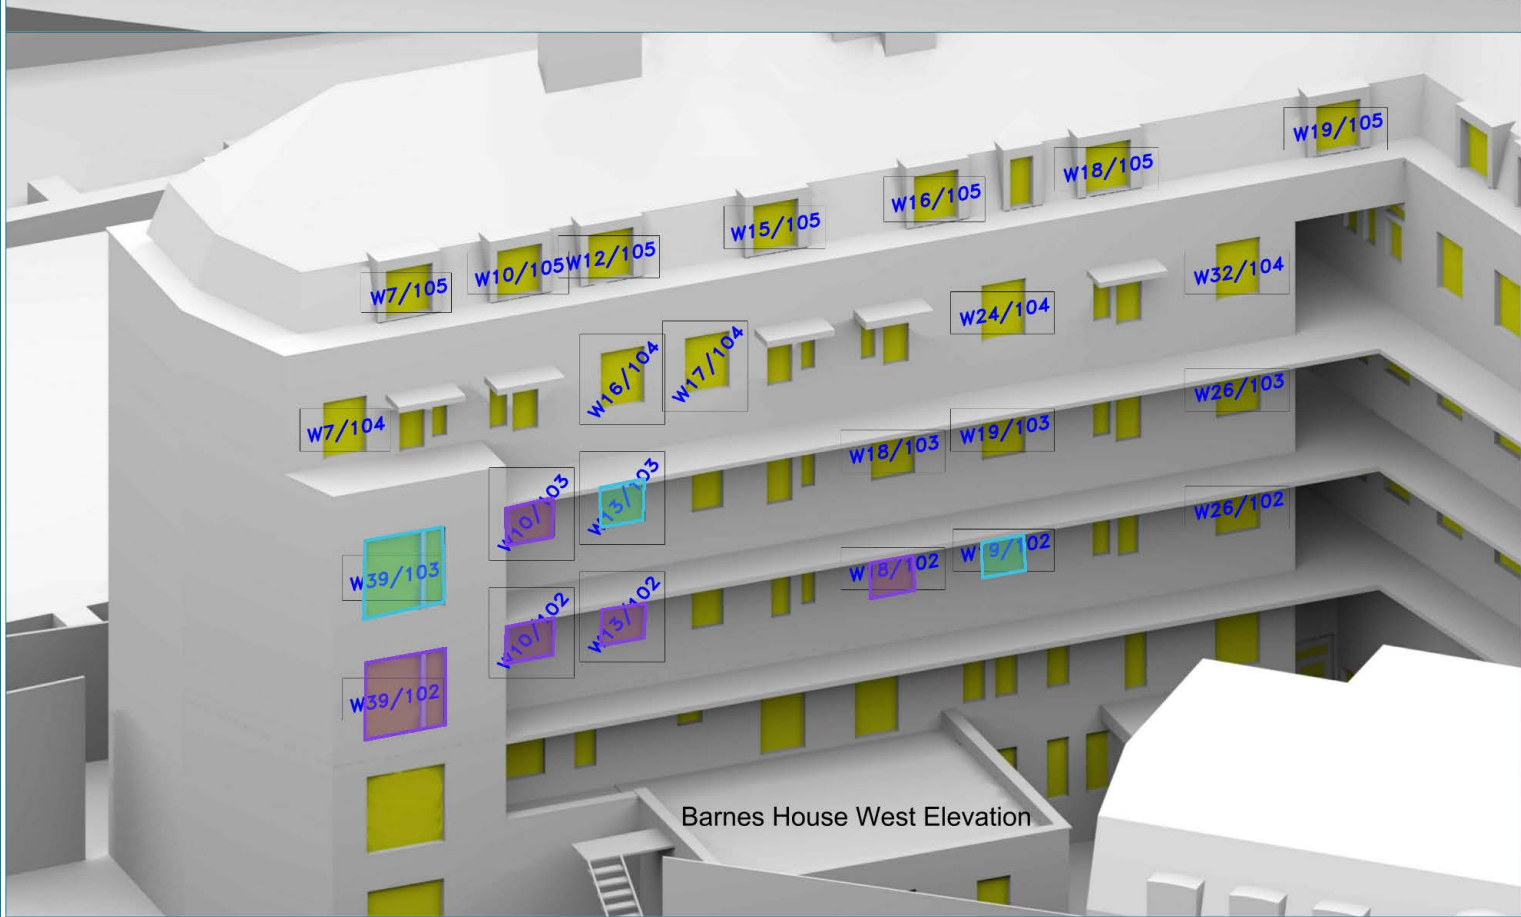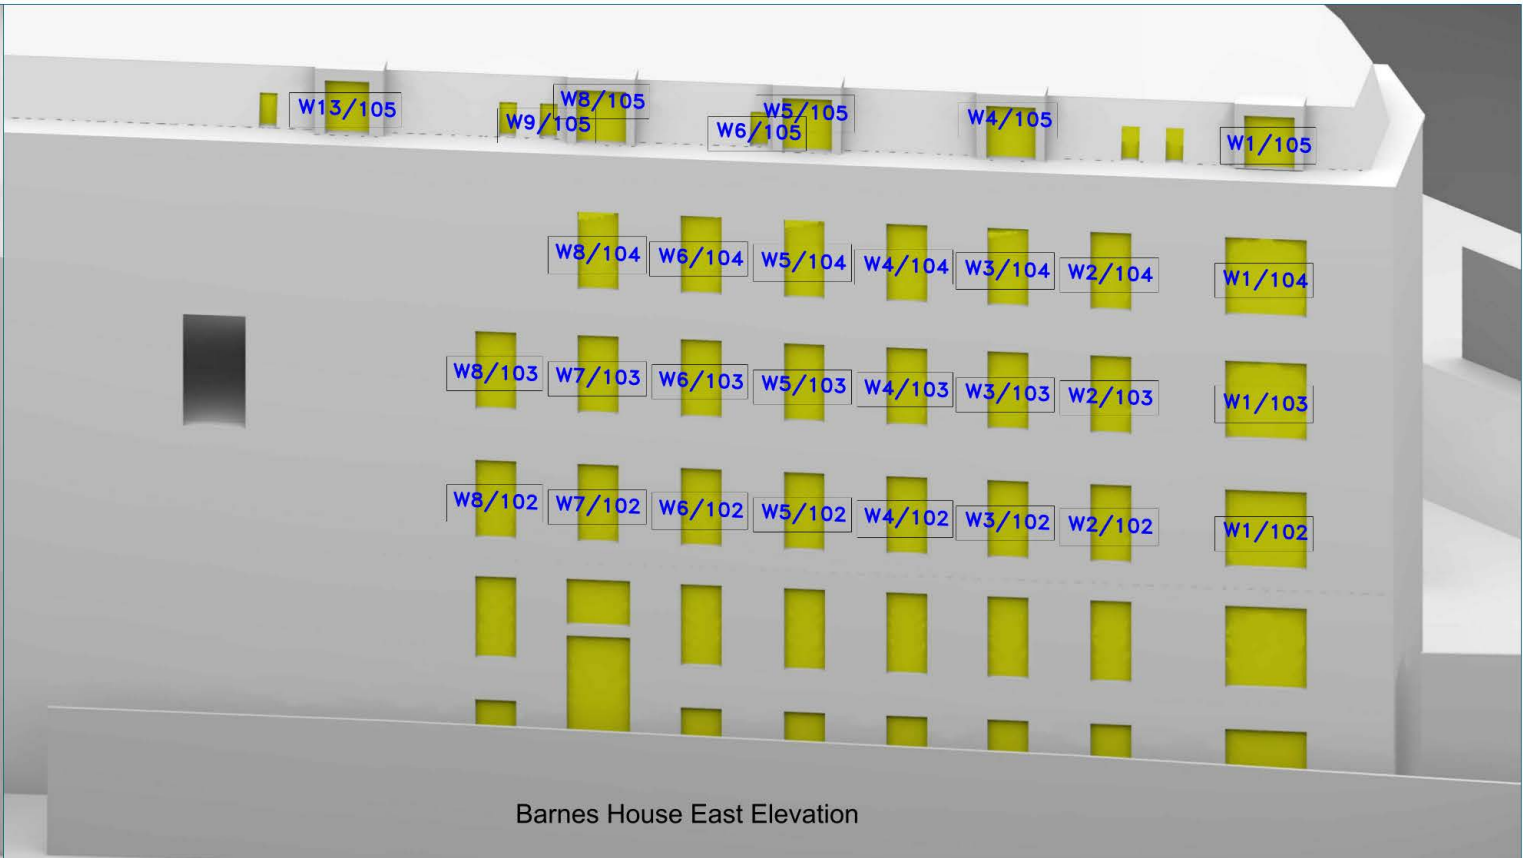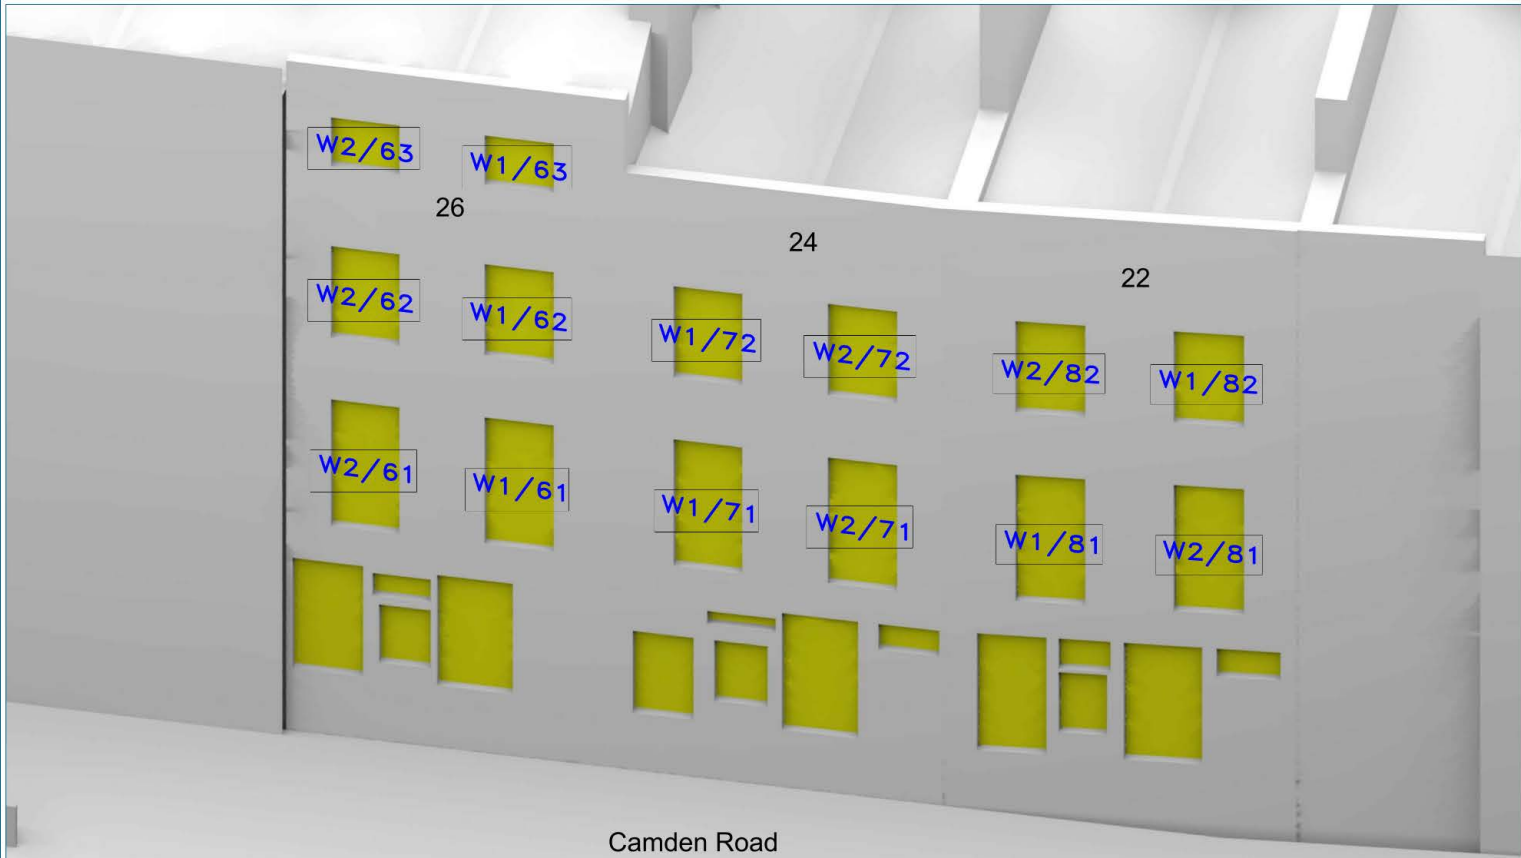

Sources: Point 2 Surveyors Point cloud Site Photos ANDREW PHILLIPS Proposed Info (received 151118) 181112_120_3D_DIA_GUH Model_AP.dwg		Key: Alterations in daylight between 20% and 30% Alterations in daylight in excess of 30%		Project: Grand Union House, Camden		Title: Window Locations Surrounding Buildings		Point 2 Surveyors Ltd, 3rd Floor, 17 Slingsby Place, London WC2E 9AB 0207 836 5828 www.point2surveyors.com	
Scheme Confirmed:		Date :		Drawn By: JB/JH/SA/CJ	Scale: NTS @ A3	Date: NOV 18	Dwg No: P1555/WM/02	Rel: 09	POINT surveyors