



**Notes:**  
 Drawings are based on survey data and may not accurately represent what is physically present.  
 All dimensions are to be verified on site before proceeding with the work.  
 All dimensions are in millimeters unless noted otherwise.  
 Purcell shall be notified in writing of any discrepancies.

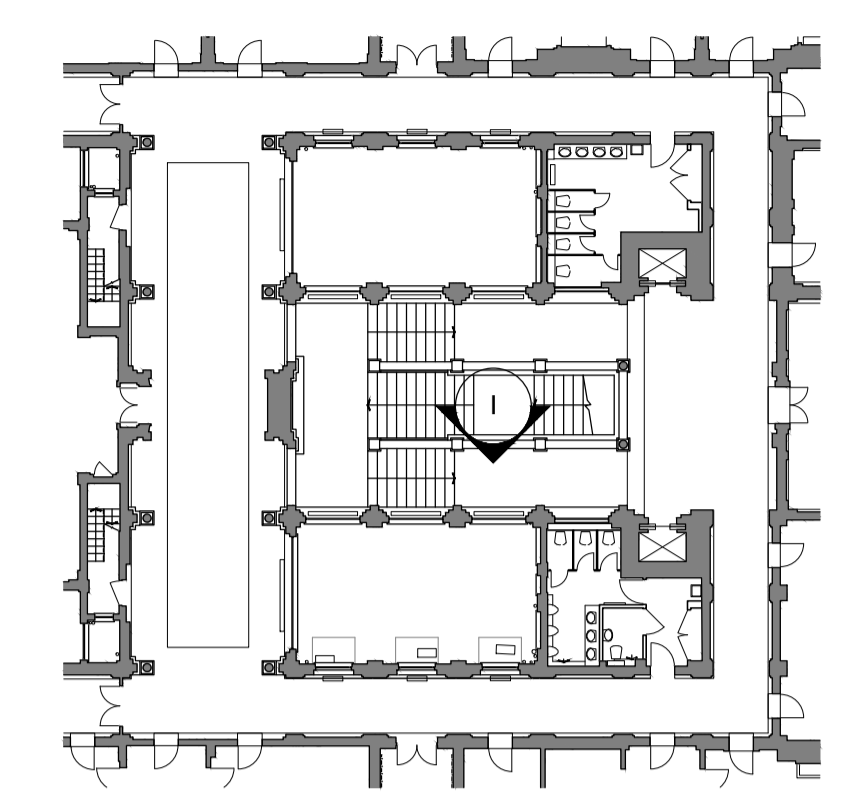

**Internal Repairs & Conservation Key**

- Drawings to be read in conjunction with Outline Conservation Strategy - Key Areas **CTH-PUR-MP-00-SP-A-00005**
- For internal Repairs and Conservation Strategy Schedule of Works, refer to drawing **CTH-PUR-MB-XX-SH-A-93000**
- 00 Existing room with modern finishes
  - FB Floor Box - Indicative location of proposed floor box. Cabling to be fed from below; openings located on site. Floor boxes to include bespoke joinery lid to allow for integration into heritage floor finishes
  - [Red Box] Area of structural opening - refer to (91)000 series drawings for dimensions
  - [Red Box] Section of timber panelling to be carefully removed for installation of electrical cabling from below. To be kept secure during works and reinstated following electrical installation. Maximum extents of removal shown - on site confirmation of panel division required
  - [Red Box] Item of removal - Original Fabric
  - [Blue Box] Item of removal - Non-Original Fabric
  - [Green Box] Existing undercut to doors used for exhaust air transfer to corridors
  - [Red Box] Overhead - 300mm wide opening to ceiling for high level concealed cable distribution - make good after installation
  - [Red Box] Overhead - Whole bay of vaulted ceiling to be removed for cabling distribution and reinstated
  - [Red Box] High level opening in wall for services distribution
  - [Red Box] Area of panelling/skirting removed for new grille installation for supply/return air flow. Extent of opening to services engineer's requirement.
  - [Green Box] Area of severe damage

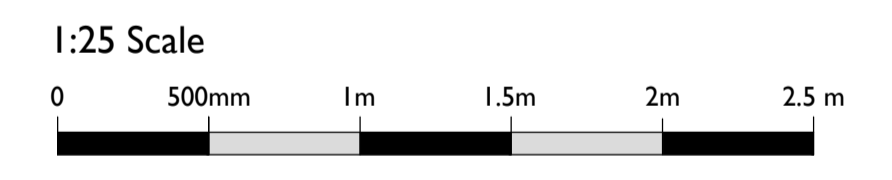

SS P00 18 Apr 2019 OB NS

ISSUE	DATE	DRAWN	CHECKED	DESCRIPTION
<b>DRAWING TITLE</b>	Int Elevations - EI.40 Proposed Internal Conservation Repairs			
<b>DRAWING NO.</b>	CTH-PUR-MB-01-DR-A-93403			
<b>REVISION</b>	SS P00			
<b>SIZE &amp; SCALE</b>	A1L 1:25			
<b>DRAWING STATUS</b>	SS SUITABLE FOR PLANNING			

**CLIENT** Lendlease

**PROJECT** Camden Town Hall

**JOB NUMBER** 238664