


1. New RWO for roof terrace. Allowance to be made for opening up works to new drainage outlets
2. Existing 1990's conservatory to be removed
3. Existing redundant plant on third floor terraces to be removed.
4. Window onto north east terrace to be removed and sill level to be dropped.
5. Roof lanterns and stair cores to south east terrace to be demolished. Existing structural columns to be retained.
6. Eastern wall to original Council Chamber plant enclosure to be demolished
7. Glazed pitched roofs to lanterns above Council Chamber removed
8. Builders work openings for services risers - refer to services engineers drawings for sizes of holes. Note: as existing structural layout is unknown, additional fabric may need to be removed to facilitate structural reinforcement.
9. Existing lift cars stripped out, cores retained.
10. Non-original fabric removed to create open office space
11. Original fabric removed to create open office space
12. Existing services and low-level radiators to be stripped out.
13. Existing raised floor of conservatory to be removed.

Notes:
 Drawings are based on survey data and may not accurately represent what is physically present.
 All dimensions are to be verified on site before proceeding with the work.
 All dimensions are in millimeters unless noted otherwise.
 Purcell shall be notified in writing of any discrepancies.

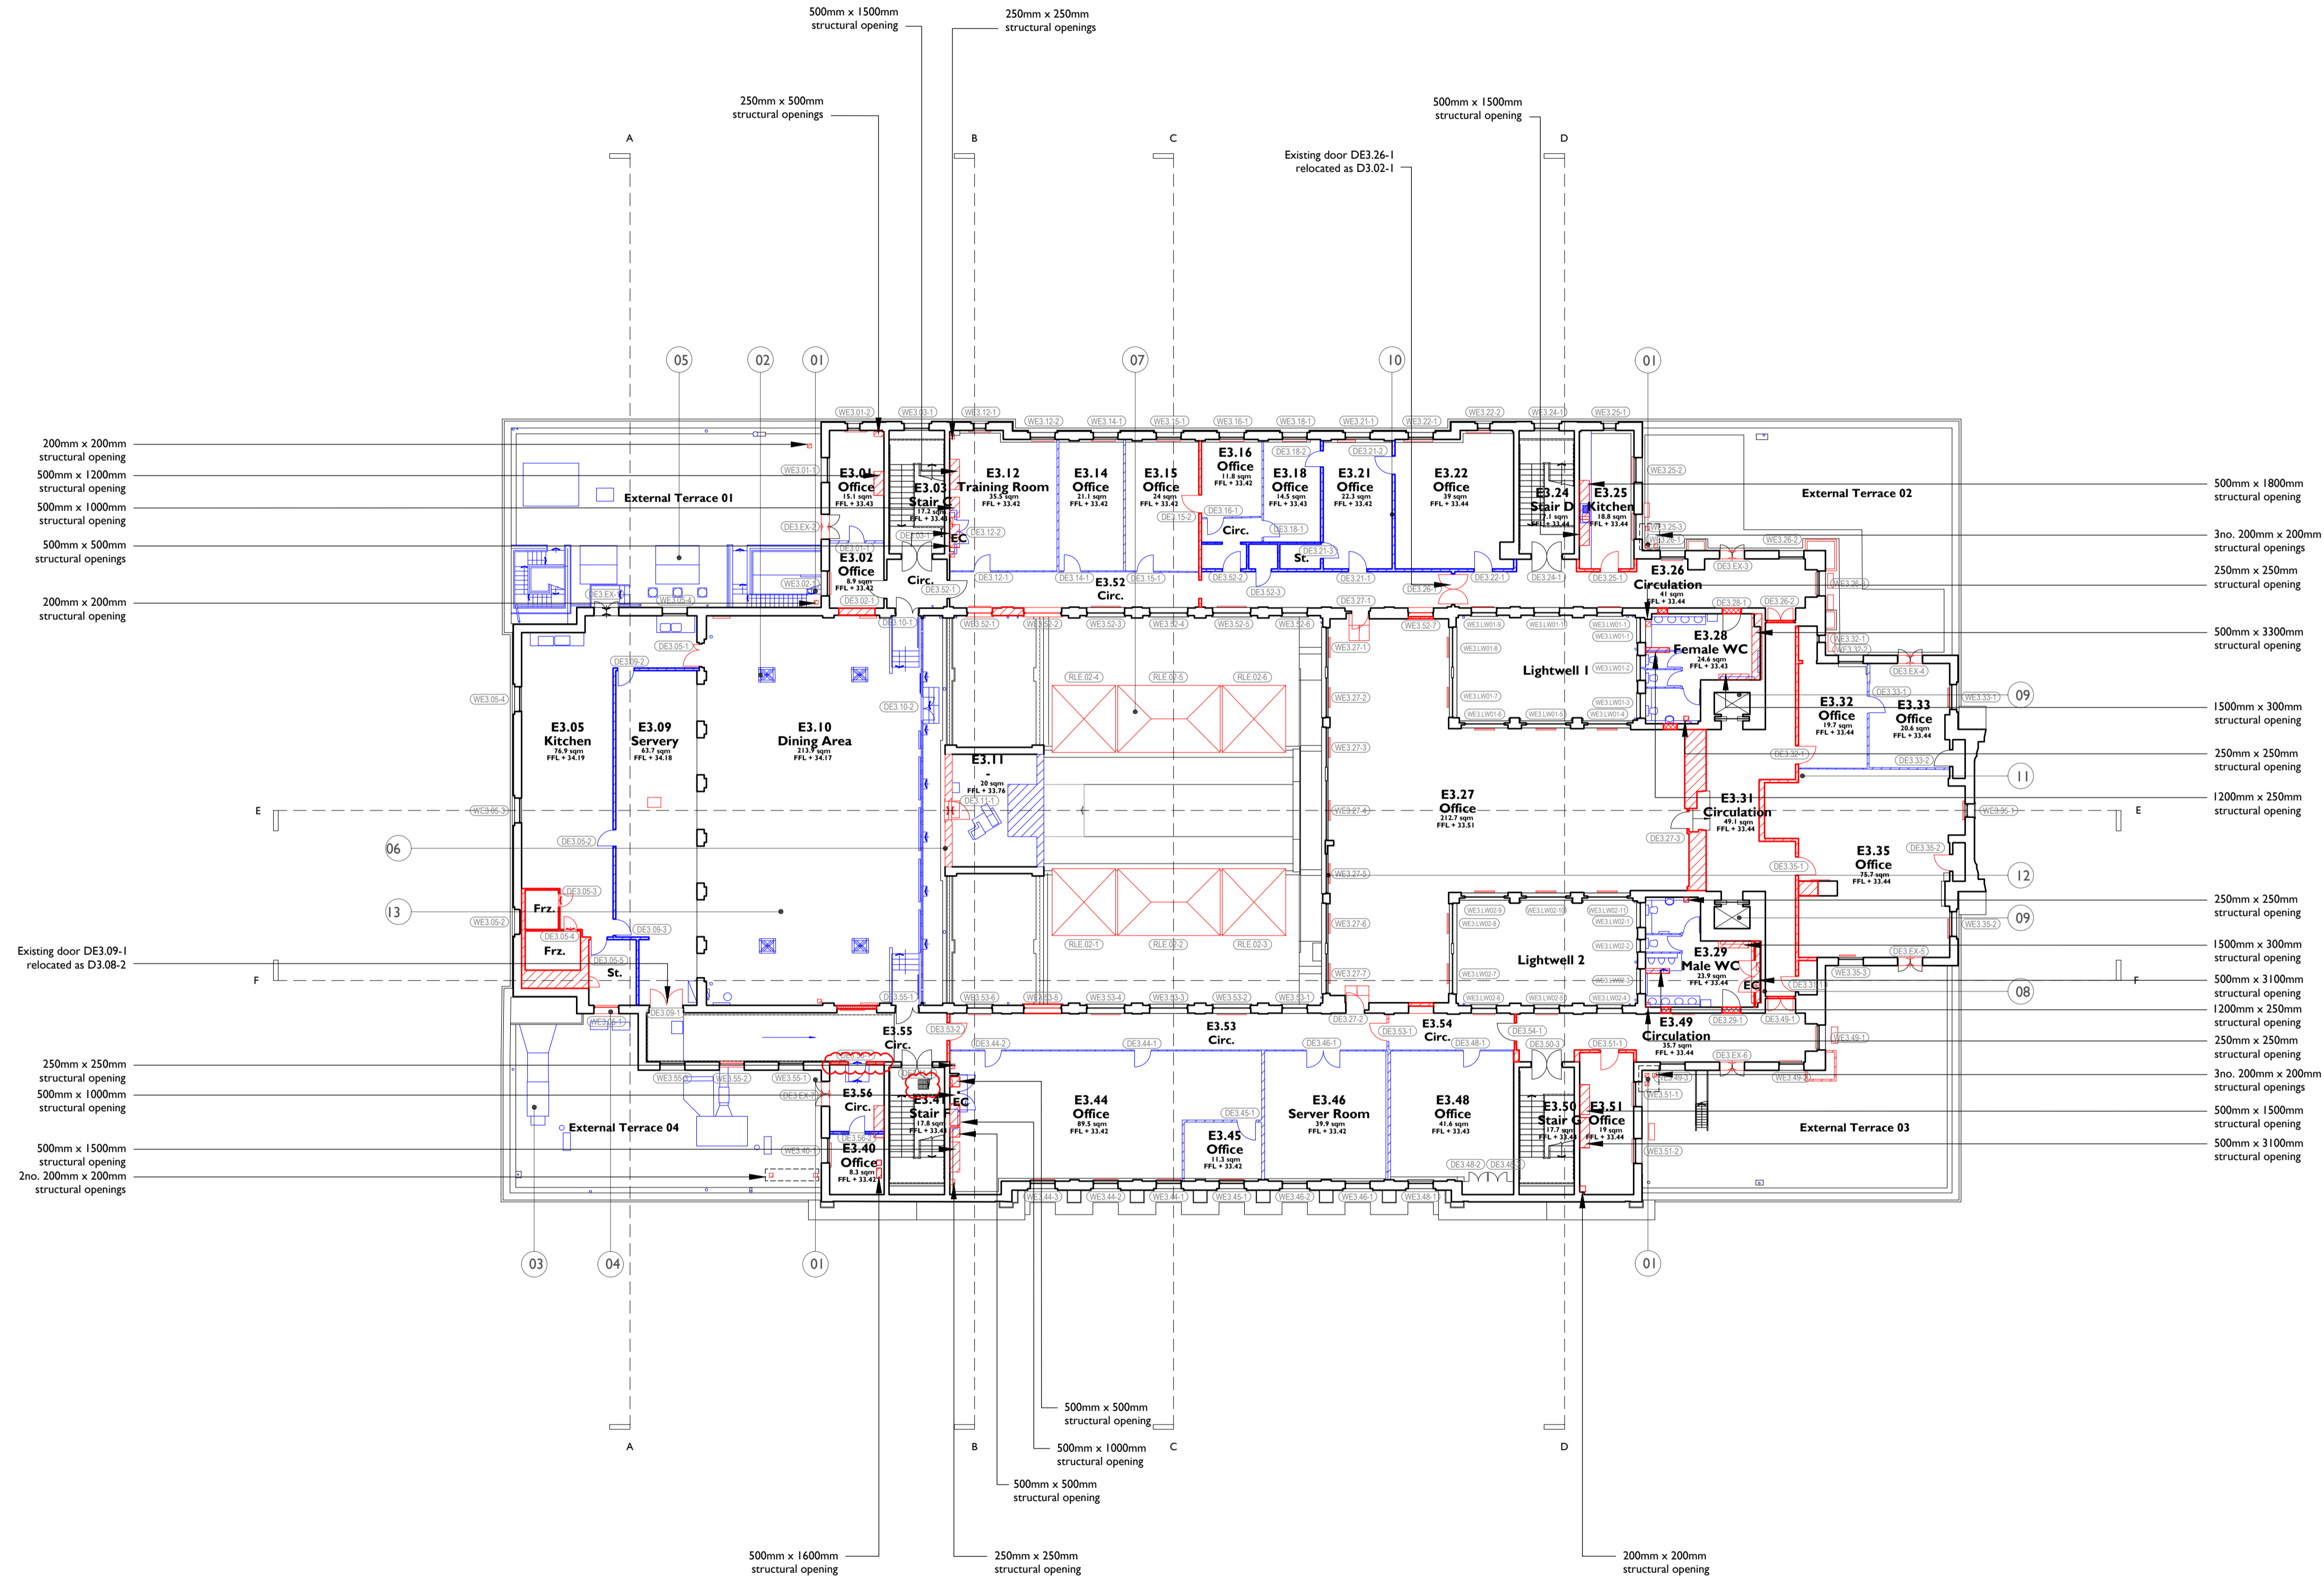


Demolitions & Alterations Key

Original fabric defined as that documented in Archive Drawings. Where date of fabric is unknown, it is assumed as original.

- Original Fabric: Section of Wall/Slab to be Demolished
- Original Fabric: Item to be Demolished
- Overhead - 300mm wide opening to ceiling for high level concealed cable distribution - make good after installation
- Overhead: Whole bay of vaulted ceiling to be removed for cabling distribution and reinstated
- Original Fabric: High level opening in wall for services distribution
- Floor trenches in slab for cable distribution
- Manhole: Opening in slab
- Non-Original Fabric: Section of Wall to be Demolished
- Non-Original Fabric: Item to be Demolished
- Window Number
- Door Number
- Annotation Item


Drawings to be read in conjunction with:
 Internal Repairs & Builder's Works drawing series (93)000 for key spaces
 Conservation Strategy Report CTH-PUR-MP-00-SP-A-00005

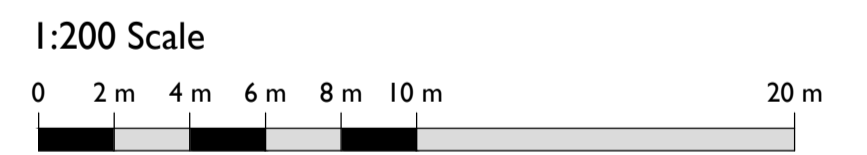

SS P00 18 Apr 2019 OB NS

ISSUE	DATE	DRAWN	CHECKED	DESCRIPTION
DRAWING TITLE		GA PROPOSED DEMOLITIONS AND STRIP OUT THIRD FLOOR LEVEL PLAN		
DRAWING NO.		CTH-PUR-MP-03-DR-A-91005		
REVISION		SS P00		
SIZE & SCALE		A1L 1:200		
DRAWING STATUS		SS SUITABLE FOR PLANNING		

CLIENT Lendlease
PROJECT Camden Town Hall
JOB NUMBER 238664

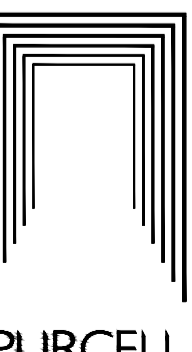

I 91005 THIRD FLOOR LEVEL PLAN PROPOSED DEMOLITIONS AND STRIP OUT 1:200 @ A1