




LEVEL MONITORING - RELATIVE SURVEY READINGS

Provider Details		Client Details			Risk Address	
Name:	MHN Ltd	Insurance Co.:			Occupier:	
Date of Issue:	14/2/20	Client Name:			Address:	Somerset House
		Contact:			Address:	31 Dartmouth Park Hill
		Email:			Town:	London
		Client Ref:			County:	
Monitoring Details		Address:	Post Code:	NW5 1HR		
Instruction Date:	16/2/19	Address:	Tel Home:			
First Reading Date:	02/05/2019	Town:	Tel Work:			
Maximum No Visits:	4	County:	Mobile:			
Anticipated Expiry Date:	Jun 2020	Post Code:	Other:			
Monitoring Int:	2 Monthly	Other Email:	Other:			

		Target Date:												
		Reading Date:	2/5/19	11/7/19	12/9/19	19/11/19	10/2/20							
		Issue Date:	9/5/19	16/7/19	18/9/19	25/11/19	14/2/20							
Row No.	Point Name	X Co-ordinate	Y Co-ordinate	1	2	3	4	5	6	7	8	9	10	11
1	1	0.00	0.00	10.1530	10.1513	10.1502	10.1531	10.1543						
2	2	-4.00	0.00	10.1295	10.1290	10.1301	10.1306	10.1308						
3	3	-11.00	0.00	10.0698	10.0693	10.0708	10.0704	10.0712						
4	4	-16.00	0.00	9.8272	9.8285	9.8296	9.8281	9.8288						
5	5	-16.00	8.00	9.4262	9.4273	9.4258	9.4263	9.4262						
6	6	-16.00	10.00	9.3448	9.3455	9.3439	9.3440	9.3451						
7	7	-10.00	10.00	9.6969	9.6966	9.6949	9.6957	9.6968						
8	8	-5.00	10.00	9.8070	9.8063	9.8017	9.8058	9.8086						
9		0.00	10.00											
10														
11														
12														
13														
14														
15														
16														
17														
18														
19														
20														
21														
22														
23														
24														
25														
26														
27														
28														
29														
30														
31														
32														

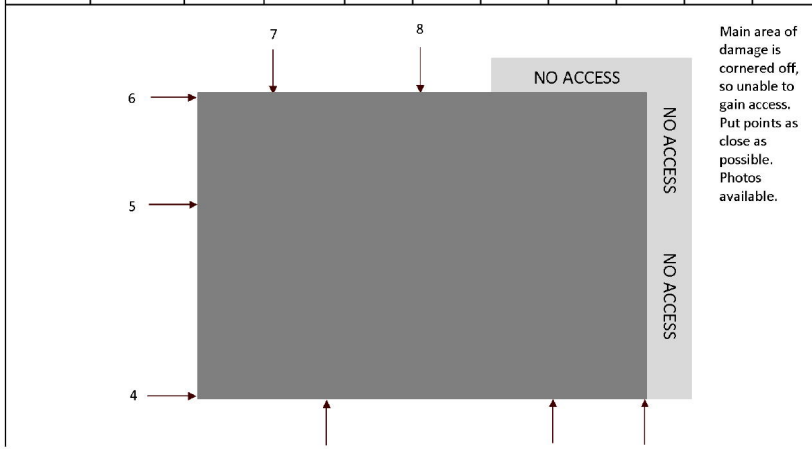

Main area of damage is cornered off, so unable to gain access. Put points as close as possible. Photos available.

- 14/02/2020
 - No new concerns raised at time of
- It was not possible to install all sta within a common brickcourse. The initial readings cannot be interpreted as Distortion Data.
- Readings have been made relative to a manhole in the road. It has an assumed value of 10.0000m. If this is not a true datum please advise if a deep datum is required.
- Further readings to be taken April 2020

