
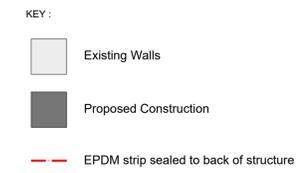
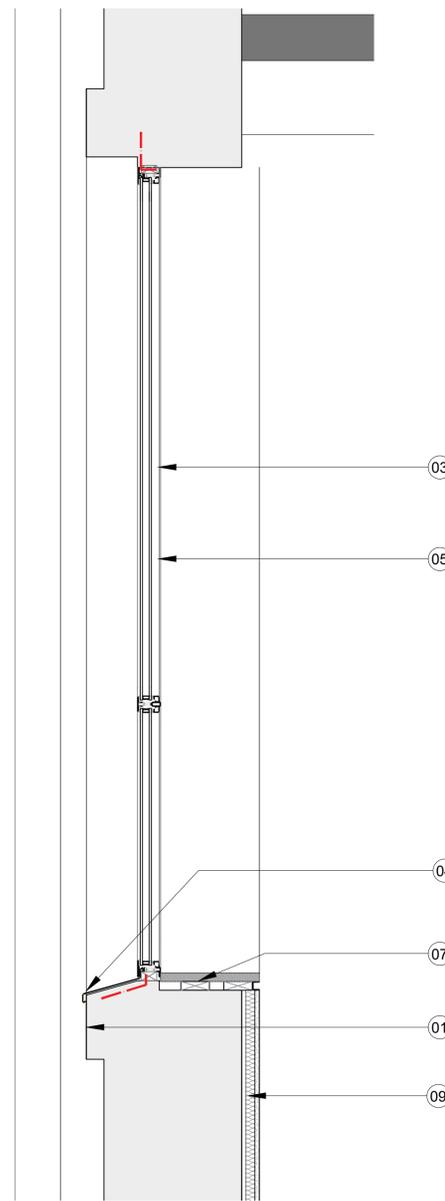



BARR GAZETAS

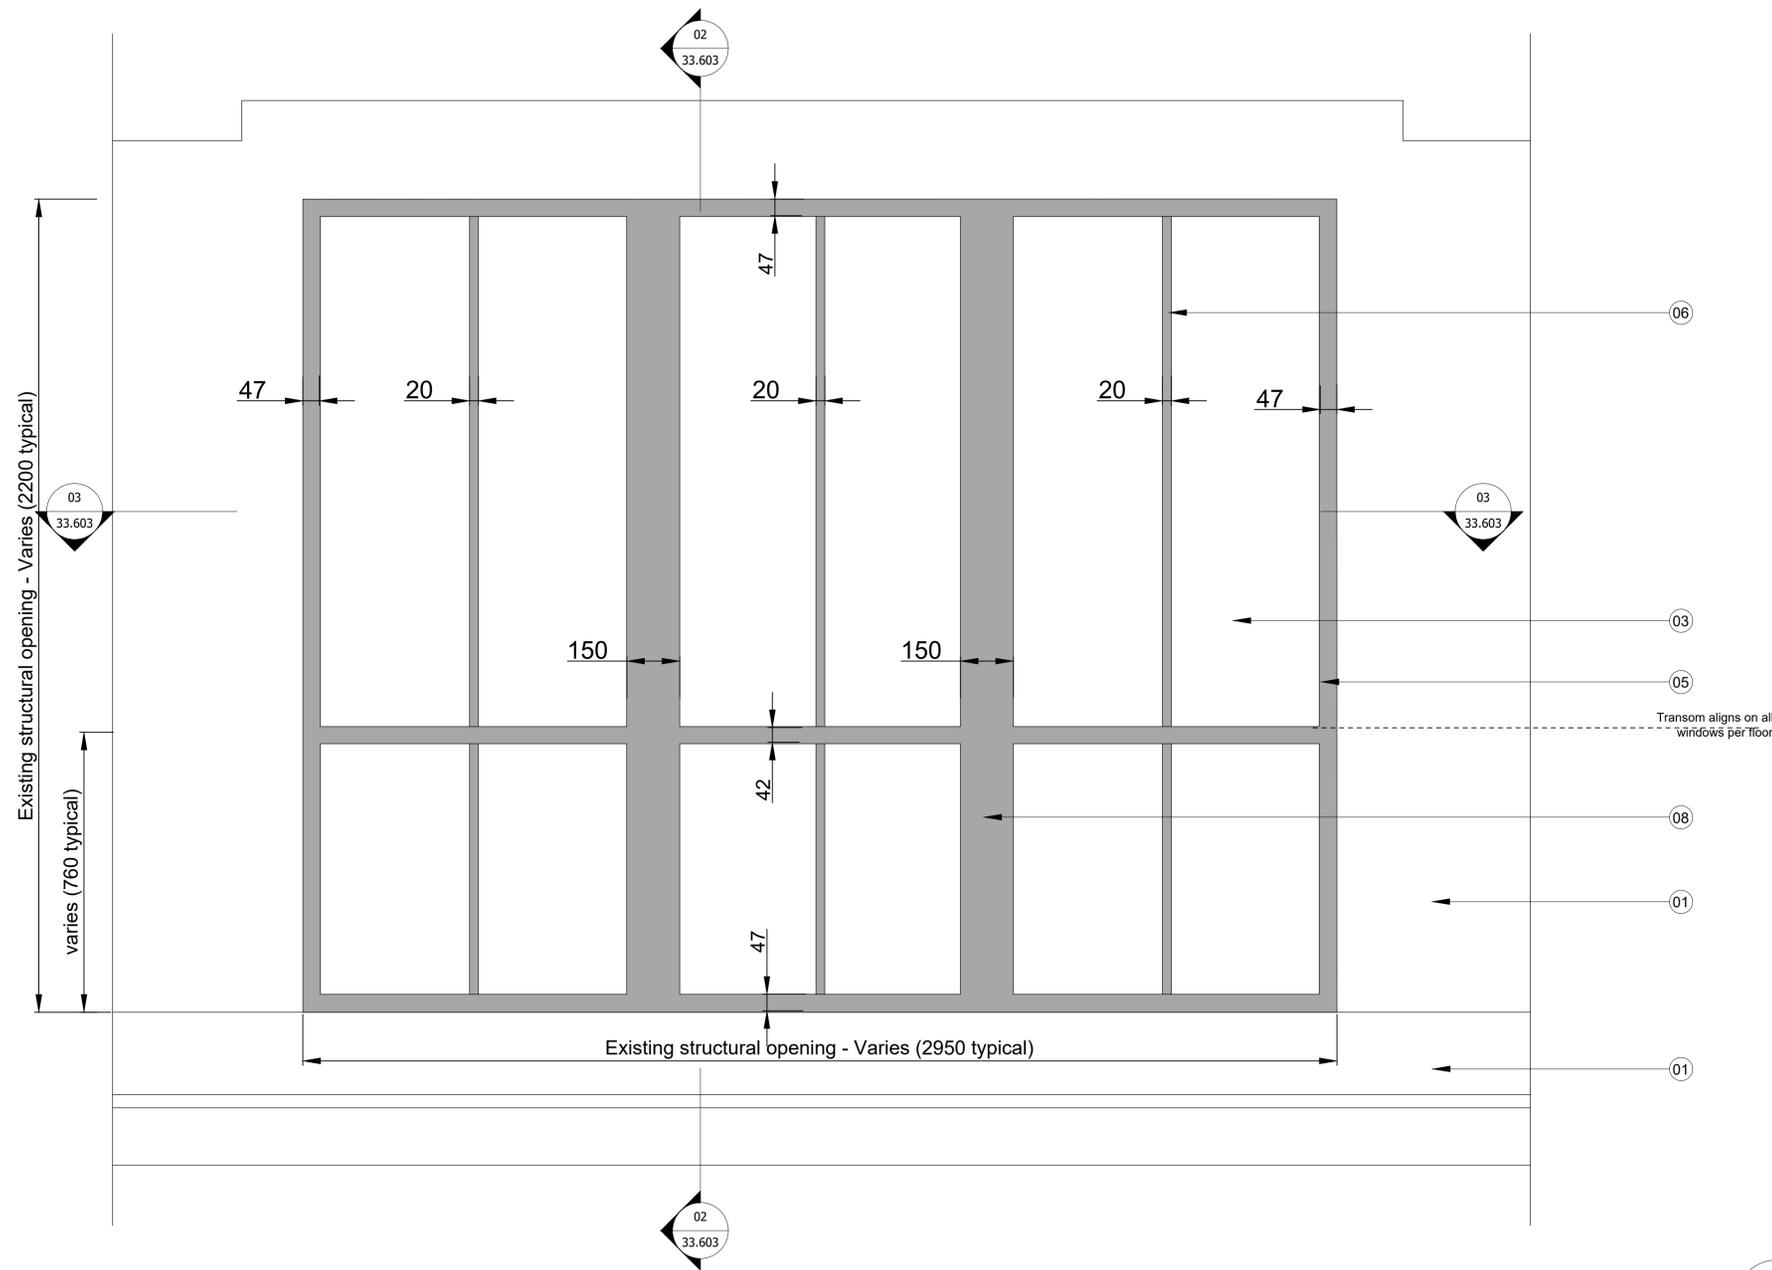

- Note:
1. Existing Portland stone cill cleaned and repaired.
 2. -
 3. Window Type 3 - Fixed thermal break steel window with historic mullion detail. Dual colour: bronze outside, black inside.
 4. New aluminum cill pressing, bronze colour
 5. PPC Steel outer frame, mullions and transom. Dual colour: bronze outside, black inside. Outer profile 47mm, transom 42mm to match original windows
 6. 20mm applied divider (Aluminium) with spacer between glass. Bronze colour
 7. Internal hardwood painted cill, white paint finish
 8. Bespoke 150mm mullion profile required to match original windows. Dual colour: bronze outside, black inside
 9. New insulated plasterboard lining, white paint finish

Note: Window Type 3 requires dual colour finish: bronze colour outside, black colour inside.


Unit to achieve barrier loading as detailed in BS 6180

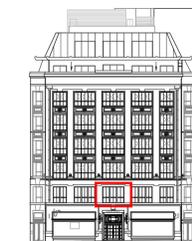

Reference Elevation - Kingsway


01 Type 3 Replacement Window - Elevation
20.271 1:10@A1, 1:20@A3

02 Type 3 Replacement Window - Section
33.603 1:10@A1, 1:20@A3

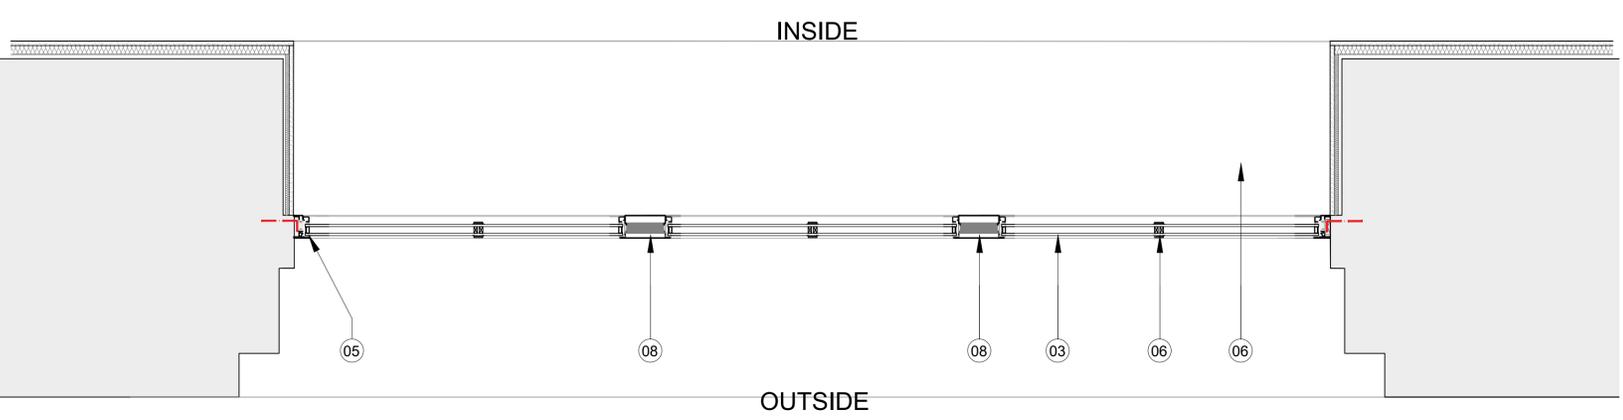

03 Type 3 Replacement Window - Plan
33.603 1:10@A1, 1:20@A3

Rev.	Description	By	Date
P1	Issued for Planning	AC	08.07.20

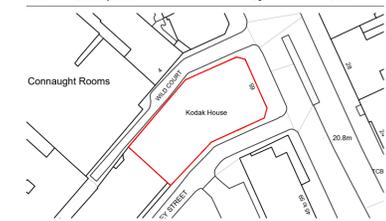

Client
Kings Keeley Limited C/o Clearbell Capital LLP
Project
65 Kingsway - Base Scheme

Title
Type 3 Replacement Window Details

Status	Purpose of issue	RIBA stage
S2	For Planning	2

Project No.	Drawn	Checked	Scale	Rev.
1914	FB	TJ/GV	1:100 @ A1 1:200 @ A3	P1

Drawing No.
1914-BG-01-00-DR-A-33.613

Do not scale from this drawing. The Contractor is to take and check all dimensions on site before work commences. Discrepancies must be reported to the Architect. Subcontractors must verify all dimensions on site before making a shop drawing or commencing manufacturing. This drawing is copyright. ©

© Copyright Barr Gazetas Ltd.
A 10 Heddon Street, London, W1B 4BG
T 0207 638 5581
W www.barrgazetas.com