


Address: 1 HILLFIELD ROAD, LONDON, NW6 1QD

Date: 29 Mar 2019

Reference: CGL01-5913494

Client: Card Geotechnics Limited

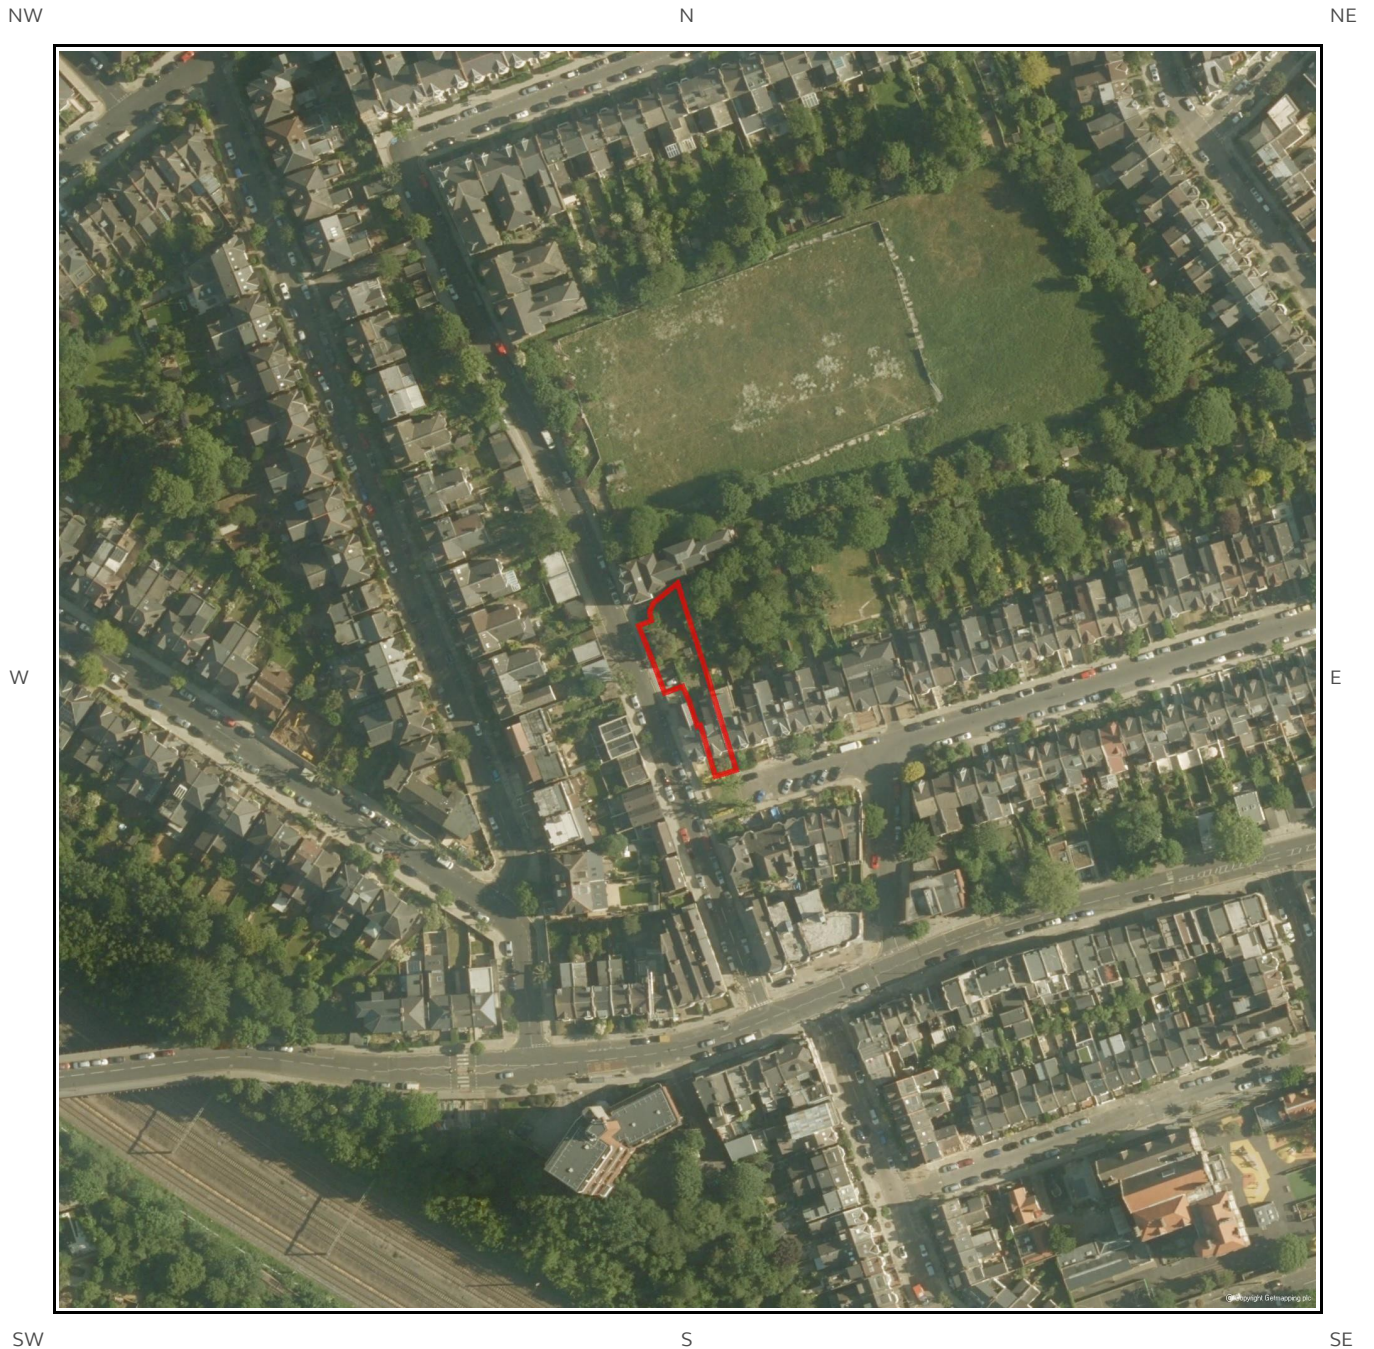

Aerial Photograph Capture date: 12-Aug-2016
Grid Reference: 524799,185209
Site Size: 0.0505ha

Contents Page

Contents Page.....	3
Overview of Findings.....	5
1:10,000 Scale Availability.....	8
Availability of 1:10,000 Scale Geology Mapping.....	9
1 Geology (1:10,000 scale).....	10
1.1 Artificial Ground map (1:10,000 scale).....	10
1. Geology 1:10,000 scale.....	11
1.1 Artificial Ground.....	11
1.2 Superficial Deposits and Landslips map (1:10,000 scale).....	12
1.2 Superficial Deposits and Landslips.....	13
1.2.1 Superficial Deposits/ Drift Geology.....	13
1.2.2 Landslip.....	13
1.3 Bedrock and linear features map (1:10,000 scale).....	14
1.3 Bedrock and linear features.....	15
1.3.1 Bedrock/ Solid Geology.....	15
1.3.2 Linear features.....	15
2 Geology 1:50,000 Scale.....	16
2.1 Artificial Ground map.....	16
2. Geology 1:50,000 scale.....	17
2.1 Artificial Ground.....	17
2.1.1 Artificial/ Made Ground	17
2.1.2 Permeability of Artificial Ground.....	17
2.2 Superficial Deposits and Landslips map (1:50,000 scale).....	18
2.2 Superficial Deposits and Landslips.....	19
2.2.1 Superficial Deposits/ Drift Geology.....	19
2.2.2 Permeability of Superficial Ground	19
2.2.3 Landslip.....	19
2.2.4 Landslip Permeability.....	19
2.3 Bedrock and linear features map (1:50,000 scale).....	20
2.3 Bedrock, Solid Geology & linear features.....	21
2.3.1 Bedrock/Solid Geology.....	21
2.3.2 Permeability of Bedrock Ground.....	21
2.3.3 Linear features.....	21
3 Radon Data.....	22
3.1 Radon Affected Areas.....	22
3.2 Radon Protection.....	22
4 Ground Workings map.....	23
4 Ground Workings.....	24
4.1 Historical Surface Ground Working Features derived from Historical Mapping.....	24
4.2 Historical Underground Working Features derived from Historical Mapping.....	25
4.3 Current Ground Workings.....	25
5 Mining, Extraction & Natural Cavities.....	27
5.1 Historical Mining.....	27
5.2 Coal Mining.....	27
5.3 Johnson Poole and Bloomer.....	27
5.4 Non-Coal Mining.....	27
5.5 Non-Coal Mining Cavities.....	28
5.6 Natural Cavities.....	28
5.7 Brine Extraction.....	28
5.8 Gypsum Extraction.....	28
5.9 Tin Mining.....	28
5.10 Clay Mining.....	29
6 Natural Ground Subsidence.....	30
6.1 Shrink-Swell Clay map.....	30
6.2 Landslides map.....	31
6.3 Ground Dissolution of Soluble Rocks map.....	32
6.4 Compressible Deposits map.....	33
6.5 Collapsible Deposits map.....	34
6.6 Running Sand map.....	35

6 Natural Ground Subsidence.....	36
6.1 Shrink-Swell Clays.....	36
6.2 Landslides.....	36
6.3 Ground Dissolution of Soluble Rocks.....	37
6.4 Compressible Deposits.....	37
6.5 Collapsible Deposits.....	37
6.6 Running Sands.....	37
7 Borehole Records.....	39
8 Estimated Background Soil Chemistry.....	40
9 Railways and Tunnels map.....	41
9 Railways and Tunnels.....	42
9.1 Tunnels	42
9.2 Historical Railway and Tunnel Features	42
9.3 Historical Railways.....	43
9.4 Active Railways.....	44
9.5 Railway Projects.....	44

Overview of Findings

The Groundsure Geo Insight provides high quality geo-environmental information that allows geo-environmental professionals and their clients to make informed decisions and be forewarned of potential ground instability problems that may affect the ground investigation, foundation design and possibly remediation options that could lead to possible additional costs.

The report is based on the BGS 1:50,000 and 1:10,000 Digital Geological Map of Great Britain, BGS Geosure data; BRITPITS database; Non-coal mining data and Borehole Records, Coal Authority data including brine extraction areas, PBA non-coal mining and natural cavities database, Johnson Poole and Bloomer mining data and Groundsure's unique database including historical surface ground and underground workings.

For further details on each dataset, please refer to each individual section in the report as listed. Where the database has been searched a numerical result will be recorded. Where the database has not been searched '-' will be recorded.

Section 1: Geology 1:10,000 Scale

1.1 Artificial Ground	1.1 Is there any Artificial Ground/ Made Ground present beneath the study site at 1:10,000 scale?	No
1.2 Superficial Geology and Landslips	1.2.1 Is there any Superficial Ground/Drift Geology present beneath the study site at 1:10,000 scale?*	No
	1.2.2 Are there any records of landslide within 500m of the study site boundary at 1:10,000 scale?	No
1.3 Bedrock, Solid Geology and linear features	1.3.1 For records of Bedrock and Solid Geology beneath the study site* see the detailed findings section.	
	1.3.2 Are there any records of linear features within 500m of the study site boundary at 1:10,000 scale?	No

Section 2: Geology 1:50,000 Scale

2.1 Artificial Ground	2.1.1 Is there any Artificial Ground/ Made Ground present beneath the study site?	No
	2.1.2 Are there any records relating to permeability of artificial ground within the study site*boundary?	No
2.2 Superficial Geology and Landslips	2.2.1 Is there any Superficial Ground/Drift Geology present beneath the study site?*	No
	2.2.2 Are there any records of permeability of superficial ground within 500m of the study site?	No
	2.2.3 Are there any records of landslide within 500m of the study site boundary?	No
	2.2.4 Are there any records relating to permeability of landslips within the study site* boundary?	No

Section 2: Geology 1:50,000 Scale

2.3 Bedrock, Solid Geology and linear features

2.3.1 For records of Bedrock and Solid Geology beneath the study site* see the detailed findings section.

2.3.2 Are there any records relating to permeability of bedrock ground within the study site boundary?

Yes

2.3.3 Are there any records of linear features within 500m of the study site boundary?

No

Section 3: Radon

3. Radon

3.1 Is the property in a Radon Affected Area as defined by the Health Protection Agency (HPA) and if so what percentage of homes are above the Action Level?

The property is not in a Radon Affected Area, as less than 1% of properties are above the Action Level.

3.2 Radon Protection

No radon protective measures are necessary.

Section 4: Ground Workings

	On-site	0-50m	51-250	251-500	501-1000
4.1 Historical Surface Ground Working Features from Small Scale Mapping	1	7	19	Not Searched	Not Searched
4.2 Historical Underground Workings from Small Scale Mapping	0	0	0	0	0
4.3 Current Ground Workings	0	0	0	0	0

Section 5: Mining, Extraction & Natural Cavities

	On-site	0-50m	51-250	251-500	501-1000
5.1 Historical Mining	0	0	0	0	0
5.2 Coal Mining	0	0	0	0	0
5.3 Johnson Poole and Bloomer Mining Area	0	0	0	0	0
5.4 Non-Coal Mining*	0	0	0	0	0
5.5 Non-Coal Mining Cavities	0	0	0	0	0
5.5 Natural Cavities	0	0	0	0	0


Section 5: Mining, Extraction & Natural Cavities	On-site	0-50m	51-250	251-500	501-1000
5.6 Brine Extraction	0	0	0	0	0
5.7 Gypsum Extraction	0	0	0	0	0
5.8 Tin Mining	0	0	0	0	0
5.9 Clay Mining	0	0	0	0	0
Section 6: Natural Ground Subsidence	On-site				
6.1 Shrink-Swell Clay	Moderate				
6.2 Landslides	Very Low				
6.3 Ground Dissolution of Soluble Rocks	Negligible				
6.4 Compressible Deposits	Negligible				
6.5 Collapsible Deposits	Very Low				
6.5 Running Sand	Very Low				
Section 7: Borehole Records	On-site	0-50m	51-250		
7 BGS Recorded Boreholes	0	0	1		
Section 8: Estimated Background Soil Chemistry	On-site	0-50m	51-250		
8 Records of Background Soil Chemistry	1	0	0		
Section 9: Railways and Tunnels	On-site	0-50m	51-250	250-500	
9.1 Tunnels	0	0	0	Not Searched	
9.2 Historical Railway and Tunnel Features	0	0	26	Not Searched	
9.3 Historical Railways	0	0	0	Not Searched	
9.4 Active Railways	0	0	18	Not Searched	
9.5 Railway Projects	0	0	0	0	

1:10,000 Scale Availability



1_10,000 Availability Legend

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.

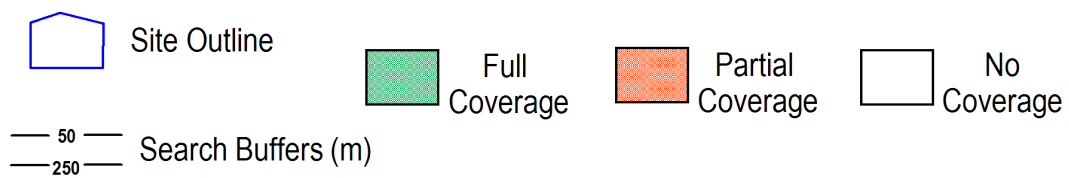

Availability of 1:10,000 Scale Geology Mapping

The following information represents the availability of the key components of the 1:10,000 scale geological data.

ID	Distance	Artificial Coverage	Superficial Coverage	Bedrock Coverage	Mass Movement Coverage
1	0.0	Some deposits are mapped	Full	Full	No coverage
2	189.0	Some deposits are mapped	Full	Full	No coverage
3	193.0	Some deposits are mapped	Full	Full	No coverage
4	271.0	Some deposits are mapped	Full	Full	No coverage

Guidance: The 1:10,000 scale geological interpretation is the most detailed generally available from BGS and is the scale at which most geological surveying is carried out in the field. The database is presented as four types of geology (artificial, mass movement, superficial and bedrock), although not all themes are mapped or available on every map sheet. Therefore a coverage layer showing the availability of the four themes is presented above.

The definitions of coverage are as follows:

Geology	Full Coverage	Partial Coverage	No Coverage
Bedrock	The whole tile has been mapped	Some but not all the tile has been mapped	No coverage
Superficial	The whole tile has been mapped	Some but not all of the tile has been mapped	No coverage
Artificial	Some deposits are mapped on this tile	-	No deposits are mapped
Mass Movement	Some deposits are mapped on this tile	-	No coverage


1 Geology (1:10,000 scale).

1.1 Artificial Ground map (1:10,000 scale)



Artificial Ground Legend

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.

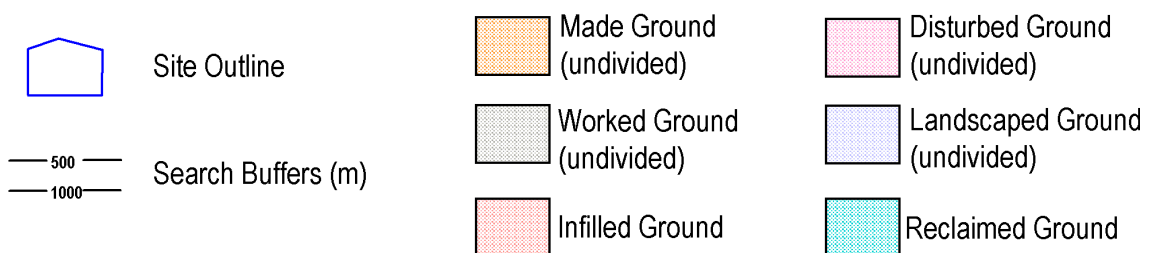

1. Geology 1:10,000 scale

1.1 Artificial Ground

The following geological information represented on the mapping is derived from 1:10,000 scale BGS Geological mapping.

Are there any records of Artificial/ Made Ground within 500m of the study site boundary at 1:10,000 scale? No




Database searched and no data found.

1.2 Superficial Deposits and Landslips map (1:10,000 scale)



Artificial Ground Legend

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.

-  Site Outline
-  500
-  1000
- Search Buffers (m)

1.2 Superficial Deposits and Landslips

The following geological information represented on the mapping is derived from 1:10,000 scale BGS Geological mapping

1.2.1 Superficial Deposits/ Drift Geology

Are there any records of Superficial Deposits/ Drift Geology within 500m of the study site boundary at 1:10,000 scale? No

Database searched and no data found.

1.2.2 Landslip


Are there any records of Landslip within 500m of the study site boundary at 1:10,000 scale? No

Database searched and no data found.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of Great Britain at 1:10,000 scale


This Geology shows the main components as discrete layers, these are: Artificial / Made Ground, Superficial / Drift Geology and Landslips. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nationwide coverage.

1.3 Bedrock and linear features map (1:10,000 scale)

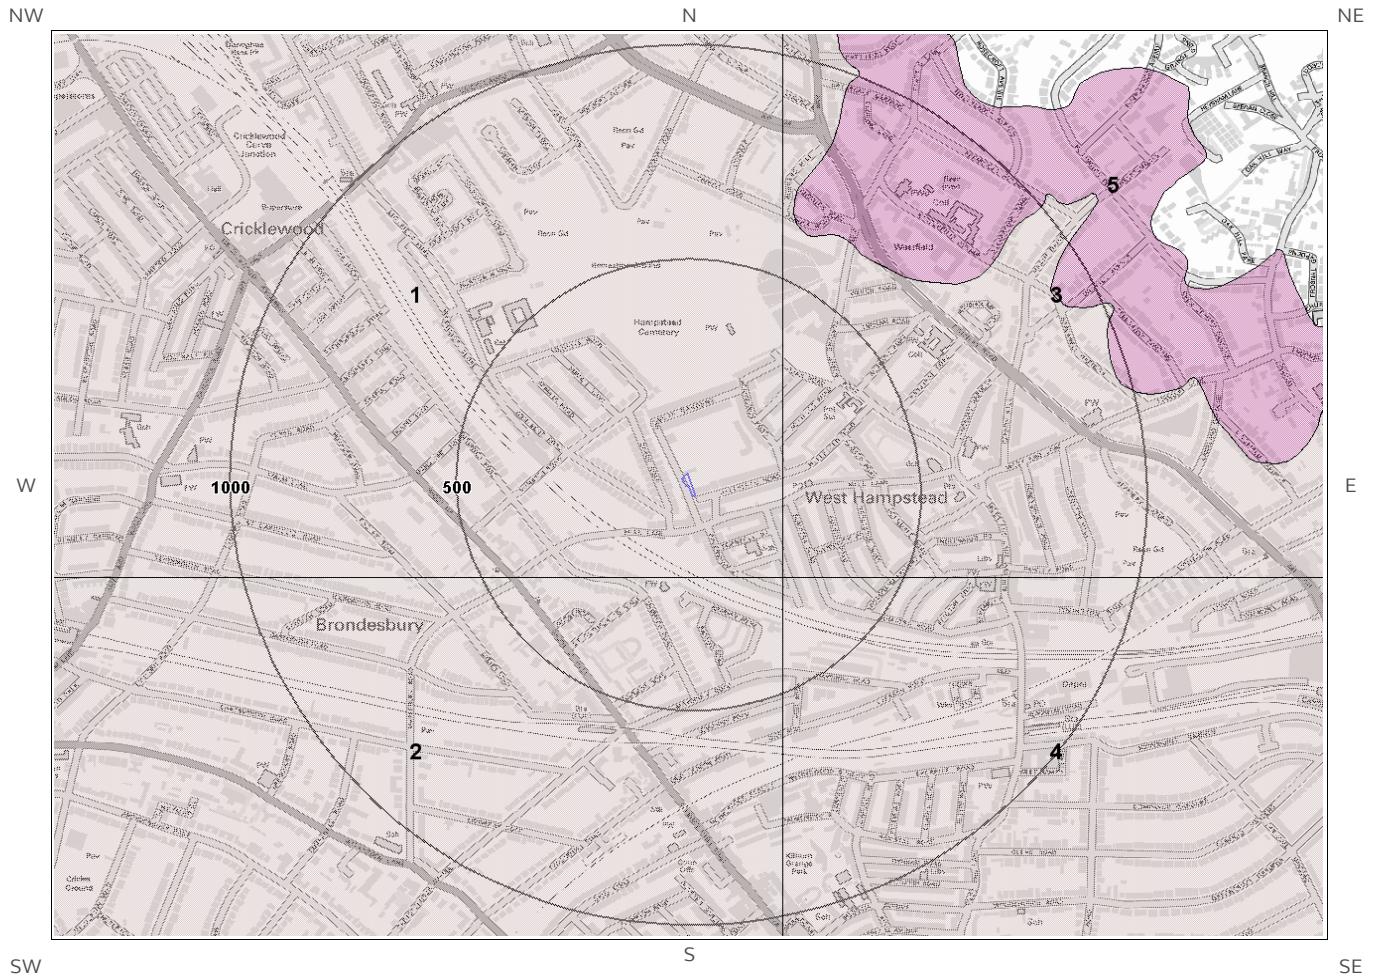

Bedrock and linear features Legend

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.

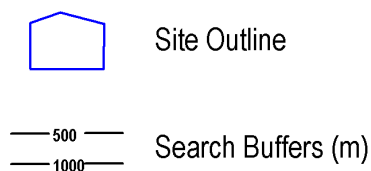

1.3 Bedrock and linear features

The following geological information represented on the mapping is derived from 1:10,000 scale BGS Geological mapping.

1.3.1 Bedrock/ Solid Geology

Records of Bedrock/Solid Geology within 500m of the study site boundary at 1:10,000 scale.

ID	Distance (m)	Direction	LEX Code	Description	Rock Age
1	0.0	On Site	LC-CLAY	London Clay Formation - Clay	Eocene Epoch
2	189.0	S	LC-CLAY	London Clay Formation - Clay	Eocene Epoch
3	193.0	E	LC-CLAY	London Clay Formation - Clay	Eocene Epoch
4	271.0	SE	LC-CLAY	London Clay Formation - Clay	Eocene Epoch

1.3.2 Linear features

Are there any records of linear features within 500m of the study site boundary at 1:10,000 scale? No

Database searched and no data found at this scale.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of great Britain at 1:10,000 scale.


This Geology shows the main components as discrete layers, these are: Bedrock/ Solid Geology and linear features such as faults. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nationwide coverage.

2 Geology 1:50,000 Scale

2.1 Artificial Ground map



© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.

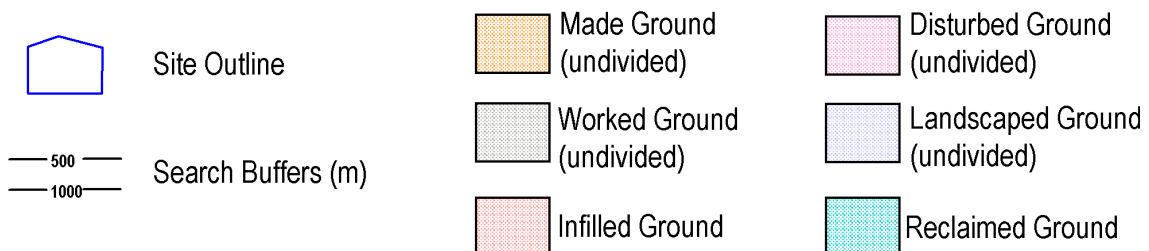

2. Geology 1:50,000 scale

2.1 Artificial Ground

The following geological information represented on the mapping is derived from 1:50,000 scale BGS Geological mapping, Sheet No: 256

2.1.1 Artificial/ Made Ground

Are there any records of Artificial/ Made Ground within 500m of the study site boundary? No

Database searched and no data found.

2.1.2 Permeability of Artificial Ground

Are there any records relating to permeability of artificial ground within the study site boundary? No

Database searched and no data found.


2.2 Superficial Deposits and Landslips map (1:50,000 scale)



© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.



Site Outline

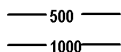

Search Buffers (m)

2.2 Superficial Deposits and Landslips

2.2.1 Superficial Deposits/ Drift Geology

Are there any records of Superficial Deposits/ Drift Geology within 500m of the study site boundary? No

Database searched and no data found.

2.2.2 Permeability of Superficial Ground

Are there any records relating to permeability of superficial ground within the study site boundary? No

Database searched and no data found.

2.2.3 Landslip

Are there any records of Landslip within 500m of the study site boundary? No

Database searched and no data found.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of Great Britain at 1:50,000 scale.


This Geology shows the main components as discrete layers, there are: Artificial/ Made Ground, Superficial/ Drift Geology and Landslips. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nationwide coverage.

2.2.4 Landslip Permeability

Are there any records relating to permeability of landslips within the study site boundary? No

Database searched and no data found.


2.3 Bedrock and linear features map (1:50,000 scale)

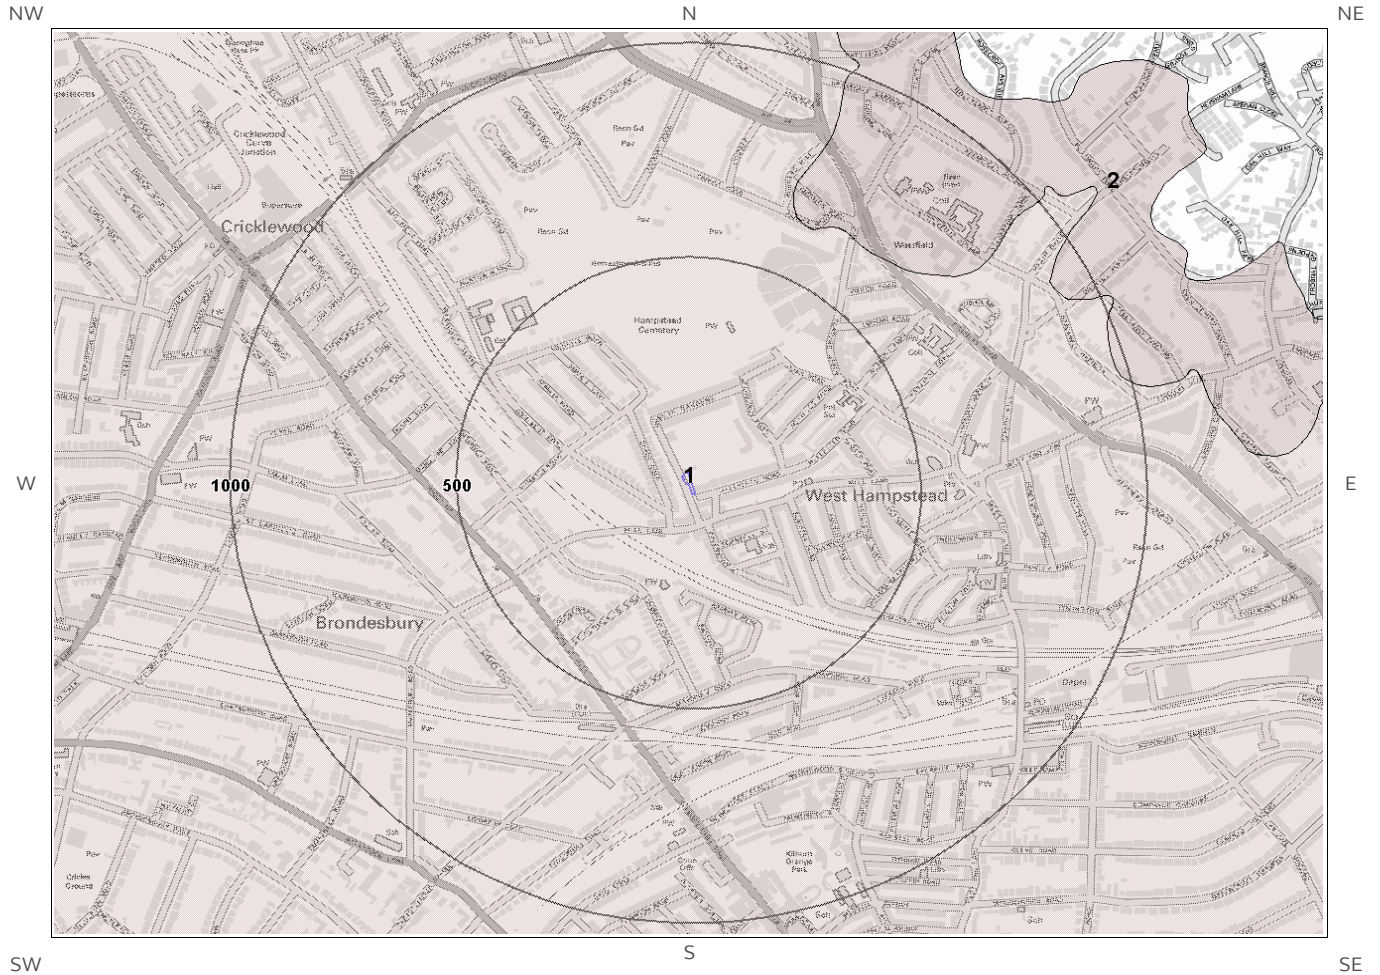

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.



Site Outline



Search Buffers (m)

2.3 Bedrock, Solid Geology & linear features

The following geological information represented on the mapping is derived from 1:50,000 scale BGS Geological mapping, Sheet No: 256

2.3.1 Bedrock/Solid Geology

Records of Bedrock/Solid Geology within 500m of the study site boundary:

ID	Distance	Direction	LEX Code	Rock Description	Rock Age
1	0.0	On Site	LC-XCZS	LONDON CLAY FORMATION - CLAY, SILT AND SAND	YPRESIAN

2.3.2 Permeability of Bedrock Ground

Are there any records relating to permeability of bedrock ground within the study site boundary? Yes

Distance	Direction	Flow Type	Maximum Permeability	Minimum Permeability
0.0	On Site	Mixed	Moderate	Very Low

2.3.3 Linear features

Are there any records of linear features within 500m of the study site boundary? No

Database searched and no data found.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of Great Britain at 1:50,000 scale.

This Geology shows the main components as discrete layers, these are: Bedrock/Solid Geology and linear features such as faults. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nation wide coverage.

3 Radon Data

3.1 Radon Affected Areas


Is the property in a Radon Affected Area as defined by the Health Protection Agency (HPA) and if so what percentage of homes are above the Action Level? The property is not in a Radon Affected Area, as less than 1% of properties are above the Action Level.

The radon data in this report is supplied by the BGS/Public Health England and is the definitive map of Radon Affected Areas in Great Britain and Northern Ireland. The dataset was created using long-term radon measurements in over 479,000 homes across Great Britain and 23,000 homes across Northern Ireland, combined with geological data. The dataset is considered accurate to 50m to allow for the margin of error in geological lines, and the findings of this report supercede any answer given in the less accurate Indicative Atlas of Radon in Great Britain, which simplifies the data to give the highest risk within any given 1km grid square. As such, the radon atlas is considered indicative, whereas the data given in this report is considered definitive.

3.2 Radon Protection



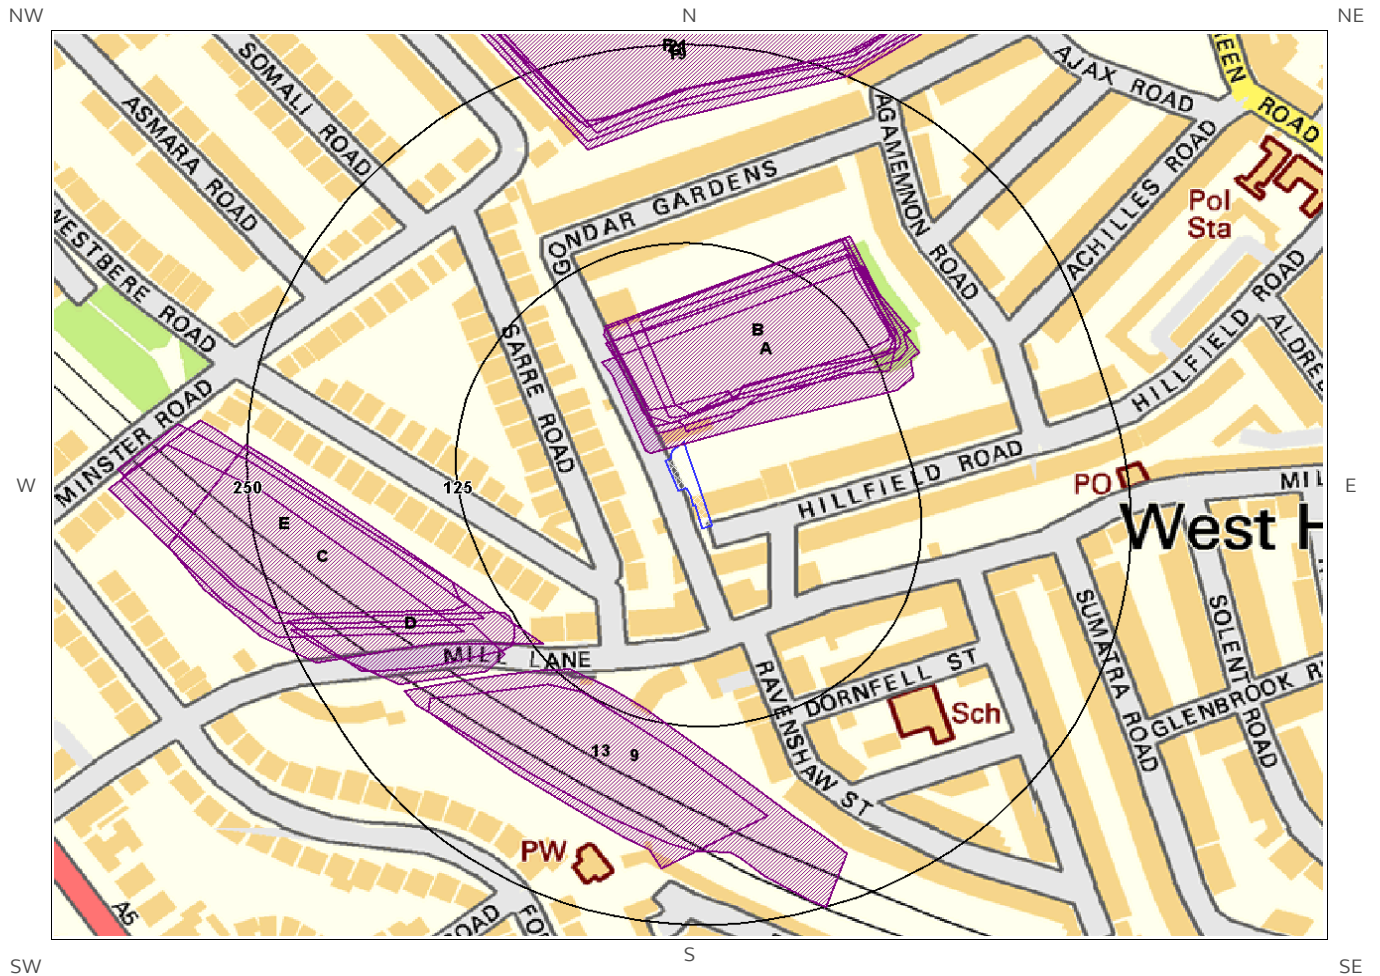


Is the property in an area where Radon Protection are required for new properties or extensions to existing ones as described in publication BR211 by the Building Research Establishment? No radon protective measures are necessary.

4 Ground Workings map



Ground Workings Legend

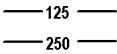© Crown copyright and database rights 2019.
 Ordnance Survey licence 100035207.

- | | | | |
|---|--------------------|---|----------------------------------|
|  | Site Outline |  | Historic Surface Ground Workings |
|  | Search Buffers (m) |  | Historic Underground Workings |
| | |  | Current Ground Workings |

4 Ground Workings

4.1 Historical Surface Ground Working Features derived from Historical Mapping

This dataset is based on Groundsure's unique Historical Land Use Database derived from 1:10,560 and 1:10,000 scale historical mapping

Are there any Historical Surface Ground Working Features within 250m of the study site boundary? Yes

ID	Distance (m)	Direction	NGR	Use	Date
1A	0.0	On Site	524836 185294	Reservoir	1911
2A	7.0	N	524842 185306	Reservoir	1920
3B	9.0	N	524842 185306	Covered Reservoir	1894
4B	14.0	N	524834 185314	Reservoir	1938
5B	16.0	N	524834 185314	Reservoir	1949
6B	18.0	N	524830 185316	Reservoir	1938
7B	23.0	N	524841 185316	Covered Reservoir	1993
8B	23.0	N	524841 185316	Covered Reservoir	1976
9	114.0	SW	524756 185025	Cuttings	1874
10C	120.0	SW	524553 185172	Cuttings	1993
11C	120.0	SW	524553 185172	Cuttings	1976
12C	120.0	SW	524553 185172	Cuttings	1966
13	126.0	SW	524739 185032	Cuttings	1894
14D	128.0	SW	524621 185117	Cuttings	1874
15E	141.0	SW	524563 185192	Cuttings	1873
16D	142.0	SW	524620 185110	Cuttings	1894
17E	145.0	SW	524556 185194	Cuttings	1894
18E	155.0	SW	524554 185180	Cuttings	1911
19	192.0	N	524865 185582	Cemetery	1911
20G	198.0	N	524862 185627	Cemetery	1920
21	201.0	N	524805 185551	Cemetery	1894

ID	Distance (m)	Direction	NGR	Use	Date
22F	206.0	N	524797 185636	Cemetery	1949
23F	206.0	N	524797 185636	Cemetery	1993
24F	206.0	N	524797 185636	Cemetery	1966
25F	206.0	N	524797 185636	Cemetery	1976
26G	208.0	N	524862 185639	Cemetery	1938
27G	210.0	N	524859 185638	Cemetery	1938

4.2 Historical Underground Working Features derived from Historical Mapping

This data is derived from the Groundsure unique Historical Land Use Database. It contains data derived from 1:10,000 and 1:10,560 historical Ordnance Survey Mapping and includes some natural topographical features (Shake Holes for example) as well as manmade features that may have implications for ground stability. Underground and mining features have been identified from surface features such as shafts. The distance that these extend underground is not shown.

Are there any Historical Underground Working Features within 1000m of the study site boundary? No

Database searched and no data found.


4.3 Current Ground Workings

This dataset is derived from the BGS BRITPITS database covering active; inactive mines; quarries; oil wells; gas wells and mineral wharves; and rail deposits throughout the British Isles.

Are there any BGS Current Ground Workings within 1000m of the study site boundary? No


Database searched and no data found.

5 Mining, Extraction & Natural Cavities map

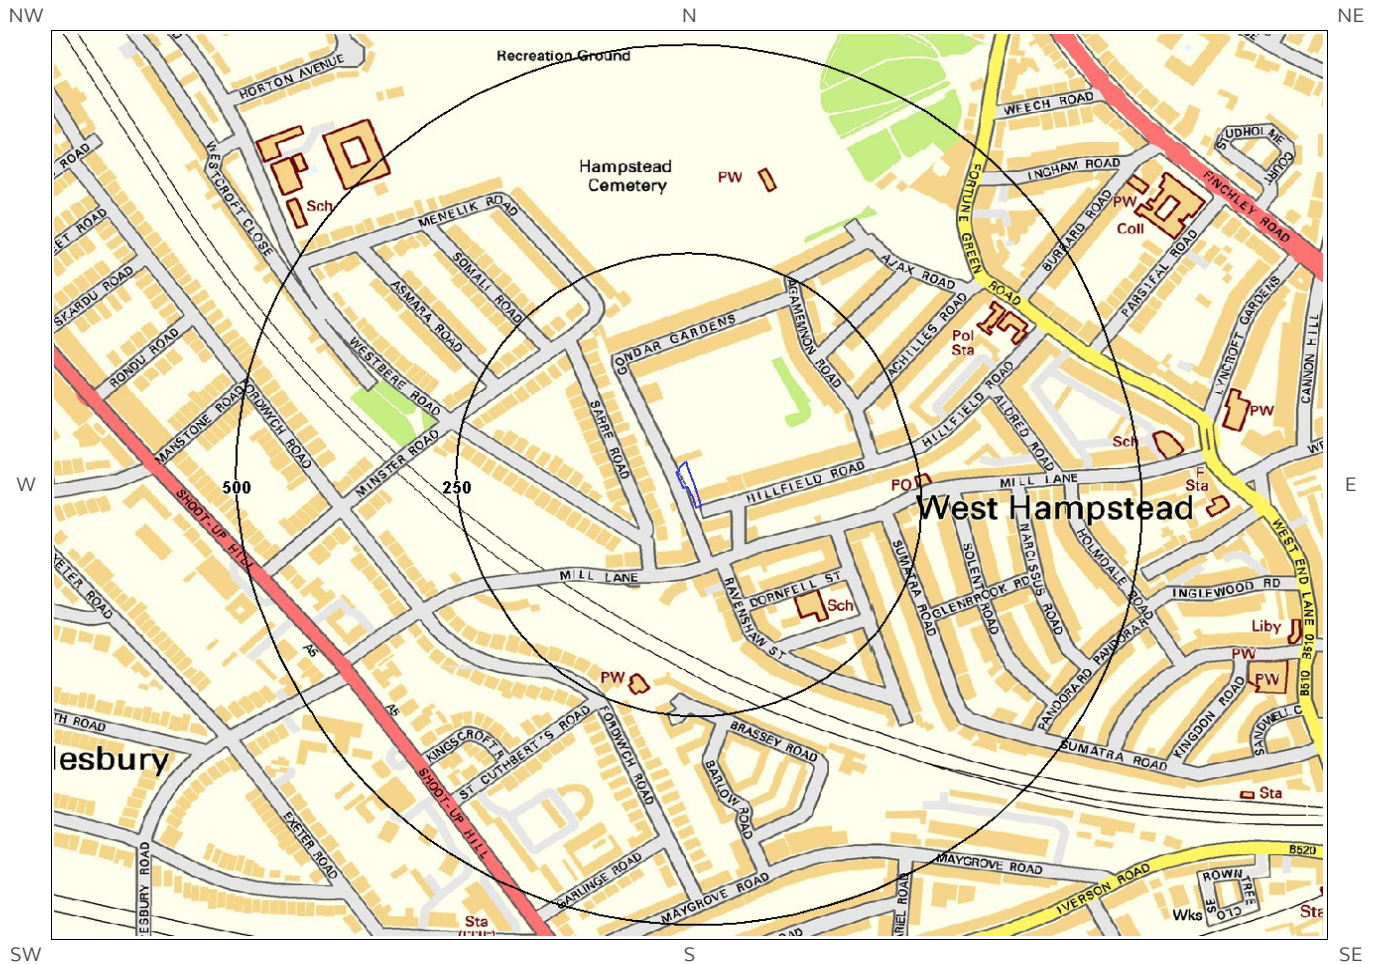

Mining, Extraction and Natural Cavities Legend

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.

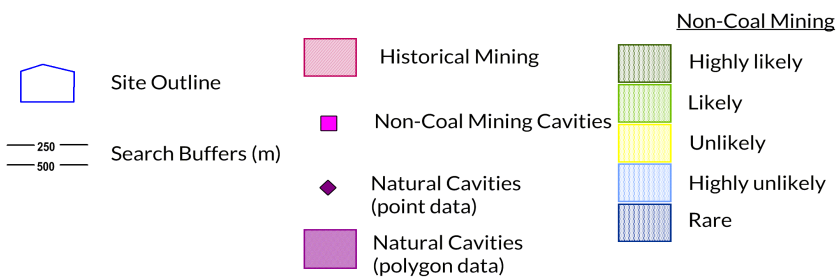

5 Mining, Extraction & Natural Cavities

5.1 Historical Mining

This dataset is derived from Groundsure unique Historical Land-use Database that are indicative of mining or extraction activities.

Are there any Historical Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.2 Coal Mining

This dataset provides information as to whether the study site lies within a known coal mining affected area as defined by the coal authority.

Are there any Coal Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.3 Johnson Poole and Bloomer

This dataset provides information as to whether the study site lies within an area where JPB hold information relating to mining.

Are there any JPB Mining areas within 1000m of the study site boundary? No

The following information provided by JPB is not represented on mapping: Database searched and no data found.

5.4 Non-Coal Mining

This dataset provides information as to whether the study site lies within an area which may have been subject to non-coal historic mining.

Are there any Non-Coal Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.5 Non-Coal Mining Cavities

This dataset provides information from the Peter Brett Associates (PBA) mining cavities database (compiled for the national study entitled “Review of mining instability in Great Britain, 1990” PBA has also continued adding to this database) on mineral extraction by mining.

Are there any Non-Coal Mining cavities within 1000m of the study site boundary? No

Database searched and no data found.

5.6 Natural Cavities

This dataset provides information based on the Peter Brett Associates natural cavities database. The dataset is made up of points and polygons. Where polygons are used these represent an area in which it is expected the cavities could be found. It does not indicate that cavities are present everywhere within the polygon, and caution should be used in the interpretation of this data.

Are there any Natural Cavities within 1000m of the study site boundary? No

Database searched and no data found.

5.7 Brine Extraction

This data provides information from the Cheshire Brine Subsidence Compensation Board.

Are there any Brine Extraction areas within 1000m of the study site boundary? No

Database searched and no data found.

5.8 Gypsum Extraction

This dataset provides information on Gypsum extraction from British Gypsum records.

Are there any Gypsum Extraction areas within 1000m of the study site boundary? No

Database searched and no data found.

5.9 Tin Mining

This dataset provides information on tin mining areas and is derived from tin mining records. This search is based upon postcode information to a sector level..

Are there any Tin Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.10 Clay Mining

This dataset provides information on Kaolin and Ball Clay mining from relevant mining records.


Are there any Clay Mining areas within 1000m of the study site boundary?

No

Database searched and no data found.

6 Natural Ground Subsidence

6.1 Shrink-Swell Clay map

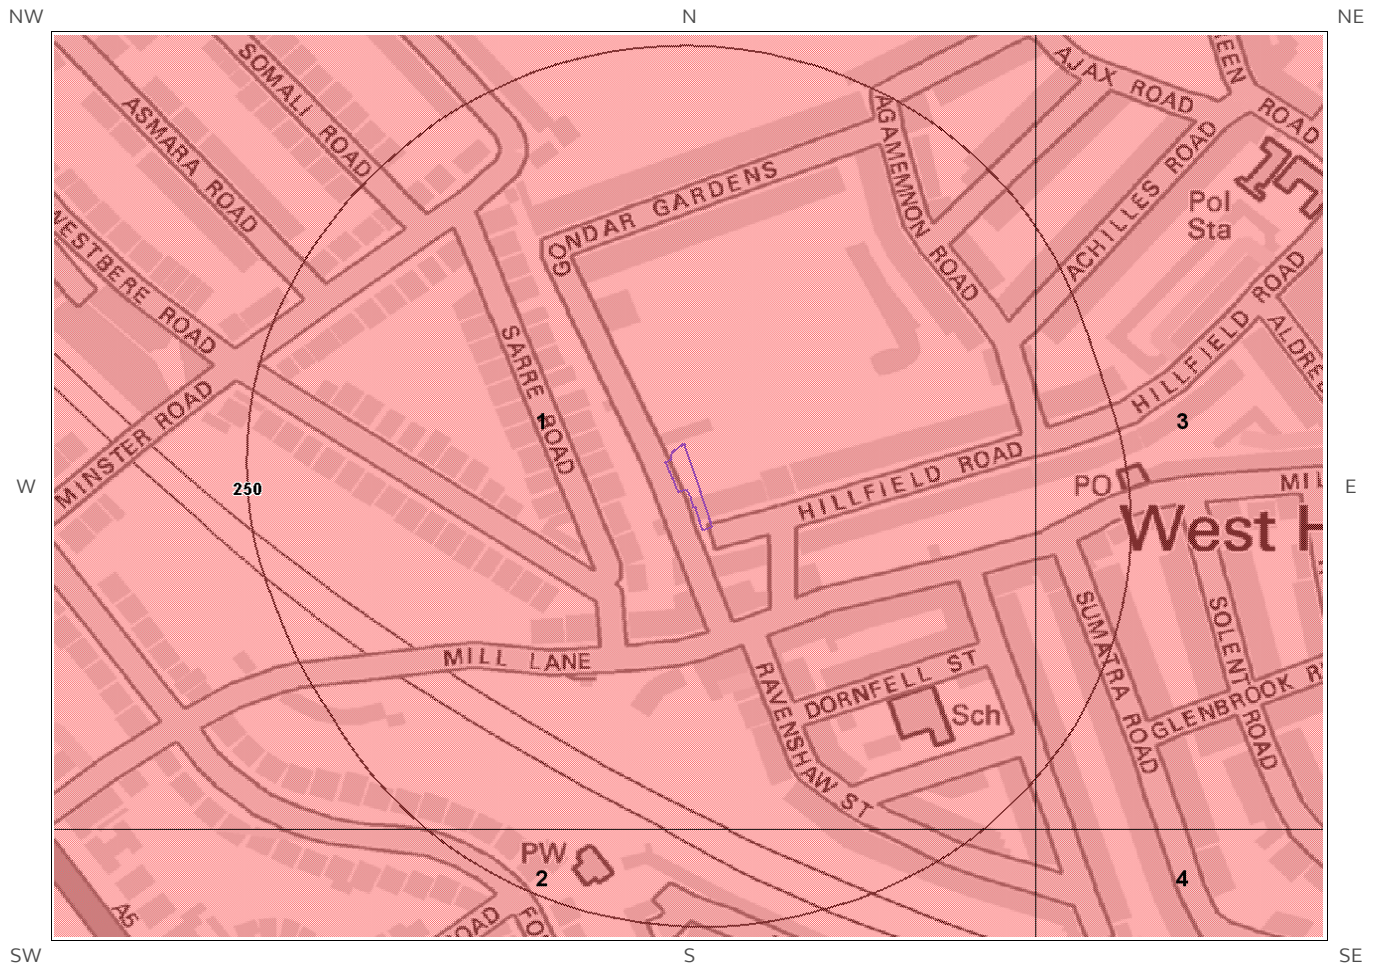


Shrink Swell Clay Legend


© Crown copyright and database rights 2019.
 Ordnance Survey licence 100035207.




6.2 Landslides map

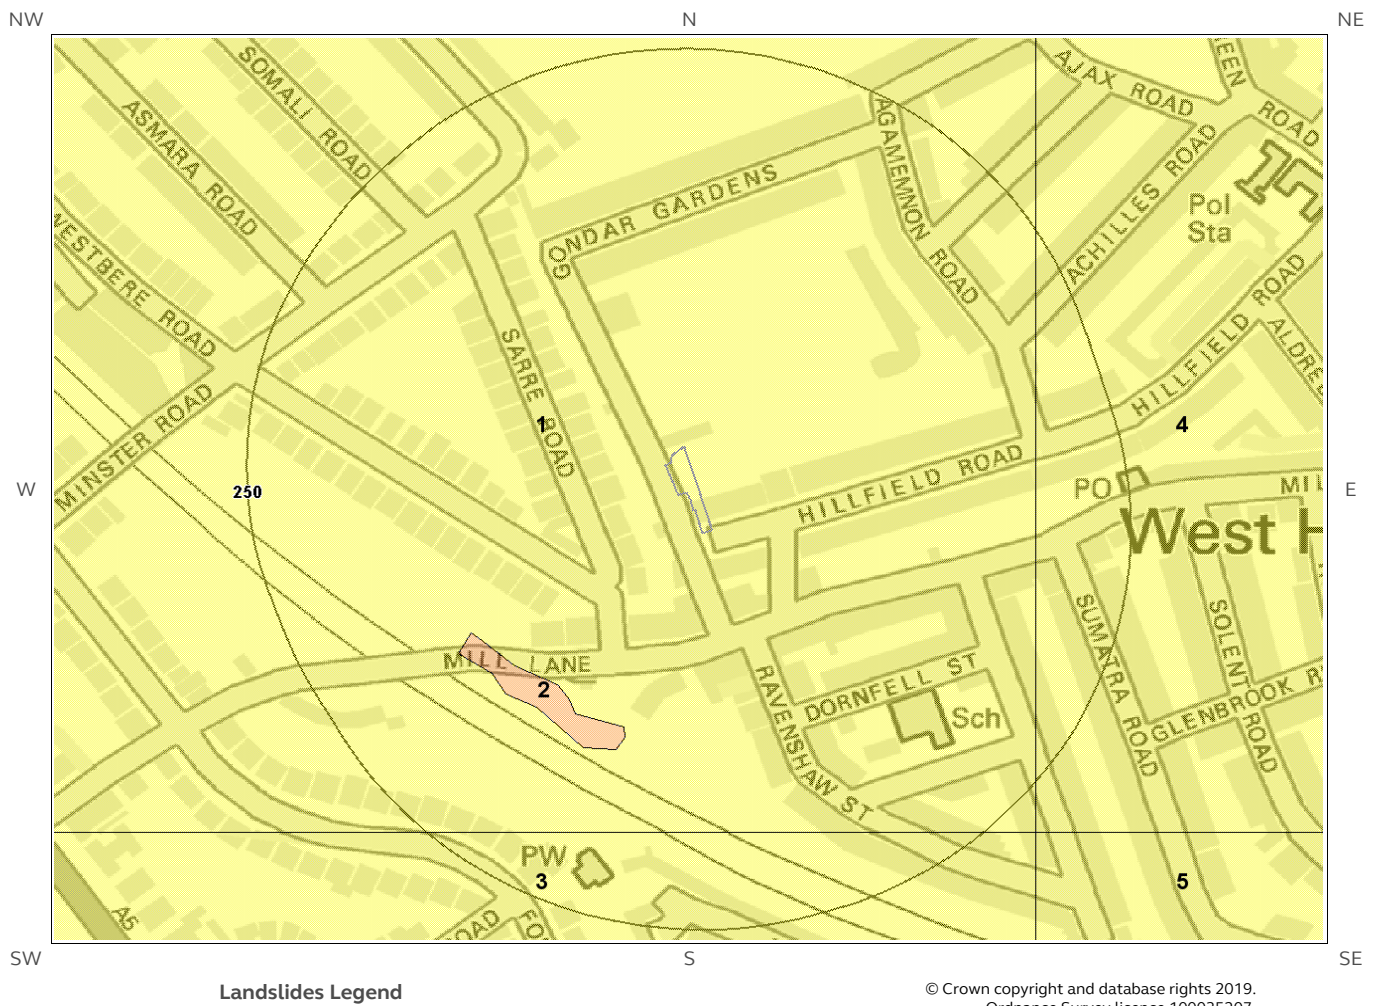

6.3 Ground Dissolution of Soluble Rocks map

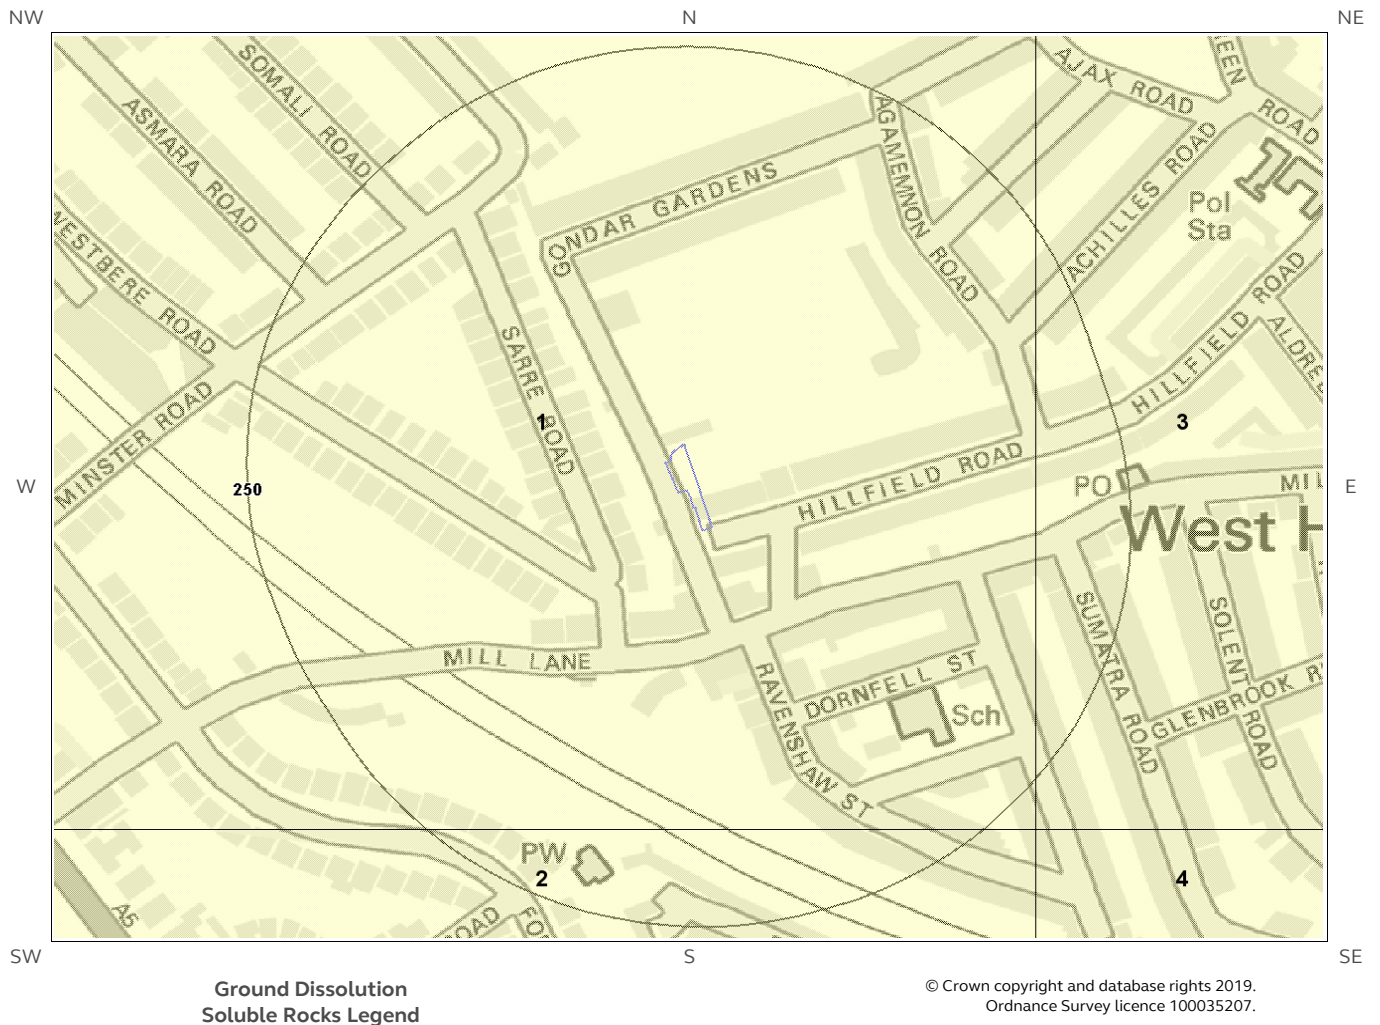

6.4 Compressible Deposits map

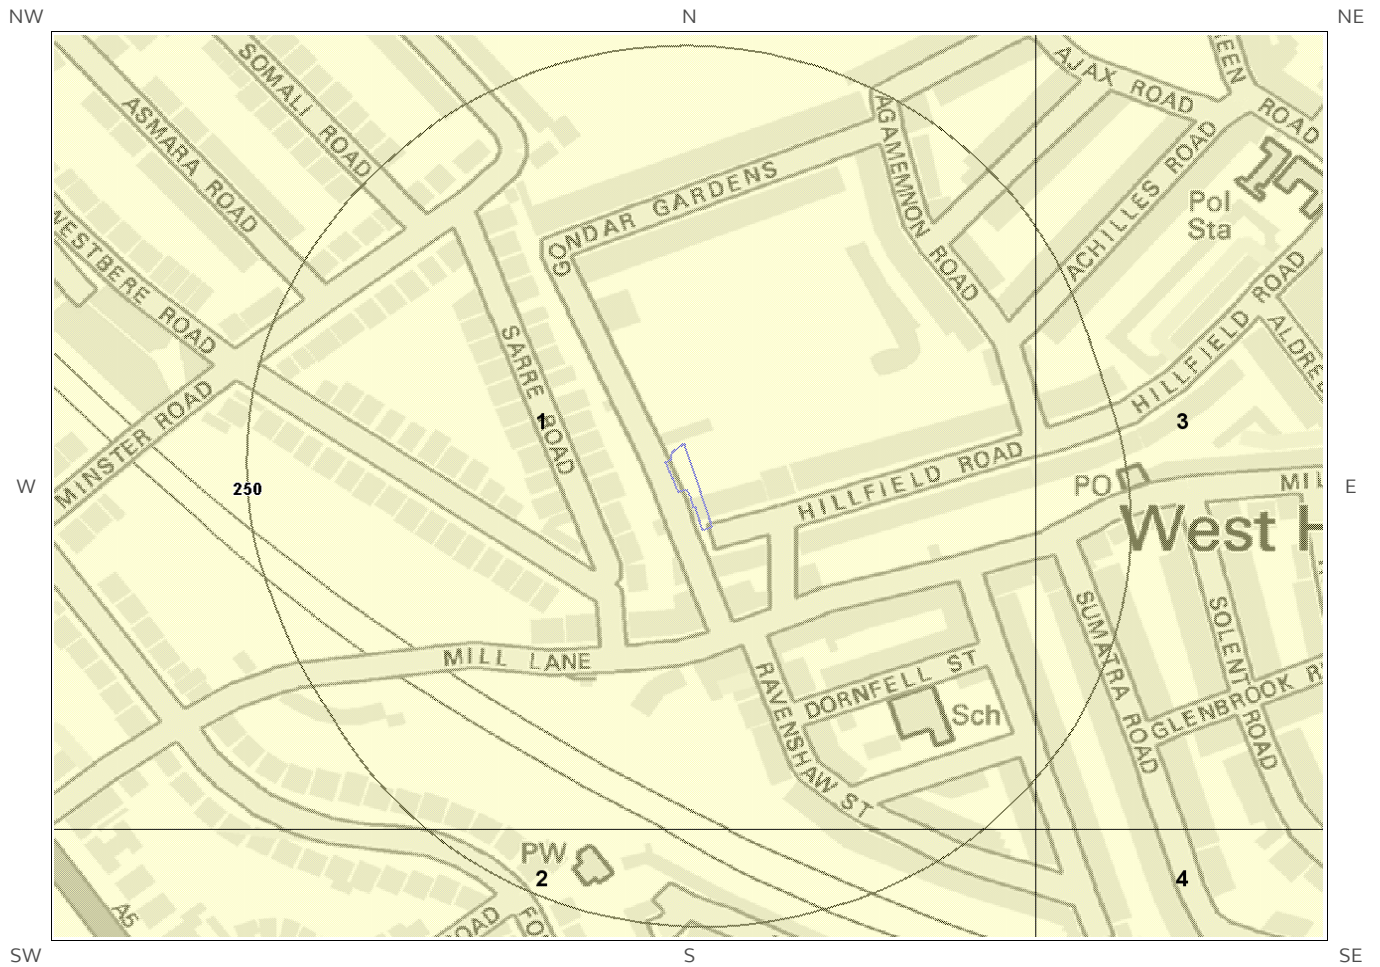


Compressible Deposits Legend

© Crown copyright and database rights 2019.
 Ordnance Survey licence 100035207.



6.5 Collapsible Deposits map

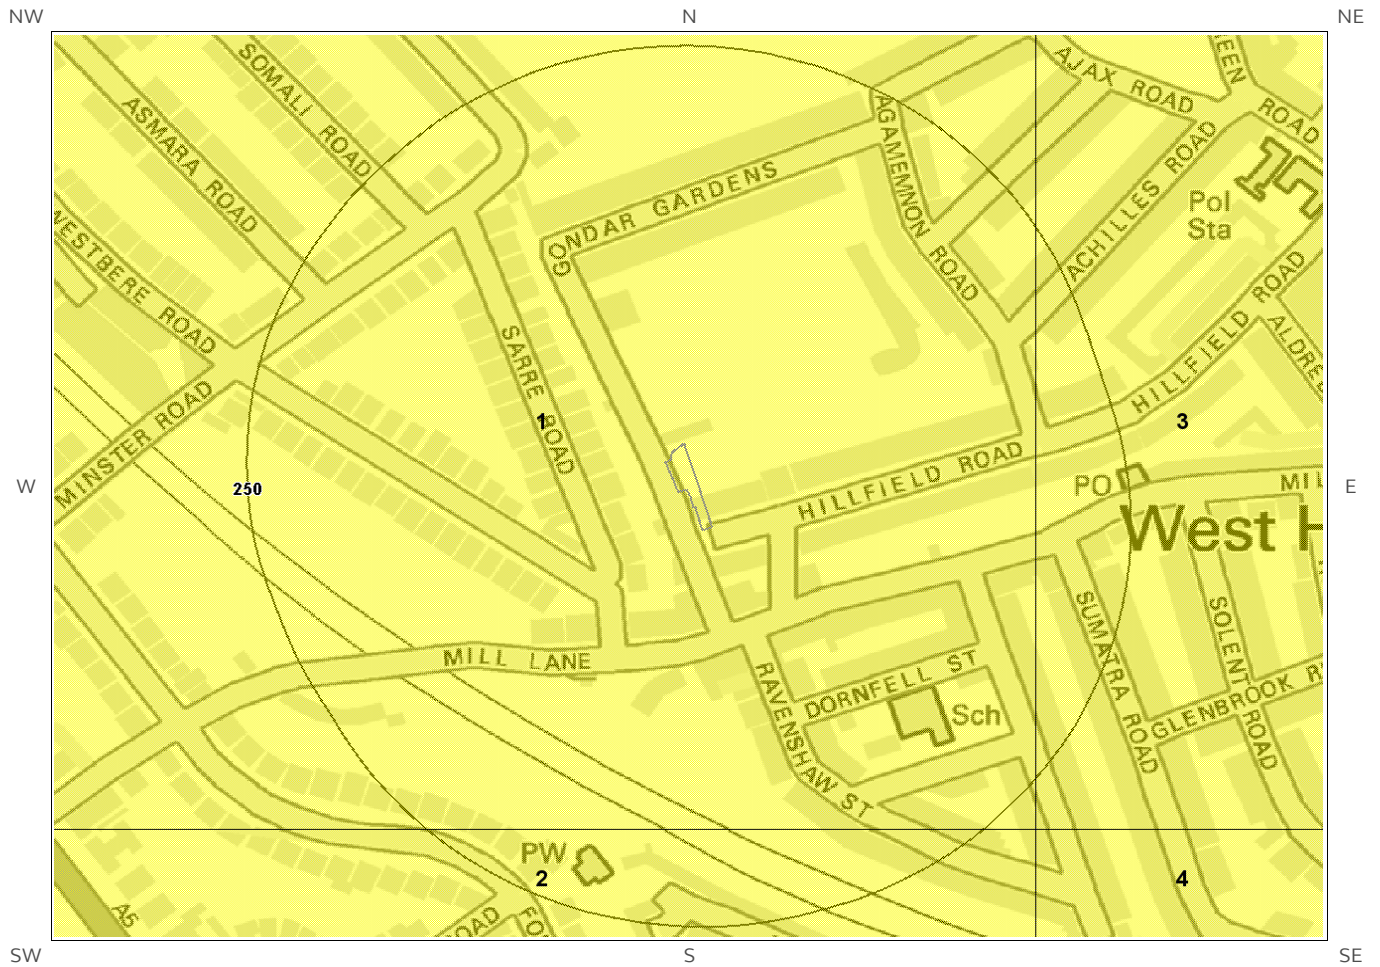


Collapsible Deposits Legend

© Crown copyright and database rights 2019.
 Ordnance Survey licence 100035207.



6.6 Running Sand map

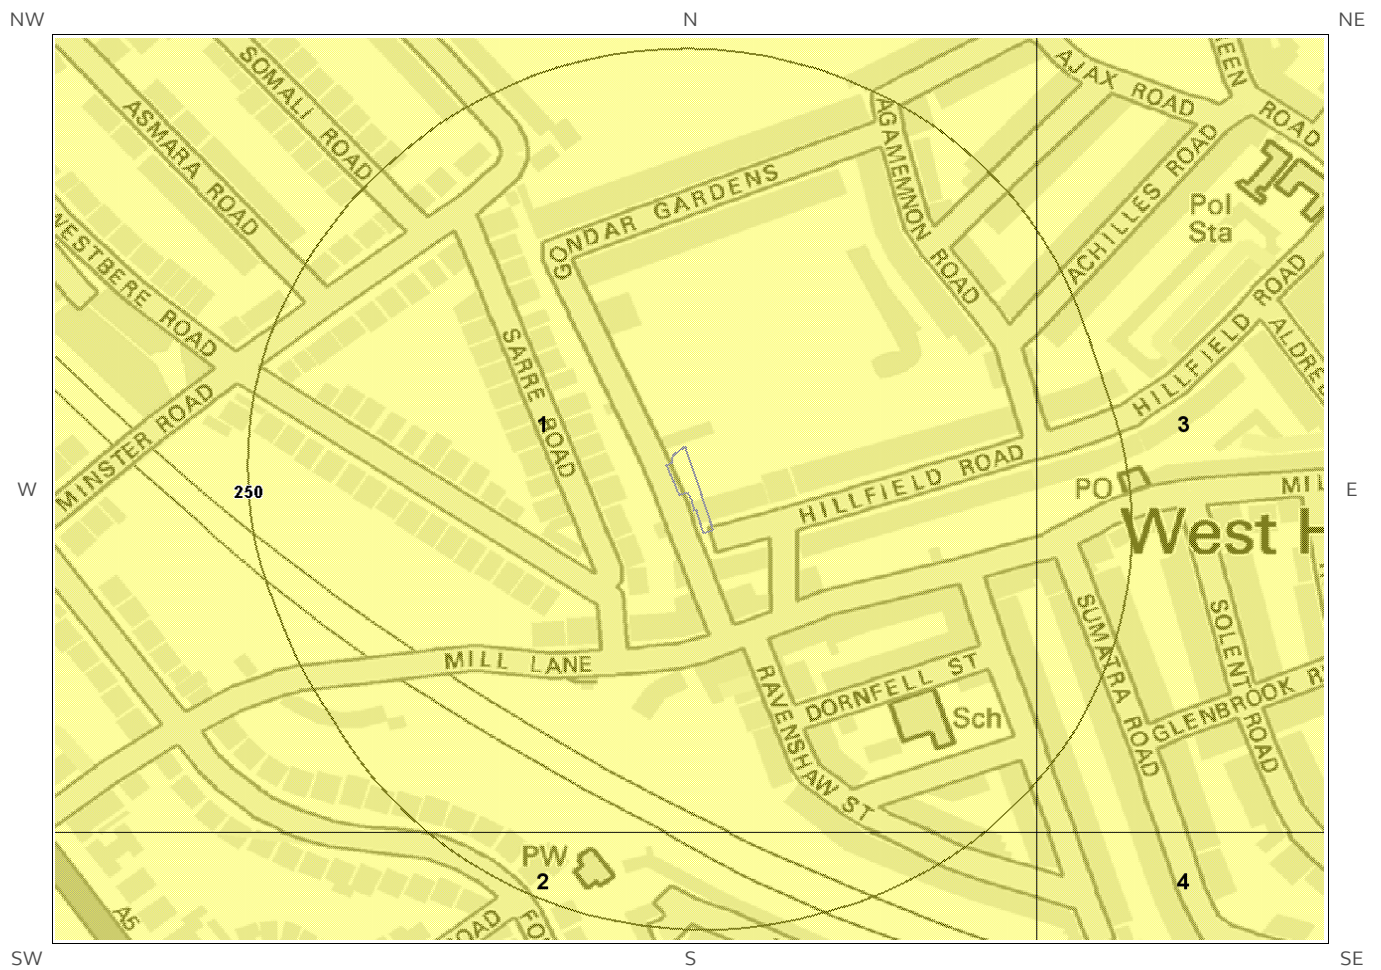

Running Sand Legend

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.



6 Natural Ground Subsidence

The National Ground Subsidence rating is obtained through the 6 natural ground stability hazard datasets, which are supplied by the British Geological Survey (BGS).

The following GeoSure data represented on the mapping is derived from the BGS Digital Geological map of Great Britain at 1:50,000 scale.

What is the maximum hazard rating of natural subsidence within the study site* boundary? Moderate

6.1 Shrink-Swell Clays

The following Shrink Swell information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Moderate	Ground conditions predominantly high plasticity. Do not plant or remove trees or shrubs near to buildings without expert advice about their effect and management. For new build, consideration should be given to advice published by the National House Building Council (NHBC) and the Building Research Establishment (BRE). There is a probable increase in construction cost to reduce potential shrink-swell problems. For existing property, there is a probable increase in insurance risk during droughts or where vegetation with high moisture demands is present.

6.2 Landslides

The following Landslides information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Very Low	Slope instability problems are unlikely to be present. No special actions required to avoid problems due to landslides. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with landslides.

* This includes an automatically generated 50m buffer zone around the site

6.3 Ground Dissolution of Soluble Rocks

The following Ground Dissolution information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Negligible	Soluble rocks are present, but unlikely to cause problems except under exceptional conditions. No special actions required to avoid problems due to soluble rocks. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with soluble rocks.

6.4 Compressible Deposits

The following Compressible Deposits information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Negligible	No indicators for compressible deposits identified. No special actions required to avoid problems due to compressible deposits. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with compressible deposits.

6.5 Collapsible Deposits

The following Collapsible Rocks information provided by the British Geological Survey:


ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Very Low	Deposits with potential to collapse when loaded and saturated are unlikely to be present. No special ground investigation required or increased construction costs or increased financial risk due to potential problems with collapsible deposits.

6.6 Running Sands

The following Running Sands information provided by the British Geological Survey:


ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Very Low	Very low potential for running sand problems if water table rises or if sandy strata are exposed to water. No special actions required, to avoid problems due to running sand. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with running sand.

7 Borehole Records map

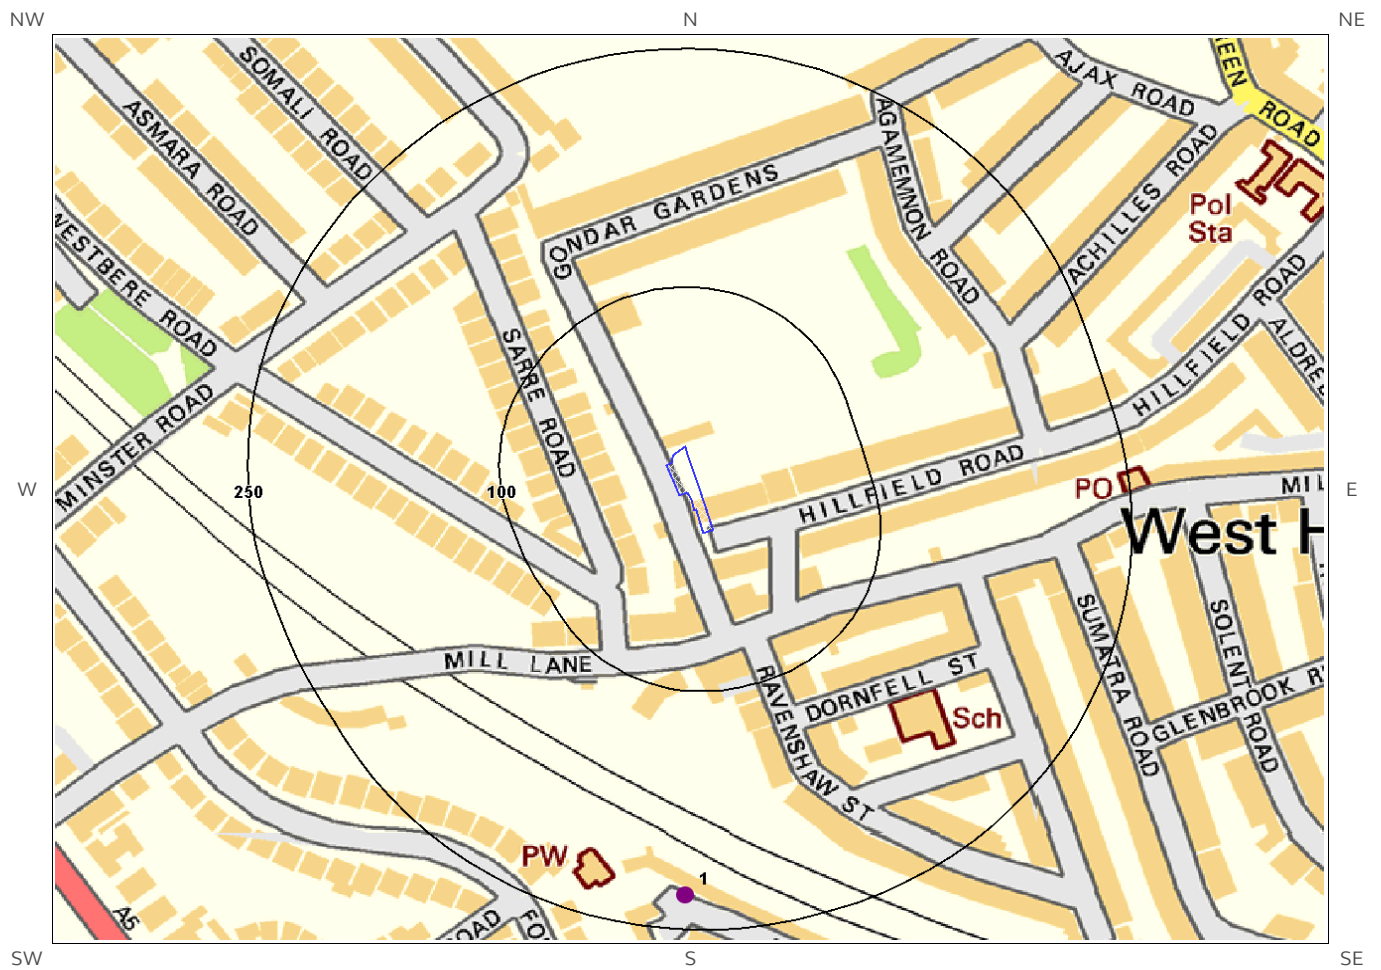

Borehole Records Legend

© Crown copyright and database rights 2019.
 Ordnance Survey licence 100035207.

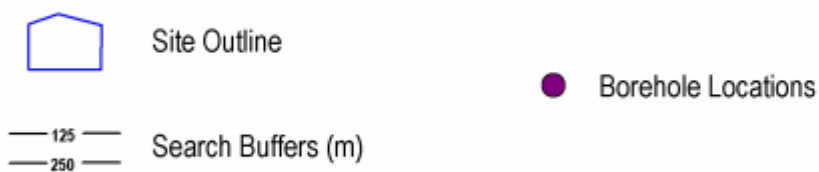

7 Borehole Records

The systematic analysis of data extracted from the BGS Borehole Records database provides the following information.

Records of boreholes within 250m of the study site boundary:

1

ID	Distance (m)	Direction	NGR	BGS Reference	Drilled Length	Borehole Name
1	229.0	S	524790 184960	TQ28SW85	15.24	MAPESBURY RD WILLESDEN

The borehole records are available using the hyperlinks below: Please note that if the donor of the borehole record has requested the information be held as commercial-in-confidence, the additional data will be held separately by the BGS and a formal request must be made for its release.

#1: scans.bgs.ac.uk/sobi_scans/boreholes/590993

8 Estimated Background Soil Chemistry

Records of background estimated soil chemistry within 250m of the study site boundary:


1

For further information on how this data is calculated and limitations upon its use, please see the Groundsure Geo Insight User Guide, available on request.

Distance (m)	Direction	Sample Type	Arsenic (As)	Cadmium (Cd)	Chromium (Cr)	Nickel (Ni)	Lead (Pb)
0.0	On Site	London	No data	No data	No data	No data	No data



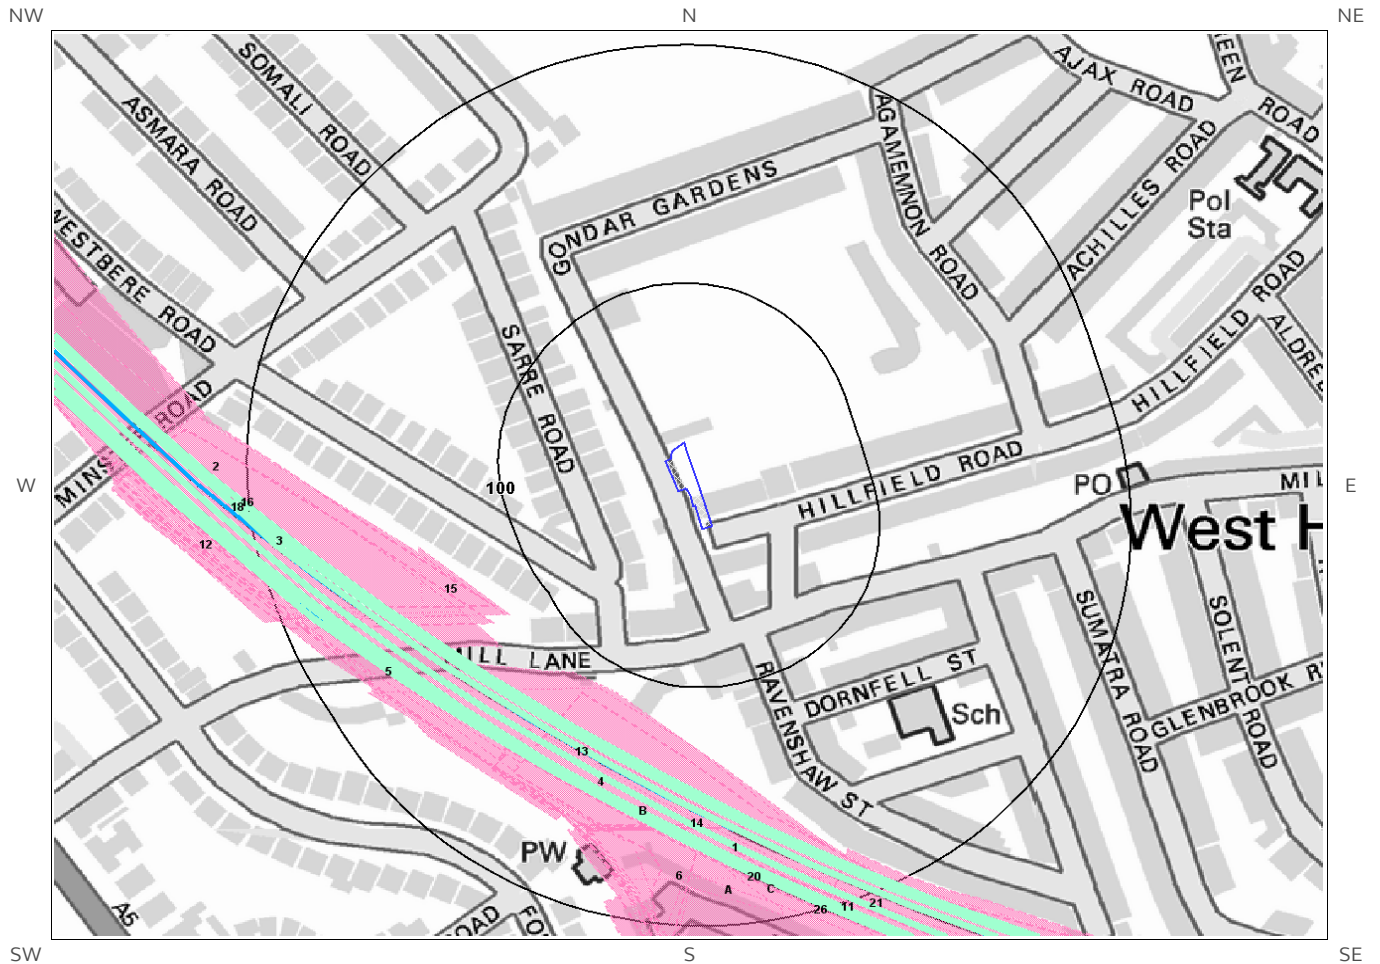









*As this data is based upon underlying 1:50,000 scale geological information, a 50m buffer has been added to the search radius.

9 Railways and Tunnels map



Railways and Tunnels Legend

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.
© OpenStreetMapContributors

	Underground or Partially Underground Railway / Subway System		Railway Track (OpenStreetMap)
	Site Outline		High Speed 2
	250 Search Buffers (m)		High Speed 2 Revised Proposed Route
	500 Search Buffers (m)		Crossrail 1
	Railway Tunnel (OS Mapping)		Railway and/or Tunnel Feature from Historical Mapping
	Abandoned or Dismantled Railway (OpenStreetMap)		
	Railway Track (OS Mapping)		

9 Railways and Tunnels

9.1 Tunnels

This data is derived from OpenStreetMap and provides information on the possible locations of underground railway systems in the UK - the London Underground, the Tyne & Wear Metro and the Glasgow Subway.

Have any underground railway lines been identified within the study site boundary? No

Have any underground railway lines been identified within 250m of the study site boundary? No

Database searched and no data found.

Any records that have been identified are represented on the Railways and Tunnels map.

This data is derived from Ordnance Survey mapping and provides information on the possible locations of railway tunnels forming part of the UK overground railway network.

Have any other railway tunnels been identified within the site boundary? No

Have any other railway tunnels been identified within 250m of the site boundary? No

Database searched and no data found.

Any records that have been identified are represented on the Railways and Tunnels map.

9.2 Historical Railway and Tunnel Features

This data is derived from Groundsure's unique Historical Land-use Database and contains features relating to tunnels, railway tracks or associated works that have been identified from historical Ordnance Survey mapping.

Have any historical railway or tunnel features been identified within the study site boundary? No

Have any historical railway or tunnel features been identified within 250m of the study site boundary? Yes

ID	Distance (m)	Direction	NGR	Details	Date
13	115	SW	n/a	Railway	1915
14	118	SW	n/a	Railway	1894
1	126	SW	525047 184912	Railway Sidings	1894
15	127	SW	n/a	Railway	1915
16	129	SW	n/a	Railway	1896
2	131	SW	523696 186292	Railway Sidings	1938
3	137	SW	524563 185188	Railway Sidings	1920

ID	Distance (m)	Direction	NGR	Details	Date
17B	149	SW	524874 184960	Railway Sidings	1915
18	149	SW	n/a	Railway	1915
4	150	SW	524752 185035	Railway Sidings	1966
19B	152	SW	524871 184958	Railway Sidings	1935
20	160	SW	524950 184922	Railway Sidings	1896
5	178	SW	524585 185115	Railway Sidings	1949
21	178	S	524988 184922	Railway Sidings	1871
6	179	SW	524888 184896	Railway Sidings	1920
22	183	SW	524565 185131	Railway Sidings	1953
7A	187	S	524863 184896	Railway Sidings	1967
8A	187	S	524863 184896	Railway Sidings	1973
23C	188	S	524866 184902	Railway Sidings	1955
24C	189	S	524867 184901	Railway Sidings	1953
25C	189	S	524867 184901	Railway Sidings	1970
9A	191	S	524866 184903	Railway Sidings	1957
10A	192	S	524860 184896	Railway Sidings	1951
11	204	S	525095 184892	Railway Sidings	1874
26	220	S	n/a	Railway	1915
12	233	W	524509 185178	Railway Sidings	1938

Any records that have been identified are represented on the Railways and Tunnels map.

9.3 Historical Railways

This data is derived from OpenStreetMap and provides information on the possible alignments of abandoned or dismantled railway lines in proximity to the study site.

Have any historical railway lines been identified within the study site boundary? No

Have any historical railway lines been identified within 250m of the study site boundary? No

Database searched and no data found.

Multiple sections of the same track may be listed in the detail above

Any records that have been identified are represented on the Railways and Tunnels map.

9.4 Active Railways

These datasets are derived from Ordnance Survey mapping and OpenStreetMap and provide information on the possible locations of active railway lines in proximity to the study site.

Have any active railway lines been identified within the study site boundary? No

Have any active railway lines been identified within 250m of the study site boundary? Yes

Distance (m)	Direction	Name	Type
146	SW	Not given	Rail
146	SW	Not given	Rail
150	SW	Not given	Rail
150	SW	Not given	Rail
156	SW	Not given	Rail
156	SW	Not given	Rail
157	SW	Not given	Multi Track
157	SW	Not given	Multi Track
164	SW	Midland Main Line	Rail
164	SW	Midland Main Line	Rail
173	SW	Not given	Rail
173	SW	Midland Main Line	Rail
173	SW	Not given	Rail
173	SW	Midland Main Line	Rail
175	SW	Not given	Multi Track
175	SW	Not given	Multi Track
177	SW	Not given	Rail
177	SW	Not given	Rail

Multiple sections of the same track may be listed in the detail above
Any records that have been identified are represented on the Railways and Tunnels map.

9.5 Railway Projects

These datasets provide information on the location of large scale railway projects High Speed 2 and Crossrail 1 .

Is the study site within 5km of the route of the High Speed 2 rail project? Yes

Is the study site within 500m of the route of the Crossrail 1 rail project? No

Further information on proximity to these routes, the project construction status and associated works can be obtained through the purchase of a Groundsure HS2 and Crossrail 1 Report.

The route data has been digitised from publicly available maps by Groundsure. The route as provided relates to the Crossrail 1 project only, and does not include any details of the Crossrail 2 project, as final details of the route for Crossrail 2 are still under consultation.

Please note that this assessment takes account of both the original Phase 2b proposed route and the amended route proposed in 2016. As the Phase 2b route is still under consultation, Groundsure are providing information on both options until the final route is formally confirmed. Practitioners should take account of this uncertainty when advising clients.

Contact Details

Groundsure Helpline
Telephone: 08444 159 000
info@groundsure.com



British Geological Survey Enquiries

Kingsley Dunham Centre
Keyworth, Nottingham NG12 5GG
Tel: 0115 936 3143.
Fax: 0115 936 3276.
Email: enquiries@bgs.ac.uk
Web: www.bgs.ac.uk

BGS Geological Hazards Reports and general geological enquiries



British Geological Survey
NATURAL ENVIRONMENT RESEARCH COUNCIL

British Gypsum

British Gypsum Ltd
East Leake
Loughborough
Leicestershire
LE12 6HX



The Coal Authority

200 Lichfield Lane
Mansfield
Notts NG18 4RG
Tel: 0345 7626 848
DX 716176 Mansfield 5
www.coal.gov.uk



The Coal Authority

Public Health England

Public information access office
Public Health England, Wellington House
133-155 Waterloo Road, London, SE1 8UG
<https://www.gov.uk/government/organisations/public-health-england>
Email: enquiries@phe.gov.uk
Main switchboard: 020 7654 8000



Public Health England

Johnson Poole & Bloomer Limited

Harris and Pearson Building, Brettell Lane
Brierley Hill, West Midlands
DY5 3LH
Tel: +44 (0) 1384 262 000
Email: enquiries.gs@jpb.co.uk
Website: www.jpb.co.uk



Ordnance Survey

Adanac Drive, Southampton
SO16 0AS
Tel: 08456 050505
Website: <http://www.ordnancesurvey.co.uk/>



Getmapping PLC

Virginia Villas, High Street, Hartley Witney,
Hampshire RG27 8NW
Tel: 01252 845444
Website: <http://www1.getmapping.com/>



Peter Brett Associates
Caversham Bridge House
Waterman Place
Reading
Berkshire RG1 8DN
Tel: +44 (0)118 950 0761 E-mail: reading@pba.co.uk
Website: <http://www.peterbrett.com/home>



Acknowledgements: Ordnance Survey © Crown Copyright and/or Database Right. All Rights Reserved. Licence Number [03421028].
This report has been prepared in accordance with the Groundsure Ltd standard Terms and Conditions of business for work of this nature.

Standard Terms and Conditions

Groundsure's Terms and Conditions can be viewed online at this link:
<https://www.groundsure.com/terms-and-conditions-feb11-2019>