



**Level Monitoring**

**Our Ref:** [REDACTED] **Date of Issue:** 18/11/2020

**Provider Details**

[REDACTED]

**Monitoring Details**

<b>Instruction Date:</b>	21/02/2019		
<b>Number of visits</b>	7	<b>Visit Frequency (Wks)</b>	8

**Visit Dates (future dates are estimated)**

<b>Setup</b>	<b>1</b>	<b>2</b>	<b>3</b>	<b>4</b>	<b>5</b>	<b>6</b>
27/03/19	22/05/19	17/07/19	11/09/19	06/11/19	01/01/20	26/02/20

**Client Details**

Insurance Co.:	
Client Ref:	[REDACTED]
Client Name:	Sedgwick
Technical Mgr:	Mark Wood
Customer support	Kerry Gilbert
Tel:	[REDACTED]
Email:	

**Risk Address**

Occupier:	Removed for data protection purposes
Address:	
Address:	Arkwright Road
Town:	
County:	LONDON
Post Code:	NW3 6DG
Contact Name	Removed for data protection purposes

**Level Monitoring**

Our Ref: [REDACTED]

Date of Issue: 18/11/2020

**Visit Notes**

Access to points difficult, bushes and shrubs


18/11/2020 No access to point due due to overgrowth



**Level Monitoring - Site Sketch**

Our Ref: [REDACTED]

Date of Issue: 18/11/2020

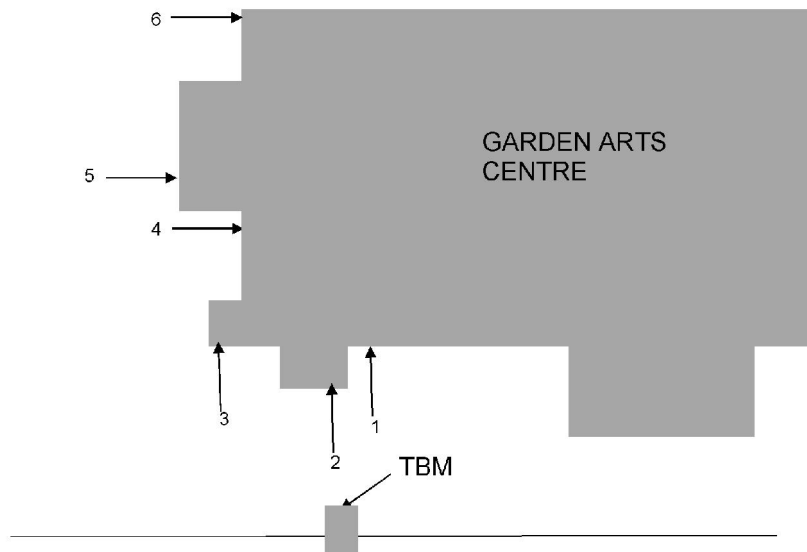



**Level Monitoring - Reduced Levels (in metres)**

Our Ref: [REDACTED] Date of Issue: 18/11/20

Reading Date	27/3/19	15/7/19	1/10/19	14/11/19	16/1/20	20/2/20	15/4/20	11/6/20	18/11/20			
Point / Reading	1	2	3	4	5	6	7	8	9	10	11	12
1	10.9527	10.9518	10.9514	10.9520	10.9534	10.9540	10.9541	10.9542	10.9540			
2	10.8375	10.8367	10.8354	10.8310	10.8342	10.8383	10.8384	10.8392				
3	10.7364	10.7353	10.7333	10.7250	10.7314	10.7346	10.7365	10.7379	10.7357			
4	10.7031	10.7018	10.7003	10.6990	10.7003	10.7029	10.7032	10.7035	10.7033			
5	10.6914	10.6898	10.6877	10.6870	10.6888	10.6915	10.6915	10.6918	10.6916			
6	10.8872	10.8852	10.8832	10.8840	10.8851	10.8874	10.8877	10.8878	10.8874			
7												
8												
9												
10												
11												
12												
13												
14												
15												
16												
Tech Initials	MT	AH	AH	JM	CD	AJ	AJ	AJ	RM			
Level S/N.	521947	520038	521947	521947	90570	521947	521947	521947	2939			



