

## BRE Global Test Report

**Ad-hoc fire resistance** test following the procedures and criteria of EN1363-1:2012 on two Wates fire cavity barriers (Burnham Profile) installed within a 200mm-deep cast concrete floor.

**Prepared for:** Wates Construction Ltd.

**Date:** 04 October 2019

**Report Number:** P115309-1000 Issue: 1

BRE Global Ltd  
Watford, Herts  
WD25 9XX

Customer Services 0333 321 8811

From outside the UK:  
T + 44 (0) 1923 664000  
F + 44 (0) 1923 664010  
E [enquiries@bre.co.uk](mailto:enquiries@bre.co.uk)  
[www.bre.co.uk](http://www.bre.co.uk)

Prepared for:  
Wates Construction Ltd.  
Wates House  
11 Ridgeway  
Quinton Business Park  
Birmingham  
B32 1AF



---

## Prepared by

---

Name L.Popkin

Position Test Engineer

Date 04 October 2019

Signature

A handwritten signature in blue ink, appearing to read 'L Popkin'.

---

## Authorised by

---

Name T. Baker

Position Laboratory Manager

Date 04 October 2019

Signature

A handwritten signature in blue ink, appearing to read 'T Baker'.

This report is made on behalf of BRE Global and may only be distributed in its entirety, without amendment, and with attribution to BRE Global Ltd to the extent permitted by the terms and conditions of the contract. Test results relate only to the specimens tested. BRE Global has no responsibility for the design, materials, workmanship or performance of the product or specimens tested. This report does not constitute an approval, certification or endorsement of the product tested and no such claims should be made on websites, marketing materials, etc. Any reference to the results contained in this report should be accompanied by a copy of the full report, or a link to a copy of the full report.

BRE Global's liability in respect of this report and reliance thereupon shall be as per the terms and conditions of contract with the client and BRE Global shall have no liability to third parties to the extent permitted in law.

Opinions and interpretations expressed herein are outside the scope of UKAS Accreditation



---

## Table of Contents

---

<b>Summary</b>	<b>3</b>
<b>1 Objective</b>	<b>4</b>
<b>2 Test construction</b>	<b>4</b>
2.1 Construction	4
2.1.1 General	4
2.1.2 Seal A (Mineral wool)	4
2.1.3 Seal B (Cement)	4
2.1.4 Final construction	4
<b>3 Conditioning</b>	<b>5</b>
<b>4 Test procedure</b>	<b>5</b>
4.1 General	5
4.2 Furnace control	5
4.3 Temperature measurements on non-fire face	5
<b>5 Results</b>	<b>6</b>
5.1 Observations	6
5.2 Temperatures recorded on non-fireside (unexposed) face	6
<b>6 Performance criteria</b>	<b>7</b>
<b>7 References</b>	<b>7</b>
<b>8 Figures</b>	<b>8</b>
<b>9 Graphs</b>	<b>12</b>
<b>10 Photographs</b>	<b>18</b>



---

## Summary

---

Two Burnham profile Wates Construction Ltd cavity barriers incorporated into the long edges of a 250mm x 1800mm x 300mm concrete slab with 12mm cement board backing and sandwiched between two 763mm x 1800mm x 200mm concrete slabs were submitted to an ad-hoc fire resistance test following the procedures and criteria of EN1363-1:2012<sup>1</sup>, for a duration of 143 minutes on 28 May 2019.

The seals were labelled Seal A and Seal B and are marked in figures.

The sealing systems satisfied the criteria as follows:

Seal A	Mineral wool RWA-45 packed 25mm deep and sealed with 10mm Firepro non-intumescent mastic (P12/391)	Integrity:	143min (no failure during test)
		Insulation:	143min (no failure during test)
Seal B	Profile prepared with Sika Monotop 610 Primer (C42/321). Profile infilled with Sika Monotop Microconcrete (C4/322)	Integrity:	143min (no failure during test)
		Insulation:	143min (no failure during test)



---

## 1 Objective

---

To determine at the request of Wates Construction Ltd, the performance of two Blashford Profile cavity barriers each with a different sealing system, when subjected to an ad-hoc fire resistance test following the procedures and criteria of EN1363-1:2012<sup>1</sup>.

---

## 2 Test construction

---

### 2.1 Construction

#### 2.1.1 General

Two cast concrete slabs nominally 763mm x 1800mm x 200mm-thick and a third concrete slab nominally 250mm x 1800mm x 300mm-thick incorporating two fully formed 25mm deep Burnham profiles in the longitudinal edge, referenced in this report as Seal A and Seal B.

The test construction is shown in Figures and before test in Photographs.

#### 2.1.2 Seal A (Mineral wool)

The seal was delivered to BRE for test, fully formed off site by the sponsor, comprising of Mineral wool RWA-45 packed 25mm deep and sealed with 10mm Firepro non-intumescent mastic (P12/391) with one layer of 12mm Cement board fixed to the outer face.

#### 2.1.3 Seal B (Cement)

The seal was delivered to BRE for test, fully formed off site by the sponsor, comprising of Sika Monotop 610 Primer (C42/321). Profile infilled with Sika Monotop Microconcrete (C4/322) with one layer of 12mm Cement board fixed to the outer face. A bead of FirePro Fire resistant silicone sealant was gunned on the top of the cement board.

#### 2.1.4 Final construction

FirePro Fire resistant silicone sealant was gunned on one side face of one of the 763mm x 1800mm x 200mm-thick concrete slabs and placed in the test frame, the 200mm x 1800mm x 300mm-thick profiled slab was pressed against it. The remaining 763mm x 1800mm x 200mm-thick concrete slab had a layer of FirePro Fire resistant silicone sealant gunned on one side face and placed in the test frame against the other edge of the profiled slab.

Strips of 180mm-thick Rockwool Rainscreen Duo slab were positioned on the outer edges of the cement boards and fixed with SFS-Intec Mids-s Insulation fastener with stainless steel plate washer (H92/777).

The test construction is shown in Figures and before test in Photographs.



### 3 Conditioning

A representative sample of Rockwool Rainscreen Duo was taken during construction, weighed and then oven-dried to determine the free moisture content by weight loss technique. The moisture content by dry weight is given below.

**Table:** Moisture content

	Oven drying temperature	Moisture content % by dry weight	Measured Density (kg/m <sup>3</sup> )
Rockwool Rainscreen Duo 180mm-thick	105°C	0.56	79.98

### 4 Test procedure

#### 4.1 General

The test was conducted in accordance with EN1363-1:2012<sup>1</sup>, on 28 May 2019 utilising the BRE 1.5m x 1.5m furnace with the specimen located horizontally on the furnace and was witnessed on behalf of the sponsor by Rob Chiles and Dave Callaghan, and by Alan Curran on behalf of OFR Consultants.

The ambient temperature at the start of the test was 15°C

#### 4.2 Furnace control

The furnace temperature was measured by means of four chromel / alumel plate thermometers, positioned symmetrically in the furnace with their measuring junctions nominally 100mm below the soffit of the concrete floor. The furnace was controlled so that the mean temperature followed the time/temperature heating curve specified in EN 1363-1: 2012<sup>1</sup>.

The actual mean furnace temperature is plotted against time in the Graphs together with the specified curve for comparison.

A pressure sensing head was positioned similarly to the furnace thermocouples. The furnace was controlled to maintain a pressure of 20Pa ± 2Pa above that in the laboratory 100mm below the floor.

#### 4.3 Temperature measurements on non-fire face

Twenty-one K-type thermocouples each covered with an insulating pad were fixed to the non-fireside face of the specimen to measure its temperature continuously during the test. Their locations are shown in Figures.



## 5 Results

### 5.1 Observations

Observations made during the test are given in the table below.

Time mins:secs	Observation
0:00	Test started.
9:23	Exposed: Concrete spalling, Unexposed: Smoke issuing from beneath Rockwool.
17:13	Exposed: Seal A- intumescent forming, causing uneven texture.
34:45	Exposed: Both seals bubbling texture
53:20	Unexposed: Smoke issuing from top edge of seal B.
88:24	Exposed: Concrete fallen away around seals, no visible change to seals Unexposed: Smoke from seals
118:10	Unexposed: Slight discolouration around seal B Smoking from multiple places.
142:00	Test terminated at sponsors request.

The construction after test is shown in Photographs.

### 5.2 Temperatures recorded on non-fireside (unexposed) face

The maximum temperatures recorded on the individual fire seals were:

- Seal A = 85.1°C (recorded by thermocouple t/c2 after 121 minutes)
- Seal B = 93.7°C (recorded by thermocouple t/c21 after 50 minutes)

The temperatures recorded by each thermocouple are plotted against time in Graphs.



---

## 6 Performance criteria

---

The criteria for failure under integrity and insulation adopted from the standard<sup>1</sup> are given below.

### 6.1 Integrity

Failure is deemed to occur:

- a) When collapse or sustained flaming for not less than 10s on the unexposed face occurs;
- b) When cracks, gaps or fissures allow flames or hot gases to cause flaming or glowing of a cotton fibre pad, when applied for a maximum of 30s;
- c) When a 6mm-diameter gap gauge can penetrate through a gap into the furnace and be moved in the gap for a distance of at least 150mm;
- d) When a 25mm-diameter gap gauge can penetrate through a gap into the furnace

### 6.2 Insulation

Failure is deemed to occur:

- a) When the mean unexposed face temperature increases by more than 140°C above its initial value;
- b) When the temperature recorded at any position (including the roving thermocouple) on the unexposed face is in excess of 180°C above the initial mean unexposed face temperature;
- c) When integrity failure occurs.

---


## 7 References

---


1. Fire resistance tests. Part 1: General requirements. EN 1363-1: 2012. British Standards Institution, London, 2012.



## 8 Figures

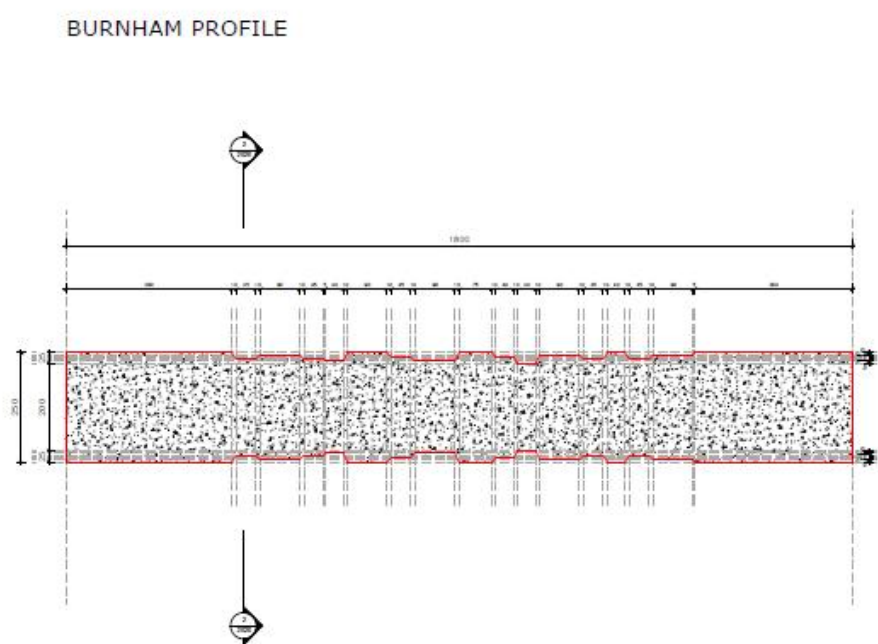


**Figure 1:** Test construction details – as supplied by the sponsor.

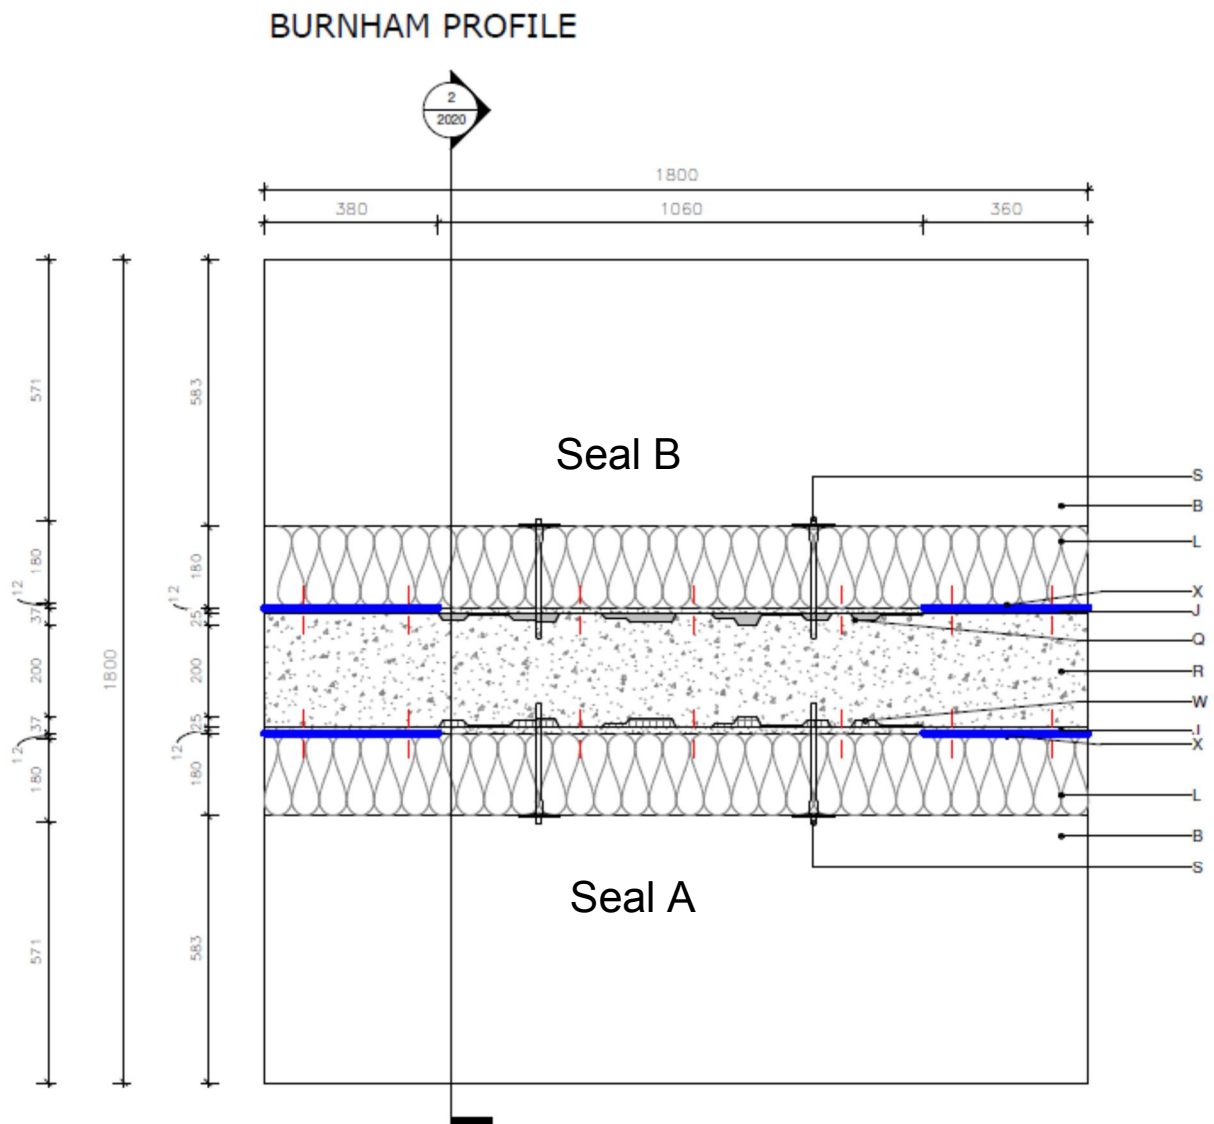

**Figure 2:** Test construction details– as supplied by the sponsor.

Page 10 of 22

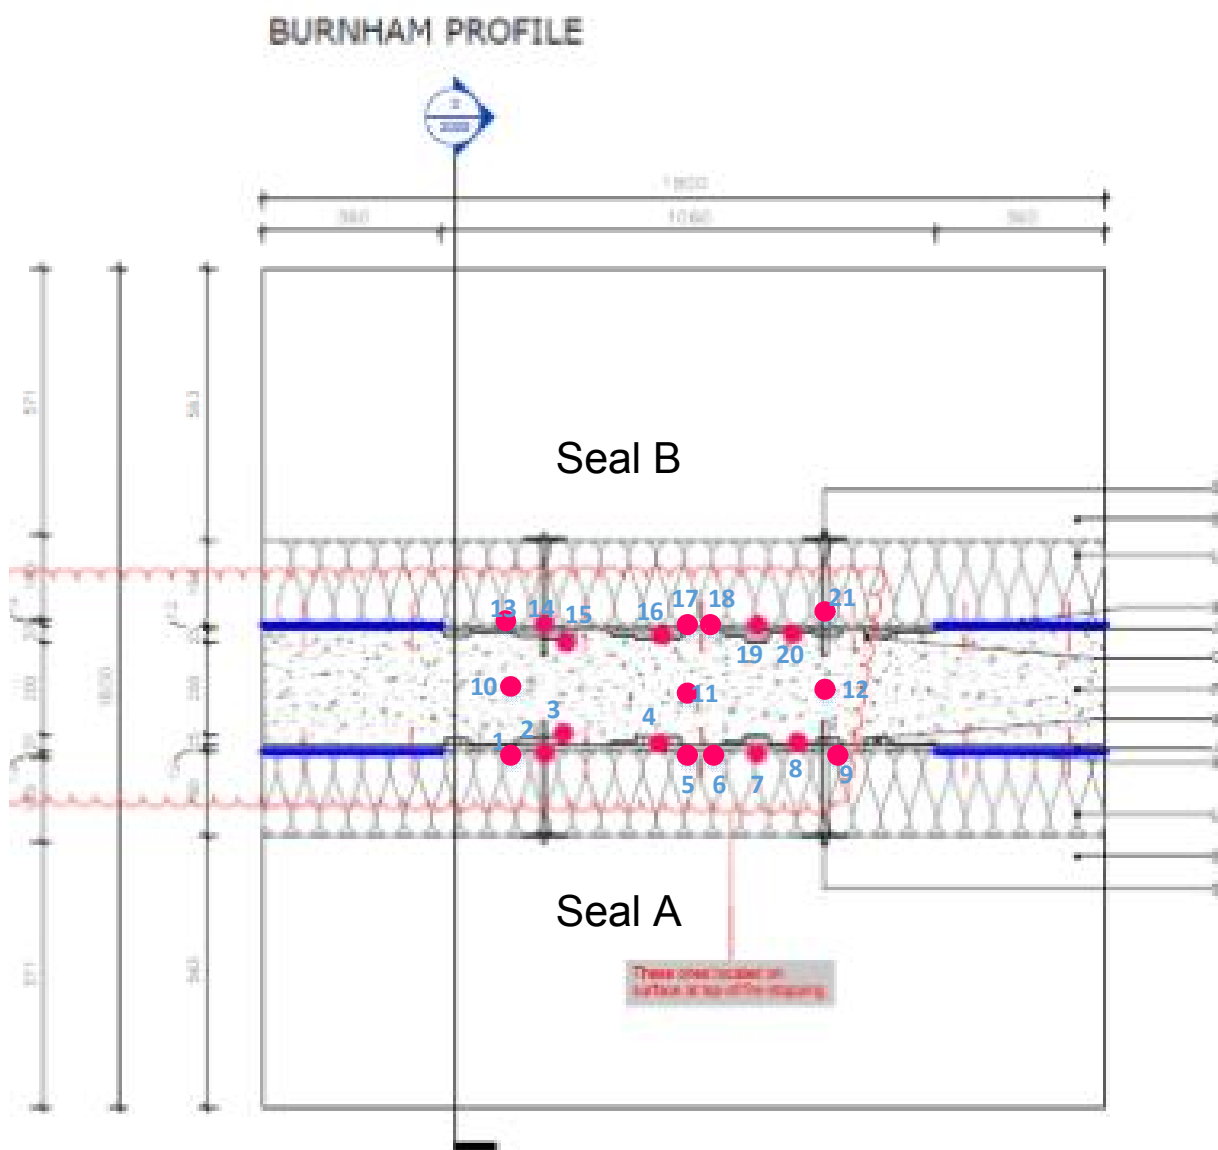


**Figure 4:** Sketch drawing showing nominal thermocouple locations.


**Note:** TCS 1,5,6,9,13,17,18,21 were located on the side faces of the Rockwool.




## 9 Graphs

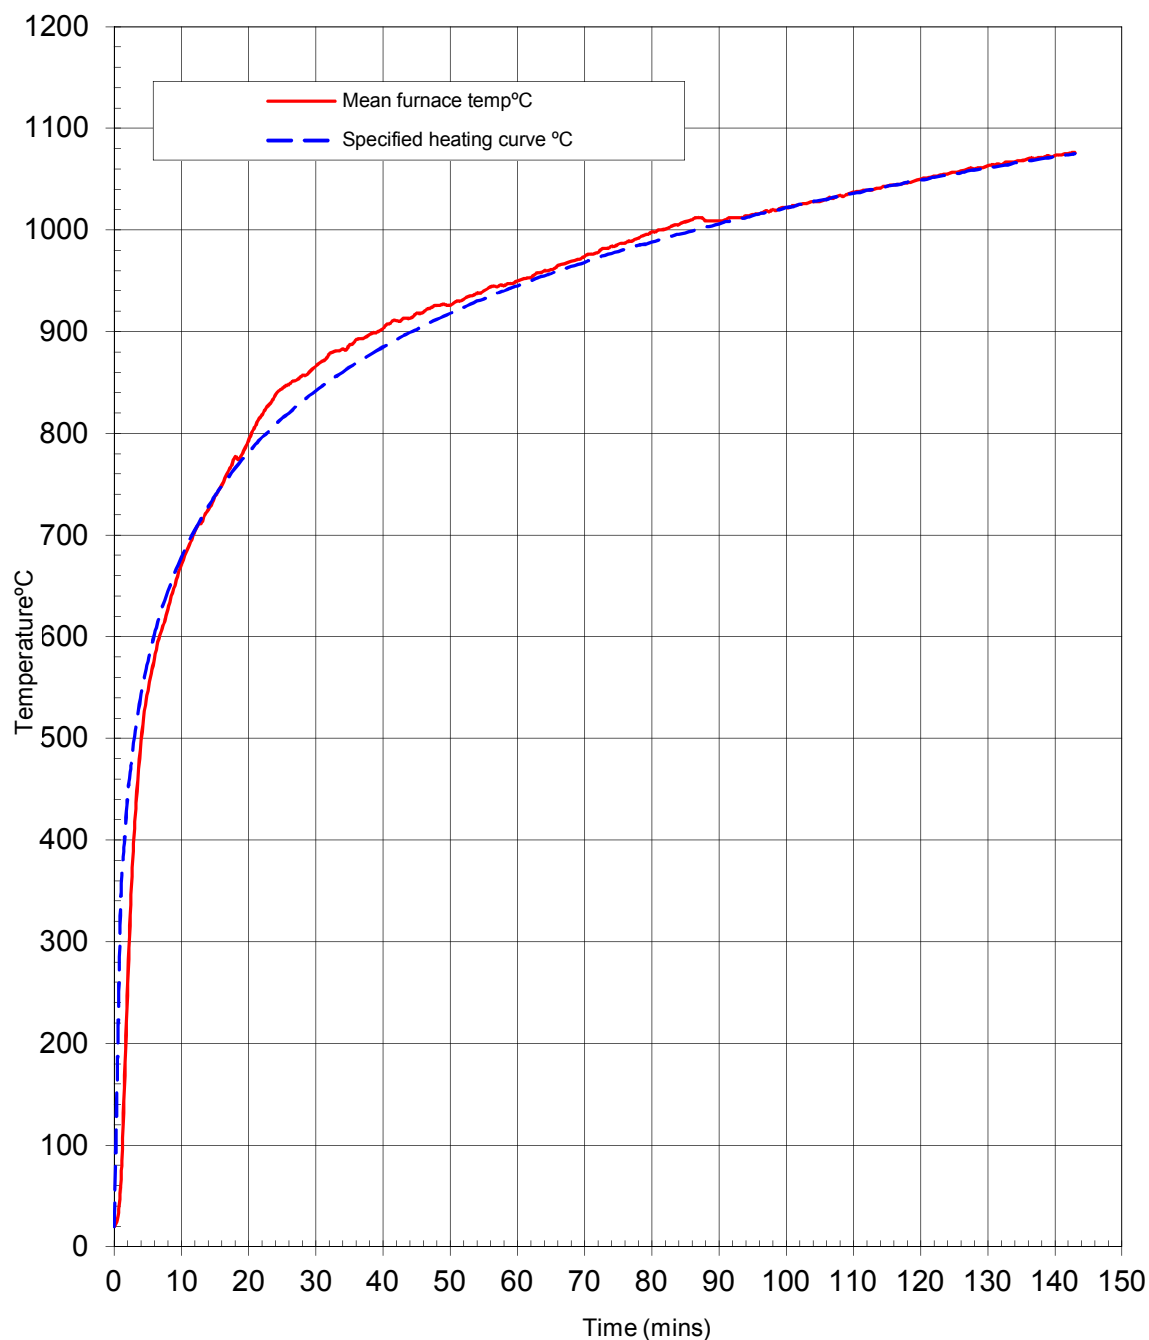


**Graph 1:** Mean Furnace Temperature with the specified furnace curve for comparison

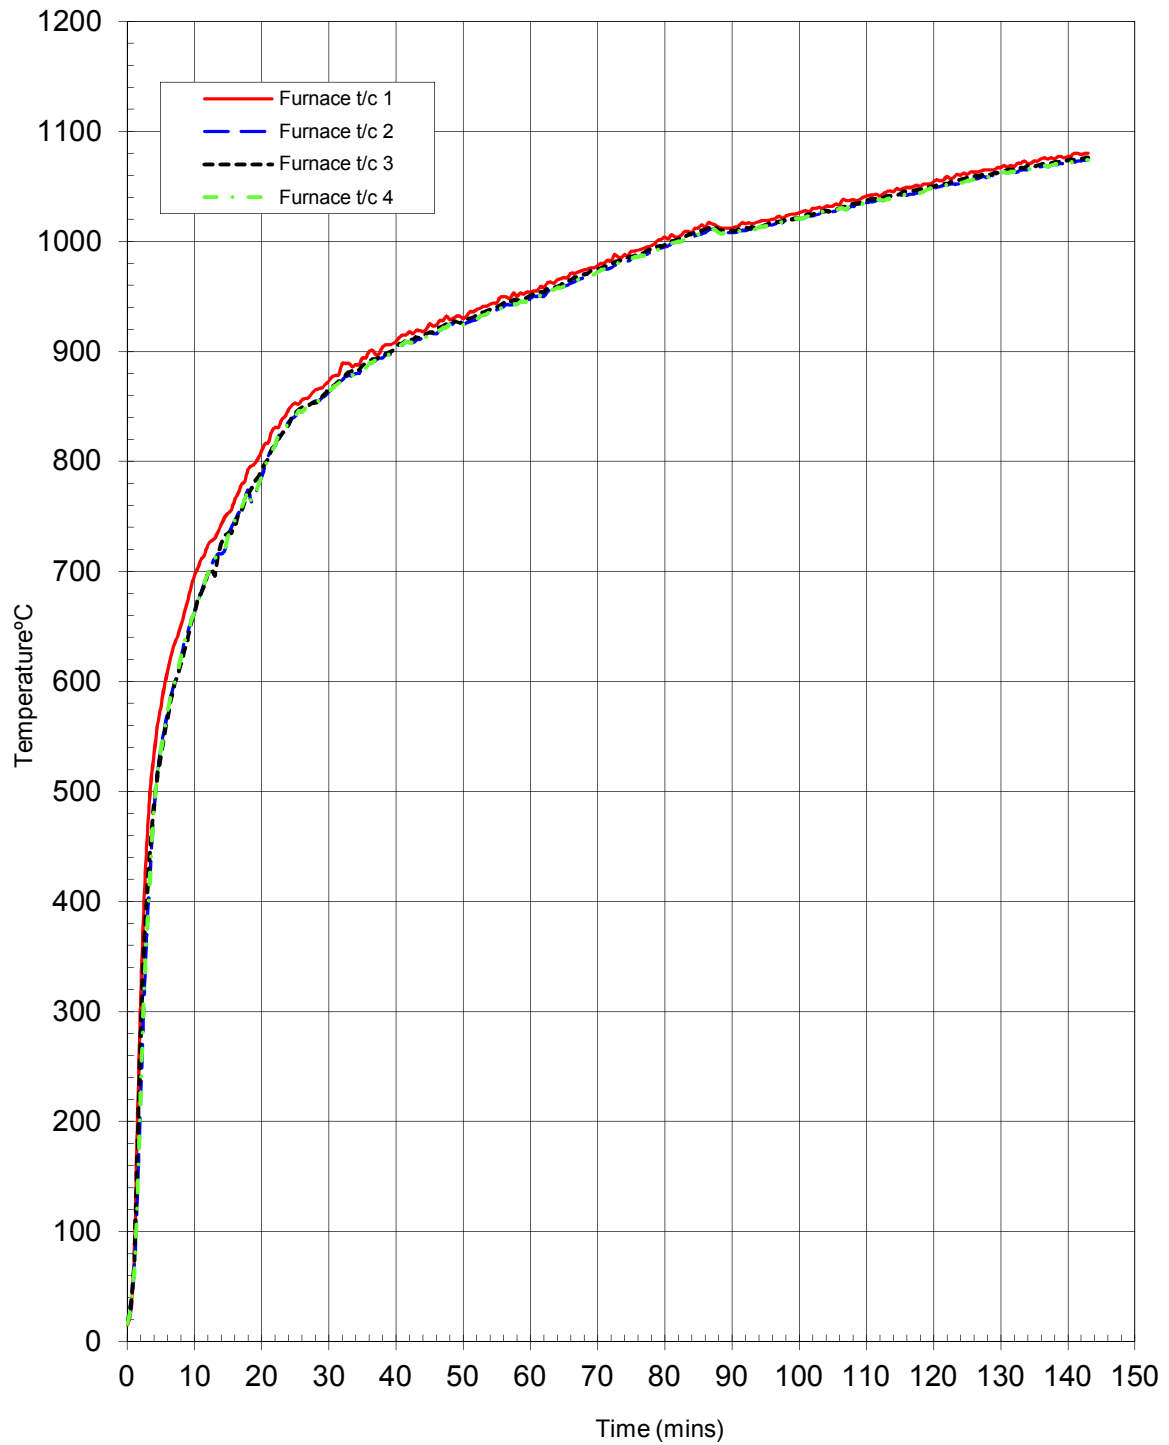


**Graph 2:** Individual furnace thermocouple temperatures.

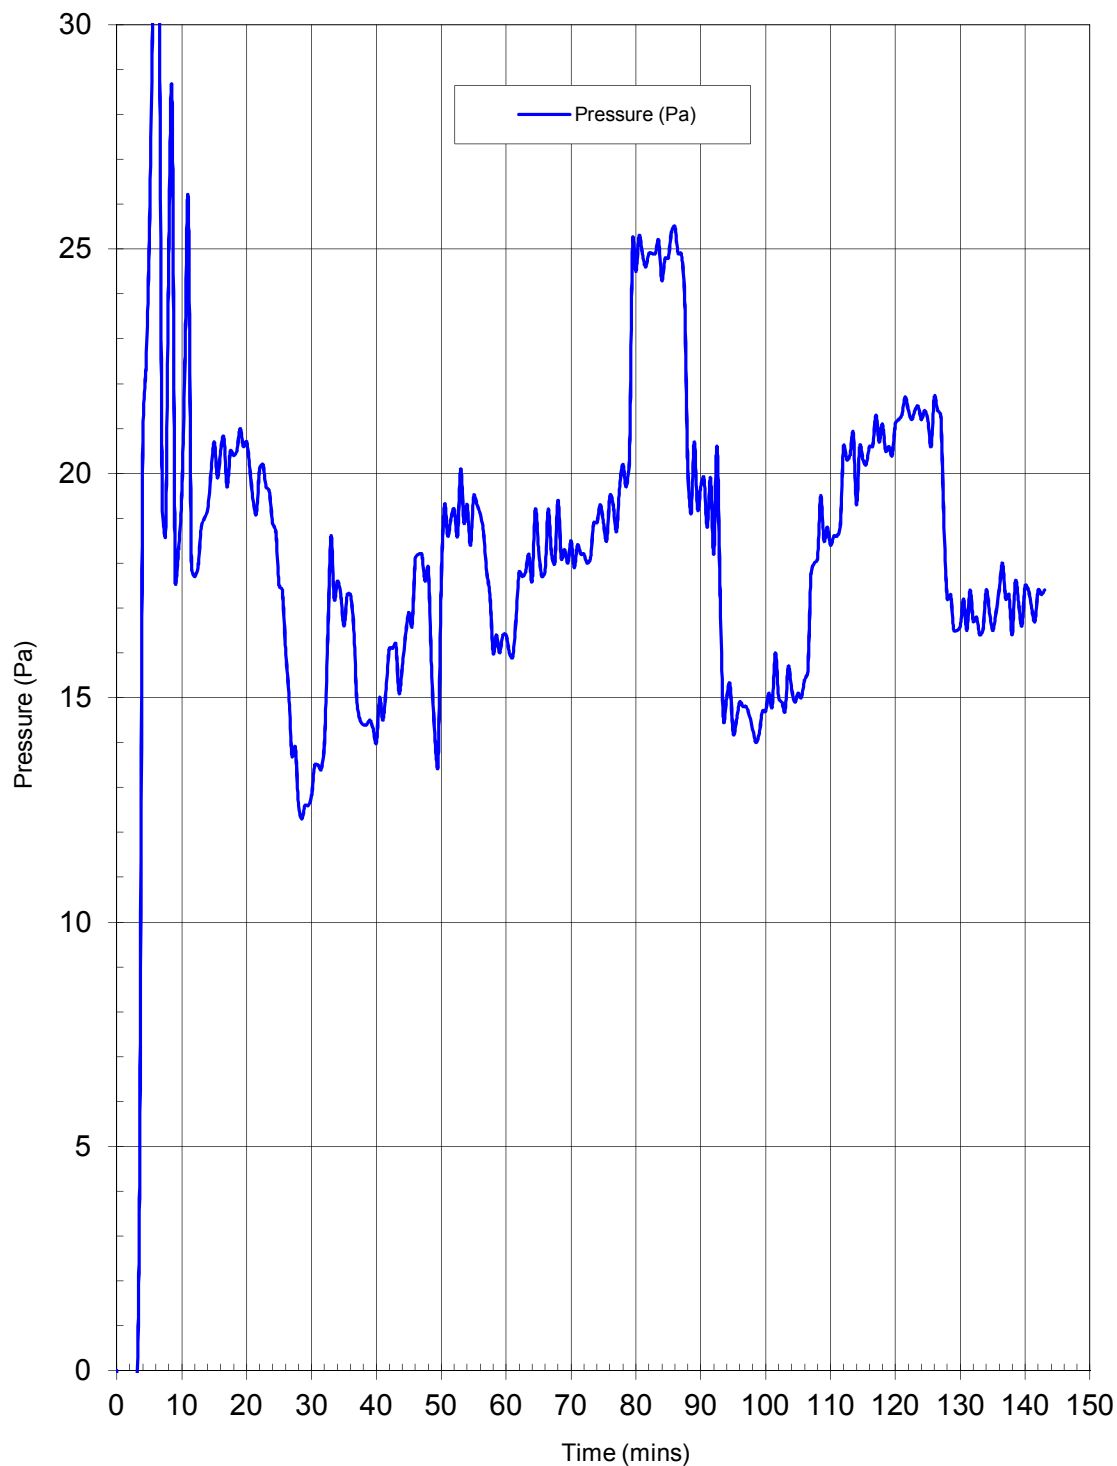


**Graph 3:** Furnace pressure

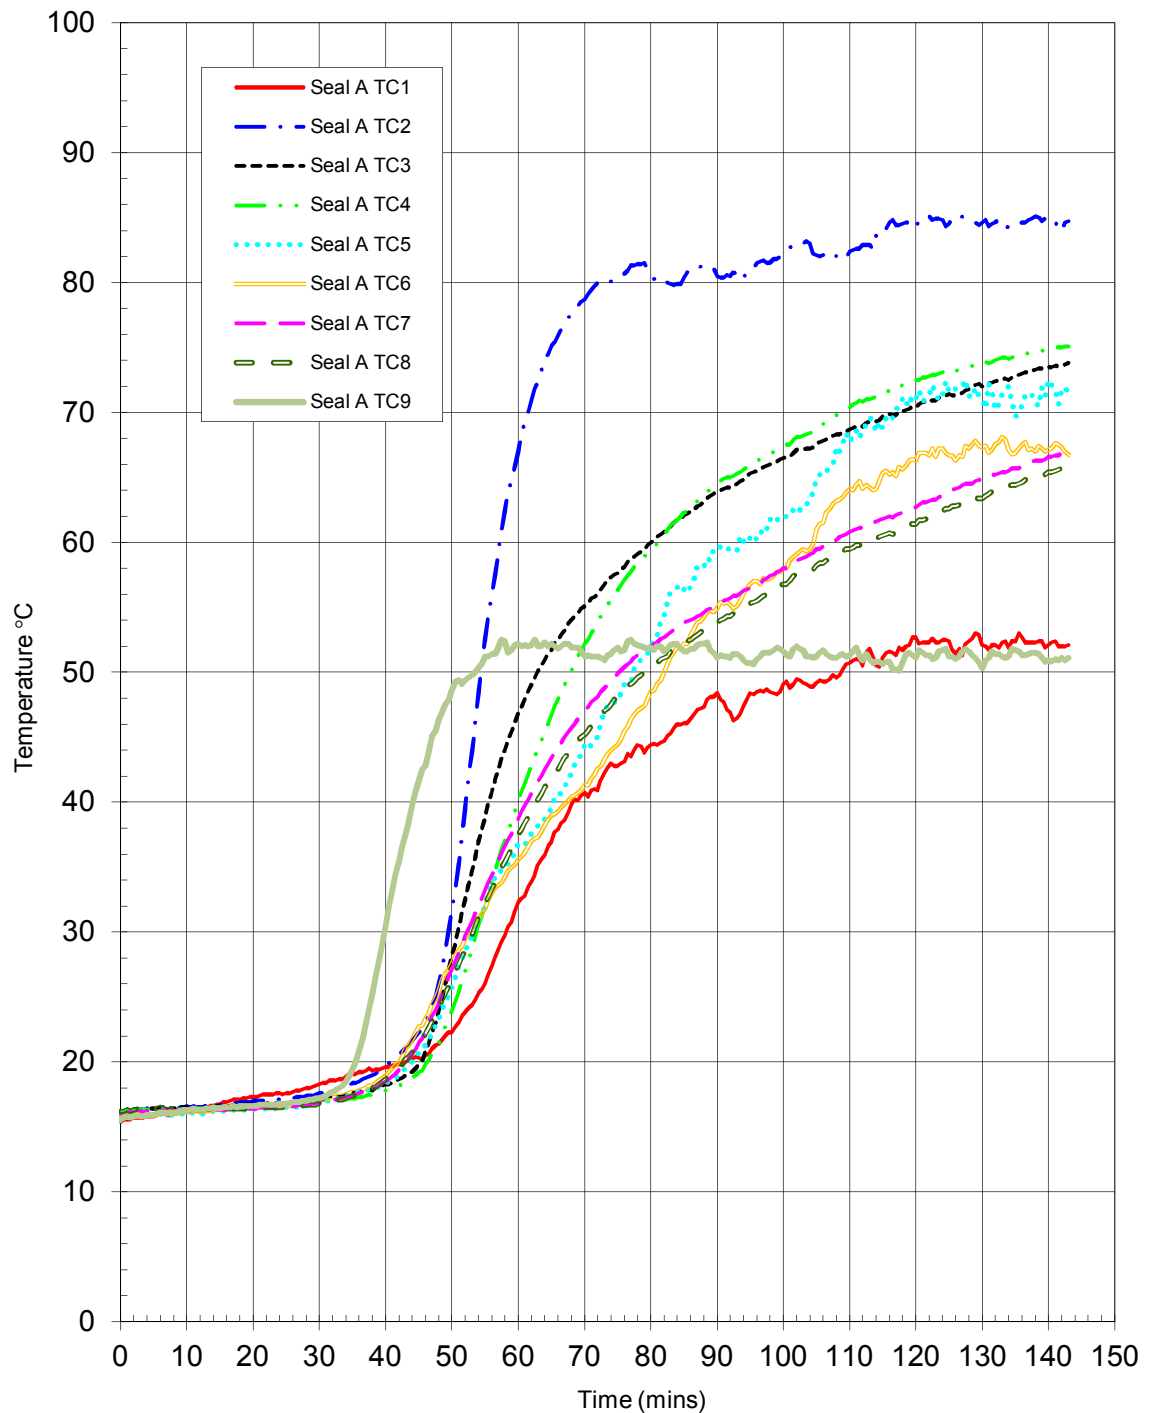

**Graph 4:** Temperature recorded by thermocouples 1 to 9 on Seal A.

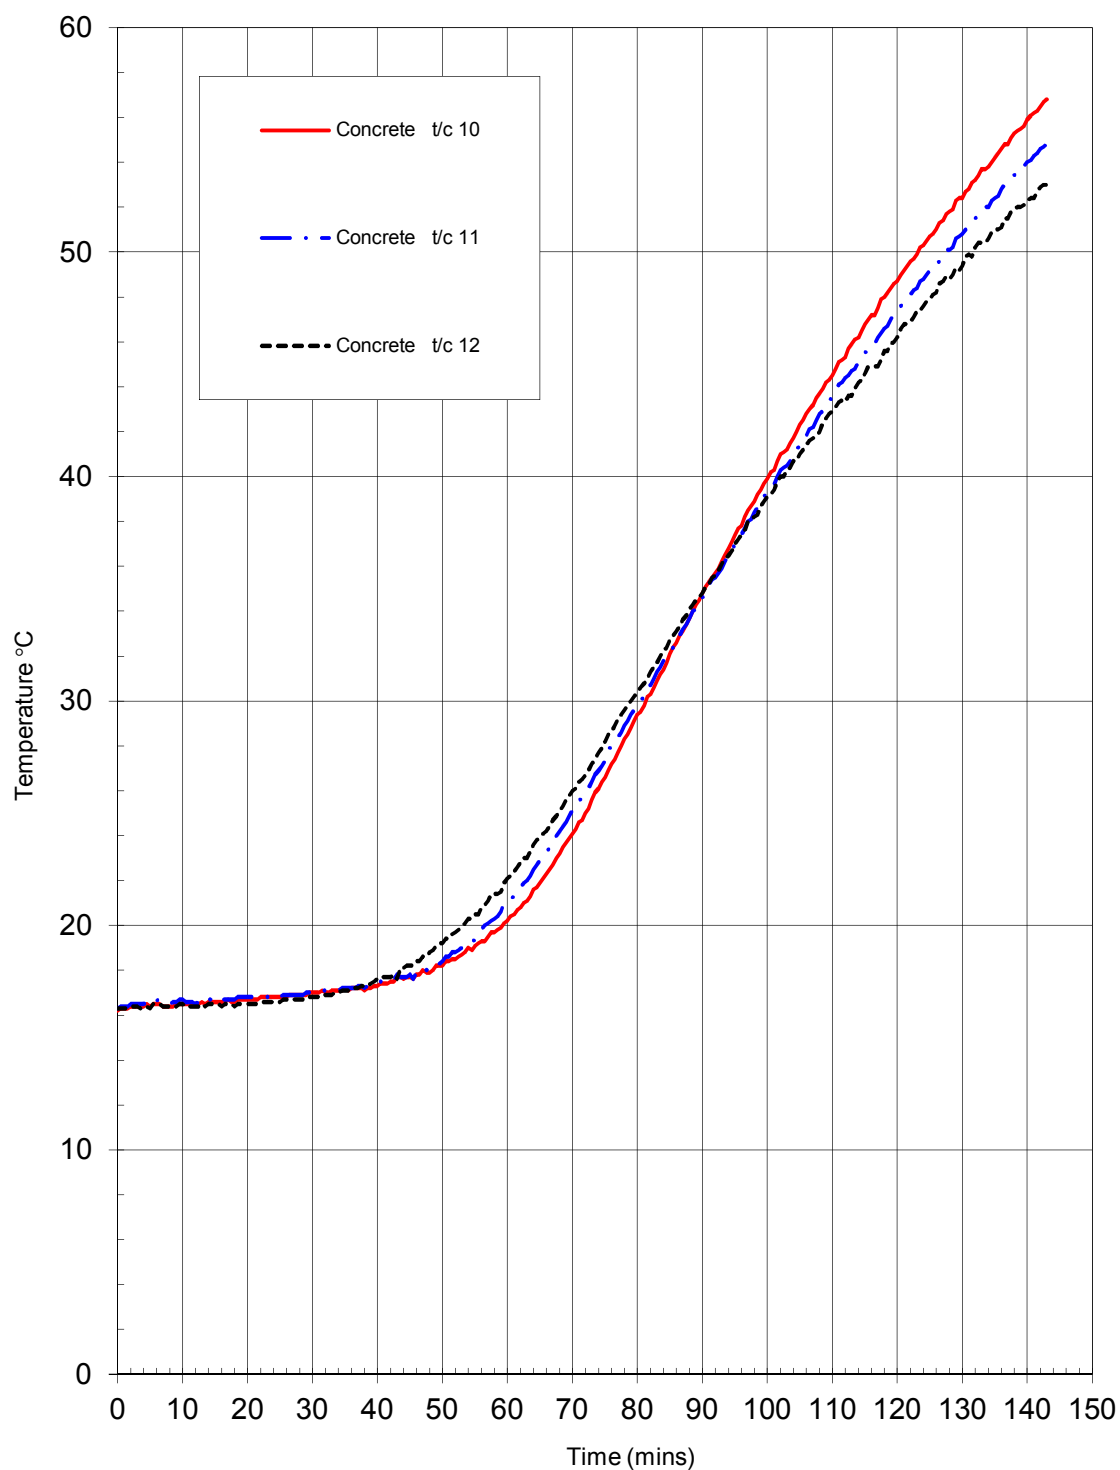

**Graph 5:** Temperature recorded by thermocouples 10 to 12 on the concrete.

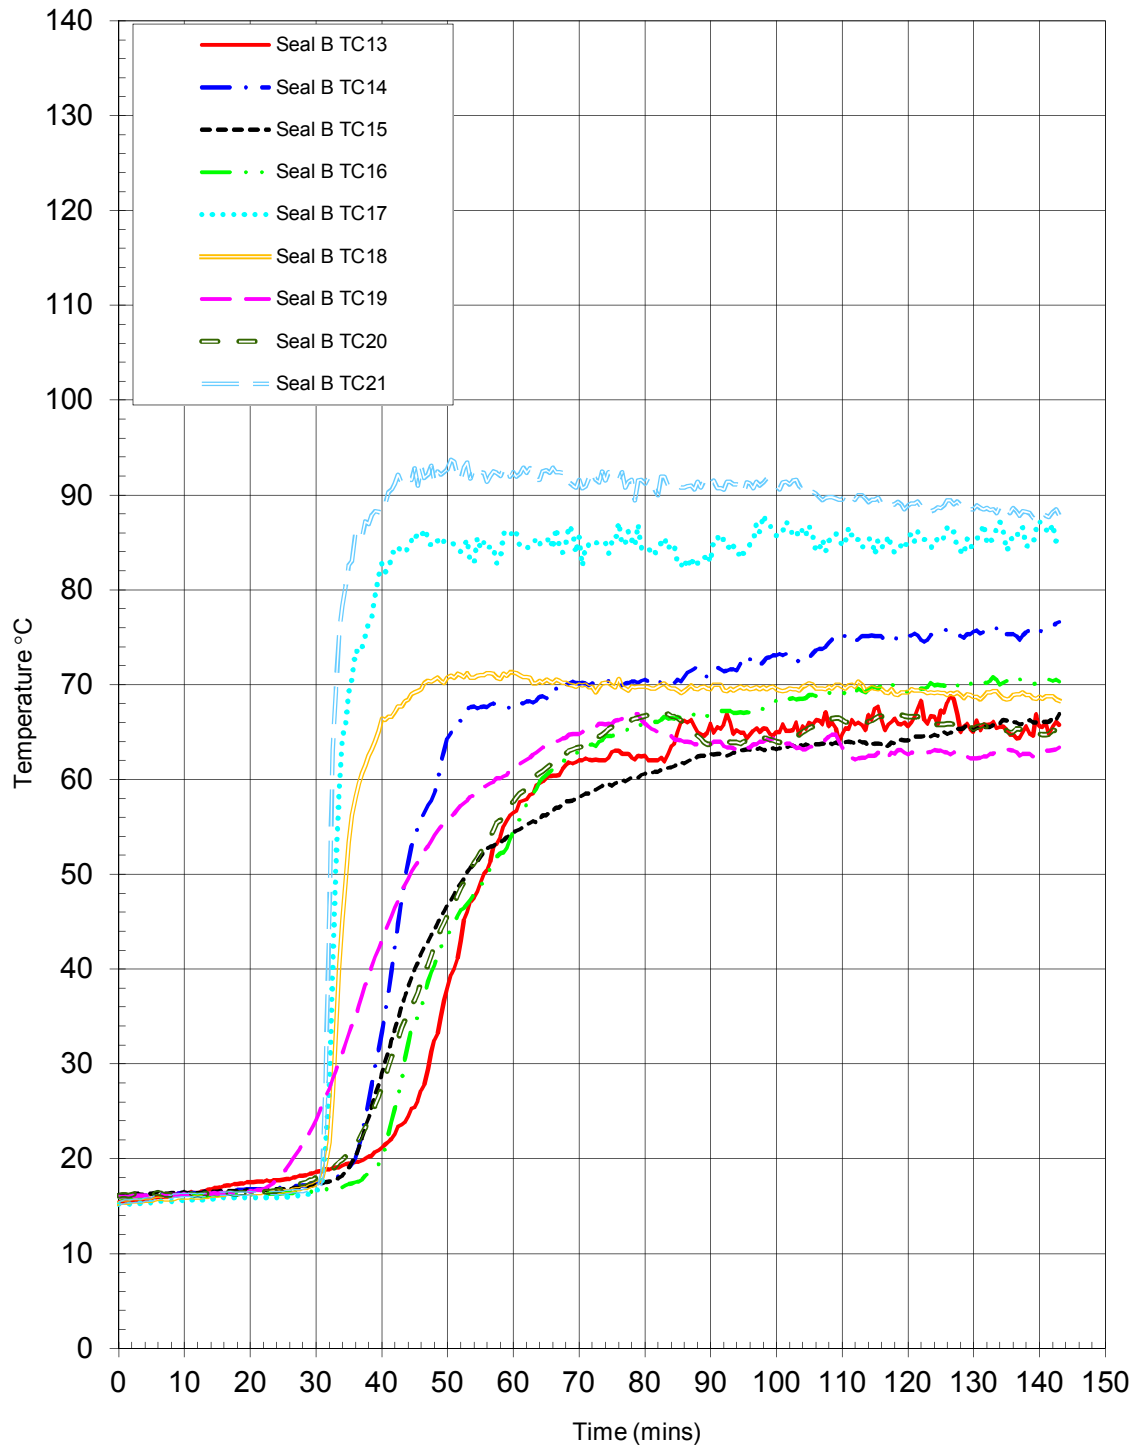

**Graph 6:** Temperature recorded by thermocouples 13 to 21 on Seal B.



## 10 Photographs



**Photograph 1:** Installation of specimen into test frame.



**Photograph 2:** Installation of test specimen into test frame.



**Photograph 3:** Installation of test specimen into test frame.



**Photograph 4:** Test Specimen.



**Photograph 5:** Exposed face (fireside) face before test.



**Photograph 6:** Unexposed face (non-fireside) face after 60minutes from the start of the test.



**Photograph 7:** Exposed face (fireside) face after test.