



LEVEL MONITORING - RELATIVE SURVEY READINGS

Provider Details		Client Details		Risk Address	
Name:	MHN Ltd	Insurance Co.:	Rsa	Occupier:	Mark Longden
Date of Issue:	17/12/20	Client Name:	Crawford & Co	Address:	9 Willoughby Road
		Contact:		Address:	London
		Email:		Town:	
		Client Ref:		County:	
		Address:		Post Code:	NW3 1RT
		Address:		Tel Home:	
		Town:		Tel Work:	
		County:		Mobile:	
		Post Code:		Other:	
		Other Email:		Other:	


Target Date:														
Reading Date:				8/5/20	9/7/20	2/9/20	4/11/20	15/12/20						
Issue Date:				12/5/20	10/7/20	7/9/20	5/11/20	17/12/20						
Row No.	Point Name	X Co-ordinate	Y Co-ordinate	1	2	3	4	5	6	7	8	9	10	11
1	1	0.00	0.00	10.2980	10.2981	10.2969	10.2971	10.2975						
2	2	-1.50	0.00	10.1638	10.1632	10.1615	10.1618	10.1627						
3	3	-2.00	-1.00	10.9454	10.9422	10.9381	10.9395	10.9427						
4	4	-4.00	-1.00	10.9065	10.9015	10.8980	10.8999	10.9029						
5		-4.50	0.00											
6	5	-5.00	0.00	10.1782	10.1724	10.1686	10.1705	10.1734						
7	6	-5.00	2.50	10.1292	10.1238		10.1221	10.1244						
8	7	-5.00	5.80		10.7115		10.7103							
9		-5.00	6.00											
10		0.00	6.00											
11														
12														
13														
14														
15														
16														
17														
18														
19														
20														
21														
22														
23														
24														
25														
26														
27														
28														
29														
30														
31														
32														
33														
34														
35														
36														
37														
38														
39														
40														
41														
42														
43														
44														

Points 3 & 4 are studs on window

7 →



- 17/12/2020
Point 3 & 4 checked. Cracking on
- It was not possible to install all studs within a common brickcourse. The initial readings cannot be interpreted. Distortion Data

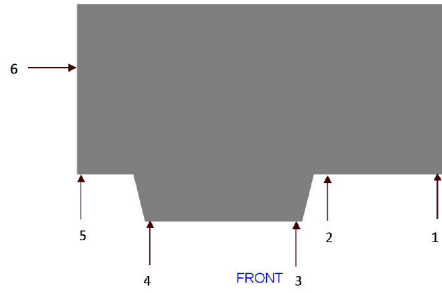

Disturbance Log:

- Readings have been made relative to a manhole in the road. It has an assumed value of 10.0000m. If this is not a deep datum is r
- No further readings to be taken.

e to a
sumed
ppropriate,
equired?