




LEVEL MONITORING - RELATIVE SURVEY READINGS

Provider Details		Client Details		Risk Address	
Name:	MHN Ltd	Insurance Co.:	NFU Mutual	Occupier:	
		Client Name:	Crawford & Co	Address:	151 Gloucester Avenue
Date of Issue:	5/11/20	Contact:	Deller M	Address:	London
		Email:		Town:	
		Client Ref:		County:	
		Address:		Post Code:	NW1 8LA
		Address:		Tel Home:	
		Town:		Tel Work:	
		County:		Mobile:	
		Post Code:		Other:	
		Other Email:		Other:	

Target Date:		Reading Date:		Issue Date:		1		2		3		4		5		6		7		8		9		10		11	
Row No.	Point Name	X Co-ordinate	Y Co-ordinate	1	2	3	4	5	6	7	8	9	10	11													
1	1	0.00	0.00	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000																	
2		2.00	0.00																								
3		2.00	-4.00																								
4		2.20	-4.00																								
5	2	2.20	-2.50	7.0839	7.0724	7.0780	7.0791	7.0822	7.0796	7.0796																	
6		2.20	0.00																								
7	3	2.70	0.00	7.0916	7.0873	7.0883	7.0887	7.0912	7.0896	7.0890																	
8	4	6.20	0.00	7.1454	7.1406	7.1412	7.1425	7.1466	7.1443	7.1440																	
9		6.20	16.50																								
10		6.00	16.50																								
11	5	6.00	16.00	9.6406	9.6399	9.6408	9.6414	9.6428	9.6397	9.6409																	
12	6	2.00	16.00	9.6783	9.6786	9.6789	9.6789	9.6793	9.6783	9.6793																	
13	7	2.00	17.00	9.6461	9.6464	9.6460	9.6461	9.6463	9.6460	9.6465																	
14	8	-1.00	17.00	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000																	
15		-1.00	0.00																								
16		-0.40	0.00																								
17		-0.40	-4.00																								
18		0.00	-4.00																								
19																											
20																											
21																											
22																											
23																											
24																											
25																											
26																											
27																											
28																											
29																											
30																											
31																											
32																											

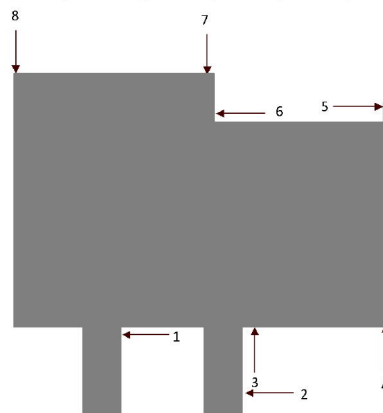

File MHN level monitoring 10.07.19 - 04.11.20.xls.XLS.XLS

Readings

- 05/11/2020
The Occupier expressed no new c
- It was not possible to install all sta within a common brickcourse. The initial readings cannot be interpre Distortion Data.
- Unable to sight through house. Fr readings have been made relative station 1. Rear readings have bee relative to level station 8. They ha assumed values of 10.0000m. If t appropriate, please advise if a dex is required?
- No further readings to be taken.

Printed on 08/04/2021



