



Level and Crack Monitoring

Our Ref:



Date of Issue:

26/01/2021

Provider Details



Monitoring Details

Instruction Date:	18/12/2019				
Number of visits	2	Visit Frequency (Wks)	8		

Visit Dates (future dates are estimated)

Setup	1	2	3	4	5	6
11/02/20	07/04/20	02/06/20				

Client Details

Insurance Co.:					
Client Ref:					
Client Name:	Sedgwick				
Technical Mgr:	Michael Whittington				
Customer support	Samuel Richman				
Tel:					
Email:					


Risk Address

Occupier:	Removed for data protection purposes
Address:	26 Estelle Road
Address:	
Town:	
County:	LONDON
Post Code:	NW3 2JY
Contact Name	Removed for data protection purposes

Level and Crack Monitoring - Site Sketch

Our Ref: [REDACTED]

Date of Issue: 26/01/2021

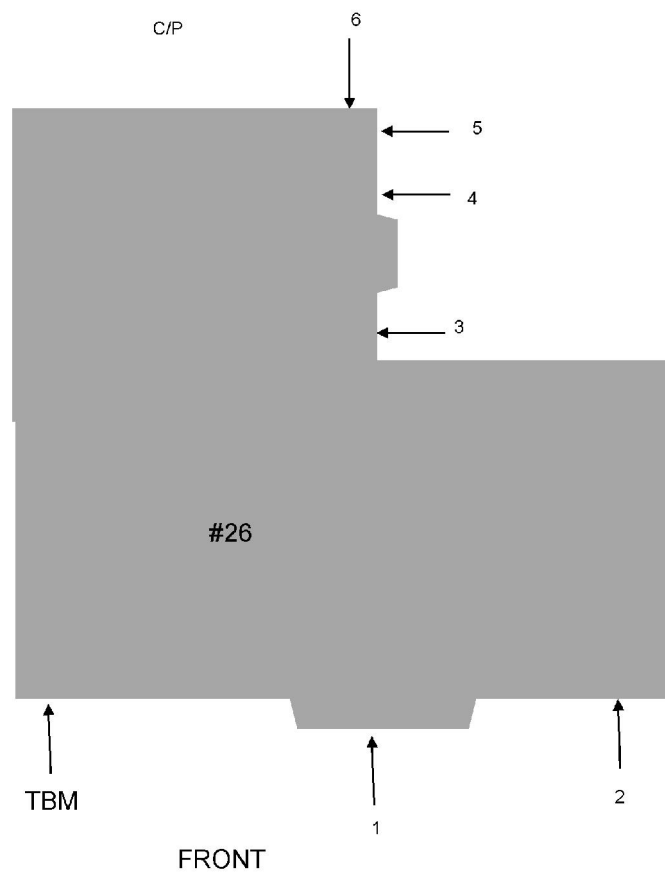



Level Monitoring - Reduced Levels (in metres)

Our Ref:



Date of Issue:

26/01/21

Reading Date	11/2/20	15/4/20	17/6/20	21/9/20	4/11/20	25/1/21						
Point / Reading	1	2	3	4	5	6	7	8	9	10	11	12
1	9.9477	9.9483	9.9461	9.9470	9.9469	9.9453						
2	9.6140	9.6155	9.6155	9.6141	9.6137	9.6138						
3	9.5079		9.5059	9.5000	9.5011	9.5050						
4	9.4490		9.4460	9.4408	9.4425	9.4457						
5	9.4632		9.4608	9.4576	9.4582	9.4609						
6	9.5544		9.5536	9.5506	9.5506	9.5528						
not used												
not used												
not used												
not used												
not used												
not used												
not used												
not used												
not used												
not used												
Tech Initials	DD	RB	NM	NM	RM	IH						
Level S/N.	521818	522939	523149	523149	2939	521947						




Level Monitoring - Movement (in millimetres)

Our Ref:

Date of Issue

26/01/21

[illegible]

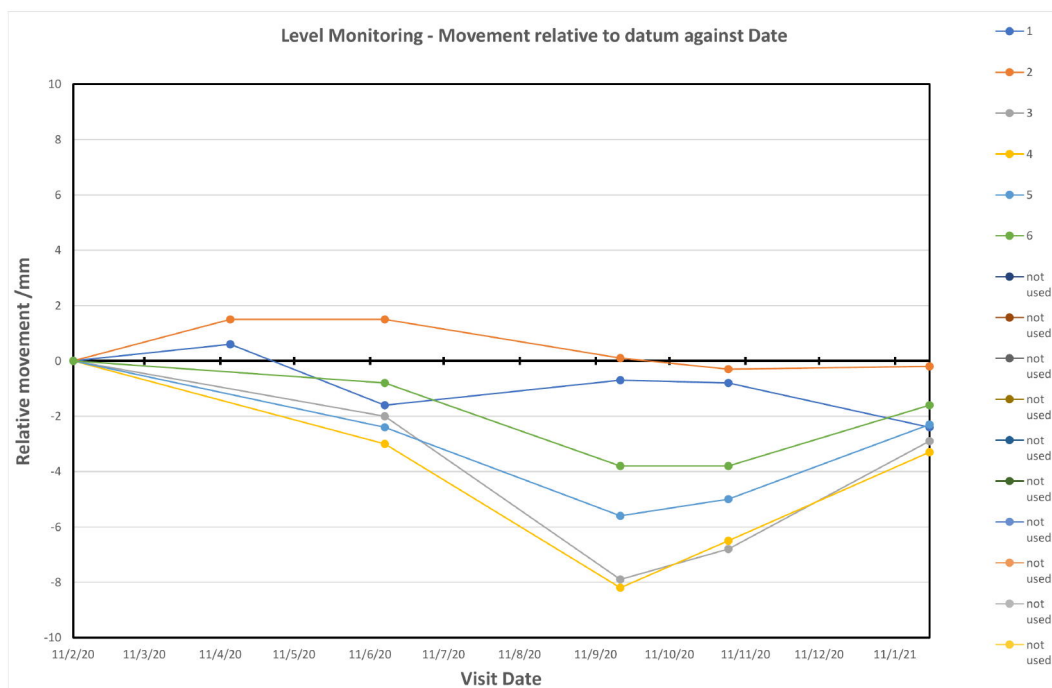



Our ref	Client ref	Client Name	Issue Date
		Sedgwick	26/01/2021

Stud locations

1	INT flat A GF rear bedroom RH flank wall
2	EXT flat A rear elevation rear door frame
3	EXT front elevation to bay window cill
4	
5	
6	

Additional instructions / notes

Crack Monitoring - Readings

Studs nos	Align-ment	Visit Date	11/02/20	Visit Date	15/04/20	Visit Date	17/06/20	Visit Date	21/09/20	Visit Date	04/11/20	Visit Date	25/01/21
		Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w
1	H	60.45	HL			60.52		61.24	0.99	60.75	0.56	60.61	0.50
1	V	75.56	HL			75.59		77.00	1.85	78.41	1.30	75.89	
1	D	87.96				87.93		87.93		87.91		88.02	
2	H	72.62	3.14					73.95	4.02	72.68	2.96	72.58	4.21
2	D												
2	Check												
3	H	57.34	3.04	57.22	2.78	57.94	4.02	58.22	4.31	57.64	2.04	57.58	3.87
3	D												
3	Check												
4	H												
4	D												
4	Check												
5	H												
5	D												
5	Check												
6	H												
6	D												
6	Check												
Caliper nos		570		1370		2890		2890		6386		6386	
Technician		DD		RB		NM		NM		RM		IH	

	Client Name	Issue Date
	Sedgwick	26/01/2021

Crack Monitoring - Movement Against Time

