




original Roman cement
coping and rendered band
to be repaired in-situ
using Roman cement



coping moulding identical to
remaining original coping to
23 Gloucester Cres.

photographic detail of house wall
on opposite corner of Inverness St.

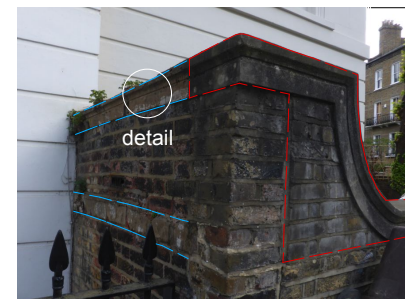


photographic detail of North East wall corner
to 23 Gloucester Crescent

Portland cement coping
and modern swept brick
detail to be removed

original dividing (party) wall to
adjoining house - existing Roman
cement in-situ run cornice over
terracotta creasing tiles evidence
original coping provision to wall

portland cement moulding matches
original with swept detail to
connect original coping level to
reduced wall height. Roman cement
band on adjoining property side
aligns with saltaire detailed wall
on opposite corner of Inverness
Street/Gloucester Crescent junction

Portland cement moulding and
swept curve removed along with
eight courses of modern brickwork

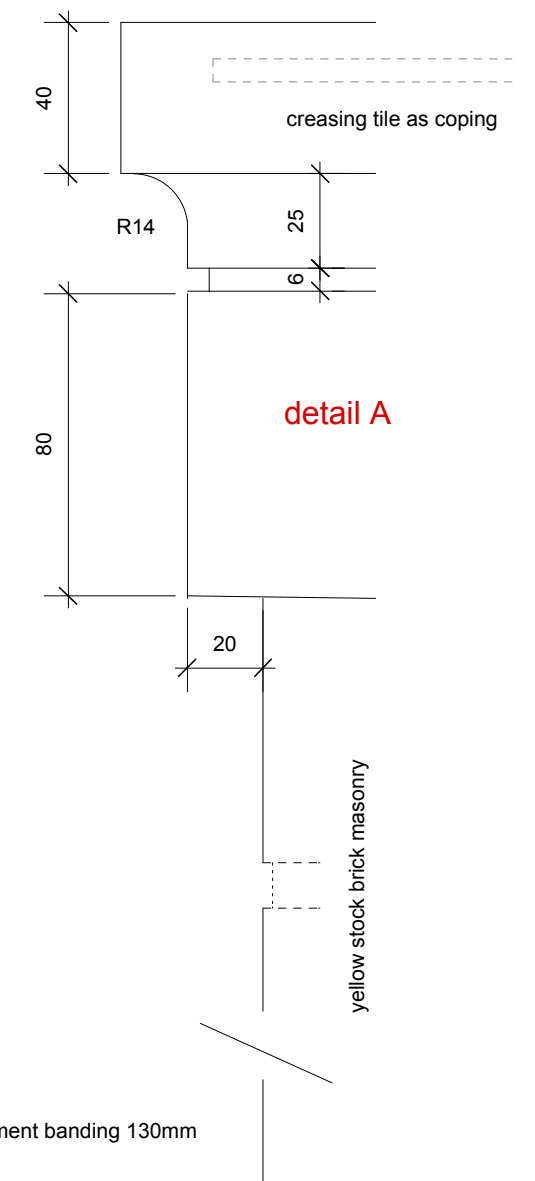

detail A

