


C Sub-Appendix  
CCTV Drainage Survey

# G.O. DRAINAGE SERVICES LTD



**CV.02435 12 PILGRIM'S LANE LONDON NW3 1SN**

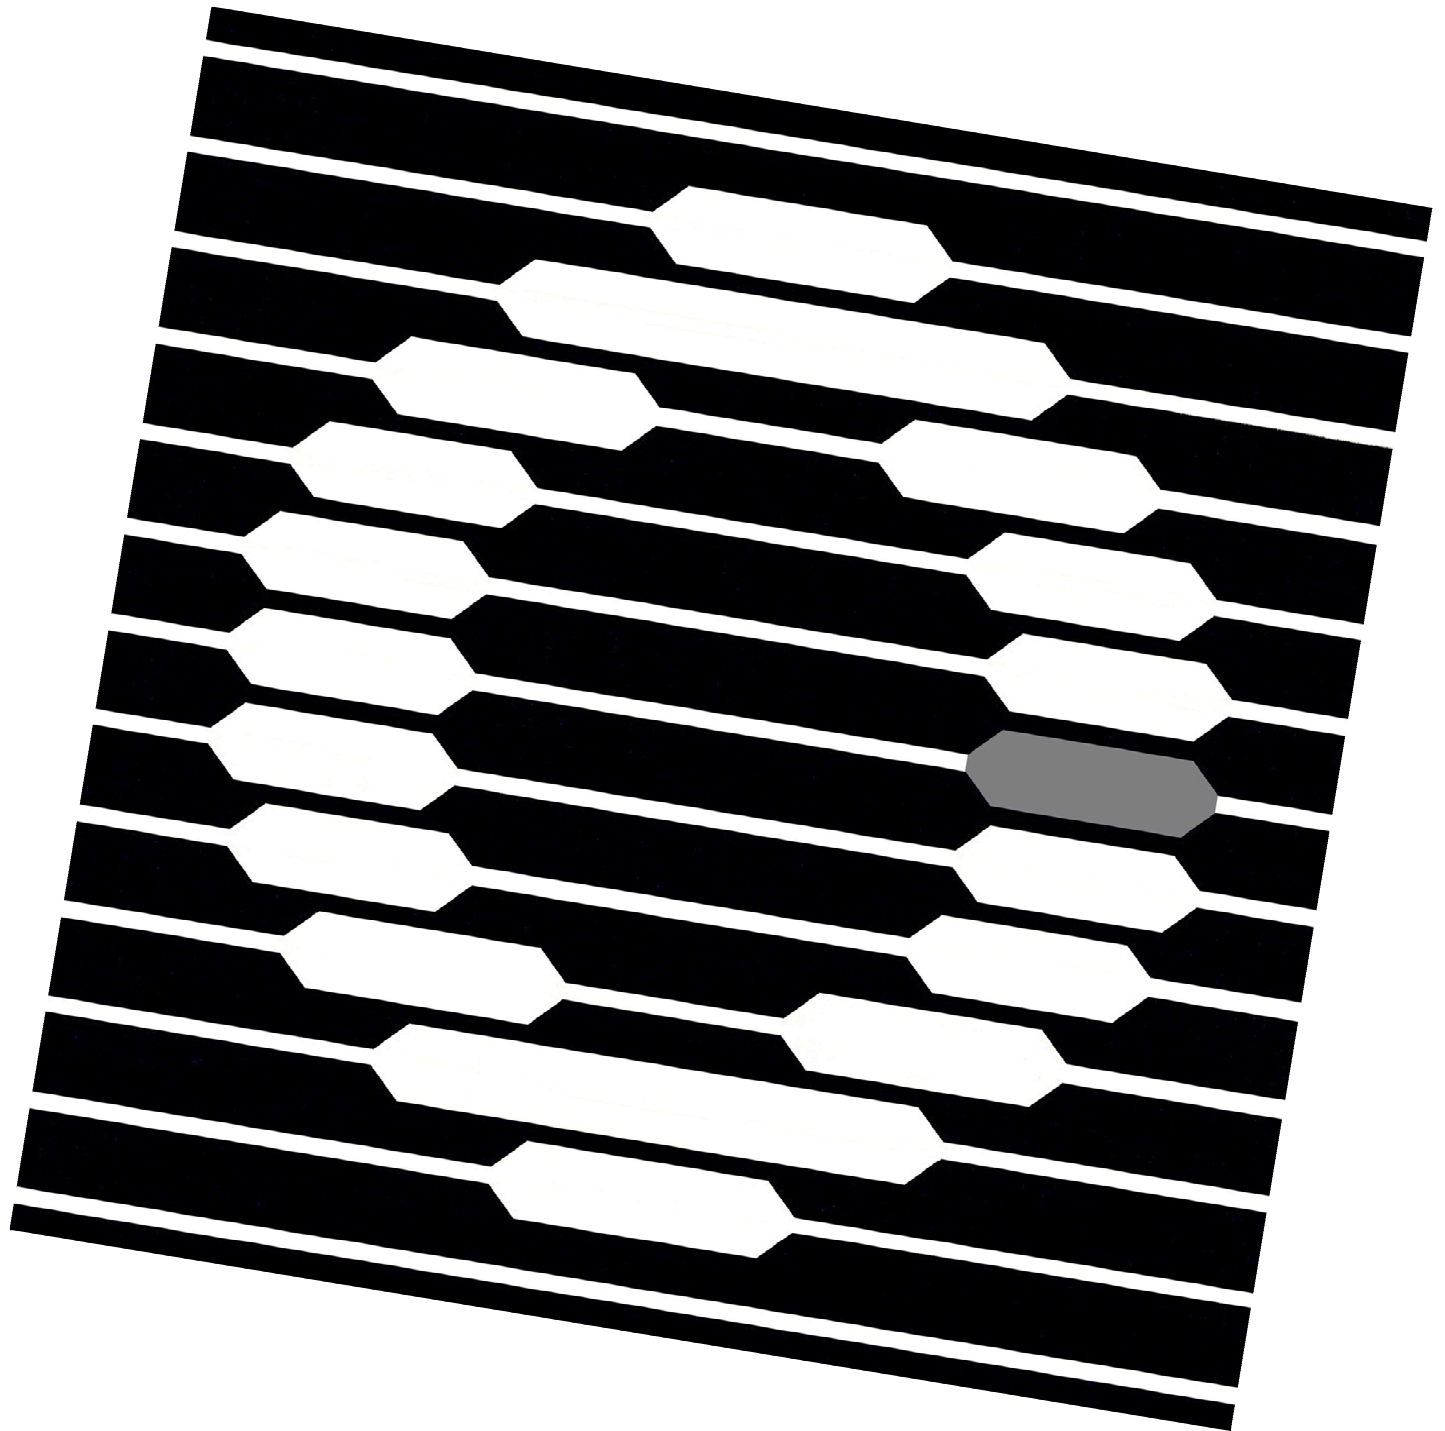

# G.O. DRAINAGE SERVICES LTD



53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com

## CCTV SURVEY HEADER SHEET

**CLIENT.**

ELLIOTTWOOD PARTNERSHIP LLP  
CONSULTING STRUCTURAL AND CIVIL ENGINEERS  
241 THE BROADWAY  
LONDON  
SW19 1SD

**LOCATION.**

12 PILGGRIMS LANE  
LONDON  
NW3 1SN

**JOB NO.**

CV.02435

**SEWER USE.**

COMBINED DRAINAGE

**WEATHER.**

DRY

**DATE.**

31/06/22

**OPERATOR.**

GO

**CLEANED.**


YES

**ORDER NO.**

E-MAIL MIKE

**TOTAL LENGTH SURVEYED.**

77.3 metres

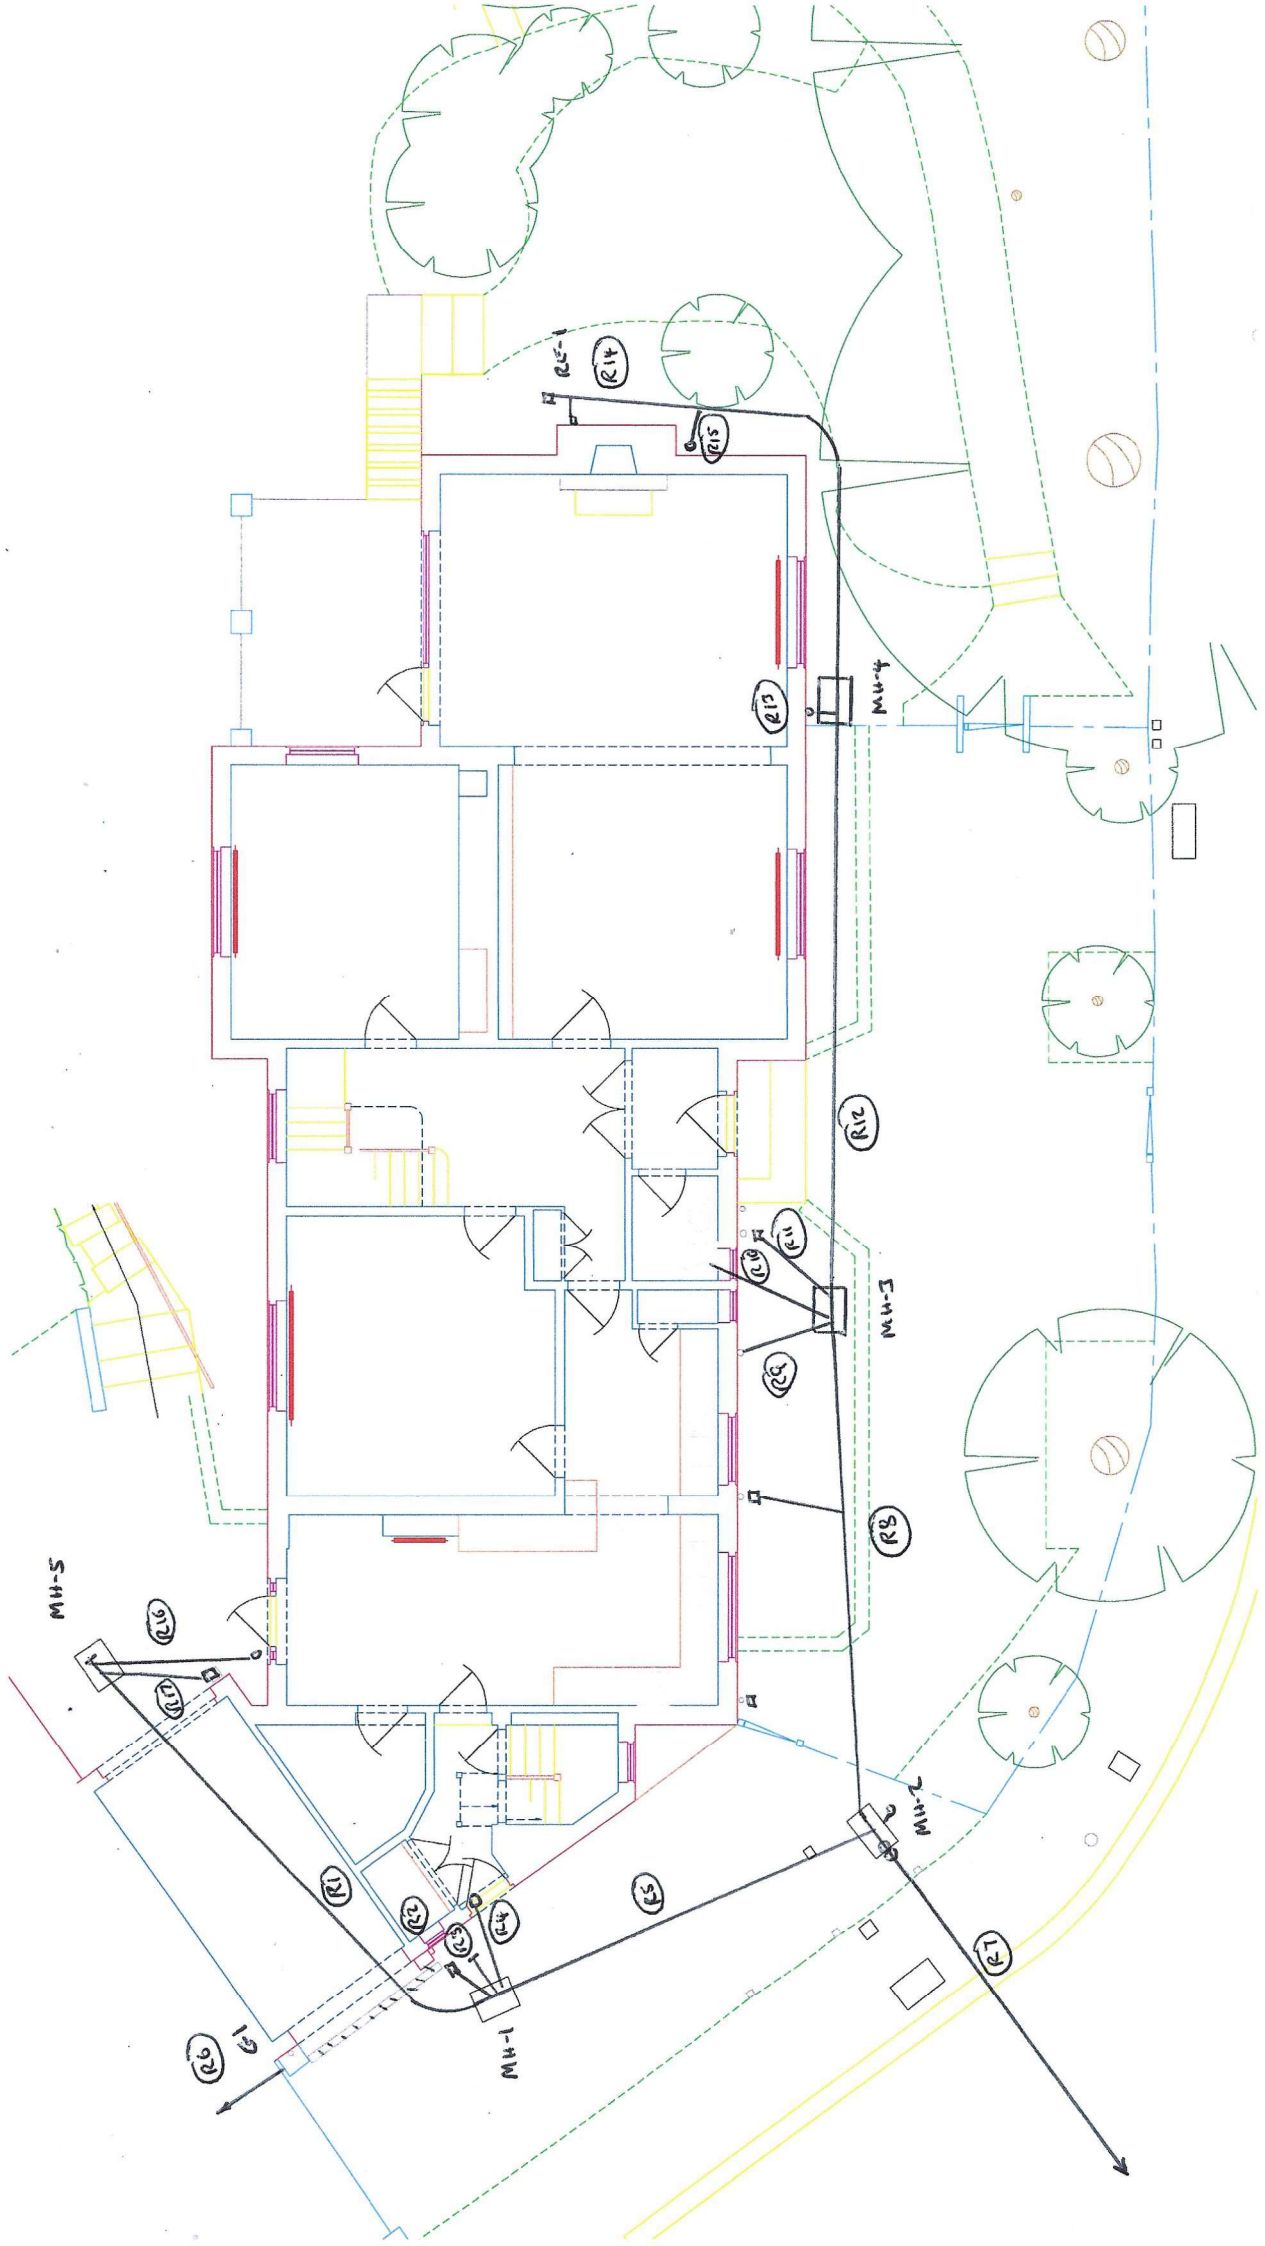





## MANHOLE SURVEY

CLIENT. ELLIOTTWOOD	LOCATION. 12 PILGRIMS LANE LONDON NW31SN
DATE 31/06/22	JOB. CV.2435

MANHOLE NO.01  
COVER 650X500mm  
CHAMBER 700X600mm

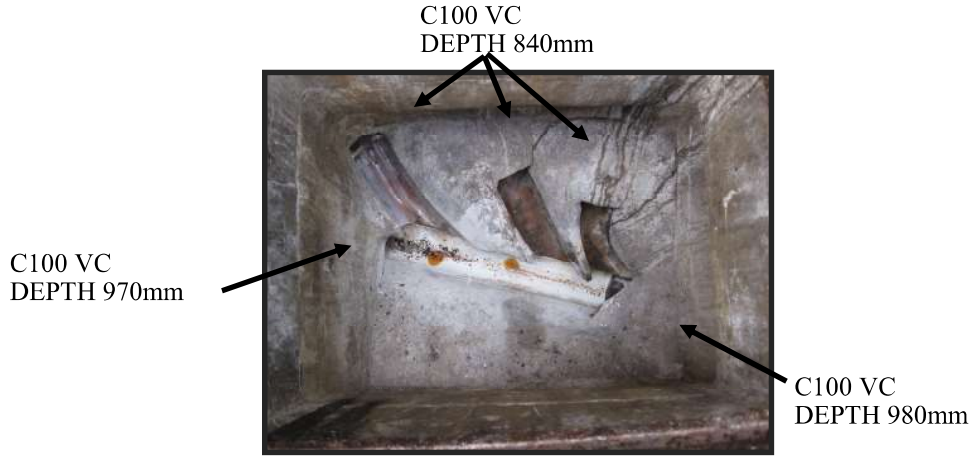

MANHOLE NO.02  
COVER 650X500mm  
CHAMBER 900X600mm

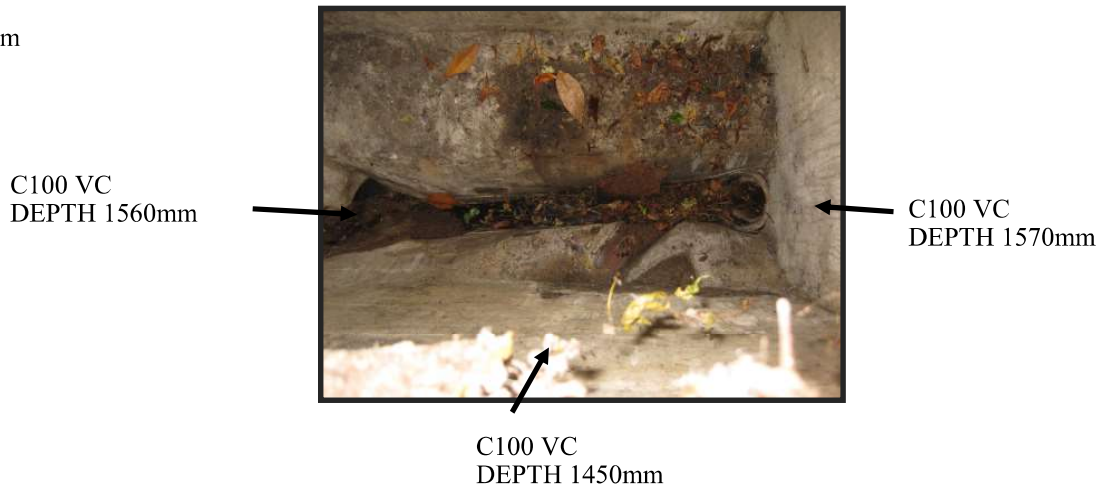

MANHOLE NO.03  
COVER 650X500mm  
CHAMBER 800X600mm





# G.O. DRAINAGE SERVICES LTD



53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com

## MANHOLE SURVEY

CLIENT. ELLIOTTWOOD	LOCATION. 12 PILGRIMS LANE LONDON NW31SN
DATE 31/06/22	JOB. CV.2435

MANHOLE NO.04  
COVER 510X510mm  
CHAMBER 500X500mm



C100 VC  
DEPTH 760mm

C100 VC  
DEPTH 620mm

C100 CI  
DEPTH 750mm

MANHOLE NO.05  
COVER 650X500mm  
CHAMBER 550X450mm



C100 VC  
DEPTH 440mm


C100 VC  
DEPTH 360mm

C100 VC  
DEPTH 340mm





# G.O. DRAINAGE SERVICES LTD

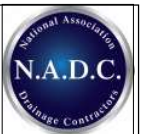

53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com

## PHOTOS


CLIENT. ELLIOTTWOOD	LOCATION. 12 PILGRIMS LANE LONDON NW31SN
DATE 31/06/22	JOB. CV.2435







# G.O. DRAINAGE SERVICES LTD

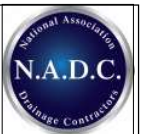

53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com

## PHOTOS

CLIENT. ELLIOTTWOOD

LOCATION. 12 PILGRIMS LANE LONDON NW31SN

DATE 31/06/22


JOB. CV.2435







# G.O. DRAINAGE SERVICES LTD

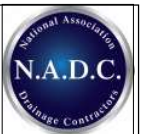

53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com

## PHOTOS

CLIENT. ELLIOTTWOOD	LOCATION. 12 PILGRIMS LANE LONDON NW31SN
DATE 31/06/22	JOB. CV.2435





# G.O. DRAINAGE SERVICES LTD



53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com

## INSPECTION REPORT

CLIENT. ELLIOTTWOOD

LOCATION. 12 PILGRIMS LANE LONDON NW31SN

JOB NO.	RUN NUMBER	DATE	SEWER USE	DEPTH	DIRECTION	PIPE SIZE	MATERIAL	WEATHER	CLEANED	OPERATOR	PAGE
CV.2435	01	31/06/22	COMBINED	970mm	UPSTREAM	100mm	V/CLAY	DRY	NO	GO	1

START FINISH  
 ST. MANHOLE No. 01 CONNECTION- 1 FH. MANHOLE NO.05

CHAINAGE	CODE	OBSERVATION
----------	------	-------------



000.0	ST	START OF SURVEY
000.0	WL	WATER LEVEL 05%
000.8	LR	LINE OF DRAIN DEVIATES RIGHT ( SLIGHT )
002.3	R	ROOTS FINE
006.9	CC	CRACK,CIRCUMFERENTIAL FROM 12 TO 12 O'CLOCK
008.2	MH	MANHOLE NO.05
008.2	FH	FINISH OF SURVEY

**END OF RUN NO.01**





# G.O. DRAINAGE SERVICES LTD



53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com

## INSPECTION REPORT

CLIENT. ELLIOTTWOOD

LOCATION. 12 PILGRIMS LANE LONDON NW31SN

JOB NO.	RUN NUMBER	DATE	SEWER USE	DEPTH	DIRECTION	PIPE SIZE	MATERIAL	WEATHER	CLEANED	OPERATOR	PAGE
CV.2435	02	31/06/22	COMBINED	840mm	UPSTREAM	100mm	V/CLAY	DRY	NO	GO	1

START	FINISH
ST. MANHOLE No. 01 CONNECTION- 2	FH. GULLY

CHAINAGE	CODE	OBSERVATION
----------	------	-------------



000.0	ST	START OF SURVEY
000.0	WL	WATER LEVEL 05%
000.3	CC	CRACK,CIRCUMFERENTIAL FROM 12 TO 12 O'CLOCK
000.3	LU	LINE OF DRAIN DEVIATES UP ( SHARP )
000.3	FH	FINISH OF SURVEY ( GULLY )

**END OF RUN NO.02**







# G.O. DRAINAGE SERVICES LTD



53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com

## INSPECTION REPORT

CLIENT: ELLIOTTWOOD LOCATION: 12 PILGRIMS LANE LONDON NW31SN


JOB NO.	RUN NUMBER	DATE	SEWER USE	DEPTH	DIRECTION	PIPE SIZE	MATERIAL	WEATHER	CLEANED	OPERATOR	PAGE
CV.2435	03	31/06/22	COMBINED	840mm	UPSTREAM	100mm	V/CLAY	DRY	NO	GO	1

START FINISH  
 ST. MANHOLE No. 01 CONNECTION- 3 FH. UPSTREAM



CHAINAGE	CODE	OBSERVATION
000.0	ST	START OF SURVEY
000.0	WL	WATER LEVEL 05%
000.4	R	ROOTS FINE
001.3	LU	LINE OF DRAIN DEVIATES UP ( SHARP )
001.3	FH	FINISH OF SURVEY BLOCKED OFF

**END OF RUN NO.03**





# G.O. DRAINAGE SERVICES LTD



53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com

## INSPECTION REPORT

CLIENT: ELLIOTTWOOD LOCATION: 12 PILGRIMS LANE LONDON NW31SN

JOB NO.	RUN NUMBER	DATE	SEWER USE	DEPTH	DIRECTION	PIPE SIZE	MATERIAL	WEATHER	CLEANED	OPERATOR	PAGE
CV.2435	04	31/06/22	COMBINED	840mm	UPSTREAM	100mm	V/CLAY	DRY	NO	GO	1

START FINISH  
 ST. MANHOLE No. 01 CONNECTION- 4 FH. UPSTREAM



CHAINAGE	CODE	OBSERVATION
000.0	ST	START OF SURVEY
000.0	WL	WATER LEVEL 05%
002.0	CC	CRACK,CIRCUMFERENTIAL FROM 12 TO 12 O'CLOCK
002.4	LU	LINE OF DRAIN DEVIATES UP ( SHARP )
002.4	FH	FINISH OF SURVEY

**END OF RUN NO.04**

U/ST



# G.O. DRAINAGE SERVICES LTD



53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com

## INSPECTION REPORT

CLIENT. ELLIOTTWOOD

LOCATION. 12 PILGRIMS LANE LONDON NW31SN

JOB NO.	RUN NUMBER	DATE	SEWER USE	DEPTH	DIRECTION	PIPE SIZE	MATERIAL	WEATHER	CLEANED	OPERATOR	PAGE
CV.2435	05	31/06/22	COMBINED	980mm	DOWNSTREAM	100mm	V/CLAY	DRY	NO	GO	1

START	FINISH
ST. MANHOLE No. 01 CONNECTION- X	FH. MANHOLE NO.02



CHAINAGE	CODE	OBSERVATION
000.0	ST	START OF SURVEY
000.0	WL	WATER LEVEL 05%
006.2	MH	MANHOLE NO.02
006.2	FH	FINISH OF SURVEY

**END OF RUN NO.05**







# G.O. DRAINAGE SERVICES LTD



53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com


## INSPECTION REPORT

CLIENT. ELLIOTTWOOD

LOCATION. 12 PILGRIMS LANE LONDON NW31SN

JOB NO.	RUN NUMBER	DATE	SEWER USE	DEPTH	DIRECTION	PIPE SIZE	MATERIAL	WEATHER	CLEANED	OPERATOR	PAGE
CV.2435	06	31/06/22	COMBINED	N/A	DOWNSTREAM	100mm	V/CLAY	DRY	NO	GO	1

START	FINISH
ST. GULLY No. 1 CONNECTION- X	FH. DOWNSTREAM



CHAINAGE	CODE	OBSERVATION
000.0	ST	START OF SURVEY
000.0	WL	WATER LEVEL 05%
000.3	DES	SETTLED DEPOSITS FINE %
000.6	LD	LINE OF DRAIN DEVIATES DOWN ( SHARP )
000.6	FH	FINISH OF SURVEY

**END OF RUN NO.06**

D/ST



# G.O. DRAINAGE SERVICES LTD



53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com

## INSPECTION REPORT

CLIENT. ELLIOTTWOOD

LOCATION. 12 PILGRIMS LANE LONDON NW31SN

JOB NO.	RUN NUMBER	DATE	SEWER USE	DEPTH	DIRECTION	PIPE SIZE	MATERIAL	WEATHER	CLEANED	OPERATOR	PAGE
CV.2435	07	31/06/22	COMBINED	1570mm	DOWNSTREAM	100mm	V/CLAY	DRY	NO	GO	1

START FINISH  
 ST. MANHOLE No. 02 CONNECTION- X FH. MAIN SEWER

CHAINAGE	CODE	OBSERVATION
----------	------	-------------



### ACCESS 100mm RODDING EYE

000.0	ST	START OF SURVEY
000.0	WL	WATER LEVEL 05%
000.4	JN	JUNCTION AT 06 O'CLOCK, DIAMETER 150mm TRAP
000.4	SC	DIMENSION OF DRAIN CHANGES TO 150mm
004.9	FC	FRACTURE, CIRCUMFERENTIAL FROM 12 TO 12 O'CLOCK
006.6	REM	GENERAL REMARK ( FLAP VALVE )
006.6	FH	FINISH OF SURVEY MAIN SEWER

**END OF RUN NO.07**

MAIN SEWER



# G.O. DRAINAGE SERVICES LTD



53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com


## INSPECTION REPORT

CLIENT. ELLIOTTWOOD

LOCATION. 12 PILGRIMS LANE LONDON NW31SN

JOB NO.	RUN NUMBER	DATE	SEWER USE	DEPTH	DIRECTION	PIPE SIZE	MATERIAL	WEATHER	CLEANED	OPERATOR	PAGE
CV.2435	08	31/06/22	COMBINED	1560mm	UPSTREAM	100mm	V/CLAY	DRY	NO	GO	1

START	FINISH
ST. MANHOLE No. 02 CONNECTION-2	FH. UPSTREAM

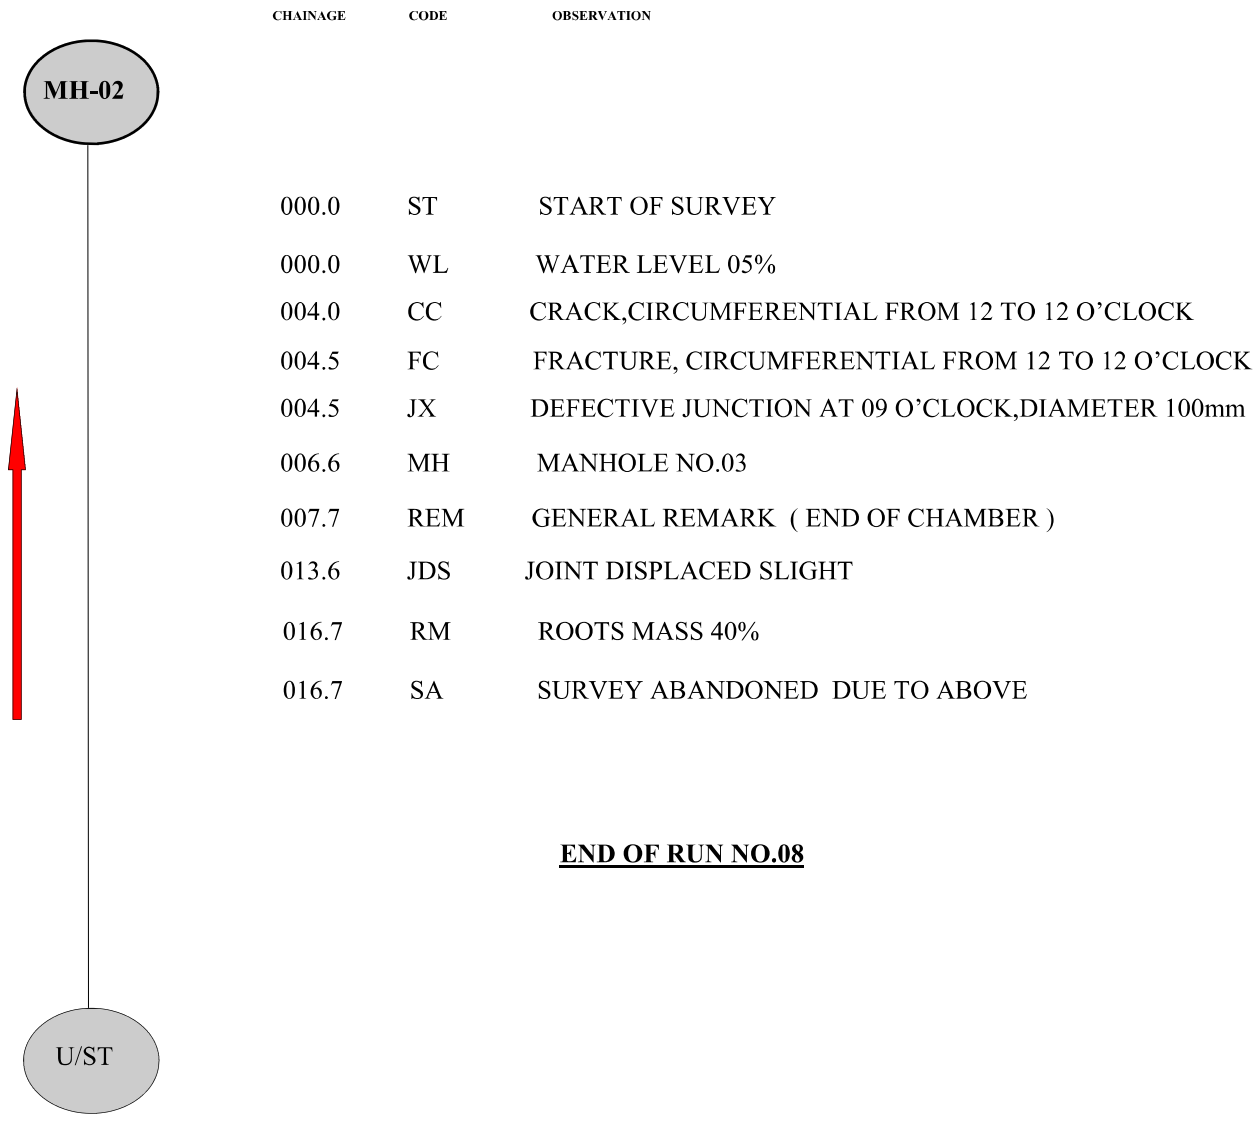

**END OF RUN NO.08**





# G.O. DRAINAGE SERVICES LTD



53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com

## INSPECTION REPORT

CLIENT: ELLIOTTWOOD LOCATION: 12 PILGRIMS LANE LONDON NW31SN

JOB NO.	RUN NUMBER	DATE	SEWER USE	DEPTH	DIRECTION	PIPE SIZE	MATERIAL	WEATHER	CLEANED	OPERATOR	PAGE
CV.2435	09	31/06/22	COMBINED	820mm	UPSTREAM	100mm	V/CLAY	DRY	NO	GO	1

START FINISH  
 ST. MANHOLE No. 03 CONNECTION- 1 FH. UPSTREAM



CHAINAGE	CODE	OBSERVATION
000.0	ST	START OF SURVEY
000.0	WL	WATER LEVEL 05%
000.4	FC	FRACTURE, CIRCUMFERENTIAL FROM 12 TO 12 O'CLOCK
001.0	LU	LINE OF DRAIN DEVIATES UP ( SHARP )
001.0	R	ROOTS FINE
001.0	FH	FINISH OF SURVEY

**END OF RUN NO.09**

U/ST



# G.O. DRAINAGE SERVICES LTD



53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com

## INSPECTION REPORT


CLIENT. ELLIOTTWOOD

LOCATION. 12 PILGRIMS LANE LONDON NW31SN

JOB NO.	RUN NUMBER	DATE	SEWER USE	DEPTH	DIRECTION	PIPE SIZE	MATERIAL	WEATHER	CLEANED	OPERATOR	PAGE
CV.2435	10	31/06/22	COMBINED	820mm	UPSTREAM	100mm	V/CLAY	DRY	NO	GO	1

START FINISH  
 ST. MANHOLE No. 03 CONNECTION- 2 FH. WC

CHAINAGE	CODE	OBSERVATION
000.0	ST	START OF SURVEY
000.0	WL	WATER LEVEL 05%
000.3	FC	FRACTURE, CIRCUMFERENTIAL FROM 12 TO 12 O'CLOCK
001.3	FC	FRACTURE, CIRCUMFERENTIAL FROM 12 TO 12 O'CLOCK
001.8	LU	LINE OF DRAIN DEVIATES UP ( SHARP )
001.8	FH	FINISH OF SURVEY WC

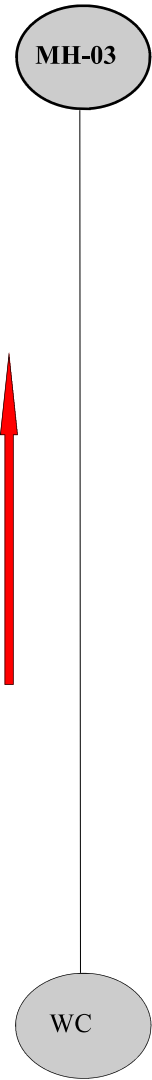

**END OF RUN NO.10**



# G.O. DRAINAGE SERVICES LTD



53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com

## INSPECTION REPORT

CLIENT: ELLIOTTWOOD LOCATION: 12 PILGRIMS LANE LONDON NW31SN

JOB NO.	RUN NUMBER	DATE	SEWER USE	DEPTH	DIRECTION	PIPE SIZE	MATERIAL	WEATHER	CLEANED	OPERATOR	PAGE
CV.2435	11	31/06/22	COMBINED	820mm	UPSTREAM	100mm	V/CLAY	DRY	NO	GO	1

START FINISH  
 ST. MANHOLE No. 03 CONNECTION- 3 FH. GULLY



CHAINAGE	CODE	OBSERVATION
000.0	ST	START OF SURVEY
000.0	WL	WATER LEVEL 05%
000.3	R	ROOTS FINE
000.3	FM	FRACTURES,MULTIPLE FROM 12 TO 12 O'CLOCK
001.3	LL	LINE OF DRAIN DEVIATES LEFT ( SLIGHT )
001.8	LD	LINE OF DRAIN DEVIATES DOWN ( SHARP )
001.8	FH	FINISH OF SURVEY ( GULLY )

**END OF RUN NO.11**



# G.O. DRAINAGE SERVICES LTD



53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com

## INSPECTION REPORT

CLIENT. ELLIOTTWOOD

LOCATION. 12 PILGRIMS LANE LONDON NW31SN

JOB NO.	RUN NUMBER	DATE	SEWER USE	DEPTH	DIRECTION	PIPE SIZE	MATERIAL	WEATHER	CLEANED	OPERATOR	PAGE
CV.2435	12	31/06/22	COMBINED	950mm	UPSTREAM	100mm	V/CLAY	DRY	NO	GO	1

START	FINISH
ST. MANHOLE No.03	FH. UPSTREAM

CHAINAGE	CODE	OBSERVATION
----------	------	-------------



000.0	ST	START OF SURVEY
000.0	WL	WATER LEVEL 05%
000.5	FC	FRACTURE, CIRCUMFERENTIAL FROM 12 TO 12 O'CLOCK
002.0	FC	FRACTURE, CIRCUMFERENTIAL FROM 12 TO 12 O'CLOCK
006.5	JDS	JOINT DISPLACED SLIGHT
009.5	R	ROOTS FINE
010.2	MH	MANHOLE NO.04
010.7	REM	GENERAL REMARK ( END OF CHAMBER )
010.7	MC	MATERIAL OF DRAIN CHANGES TO CAST IRON AT THIS POINT
015.1	LL	LINE OF DRAIN DEVIATES LEFT ( SLIGHT )
015.1	FH	FINISH OF SURVEY

**END OF RUN NO.12**

U/ST



# G.O. DRAINAGE SERVICES LTD



53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com

## INSPECTION REPORT

CLIENT: ELLIOTTWOOD LOCATION: 12 PILGRIMS LANE LONDON NW31SN

JOB NO.	RUN NUMBER	DATE	SEWER USE	DEPTH	DIRECTION	PIPE SIZE	MATERIAL	WEATHER	CLEANED	OPERATOR	PAGE
CV.2435	13	31/06/22	COMBINED	670mm	UPSTREAM	100mm	V/CLAY	DRY	NO	GO	1

START FINISH  
 ST. MANHOLE No.04 CONNECTION- 1 FH. GULLY

CHAINAGE	CODE	OBSERVATION
----------	------	-------------



000.0	ST	START OF SURVEY
000.0	WL	WATER LEVEL 05%
000.3	LD	LINE OF DRAIN DEVIATES DOWN ( SHARP )
000.3	FH	FINISH OF SURVEY ( GULLY )

**END OF RUN NO.13**







# G.O. DRAINAGE SERVICES LTD



53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com

## INSPECTION REPORT


CLIENT. ELLIOTTWOOD

LOCATION. 12 PILGRIMS LANE LONDON NW31SN

JOB NO.	RUN NUMBER	DATE	SEWER USE	DEPTH	DIRECTION	PIPE SIZE	MATERIAL	WEATHER	CLEANED	OPERATOR	PAGE
CV.2435	14	31/06/22	COMBINED	N/A	DOWNSTREAM	100mm	CAST IRON	DRY	NO	GO	1

START	FINISH
ST. RE No. 1 CONNECTION- X	FH. DOWNSTREAM

CHAINAGE	CODE	OBSERVATION
000.0	ST	START OF SURVEY
000.0	WL	WATER LEVEL 05%
002.0	JN	JUNCTION AT 03 O'CLOCK, DIAMETER 100mm
004.2	LR	LINE OF DRAIN DEVIATES RIGHT ( SLIGHT )
009.2	MH	MANHOLE NO.04
009.2	FH	FINISH OF SURVEY



**END OF RUN NO.14**



# G.O. DRAINAGE SERVICES LTD



53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com

## INSPECTION REPORT

CLIENT. ELLIOTTWOOD

LOCATION. 12 PILGRIMS LANE LONDON NW31SN

JOB NO.	RUN NUMBER	DATE	SEWER USE	DEPTH	DIRECTION	PIPE SIZE	MATERIAL	WEATHER	CLEANED	OPERATOR	PAGE
CV.2435	15	31/06/22	COMBINED	N/A	DOWNSTREAM	100mm	CAST IRON	DRY	NO	GO	1

START	FINISH
ST. SVP No. 1 CONNECTION- X	FH. DOWNSTREAM

CHAINAGE	CODE	OBSERVATION
000.0	ST	START OF SURVEY
000.0	WL	WATER LEVEL 05%
001.6	FH	FINISH OF SURVEY JUNCTION WITH SEWER



**END OF RUN NO.15**

D/ST



# G.O. DRAINAGE SERVICES LTD



53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com

## INSPECTION REPORT

CLIENT. ELLIOTTWOOD

LOCATION. 12 PILGRIMS LANE LONDON NW31SN

JOB NO.	RUN NUMBER	DATE	SEWER USE	DEPTH	DIRECTION	PIPE SIZE	MATERIAL	WEATHER	CLEANED	OPERATOR	PAGE
CV.2435	16	31/06/22	COMBINED	340mm	UPSTREAM	100mm	V/CLAY	DRY	NO	GO	1

START	FINISH
ST. MANHOLE No. 05 CONNECTION- 1	FH. UPSTREAM



CHAINAGE	CODE	OBSERVATION
000.0	ST	START OF SURVEY
000.0	WL	WATER LEVEL 05%
000.3	LR	LINE OF DRAIN DEVIATES RIGHT ( SLIGHT )
002.0	LR	LINE OF DRAIN DEVIATES RIGHT ( SLIGHT )
002.8	LU	LINE OF DRAIN DEVIATES UP ( SHARP )
002.8	FH	FINISH OF SURVEY

**END OF RUN NO.16**

U/ST



# G.O. DRAINAGE SERVICES LTD



53 PREMIER AVENUE GRAYS RM16 2SJ TEL:01375 373302 MOB:07792 815977 E-MAIL: godrainage@aol.com

## INSPECTION REPORT

CLIENT: ELLIOTTWOOD

LOCATION: 12 PILGRIMS LANE LONDON NW31SN

JOB NO.	RUN NUMBER	DATE	SEWER USE	DEPTH	DIRECTION	PIPE SIZE	MATERIAL	WEATHER	CLEANED	OPERATOR	PAGE
CV.2435	17	31/06/22	COMBINED	360mm	UPSTREAM	100mm	V/CLAY	DRY	NO	GO	1

START	FINISH
ST. MANHOLE No. 05 CONNECTION- 2	FH. GULLY

CHAINAGE	CODE	OBSERVATION
----------	------	-------------



000.0	ST	START OF SURVEY
000.0	WL	WATER LEVEL 05%
000.7	CC	CRACK,CIRCUMFERENTIAL FROM 12 TO 12 O'CLOCK
001.4	LD	LINE OF DRAIN DEVIATES DOWN ( SHARP )
001.4	FH	FINISH OF SURVEY ( GULLY )

**END OF RUN NO.17**

GULLY



## SUMMARY AND RECOMMENDATIONS

CLIENT. ELLIOTTWOOD	LOCATION. 12 PILGRIMS LANE LONDON NW31SN
DATE 31/06/22	JOB. CV.2435

- RUN NO.01 CRACK ROOTS**
- RUN NO.02 CRACK**
- RUN NO.03 ROOTS**
- RUN NO.04 CRACK**
- RUN NO.05 NO WORK NEEDED**
- RUN NO.06 NO WORK NEEDED**
- RUN NO.07 FRACTURE**
- RUN NO.08 CRACK FRACTURE**
- RUN NO.09 FRACTURE**
- RUN NO.10 FRACTURES**
- RUN NO.11 ROOTS FRACTURES**
- RUN NO.12 ROOTS FRACTURES**
- RUN NO.13 NO WORK NEEDED**
- RUN NO.14 NO WORK NEEDED**
- RUN NO.15 NO WORK NEEDED**
- RUN NO.16 NO WORK NEEDED**
- RUN NO.17 CRACK**



**DRAIN & PIPEWORK CCTV  
SURVEYS**

-

**DRAINS  
PIPEWORK  
CULVERTS**

**DUCTS**

**CHUTES**

**CHIMNEY FLUES**

**TANKS**

**HIGH PRESSURE  
WATER JETTING**

-

**SEWER & DRAIN BLOCKAGES**

**DESCALING**

**SILT REMOVAL**

**ROOT CUTTING**

**GREASE REMOVAL**

-



**G.O. DRAINAGE SERVICES LTD**

