



**Level and Crack Monitoring**

Our Ref: [REDACTED]

Date of Issue: 20/06/2022

**Provider Details**

CET Property Services [REDACTED]

**Monitoring Details**

Instruction Date:	11/10/2021		
Number of visits	6	Visit Frequency (Wks)	8

**Visit Dates (future dates are estimated)**

Setup	1	2	3	4	5	6
08/11/21	03/01/22	28/02/22	25/04/22	20/06/22	15/08/22	10/10/22

**Client Details**

Insurance Co.:	[REDACTED]
Client Ref:	[REDACTED]
Client Name:	Sedgwick
Technical Mgr:	Gavin Catheline
Customer support	David McCormack
Tel:	[REDACTED]
Email:	


**Risk Address**

Occupier:	
Address:	37C Westbere Road
Address:	
Town:	London
County:	
Post Code:	NW2 3SP
Contact Name	

**Level and Crack Monitoring - Site Sketch**

Our Ref: [REDACTED]

Date of Issue: 20/06/2022

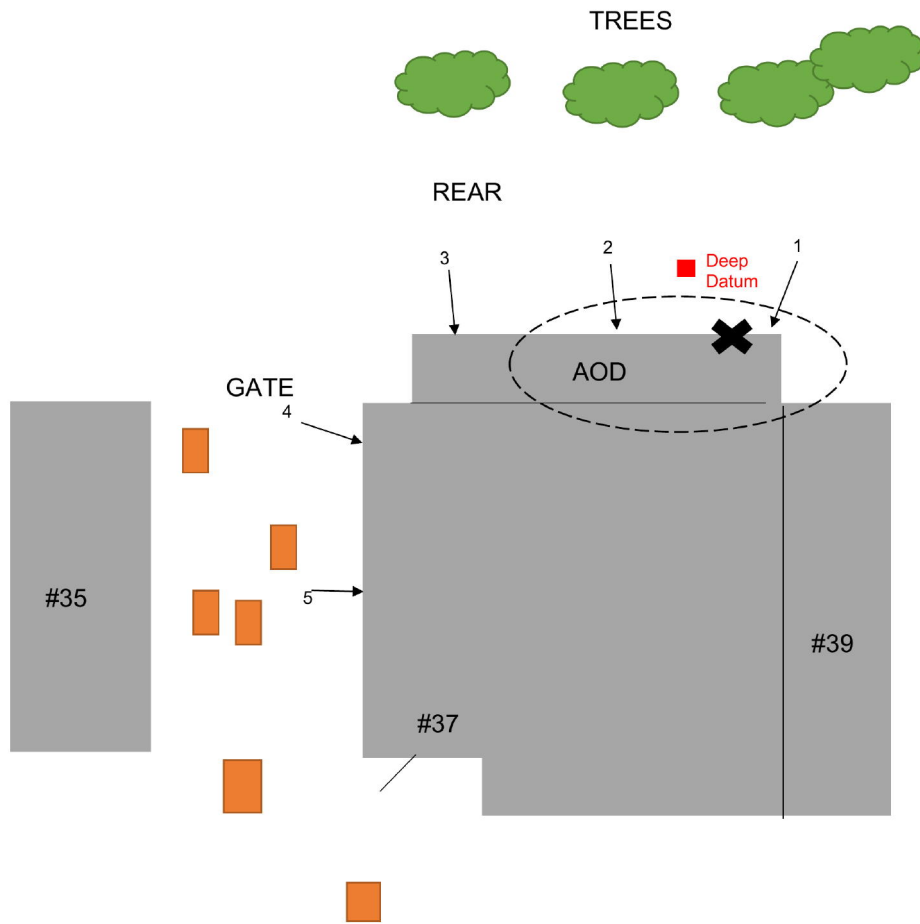



**Level Monitoring - Reduced Levels (in metres)**


Our Ref: [REDACTED]

Date of Issue:

20/06/22

Reading Date	8/11/21	23/12/21	4/3/22	29/4/22	20/6/22							
Point / Reading	1	2	3	4	5	6	7	8	9	10	11	12
1	10.8245	10.8244	10.8271	10.8263	10.8255							
2	10.8782	10.8783	10.8805	10.8798	10.8794							
3	10.6471	10.6478	10.6501	10.6501	10.6497							
4	10.9430	10.9430	10.9447	10.9444	10.9435							
5	11.2139	11.2137	11.2151	11.2150	11.2143							
not used												
not used												
not used												
not used												
not used												
not used												
not used												
not used												
not used												
not used												
Tech Initials	RH	RH	BA	BA	BA							
Level S/N.	524015	524015	522888	522888	521856							



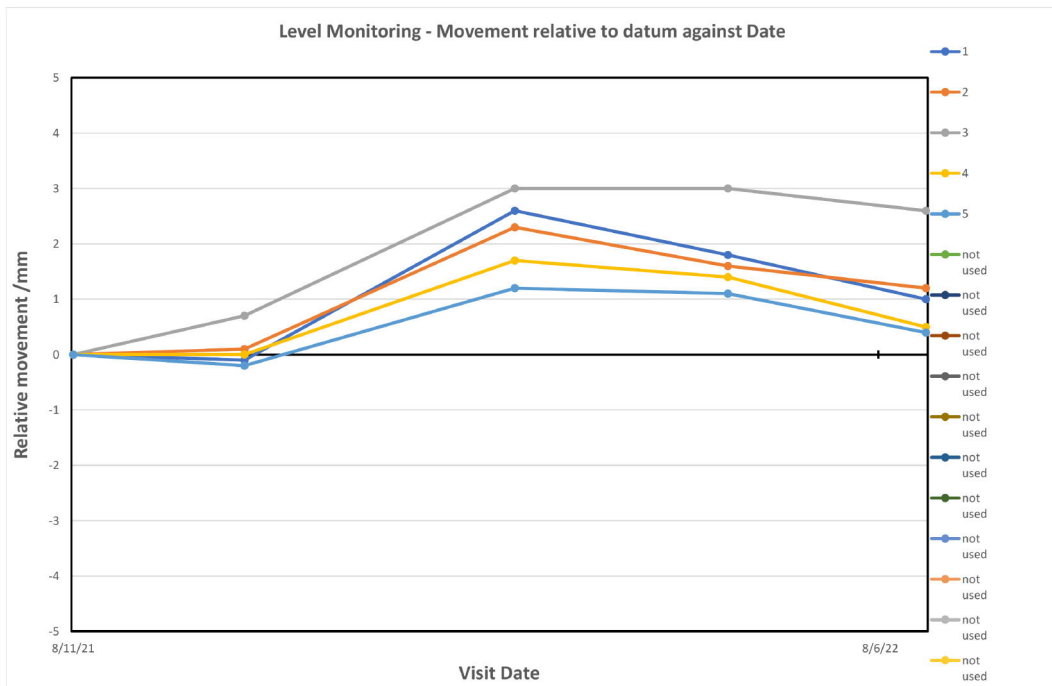



Our ref	Client ref	Client Name	Issue Date
		Sedgwick	20/09/2022

**Stud locations**

1	EXT rear above kitchen door
2	
3	
4	
5	
6	

Additional instructions / notes

**Crack Monitoring - Readings**

Studs nos	Align-ment	Visit Date	08/11/21	Visit Date	23/12/21	Visit Date	04/03/22	Visit Date	29/04/22	Visit Date	20/06/22	Visit Date	
		Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w
1	H	67.01	2.59	66.99	3.24	66.98	3.64	66.99	3.50	66.94	3.71		
1	D												
1	Check												
2	H												
2	D												
2	Check												
3	H												
3	D												
3	Check												
4	H												
4	D												
4	Check												
5	H												
5	D												
5	Check												
6	H												
6	D												
6	Check												
Caliber nos		6883		6883		9171		9171		9171			
Technician		RH		RH		BA		BA		BA			

	Client Name	Issue Date
	Sedgwick	20/06/2022

**Crack Monitoring - Movement Against Time**

