


Lassco Reclamation chimney piece, Pine & Plaster in the style of Robert Adam.

Tile and brick insert to be removed.

New Carrara marble slips to match new hearth to be cut to size to match the register grate.

Grove register grate by Jamb. All dimensions to be checked on site in relation to the reinstated fireplace, the register grate to be aligned with the back side of front marble pieces.

01 CHIMNEY PIECE ELEVATION
scale 1:10

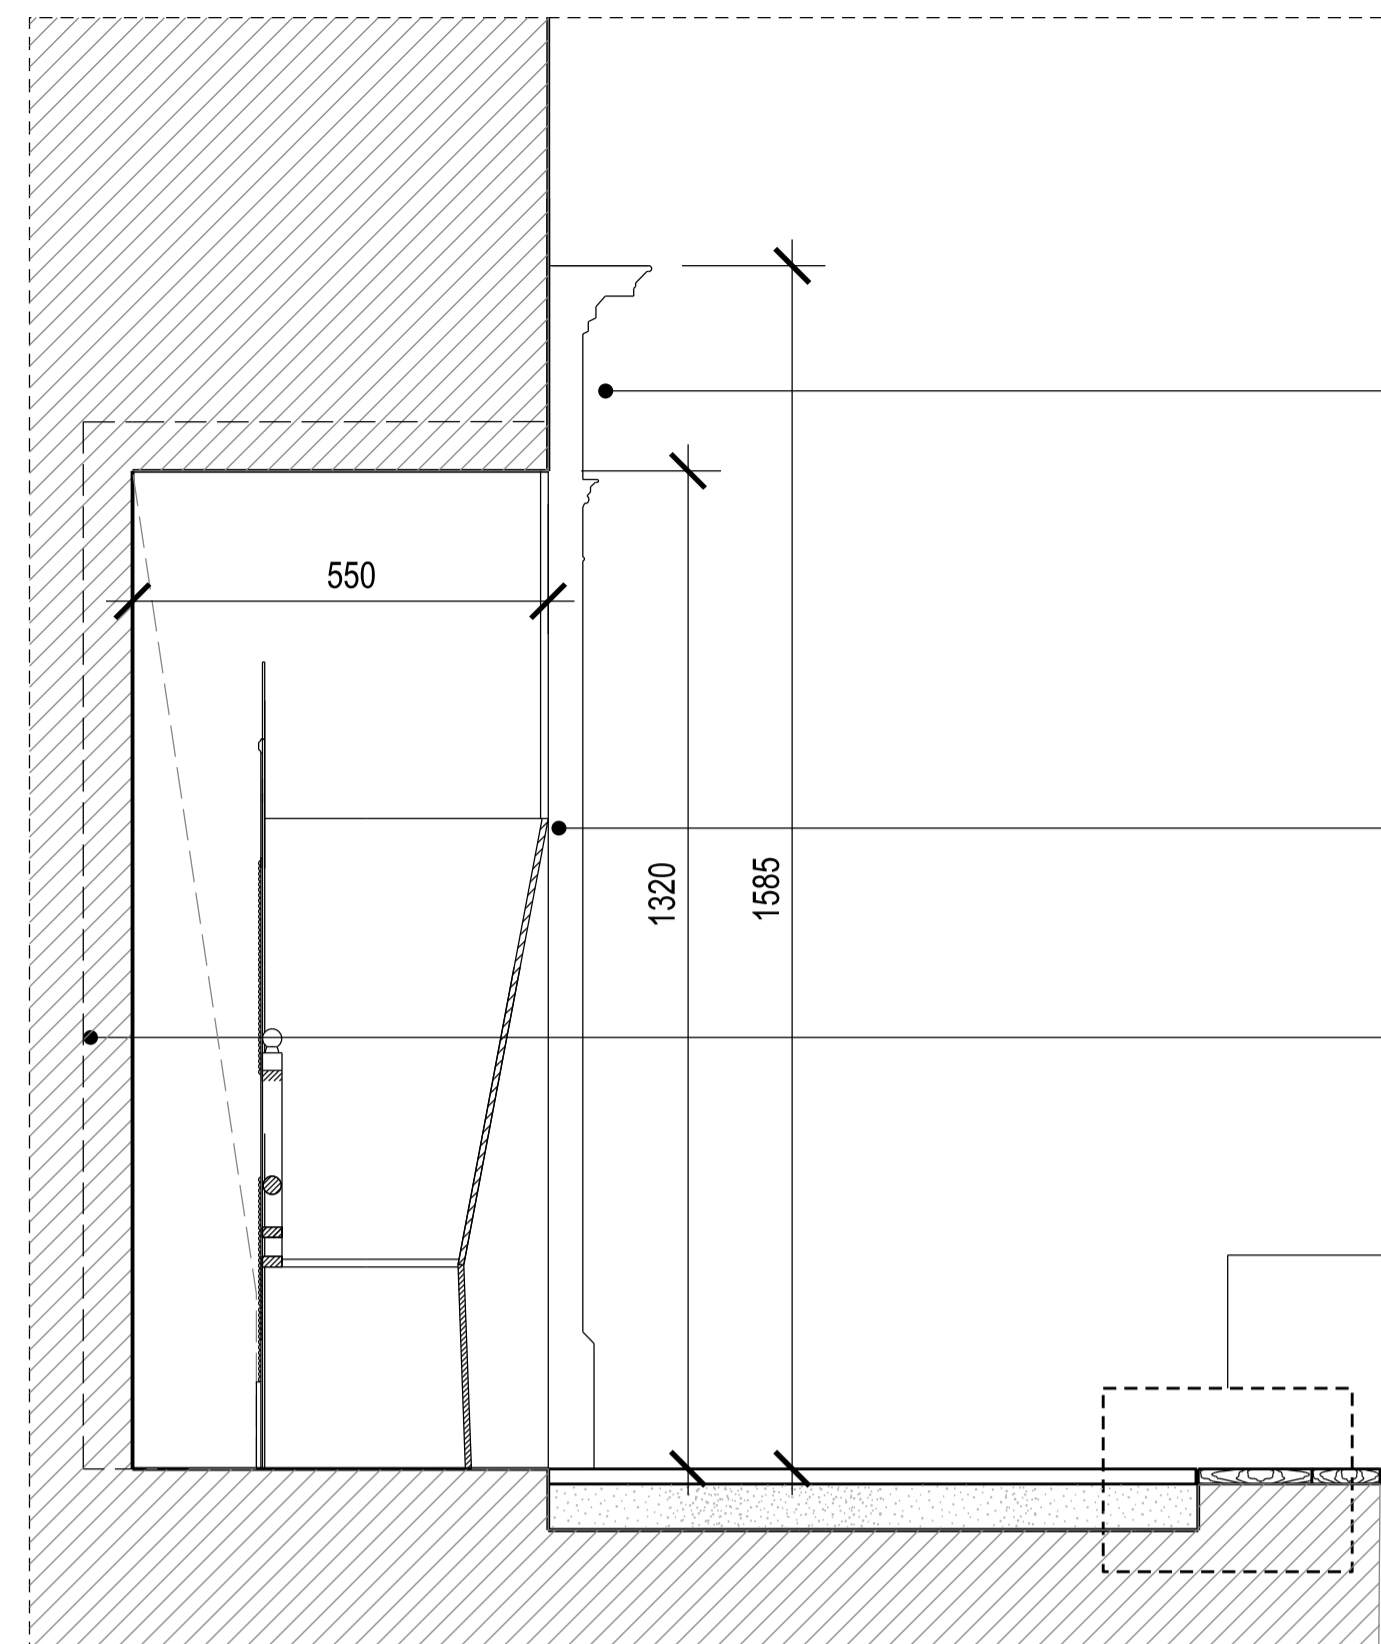

Lasco reclamation chimney piece, pine & plaster in the style of Robert Adam.

Grove register grate by Jamb.

Dashed line indicates brick surround

03
(33)AD003

02 CHIMNEY PIECE SECTION
scale 1:10


Method Statement of Repair

Clean, repair and carefully reinstate original pieces to their original location. Add new pieces in a like for like basis, when missing or not able to be repaired.


Clean and repair existing firebox and integrate new marble hearth to match the existing from the photos and the chimney piece as closely as possible.

Tiles to be removed, register grate to be inserted in a 18th century style appropriate to age + style of building.
To be discussed with local planning authority prior to submitting to discharge of conditions.

Redecorate painted elements, using same colour and type of paint, as existing.

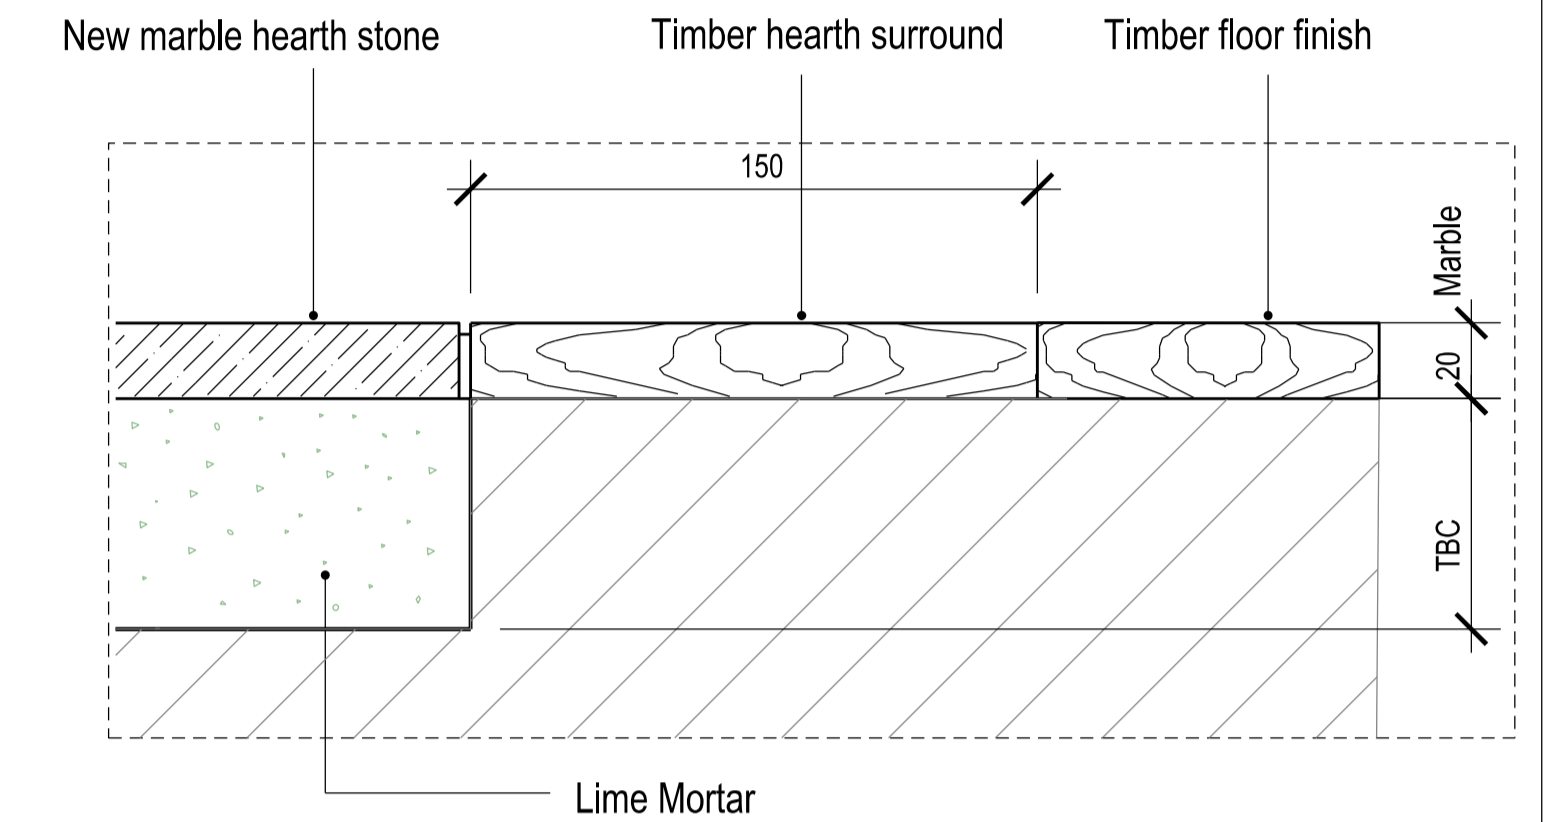

03 DETAIL HEARTH SECTION
scale 1:2

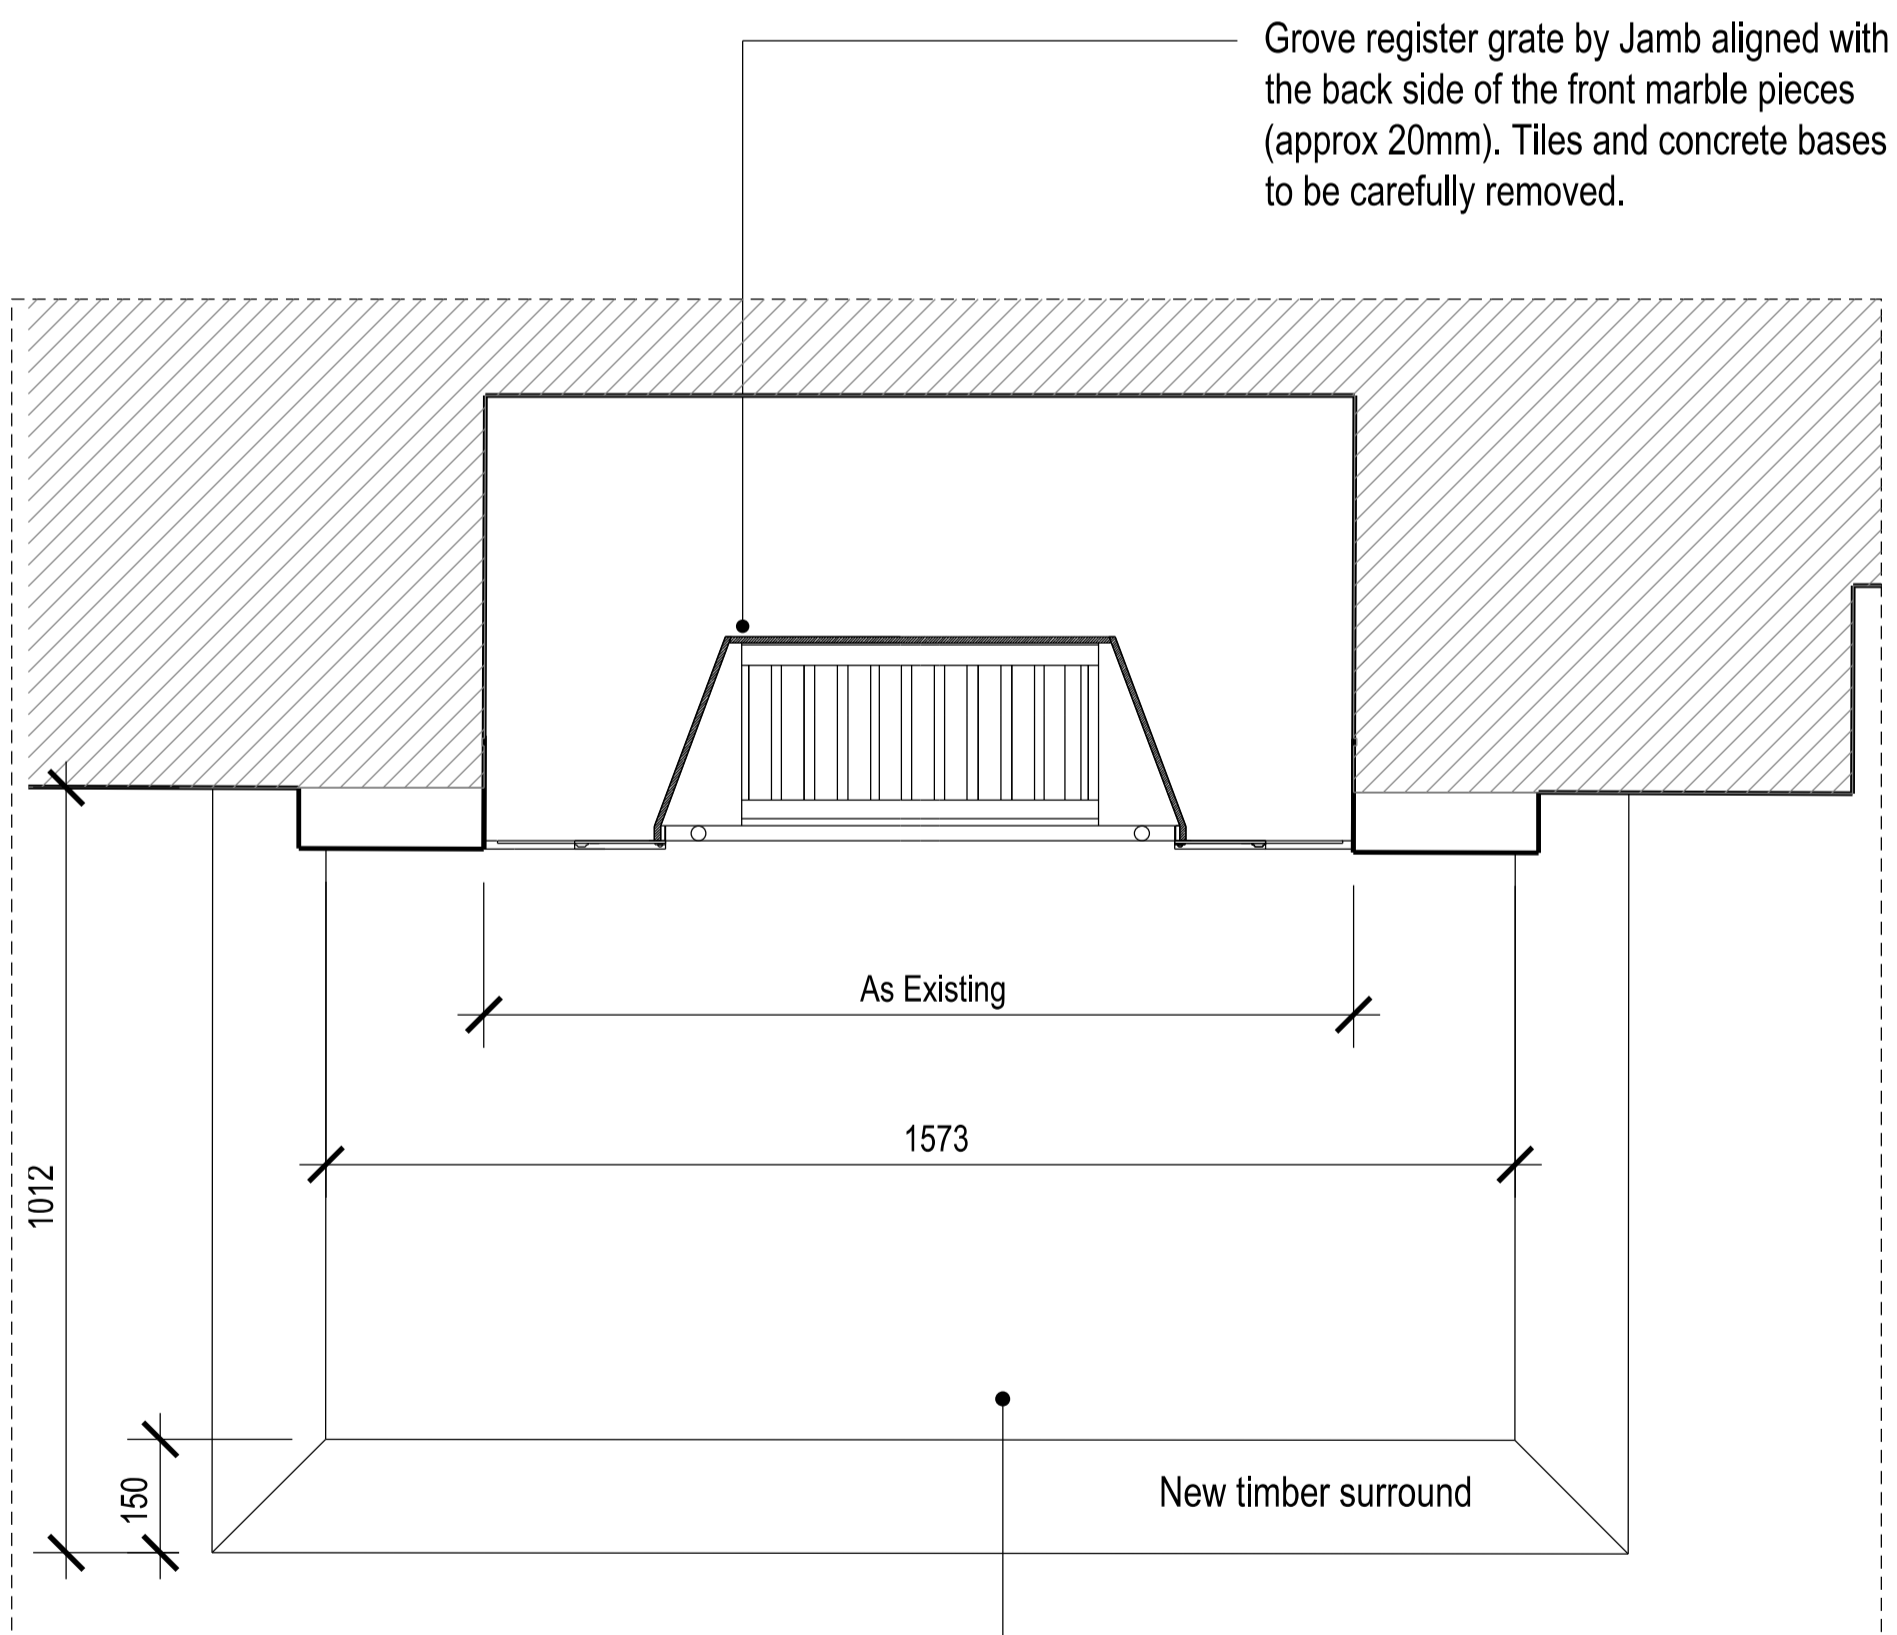


Grove register grate by Jamb aligned with the back side of the front marble pieces (approx 20mm). Tiles and concrete bases to be carefully removed.

As Existing

New timber surround


New marble hearth stone to match others in the house. Original hearth stone found to be lost.

04 CHIMNEY PIECE AND HEARTH PLAN VIEW
scale 1:10

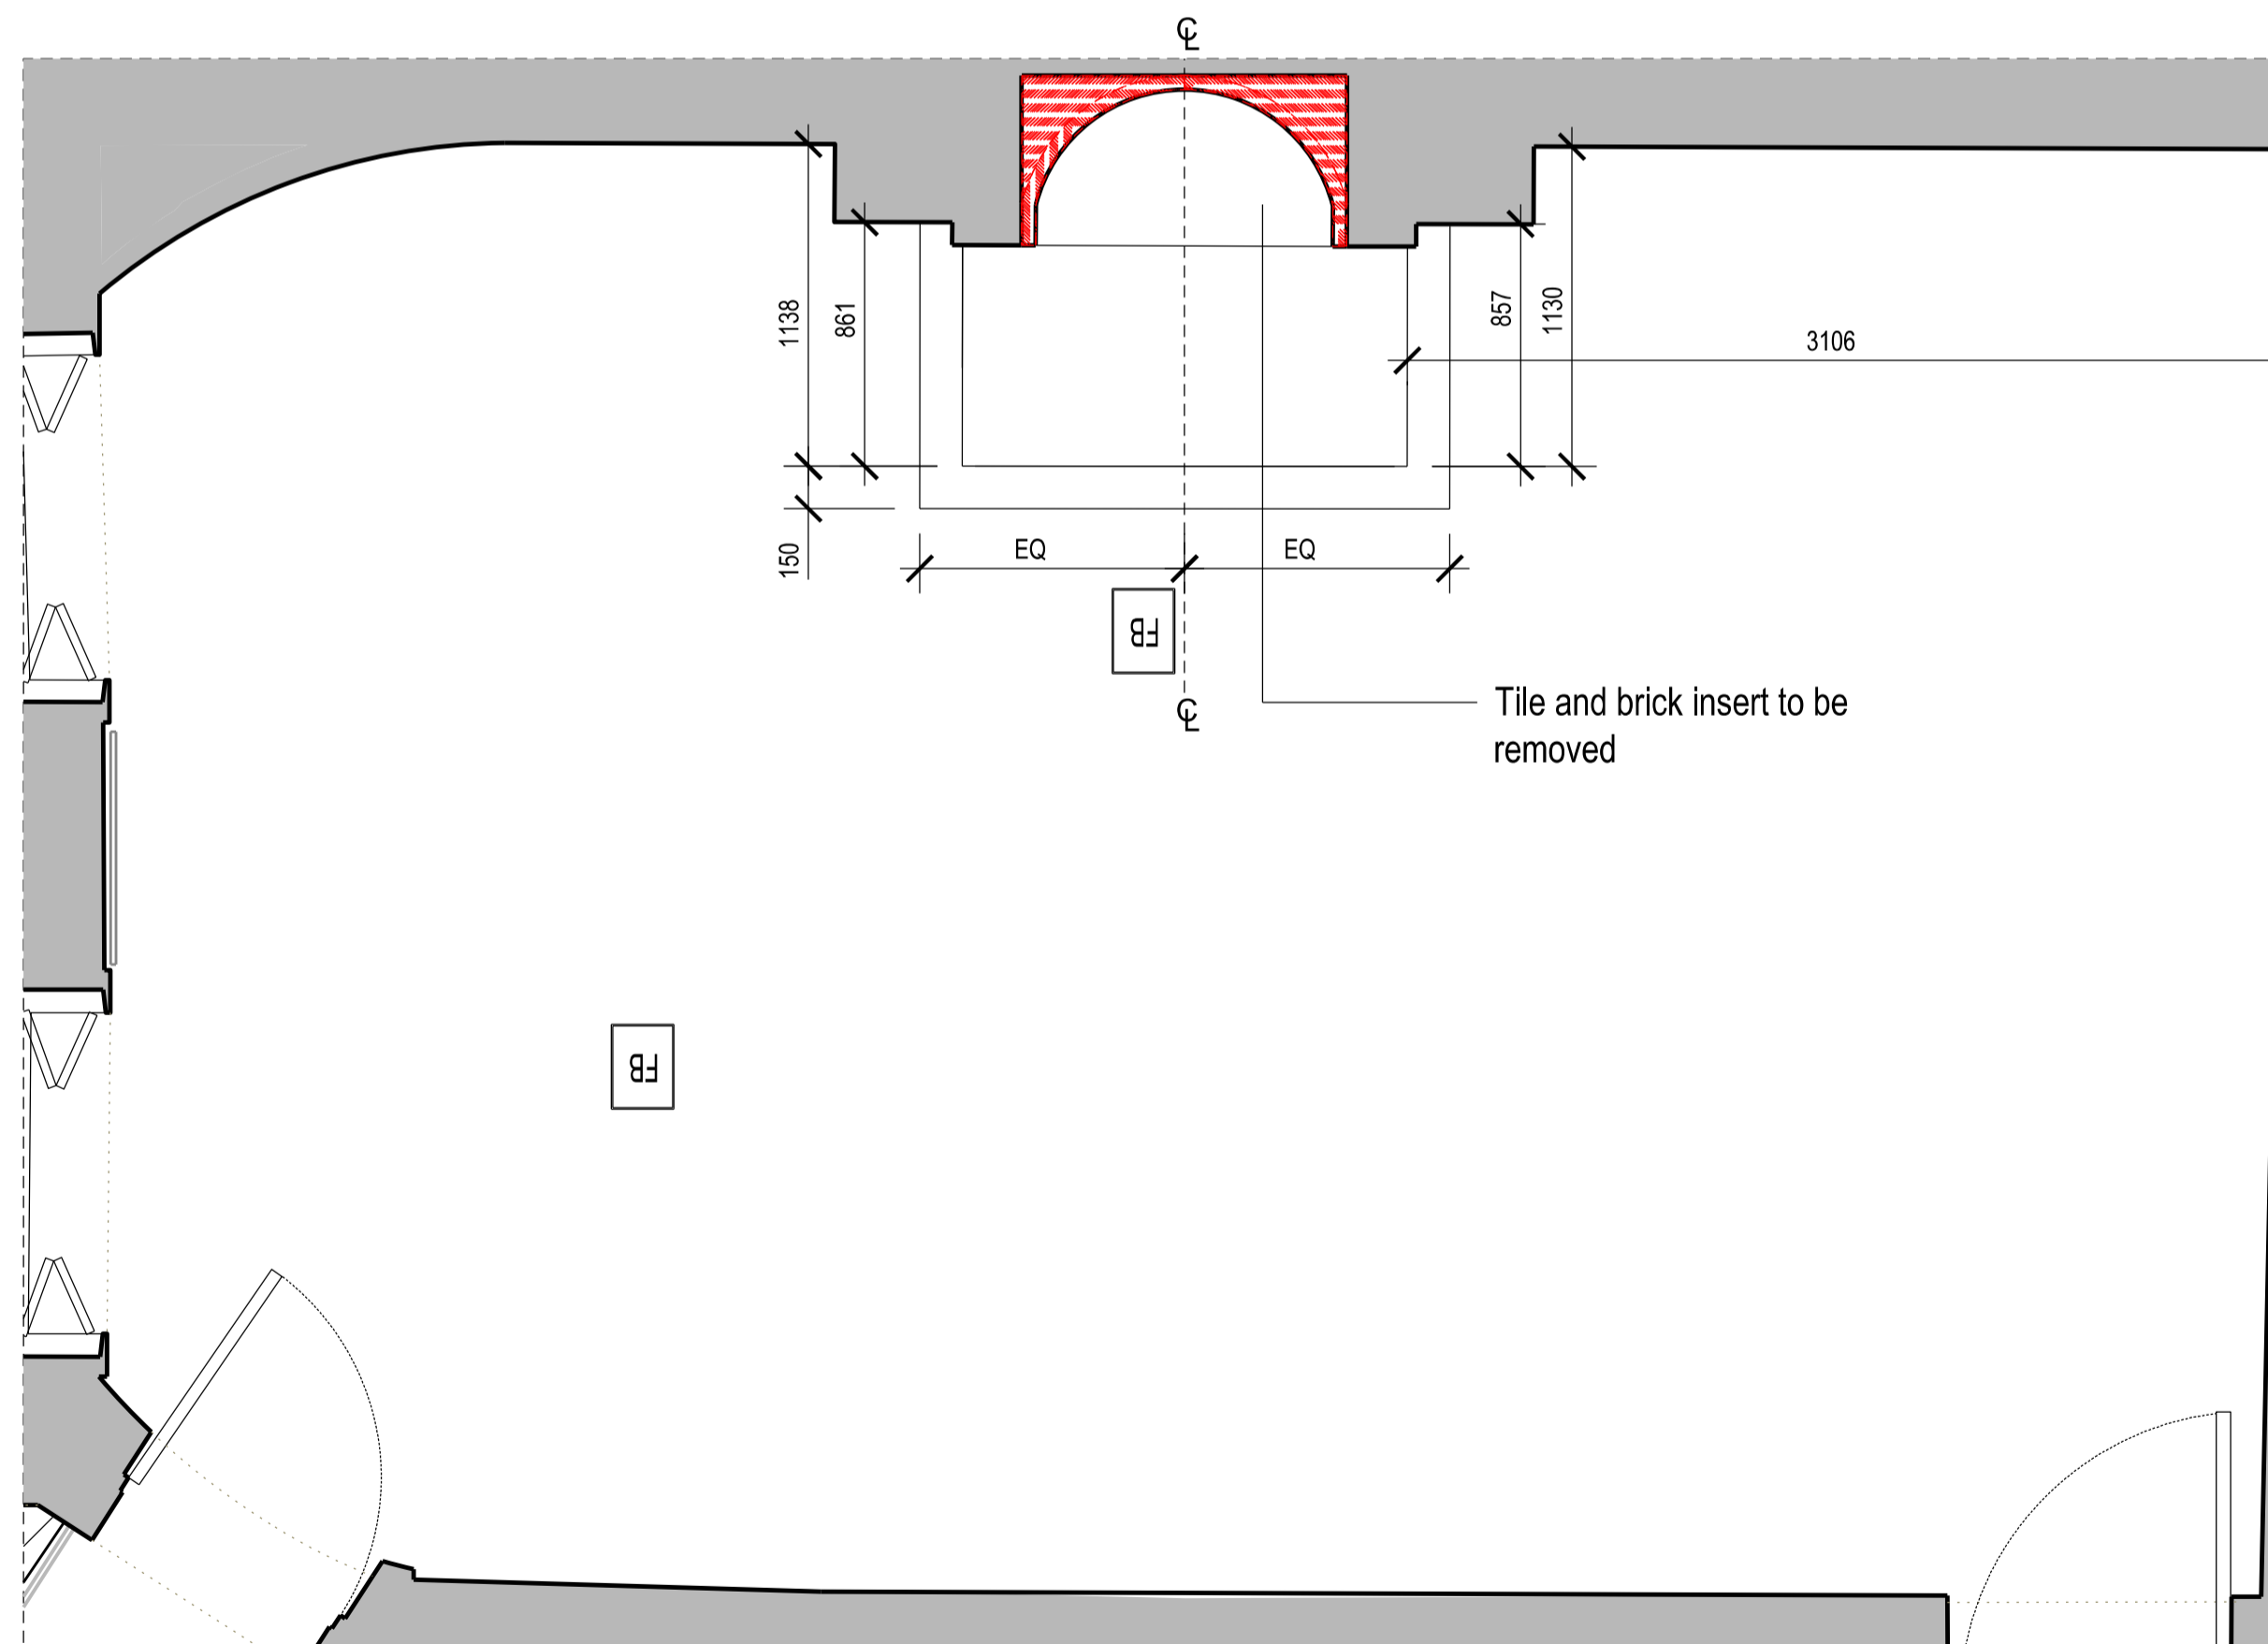

Tile and brick insert to be removed

05 KEY PLAN
ROOM 1.03 LIBRARY
scale 1:25

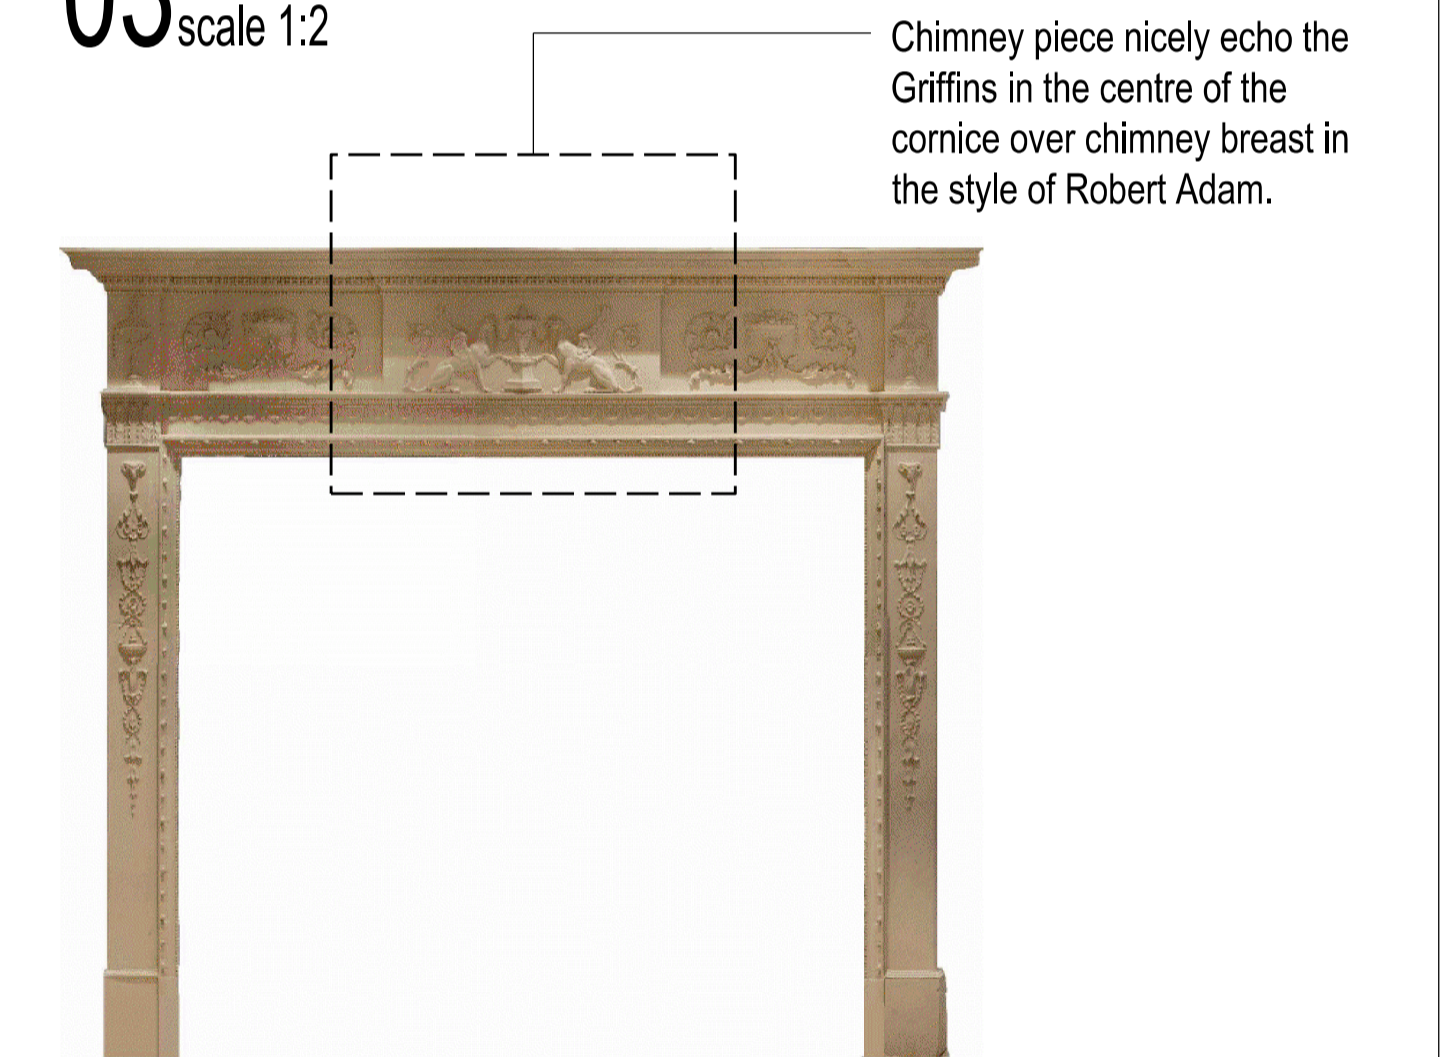

Chimney piece nicely echo the Griffins in the centre of the cornice over chimney breast in the style of Robert Adam.

CHIMNEY PIECE IMAGE
18th Century Pine & Plaster chimney piece purchased from Lassco Reclamation in London.

See (33)AD003_B elevation drawings for comparison of scale between the original chimney piece and this reclaimed chimney piece. The original chimney piece was lost prior to current owner purchasing the building. Our consent allowed for the reproduction chimney piece however through discussions with the Conservation Officer it was agreed that this reclaimed chimney piece would make an adequate substitute.

BUILDING DESIGN PARTNERSHIP LTD SHALL HAVE NO RESPONSIBILITY FOR ANY USE MADE OF THIS DOCUMENT OTHER THAN FOR THAT WHICH IT WAS PREPARED AND ISSUED

ALL DIMENSIONS SHOULD BE CHECKED ON SITE.

DO NOT SCALE FROM THIS DRAWING.

ANY DRAWING ERRORS OR DIVERGENCES SHOULD BE BROUGHT TO THE ATTENTION OF BUILDING DESIGN PARTNERSHIP LTD AT THE ADDRESS SHOWN.

Demolition
 Existing Fabric
 As Proposed Fabric

REVISION/DESCRIPTION	DATE	CHECKED	DRAWN

REVISION/DESCRIPTION	DATE	CHECKED	DRAWN


REVISION/DESCRIPTION	DATE	CHECKED	DRAWN

REVISION/DESCRIPTION	DATE	CHECKED	DRAWN

REVISION/DESCRIPTION	DATE	CHECKED	DRAWN

REVISION/DESCRIPTION	DATE	CHECKED	DRAWN

REVISION/DESCRIPTION	DATE	CHECKED	DRAWN

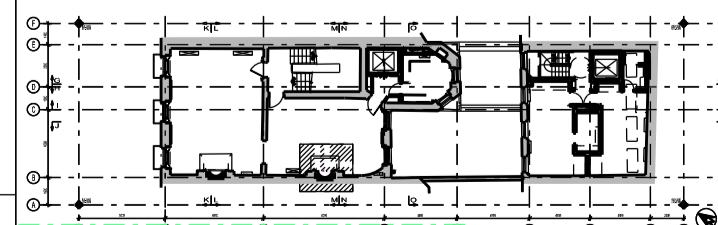

16 Brewhouse Yard
Clerkenwell
London, EC1V 4LJ
United Kingdom

T +44 (0)20 7812 8000
F +44 (0)20 7812 8399
www.bdp.com

BDP.

PROJECT TITLE
42 BEDFORD SQUARE

PROJECT NUMBER
P2005698

DRAWING TITLE
**1.03 LIBRARY CHIMNEY PIECE
FIRST FLOOR
REPRODUCTION**

DRAWING NO.
(33)AD003_MH

SCALE @ A1
varies

DATE
03.2019

REVISION
B