



**Building B - Parapet over Balcony (Courtyard)**1: 10

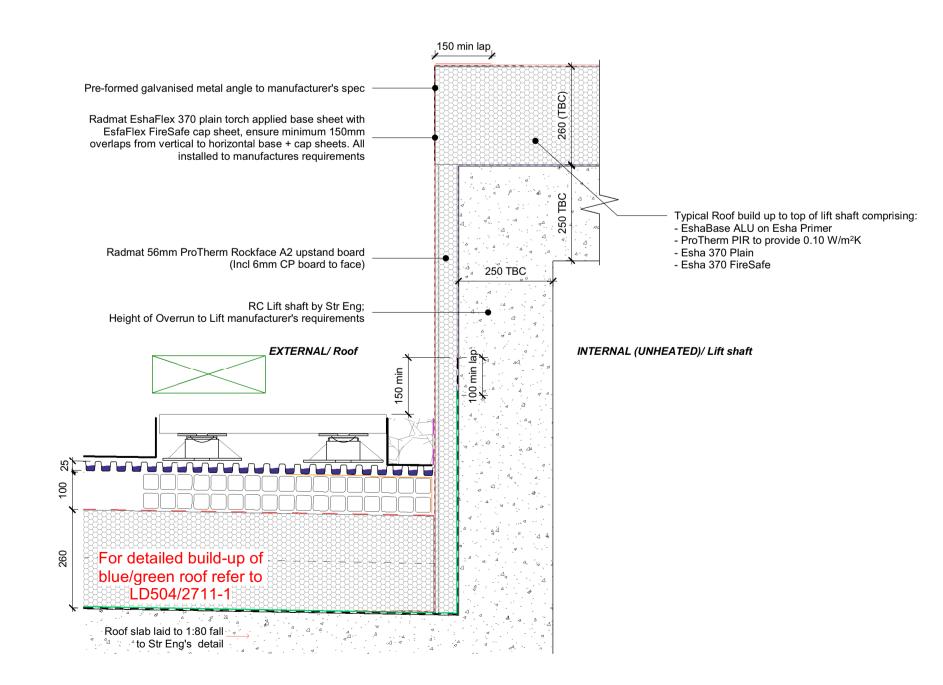


2 Typical Lift Overrun 1:10

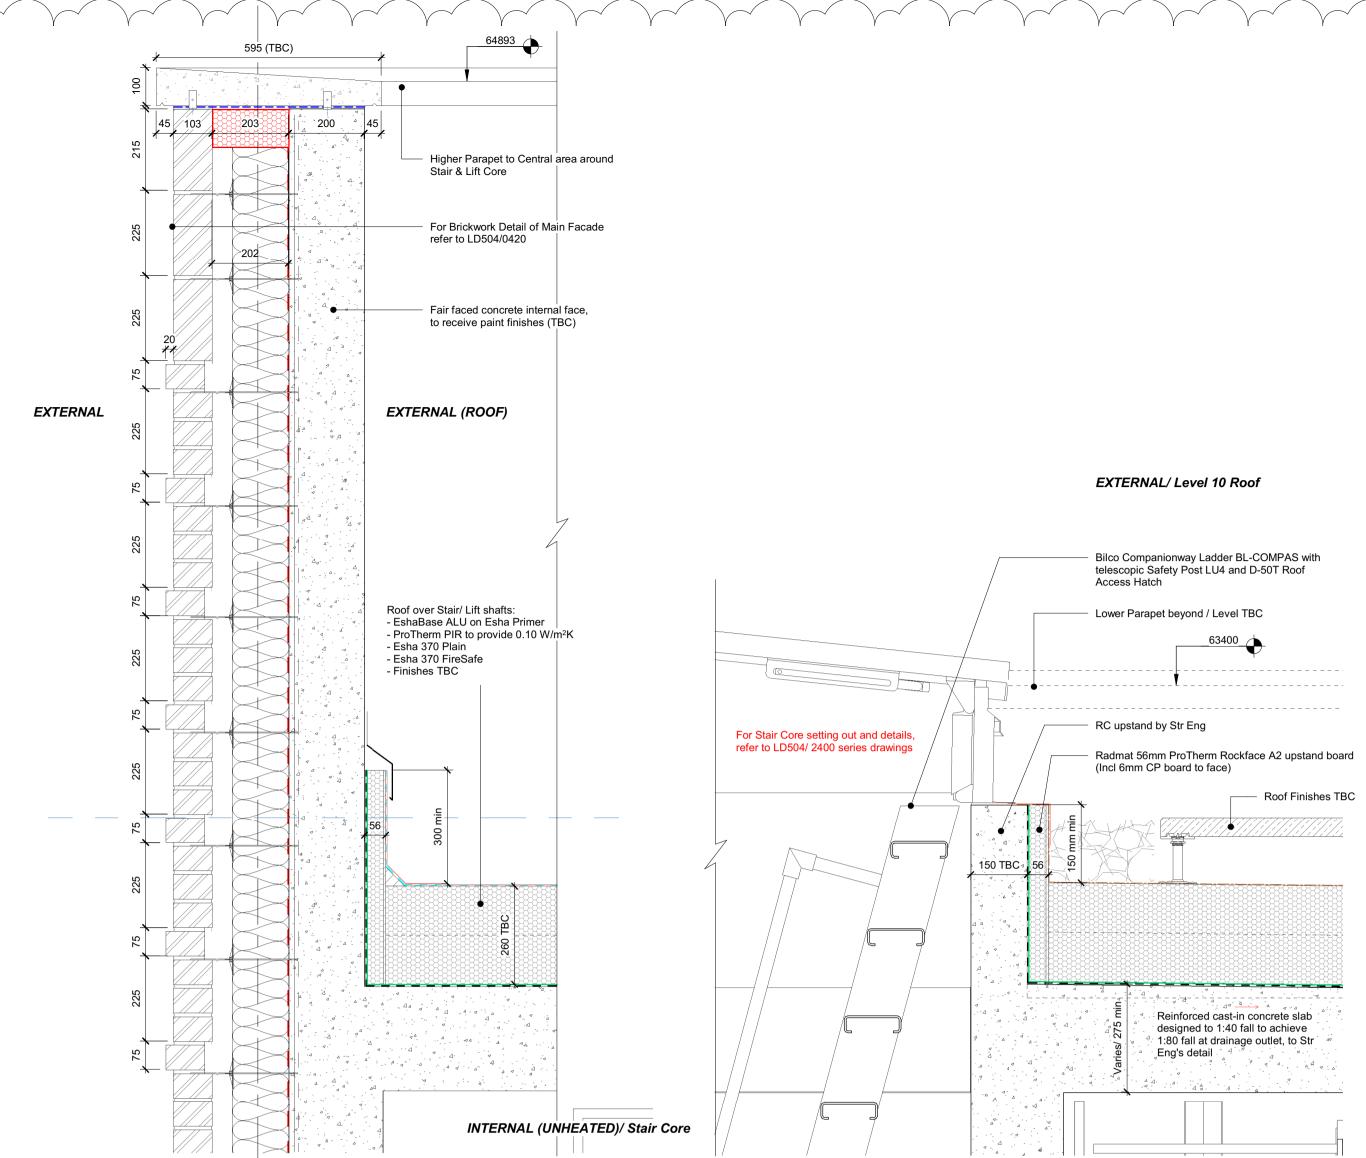

**Building B Stair - Roof Parapet**1:10

Building B Stair - Access to Roof

1:10

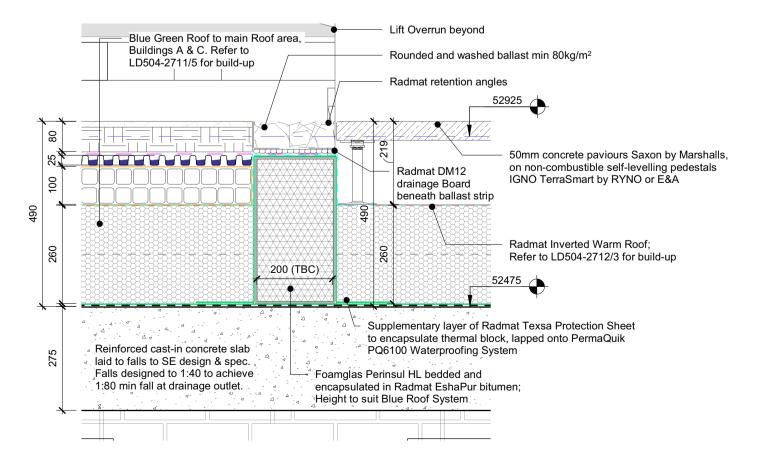

Building A - Blue Roof Bund Wall

CDM 2015 Health & Safety Information

This information relates only to 'Significant Hazards' identified on this drawing and is to be read in conjunction with the Designer's Risk Assessment Register.

P0202.09..22VE Changes incorporated<br/>P01AL<br/>18.02.22PARevDateRevision DetailsDrCh



London: 76 Great Suffolk Street,
London, SE1 0BL
T 020 7928 2773 E london@ecearchitecture.com
Sussex: Brooklyn Chambers, 11 Goring Road,
Worthing, West Sussex, BN12 4AP
T 01903 248777 E sussex@ecearchitecture.com
Bristol: Westworks, Beacon Tower,
Colston Street, Bristol, BS1 4XE
T: 0117 214 1101 E bristol@ecewestworks.com

ECE Architecture
www.ecearchitecture.com



Job Title
Belmont Street, Camden

Drawing Tittle

Roof Section Details - Sheet 2

1:10 @ A1 / 1:20 @ A3

 Project
 Originator
 Zone
 Level
 Type
 Displ.
 Drg. No.
 Rev

 LD504- ECE - ZZ - ZZ - DR - A - 2712 P02

 Drawn
 Checked
 Date

 AL
 PA
 12/02/21

Stage 3 - Suitable for Review and Comment

CAD Plot Date:01/09/2022 20:39:59

© ECE Architecture Limited. No dimensions to be scaled from drawing except for the purposes of Planning Applications. The contractor should check all dimensions on site. It is the contractors responsibility to ensure compliance with Building Regulations.