



Level and Crack Monitoring

Our Ref:



Date of Issue:

23/11/2022

Provider Details



Monitoring Details

Instruction Date:	09/05/2021	Visit Frequency (Wks)	8
Number of visits:	MUFN		

Client Details

Insurance Co.:	
Client Ref:	
Building Consultant:	
Building Consultant Tel:	
Building Consultant Email:	
Claims Technician:	
Claims Technician Tel:	
Claims Technician Email:	

Risk Address


Occupier:	
Address:	45 Gondar Gardens, London
Address:	
Town:	
County:	
Post Code:	NW6 1EP

Level and Crack Monitoring - Site Sketch

Our Ref: [REDACTED]

Date of Issue:

23/11/2022

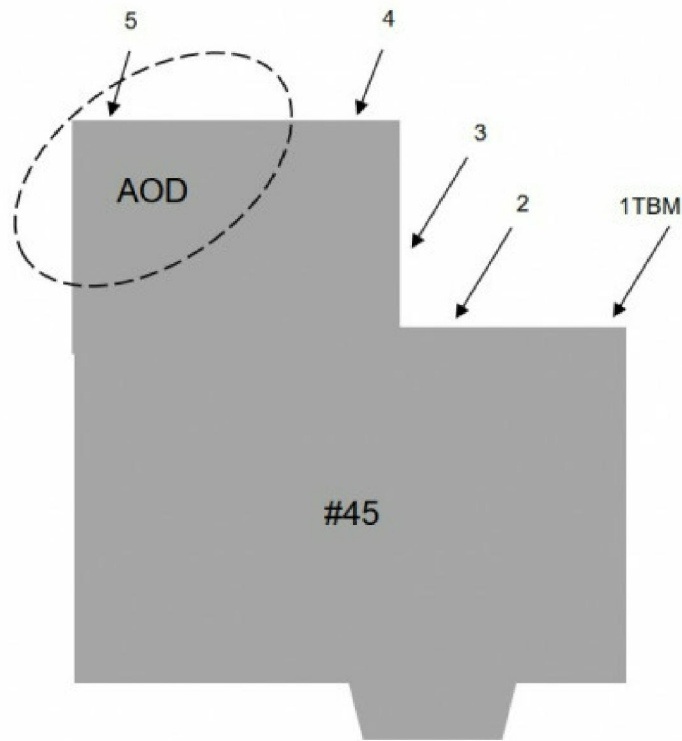

FRONT



Level Monitoring - Reduced Level (In metres)

Our Ref: [REDACTED]

Date of Issue: 23/11/22

Reading date / Level Point	18/02/19	23/04/19	24/06/19	12/09/19	16/12/19	02/03/20	21/09/20	30/11/20	29/01/21	23/03/21	08/06/21	19/07/21
TBM 1	10	10	10	10	10	10	10	10	10	10	10	10
2	10.026	10.0263	10.026	10.0257	10.0262	10.0253	10.0252	10.0258	10.0282	10.0286	10.026	10.0261
3	9.9667	9.967	9.9665	9.9656	9.9665	9.9664	9.9656		9.968	9.969	9.9662	9.9669
4	9.9703	9.971	9.9709	9.9688	9.9686	9.9684	9.9679	9.9689	9.9699	9.9705	9.9689	9.9693
5	9.9436	9.9444	9.9436	9.9372	9.9402	9.942	9.9366	9.9381	9.9399	9.9421	9.9402	9.9398
Technician	N.D	N.D	J.H	N.D	J.H	A.J	N.M	N.D	I.H	D.H	I.H	R.H



Level Monitoring - Reduced Level (In metres)

Our Ref: [REDACTED]

Date of Issue: 23/11/22

Reading date / Level Point	17/09/21	04/11/21	19/11/22
TBM 1	10	10	10
2	10.0259	10.0248	10.0242
3	9.9662	9.9659	9.9631
4	9.9686	9.9686	9.9633
5	9.9393	9.938	9.9332
Technician	N.U	D.D	B.A



Level Monitoring - Movement (In Millimetres)

Our Ref: [REDACTED]

Date of Issue: 23/11/22

Reading date / Level Point	18/02/19	23/04/19	24/06/19	12/09/19	16/12/19	02/03/20	21/09/20	30/11/20	29/01/21	23/03/21	08/06/21	19/07/21
TBM 1												
2		0.3		-0.3	0.2	-0.7	-0.8	-0.2	2.2	2.6		0.1
3		0.3	-0.2	-1.1	-0.2	-0.3	-1.1		1.3	2.3	-0.5	0.2
4		0.7	0.6	-1.5	-1.7	-1.9	-2.4	-1.4	-0.4	0.2	-1.4	-1
5		0.8		-6.4	-3.4	-1.6	-7	-5.5	-3.7	-1.5	-3.4	-3.8



Level Monitoring - Movement (In Millimetres)

Our Ref: [REDACTED]

Date of Issue: 23/11/22


Reading date / Level Point	17/09/21	04/11/21	19/11/22
TBM 1			
2	-0.1	-1.2	-1.8
3	-0.5	-0.8	-3.6
4	-1.7	-1.7	-7
5	-4.3	-5.6	-10.4



Level Monitoring - Movement (In Millimetres)

Our Ref: [REDACTED]

Date of Issue: 23/11/22

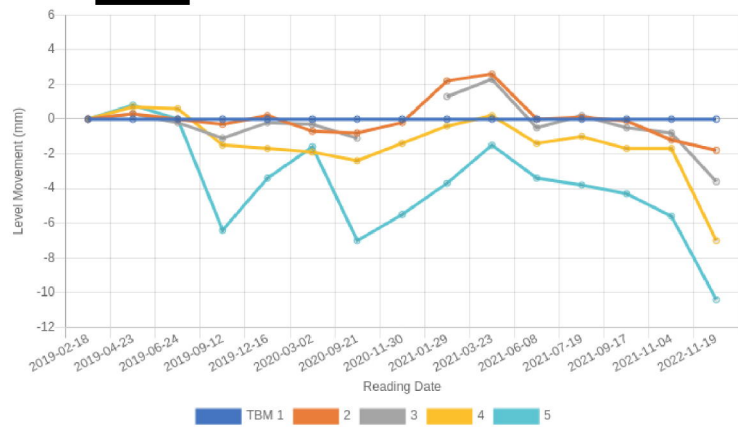



Giving our all

Our Ref	Client Ref	Client Name	Issue Date
		Sedgwick	23/11/2022

Stud locations

1	INT first floor landing LHS
---	-----------------------------

Additional instructions/notes

Crack Monitoring - Readings

Studs nos.	Alignment	Visit Date	18/02/19	Visit Date	16/12/19	Visit Date	02/03/20	Visit Date	21/09/20	Visit Date	30/11/20	Visit Date	29/01/21
		Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w
1	H	61.98	4.89	64.58	8.45	63.63	8.39	66.99	12.03	65.24	9.01	64.39	8.45
1	D	83.31		85.73		84.85	6.54	88.03		86.4		85.48	6.92
1	Check	61.72		61.67		61.63		61.75		61.61		61.6	
Callipers:		9804		4961		6758		2860		6386		6386	
Technician:		N.D		none		A.J		N.M		N.D		I.H	



Giving our all

Our Ref	Client Ref	Client Name	Issue Date
		Sedgwick	23/11/2022

Stud locations

1	INT first floor landing LHS
---	-----------------------------

Additional instructions/notes

Crack Monitoring - Readings (Continuation Sheet)

Studs nos.	Alignment	Visit Date	23/03/21	Visit Date	08/06/21	Visit Date	19/07/21	Visit Date	17/09/21	Visit Date	04/11/21	Visit Date	19/11/22
		Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w	Reading	Current c/w
1	H	64.05		64.17		64.18		64.97	11.76	65.55		67.88	17.36
1	D	85.27		85.47		85.5		85.16	13.71	86.74		89.83	23.26
1	Check	61.5		61.68		61.62		61.68		61.68		61.78	
Callipers:		3971		6386		8511		449		570		9171	
Technician:		D.H		I.H		R.H		N.U		D.D		B.A	



Giving our all

Our Ref	Client Ref	Client Name	Issue Date
		Sedgwick	23/11/2022

Crack Monitoring - Movement Against Time

