



Section of window is assumed based on photographs of existing condition.

1 Existing Window Typical Detail
1 : 5

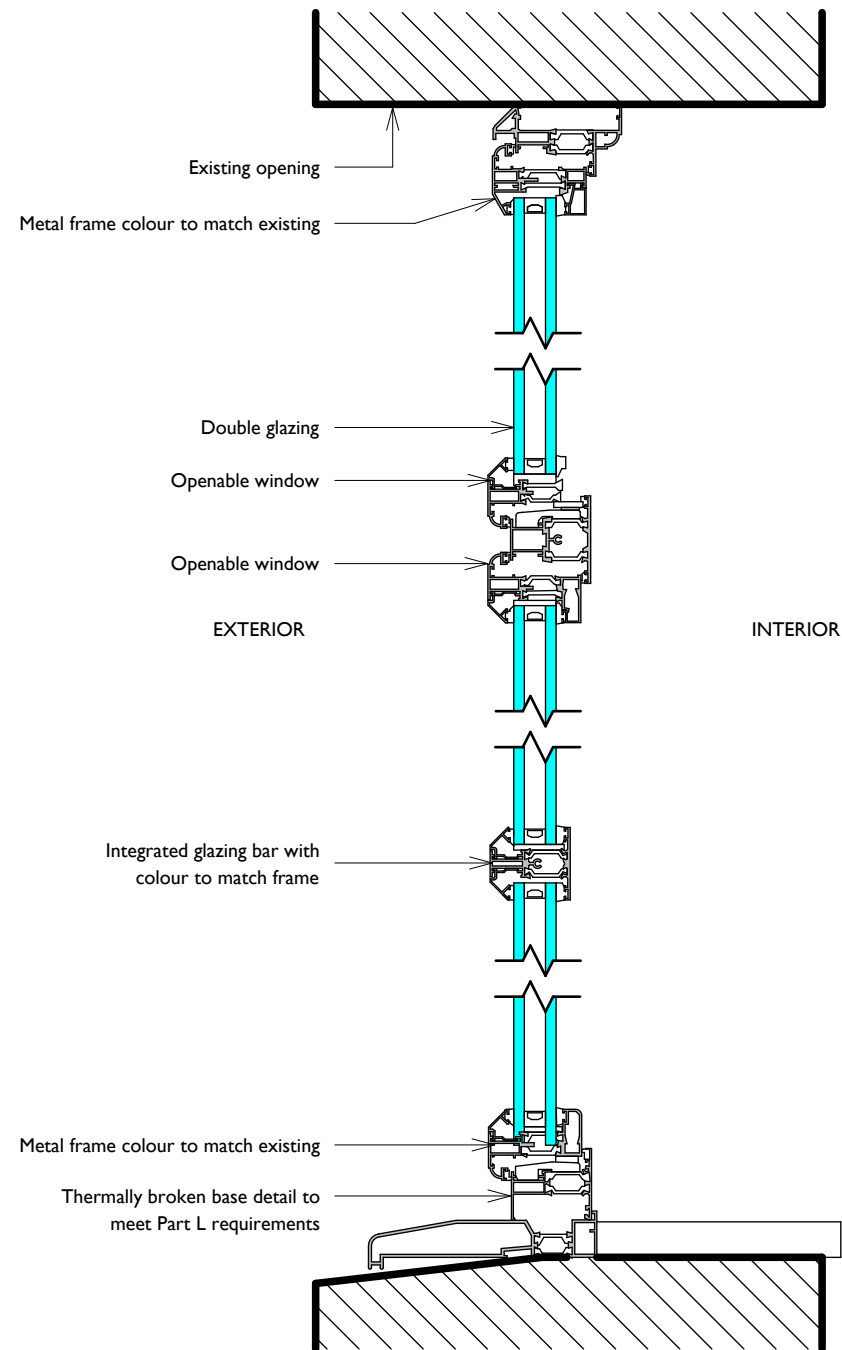

Section of window based on thermally broken Alitherm 300 system.

2 Proposed Window Typical Detail
1 : 5



General Notes

Copyright
No license or assignment of any kind is granted to any third party whether by provision of copies or originals or otherwise unless agreed in writing with the original author.

Building Regulations Compliance
All work to comply with current Building Regulations.

Notes

1. Proposed window and door frames to be thermally broken aluminium to meet Approved Documents Part L minimum thermal requirements.
2. Proposed window ironmongery to be black monkey tail style to match existing.
3. Drawing issued for planning purposes only. Window manufacturer to provide drawings and specifications prior to fabrication based on typical details.

B	01.03.23	Amended for Planning
A	26.02.23	Issued for Planning

Revision	Date	Description
----------	------	-------------

11a Heath Drive
London NW3 7SN

Typical Window Details

Date March 2023

Drawn by DE

Drawing PL-26 Revision B

Scale 1 : 5 @A3