

W.03.05

NOTES :

Modern casement
Post condition

Modern casement window.
Lowest significance.
No related detail of interest.
No related detail of interest.
Non original dormer (widened pre-existing).



W.02.08

NOTES :

Weighted sash
6 panel sashes
Shutter box non functioning
Concealed radiator below
OK condition
Manually operated blinds

Good quality historic window without horns. Historic shutters much painted over. Reasonable condition. Radiator box below obscuring window details. Highest significance.



W.01.08

NOTES :

Weighted sash
6 over 9 panel sashes
Shutters historic and probably original
Painted shutters
Manually operated blinds shut
Pipework through the panel

Chamfered reveals and shutters original although in a poor condition. Left hand side shutter one of few openable shutters. High significance. Windows have no horns and appear to be original to the building although the glazing is later and sources record that the windows of the first floor were 'lown out (including glazing bars) during WWII. In addition, it has been reported that the windows to no. 34 were replaced in the 1920s to match those at no. 35 (the windows to no. 34 having been replaced in the 19th century). Given the importance of the first floor windows and appropriate detailing these are considered to be of the highest significance.



W.00.06

NOTES :

Weighted sash
6 panel sashes
OK condition
Pipes through panelling
Electric operated blinds

Chamfered reveals and shutters original with evidence of past repair. Reasonable condition but fixed shut and painted over. Highest significance. Windows have horns and glazing bars that lack the finesse of original windows suggesting post late Victorian date. Glazing bar pattern matches the 1919 front door suggesting all of the windows at ground floor were altered to match.





W.B1.05

NOTES :

New radiator

Historic window possibly 20th century but without horns. Very modest detailing. Medium significance.

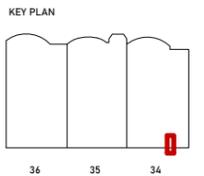

| Rev | Date | Description | Author | Checker |
|-----|------|-------------|--------|---------|
|-----|------|-------------|--------|---------|

Scale at A1 / A3

1:25 / 1:50



Drawing Name

Existing Internal Elevations Window Stack 02

Drawing Number Revision

BW125 - BW - ## - XX - DR - E3002

020 86385945
 info@built.works
 www.built.works