

W.03.09

NOTES :

Modern casement
Post condition
3 panel sashes

1920s sash window with horns.
No panelling or other detail
beyond modest architrave.



W.02.12

NOTES :

Weighted sash
6 panel sashes
OK condition
Manually operated blinds

1920s sash windows with horns.
Original shutter and simple
panelling below window. Much
painted over, fixed and filled.
Lost definition.
Medium to high significance.




W.01.11

NOTES :

Weighted sash
Painted shutters
Manually operated blinds shut
Pipework through panels
6 panel sashes

Windows with horns and glazing bars
matching all others during
the 20th century (see front elevation and
Morwell Street). Medium
significance.
Shutters painted over and fixed shut.
Linings beneath cills original
but in a poor condition. Highest
significance.

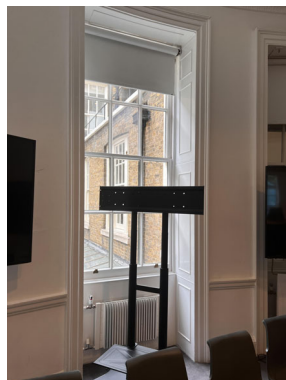


W.00.08

NOTES :

Weighted sash
6 panel sashes
OK condition
Pipes through panelling
Electric operated blinds



Windows with horns and
glazing bars matching all
others during
the 20th century (see front
elevation and Morwell Street).
Medium
significance.
Shutters painted over and fixed
shut. Mouldings to shutters do
not
match those to the front room
but instead are closer in
character to
the front room shutters of 35
and 36. Medium to high
significance.

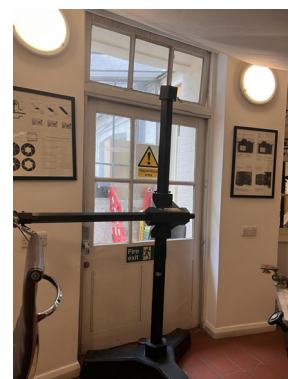

D.B1.41

NOTES :

1920s door with fanlight.
Low-medium significance.

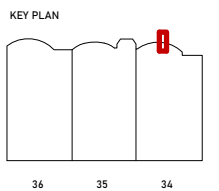

Rev	Date	Description	Author	Checker

Scale at A1 / A3

1:25 / 1:50



Drawing Name

Existing Internal Elevations
Window Stack 12

Drawing Number Revision

BW125 - BW - ## - XX - DR - E3012