

**W.03.12**

**NOTES :**

Modern casement  
Post condition  
3 panel sashes

1920s sash with horns. Historic modest panel behind radiator reflecting floor hierarchy. Medium to high significance.



**W.02.15**

**NOTES :**

Weighted sash  
6 panel sashes  
Shutter box non functioning  
OK condition

Original window much painted over and repaired shutter boxes. No horns. Panelling below good architrave. Reasonable condition. Highest Significance.



**W.01.14**

**NOTES :**

Weighted sash  
6 panel sashes  
Painted shutters  
Manually operated blinds

**FURTHER INSPECTION REQUIRED**



**W.00.11**

**NOTES :**



Weighted sash  
6 panel sashes  
OK condition  
Manually operated blinds

Good quality historic window shutters painted shut with no lining below. New panel to side below cill with pipe fitting. High significance despite later alteration. Good glazing bars and probably original sashes. Highest significance.



**W.B1.10**

**NOTES :**

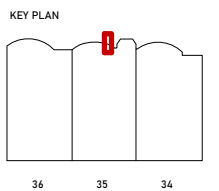

Rev	Date	Description	Author	Checker

Scale at A1 / A3

1:25 / 1:50



Drawing Name

**Existing Internal Elevations Window Stack 15**

Drawing Number Revision

BW125 - BW - ## - XX - DR - E3015

